

REF: NS/INC18008369 / Stbr

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TPRES / OD RES / EVA / INV / MV

To inspect Vehicle No:

at Workshop n/s

of

Insured:

Policy No:

Claims No:

Sum Insured:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value:

IOAC Accident Report:

GIA / PR Seen:

Est. Repairs:

Lump Sum:

Consistent? : Yes or No

Consistent? : Yes or No

days Res.: Yes or No

% 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Date / Time

Action / Instruction

Date/Time: File Pass to?

12/6 Typist

Date/Time: File Return to?

2

Report Format:

Lump Sum / L.B.: (\$

☐ : Prell. Report
☒ : Final Report

TP

80501-

Veh No:

SHF 4413

Yr Regn:

27/12/2013

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Toyota Prius

Colour:

Maroon

Sp. Reading

No Display

Eng/No:

C/No:

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modl: Nil / S/Rim / STD A/Rim or

Tyre Size:

F: 195/65R15

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

R/Bal.

6

mm

L/Bal.

6

mm

D.O.A.

1/5/15

Survey held at

SMART

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

Rear o/s

The UIC / Chassis frame / Body Structure affected due to collision

Rear

R/Bal.

6

mm

L/Bal.

6

mm

D.O.I.

4/5/18

Lump Sum \$30501- (Red: 1944-14: 70%)

SHB 8401T

RECEIVED - 2-204 2018

Days Of Repair:

10

Resurvey No. of Trip:

2

Add Fee:

☐ : Site Insp (\$
☐ : Interview (\$
☐ : Tech. Invs (\$
☐ : Weekend (\$

Survey Fee:

Transportation:

1 - S - RS - SI

: Photo

: Collect

TOTAL

 160
 35
 145



National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



NTUC INCOME INSURANCE CO-OPERATIVE LTD Ref: NS/INC18008269/Stb

73 BRAS BASAH ROAD

#05-01 NTUC TRADE UNION HOUSESINGAPORE Date: 07-05-2018

189556



Code: INC4

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SHB 8401T	Veh. Inspected	SHF 441J
Policy No.	5095103893	Coverage (\$)	0.00
Claim No.		Excess (\$)	0.00
Assign From		Assign Date	04/05/2018

2. Vehicle Particulars & Condition

Make & Model	c.c	0
Engine No.	HIDDEN	Year of Reg.
Chassis No.		Colour
Odometer	-	Steering
Brakes		Modification
General		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm

4. Description of Damages

--

5. General Information

Accident Date	01/05/2018	Inspection Date	04/05/2018
Survey held at	SMRT AUTOMOTIVE SERVICES PTE LTD 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
--

eBaoTech

General Claim

Hello, NAC_PAYA_UBI_800601

[Change Language](#)[Change Password](#)[Log Out](#)

Policy Query

Policy No.		Date of Accident	01/05/2018 14:32						
Vehicle No. (For Motor)	SHB8401T								
Search									
Select	Policy No.	Policyholder Name	Policyholder NRIC	Product	Cover Type	Vehicle No.	Insured Object	Commence Date	Expiry Date
☒	5095103893	PREMIER TAXIS PTE. LTD.	200304975H	GFT	Third Party	SHB8401T	SHB8401T	20/10/2017	
Continue									

TP Claims against NTUC Income: Follow-Through Survey

S/No	Income Reference	Claimant (Owner / Taxi Company)	Claimant Vehicle No.	Income Vehicle No.	Date of Accident	Estimate	Tentative repair cost
1	MT/0997402-002	COMFORT TRANSPORTATION PTE LTD	SHA 3102U	SIK 4437X	03/06/2018	\$ 2,431.58	\$ 450.00
2	MT/0996966-002	CITYCAB PTE LTD	SHA 8202G	SIF 5615T	01/06/2018	\$ 2,077.44	\$ 1,100.00
3	MT/0997824-001	CITYCAB PTE LTD	SHA 811B	SLH 5573X	30/05/2018	\$ 3,265.96	\$ 2,850.00
4	MT/0994720-002	SMRT TAXI PTE LTD	SHB 5571E	GU 5967J	15/05/2018	\$ 6,170.40	\$ 2,240.23
5	MT/0992549-002	SMRT TAXI PTE LTD	SHF 441J	SHB 8401T	01/05/2018	\$ 26,621.94	\$ 8,100.00
6	MT/0994278-002	SMRT TAXI PTE LTD	SHC 4212T	XE 565B	13/05/2018	\$ 21,016.42	\$ 4,600.00
7	MT/0997827-001	SMRT TAXI PTE LTD	SHC 4382K	SKT 1790K	19/05/2018	\$ 1,449.70	\$ 300.00
8	MT/0994682-002	SMRT TAXI PTE LTD	SHC 4536J	GBD 5726L	14/05/2018	\$ 5,555.30	\$ 950.00
9	MT/0997288-002	COMFORT TRANSPORTATION PTE LTD	SHD 3230S	SIN 6185T	02/06/2018	\$ 2,736.58	\$ 1,302.98
10	MT/0997833-001	COMFORT TRANSPORTATION PTE LTD	SHC 1781L	SJT 1714T	03/06/2018	\$ 5,712.98	\$ 2,300.00
11	MT/0997524-002	COMFORT TRANSPORTATION PTE LTD	SHA 3460K	GBG 4353J	05/06/2018	\$ 2,752.02	\$ 900.00
12	MT/0997717-002	COMFORT TRANSPORTATION PTE LTD	SHC 2931P	GBC 3789Z	05/06/2018	\$ 2,751.20	\$ 1,250.00
13	MT/0996973-002	COMFORT TRANSPORTATION PTE LTD	SHA 3075P	FBE 3401G	01/06/2018	\$ 1,087.44	\$ 508.00
14	MT/0997835-001	COMFORT TRANSPORTATION PTE LTD	SHA 3514P	SJA 2496R	04/06/2018	\$ 2,836.58	\$ 800.00

Claim received from LKK Auto

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the Insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the Insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	03/05/2018 12:39
Date Of Accident	01/05/2018 23:00
Exact Location Of Accident	BRADDELL ROAD TOWARDS BARTLEY ROAD
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SHF441J
Insured/Policyholder	
Name Of Registered Owner	SMRT TAXIS PTE LTD
Co Reg No	198905369K
Email Address	NOEMAIL
Mobile Phone No	
Alternative Phone No	OFFICE-800000000

Vehicle Particulars

Manufacturer	TOYOTA
Model	PRIUS TAXI-1.8 (A)
Exact Purpose for which vehicle was being used at time of accident	HIRE AND REWARD
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	TAXI

Insurance Company

Name of Insurance Company	MS FIRST CAPITAL INSURANCE LTD
Type Of Coverage	THIRD PARTY FIRE AND/OR THEFT
Fleet Policy	YES
Policy Number	D-18090213MFSH
Cover Note Number	

Driver

Name of Driver	CHIA SIEW KEE
NRIC No	S7212657B
Date Of Birth	20/04/1972
Occupation	OUTDOOR
Date Of Driving Pass	17/02/1992
Driving Experience	26 YEARS AND 2 MONTHS
Gender	MALE
Mobile Number	
Fax Number	
Contact Number	
Email Address	NOEMAIL

Address 547
 Postcode
 Was driver an employee of the Insured's Company NO
 If No, Relationship of the Driver with the Insured OTHER - HIRER
 Vehicle Registration Number of Driver's Own Vehicle -
 -
 -
 Insurance Company of Driver's Own Vehicle -
 -
 -

General Information of the Accident

Type Of Accident COLLISION - HEAD TO REAR
 Weather Conditions CLEAR
 Road Surface DRY

Other Information

Was any foreign vehicle involved in this accident? NO
 Number of vehicles involved in the accident
 Was any body injured in the Accident? YES
 Was any injured conveyed to hospital by ambulance? YES
 Was any other material or property damaged? YES
 I have been approached by unknown person(s) soliciting/offering accident claims assistance. NO
 Number of Passengers (Including Driver) 1

Details of Police Action

Was the accident reported to the police? YES
 If Yes, Please state which Police Station
 Police Station Name BISHAN NEIGHBOURHOOD POLICE CENTRE
 Police Station Address ROAD: 20 BISHAN STREET 23 , POSTCODE: 579757 , COUNTRY: SINGAPORE
 Police Station Contact TEL NO: 1800-5529999 - FAX NO: 65561905
 Was notice of intended Prosecution given? NO
 If Yes, against whom?

Circumstances of Accident

REFER TO POLICE REPORT - T/20180502/2167 On 1.5.18 at about 2300hrs, I was travelling along Braddell Rd towards Bartley Rd. I was on the centre lane when I suddenly felt a huge impact coming from the rear of my vehicle (SHF441J) when I was near the Shell petrol kiosk. There was not much traffic at that point of time. The strong impact caused my vehicle to move forward and swerve to the left. I managed to hit the break to stop the vehicle (just after the Shell petrol kiosk near Croucher Rd). I was in a state of shock and pain so I stayed in the vehicle until the ambulance came. The paramedics assisted me to get out of my vehicle and I was then conveyed to the hospital and was discharged from hospital on the 2.5.18. Traffic police was at scene too. No government property was damaged. Traffic police contacted me today and provided me with the vehicle registration plate number of the other vehicle which collided into mine. There is an in built camera in my vehicle however I am not too sure if the incident was captured or not. My vehicle was towed by the Traffic Police. Today, I went to the clinic at Intemedial 24hr Clinic as my body was still in pain. I received a 5 days medical leave from the doctor dated 02/05/2018 to 06/05/2018.

Attachment(s)

Are accident photos available for attachment? NOT AVAILABLE DUE TO CIRCUMSTANCES OF ACCIDENT
 Was there any video captured by Car Camera? NO
 Was there any audio recorded? NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number SHB8401T
 Vehicle Make/Model/Colour
 Details Of Properties
 Vehicle Category TAXI
 Name of Driver

NRIC/Passport Number
Contact Number
Address
Postcode
Insurance Company Name
Nature Of Damage
No. Of Passenger (Including Driver)

DETAILS OF INJURED PERSON 1

Name	CHIA SIEW KEE
Approximate Age	
Injuries Sustain	
Injured person in which vehicle?	SHF441J
Were seat belts worn?	YES
Was this injured conveyed to hospital by ambulance?	YES
Address	
Postcode	

SKETCH PLANIMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.




Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time: 3/5/2018

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

SKETCH PLAN

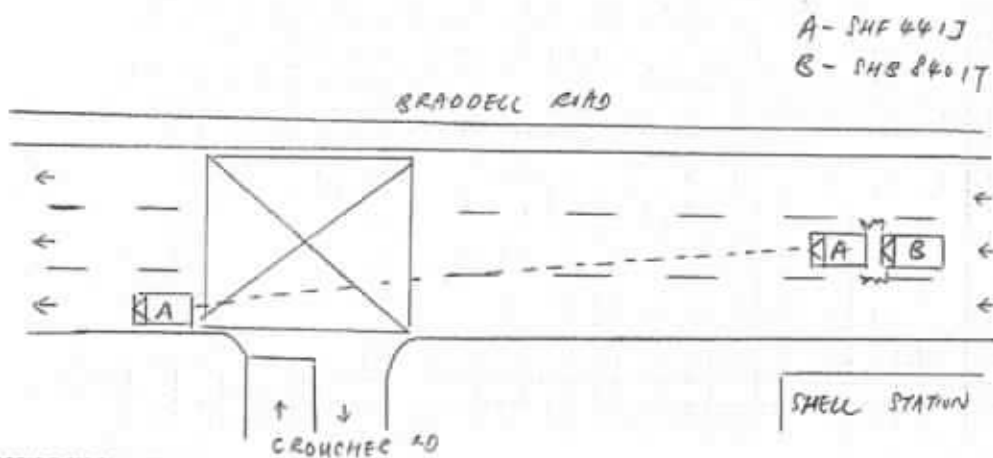

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

REFER TO POLICE REPORT - 7/20180503/2167

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature _____

Date & Time:

Driver's Signature

(If driver is not the policyholder)

Date & Time:

3/5/2018

Reporting Centre Personnel's Signature

Name: _____

NRIC/FIN No.:



**SINGAPORE
POLICE FORCE**



T/20180502/2167

Police Station Of Origin:
Bishan N.P.C
20 Bishan Street 23 SINGAPORE 579757
Tel No: 1800-5529999

1 of 3

Report No. T/20180502/2167

REPORT OF A TRAFFIC ACCIDENT

Date/Time Report Made: 02/05/2018 19:17	Vide Report No.:	Station Diary No.: 151
--	------------------	---------------------------

Informant's Particulars

Name of Informant: CHIA SIEW KEE			Address: APT BLK 547 HOUGANG STREET 51 #07-214 SINGAPORE 530547	
ID Type / ID No.: NRIC NO / S7212657B			Contact No.: Home/Office: Mobile: 88288944	
Nationality: SINGAPORE CITIZEN			Email:	
Sex: Male	Age: 46	Date of Birth: 20/04/1972	Type of Informant: Driver	
Race: Chinese			Language: English	Institution / School Name:
Occupation: Taxi Driver			Driving Licence Information: Class: 3,4 Date of Expiry:	

General Information of the Accident

Type of Accident:	Injury Conveyed By Ambulance	Drink Drive: No	Date/Time of Accident: 01/05/2018 23:00	Type of Location: Straight Road
Location: Along Road 1 Traveling Toward Road 2 BRADDELL ROAD BARTLEY ROAD Travelling along Braddell Road towards Bartley Road (After Braddell underpass)				
Weather: Clear		Road Surface: Dry		Road Speed Limit:
Traffic Flow: One Way		Traffic Control: Not Controlled		Traffic Volume: Light
Type of Collision: Between Moving Vehicles - Head To Rear				Anyone conveyed by ambulance: Yes

Details of Vehicle Involved

Vehicle No.	Type	Make	Model	Color	Condition	No. of Passenger
SHB8401T	Car				Seriously Damaged	0
SHF441J	Car				Seriously Damaged	0

Details of Person Involved

Any Pedestrian Involved: No	
No. of Pedestrians Injured: NIL	Use of Pedestrian Crossing: NA



**SINGAPORE
POLICE FORCE**



T/20180502/2167

Police Station Of Origin:
Bishan N.P.C
20 Bishan Street 23 SINGAPORE 579757
Tel No: 1800-5529999

2 of 3

Report No. T/20180502/2167

CONTINUATION OF REPORT

Driver			
Name	CHIA SIEW KEE	ID No.	S7212657B
Related Vehicle	SHF441J (Car)	Contact No.	88288944
Hospital/Clinic	TAN TOCK SENG HOSPITAL	Class of Driving Licence & Expiry Date	Class: 3,4 Date of Expiry: NIL
Date Treatment	01/05/2018	Date Discharge	02/05/2018
No. of Days granted Medical Leave	02	Degree of Injury	Slight

Brief Details.

On 1.5.18 at about 2300hrs, I was travelling along Braddell Road towards Bratley Road. I was on the centre lane when I suddenly felt a huge impact coming from the rear of my vehicle (SHF441J) when I was near the shell patrol kiosk. There was not much traffic at that point of time. The strong impact caused my vehicle to move forward and swerve to the left. I managed to hit the break to stop the vehicle (just after the shell patrol kiosk near Croucher Road).

I was in a state of shock and pain so I stayed in the vehicle until the ambulance came. The paramedics assisted me to get out of my vehicle and I was then conveyed to the hospital and was discharged from hospital on the 2.5.18. Traffic police was at scene too. No government property was damaged.

Traffic Police contacted me today and provided me with the vehicle registration plate number of the other vehicle which collided into mine. There is an in built camera in my vehicle however I am not too sure if the incident was captured or not. My vehicle was towed by the Traffic Police.

Today, I went to the clinic at Intermedial 24 Hr Clinic as my body was still in pain. I received a 5 days medical leave from the doctor dated 02/05/2018 to 06/05/2018.



**SINGAPORE
POLICE FORCE**



T/20180502/2167

Police Station Of Origin:
Bishan N.P.C
20 Bishan Street 23 SINGAPORE 579757
Tel No: 1800-5529999

3 of 3

Report No. T/20180502/2167

CONTINUATION OF REPORT

Sketch Plan

Informant is not able to provide sketch plan

IMPORTANT: Please attach a copy of your vehicle's Insurance Certificate to this report. If you don't have the certificate with you now, please fax a copy to 65474885 stating the report number as reference.

Signature Of Officer Recording The Report: E / Sgt 3 LIYANA BINTE MOHD RAZALI	Signature Of Informant:
Signature Of Interpreter: Not applicable	Date/Time: 02/05/2018 19:17
Officer In Charge Of Case: TP / GIT /	Classification Of Case:
Contact No.:	
Authentication Stamp NP168	SN-061



Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Company
Owner ID:	5369K
Vehicle Details	
Vehicle No.:	SHF441J
Vehicle to be Exported:	No
Intended De-registration Date:	07 May 2018
Vehicle Make:	TOYOTA
Vehicle Model:	PRIUS TAXI (SMRT)
Primary Colour:	Maroon
Manufacturing Year:	2013
Engine No.:	2ZR5906783
Chassis No.:	JTDKN36U005719354
Maximum Power Output:	100.0 kW (134 bhp)
Open Market Value:	\$33,120.00
Original Registration Date:	27 Dec 2013
First Registration Date:	27 Dec 2013
Transfer Count:	0
Actual ARF Paid:	\$8,368.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	26 Dec 2021
PARF Rebate Amount:	\$6,276.00
Intended COE Rebate Details	
COE Expiry Date:	26 Dec 2021
COE Category:	A - Car (1600cc & below)
COE Period(Years):	8
PQP Paid:	\$62,740.00
COE Rebate Amount:	\$28,502.00
Total Rebate Amount:	\$34,778.00
Message	
Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.	

The information contained herein is correct as at 07 May 2018

OK

14-5-18 / 16:20

14-5-18 / 14:20

4-5-18 / 14:20

SMRT Accident Vehicle Repair Estimates

Section A - To be completed by claims Advisor/Duty officer at Accident Reporting Centre

Reg. No : SHF441J
Ref. No : TAX/05/18/2011
Reg. Date : 27/12/2013
Vehicle Type : TAXI
Make : TOYOTA PRIUS
Model : PRIUS
Name of Driver : CHIA SIEW KEE
Type of Accident : HEAD TO REAR
Date / Time of Accident : 01/05/2018 11:00:00 PM
Accident Reported Date / Time : 03/05/2018 12:00:00 AM
Surveyor Is Required? : Yes
Survey by : Sebastian
Vehicle is Towed Back? : Yes
Towed Back Date/Time : 03/05/2018
Replacement Vehicle issued? : No
Accident Repair Job Card No : 000024095862
Special Instruction to ARC, if any :

TOWED TO TP COMPOUND \$90 / SHB8401T NTHC 4B
BEFORE PAINT PHOTO AND AFTER PAINT, FOR CHECK ITEM AND REPLACE ITEM PLEASE CALL
SURVEYOR SEBASTIAN (LKK) & Email : sebastianyeang@lkkauto.com HP: 90036121
LUMP SUM REPAIR
TYRE = 60%

Prepared Date : 03/05/2018 01:00:17 PM



Recording Camera

☐ ☒

Radio Antenna

☐ ☒

1st witness

m

Date 4-5-18

2nd witness

Date

531213
1 1/4 1/2 3/4 1

QC 17/5/18

531250

18.42 pass

Vehicle Return Date: 17-5-2018

Vehicle Return Time: 14:45

SMRT staff sign:

Supplementary
Refer to the Supplementary part list ✓

Section B - To be Completed by Service Advisor, Accident Repair Centre

Chassis No : JTDKN36U00-5719354

Mileage

0

Work Shop :

Repair Completed Date / Time :

Summary of Repair Estimates

	Quotation from ARC	Adjusted by Surveyor, If applicable
Total Labour Charges	: 1,521.00	1,400.00
Total Spray Painting Charges	: 3,132.00	1,400.00
Total Material Charges	: 8,334.70	6,568.42
Other Charges	: 2,025.00	-1,268.42
TOTAL	: 15,012.70 <i>27467.14</i>	8,100.00
Lump Sum Total	: 0.00	0.00
No. of Repair Days	: 11.00	10.00
Prepared / Adjusted By	:	SEBASTIAN (LKK)
Arc / Surveyor Sing Off Date	: 04/05/2018 09:20:30 AM	04/05/2018 02:11:08 PM

F

LKK

Prepared / Adjusted Date :

Remarks :

Prepared Date : 04/05/2018 09:18:59 AM

Section C - To be Completed by Admin Assistant, Accident Repair Centre, Upon Completion of Repair

Quotation No : *QN-1805-2551*

Invoice No :

Quotation Date : *23/5*

Invoice Date :

Invoice Amount : 0.00

Prepared Date : 5/4/2018 9:20:22 AM

Section D - Details of Repair Estimates

Part 1 - Labour Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPAIR REAR PORTION	1,521.00	1,400.00 /
Total Labour	1,521.00	1,400.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPSRAY REAR BUMPER	378.00	200.00 /
TO RESPRAY TAIL GATE	378.00	200.00 /
TO RESPRAY TAILGATE OUTSIDE GARNISH	180.00	100.00 /
TO RESPRAY REAR PANEL	180.00	100.00 /
TO RESPRAY REAR SPARE TYRE PANEL	180.00	100.00 /
TO RESPRAY REAR MEMBER, RH	180.00	50.00 /
TO RESPRAY FLOOR CORNER PANEL RH	180.00	50.00 /
TO RESPRAY REAR RH WHEEL HOUSE	180.00	100.00 /
TO RESPRAY BATTERY PANEL	180.00	50.00 /
TO RESPRAY TROUGH BACK DOOR RH	180.00	50.00 /
TO RESPRAY REAR FENDER RH	378.00	200.00 /
TO RESPRAY RIM	180.00	0.00
TO RESPRAY REAR DOOR RH	378.00	200.00 /
Total Spray Painting & Panel Beating	3,132.00	1,400.00

Part 3 - Other Costs - Accident and Accident Repair Related Expenses

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO CHECK WIRING AND SYSTEM FUNCTION	80.00	30.00 /
TO APPLY RUST-PROOFING ON AFFECTED AREA	100.00	40.00 /
TO DO WHEEL ALIGNMENT / TYRE BALANCING	120.00	0.00
TO REMOVE AND REFIT TYRE RIM (SPRAYING PURPOSE)	120.00	0.00
TO PROVIDE LABOUR & MATERIAL FOR SOLAR FILM (NET)	125.00	125.00 /
TO REMOVE & REFIT REAR QUARTER GLASS RH	120.00	30.00 /
TO REMOVE AND REFIT WIRE HARDESS	250.00	100.00 /
TO REMOVE & REFIT EXHAUST	120.00	50.00 /
CHASSIS ALIGNMENT	350.00	200.00 /
TO TEST AND REFIX REVERSE SENSOR SYSTEM	120.00	30.00 /
TO REMOVE AND INSTALL LUGGAGE COMPARTMENT TRIM TO FACILITATE REPAIR.	120.00	50.00 /
TO INSPECT RR LIGHTING, MECHANISMS & WATER TEST RR LIGHTING FOR LEAKAGE	120.00	30.00 /
TO TRANSFER REAR TAILGATE MECHANISM	120.00	50.00 /
TO REPLACE SUNDRY PARTS	100.00	0.00
TO WASH AND VACUUM	50.00	0.00
Lump Sum Adjustment by Surveyor	0.00	-2,003.42
Total Other Costs	2,025.00	-1,268.42

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommendation	Surveyor Approved	Photo Attached
75442-47030			NAME PLATE (PRIUS)	1	60.80	25.00	45.60	Replace	Replace	No
75443-47030			NAME PLATE (TOYOTA)	1	51.90	25.00	38.92	Replace	Replace	No
	COMMON		SMRT LOGO	1	7.80	0.00	7.80	Replace	Replace	
			STICKER DECAL 6555 8888	1	21.60	0.00	21.60	Replace	Replace	No
58307-47060		6505522	END PANEL	1	602.10	25.00	451.57	Replace	Replace	No
64718-47031B0			END PANEL COVER, DECK TRIM HOLE	1	46.10	25.00	34.58	Replace	Replace	No
64718-47031B0			END PANEL COVER, DECK TRIM, RR	1	121.10	25.00	90.83	Replace	Replace	No
58336-12090			REINFORCEMENT, RR	1	34.60	25.00	25.95	Replace	Check	
	COMMON	4006314	SEALANT SIKAFLEX	1	37.00	0.00	37.00	Replace	Replace	
58311-47071		6505523	SPARE TYRE PANEL	1	667.70	100.00	0.00	Replace	Repair	
57603-47030			MEMBER SUB-ASSY, RR RH	1	174.10	100.00	0.00	Replace	Repair	
58302-47030			FLOOR PANEL RR/RH	1	209.90	25.00	157.42	Replace	Replace	
			BATTERY	1	278.00	10.00	250.20	Replace	Replace	
74481-47050			BATTERY CLAMP	1	18.10	25.00	12.07	Replace	Replace	
74440-47030			BATTERY TRAY	1	42.80	25.00	32.10	Replace	Replace	
82162-47B20			WIRE, FLOOR, NO.2	1	1,305.40	10.00	1,174.86	Replace	Check	
82164-47070			WIRE, FRAME	1	1,680.90	25.00	1,260.68	Replace	Check	
61607-47060			PANEL SUB-ASSY, QTR	1	586.40	25.00	441.30	Replace	Replace	
64730-47031B2			PANEL ASSY, DECK RH	1	307.00	25.00	230.25	Replace	Replace	
58490-47140B0			BOARD ASSY, RR RH	1	379.20	25.00	284.40	Replace	Check	
58427-47040			SPACER, RR FLOOR	1	130.60	25.00	97.95	Replace	Check	
64997-47020			BOX, DECK FLOOR, LH	1	196.80	25.00	147.60	Replace	Check	
58418-47070B0			BOX, DECK FLOOR, COVER LH	1	230.10	25.00	172.58	Replace	Check	
58416-47030B3			BOX, RR FLOOR, BOARD	1	679.60	25.00	509.70	Replace	Check	
64993-47020			BOX, DECK FLOOR, RR	1	649.70	25.00	487.28	Replace	Check	
58415-47030			BOARD, RR FLOOR	1	392.30	25.00	294.23	Replace	Check	
52562-47010			TAIL LAMP BRACKET, RH	1	30.70	25.00	23.02	Replace	Replace	
61551-47180		6505462	TAIL LAMP RH	1	557.80	10.00	502.02	Replace	Replace	
61621-47030			TROUGH, BACK DOOR	1	110.90	25.00	83.18	Replace	Check	
61604-47090			FENDER RR/RH	1	766.80	25.00	575.10	Replace	Replace	
	COMMON		SMRT LOGO	1	7.80	0.00	7.80	Replace	Replace	

2457.12

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommendation	Surveyor Approved	Photos Attached	
52159-47905		6505548	BUMPER REAR	1	458.60	25.00	343.95	Replace	Replace	No	OK
52151-15010			BUMPER CLIPS	10	1.81	25.00	12.07	Replace	Replace	No	OK
52023-12240		6505547	BUMPER REINFORCEMENT REAR	1	205.70	25.00	154.27	Replace	Replace	No	OK
52015-47050			ARM SUB-ASSY, RR BUMPER RH	1	139.60	25.00	104.70	Replace	Replace	No	OK
52015-47030			ARM SUB-ASSY, RR BUMPER LH	1	139.60	25.00	104.70	Replace	Replace	No	OK
			SENSOR REVERSE	1	180.00	0.00	180.00	Replace	Replace	No	OK
			PIXEL STICKER	2	60.00	0.00	120.00	Replace	Replace	No	OK
76087-47020		6505618	BUMPER LIP COVER RR/RH	1	118.10	25.00	88.57	Replace	Replace	No	OK
76091-47020		6505619	BUMPER LIP REAR	1	228.90	25.00	171.67	Replace	Replace	No	OK
52591-47021			BUMPER SEAL, RR RH	1	65.70	25.00	49.28	Replace	Replace	No	OK
52576-47020		6505550	BUMPER SIDE RETAINER RR/LH	1	94.80	25.00	71.10	Replace	Replace	No	OK
52575-47020		6505549	BUMPER SIDE RETAINER RR/RH	1	94.80	25.00	71.10	Replace	Replace	No	OK
56308-47011			UNDER COVER SUB-ASSY, RR FLOOR	1	514.50	25.00	385.88	Replace	Check	No	X
17565-22030			SUPPORT, EXHAUST REAR	2	33.60	25.00	50.40	Replace	Check	No	X
58327-47020			EXHAUST HEAT SHIELD, REAR	1	107.40	25.00	80.55	Replace	Check	No	X
17430-37380			EXHAUST TAIL PIPE	1	656.20	25.00	492.15	Replace	Check	No	X
67005-47241			TAILGATE ASY	1	1,007.90	25.00	755.92	Replace	Replace	No	X
75574-47020			TAIL GATE DOOR GLASS MOULDING, LH	1	29.40	25.00	22.05	Replace	Replace	No	X
75573-47080			TAIL GATE DOOR GLASS MOULDING, RH	1	29.40	25.00	22.05	Replace	Replace	No	X
75575-47030			MOULDING BACK WINDOW, LOWER NO.1	1	29.40	25.00	22.05	Replace	Replace	No	X
	COMMON		SEALANT W/SCREEN	3	37.00	0.00	111.00	Replace	Replace	No	X
68810-47010			TAILGATE DOOR HINGE LH/RH	0	58.30	25.00	0.00	Replace	Not given	No	X
69350-47030			TAILGATE DOOR LOCK	1	444.10	25.00	333.08	Replace	Check	No	X
60415-47020			TAILGATE LOCK, COVER	1	15.70	25.00	11.78	Replace	Check	No	X
67691-47022			TAILGATE DOOR WEATHER STRIP	0	353.40	25.00	0.00	Replace	Not given	No	X
76801-47070-B0			TAILGATE OUTSIDE GARNISH	1	504.90	100.00	0.00	Replace	Repair	No	X
75310-47020		6505639	EMBLEM REAR	1	60.30	25.00	45.22	Replace	Replace	No	X
75374-47051			NAME PLATE (HYBRID)	1	51.90	25.00	38.92	Replace	Replace	No	X

24586L

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommendation	Surveyor Approved	Photos Attached
	COMMON		STICKER DECAL 6555 8888	1	21.60	0.00	21.60	Replace	Replace	No /
65637-47021		6505480	FENDER LINER RR/RH	1	141.30	25.00	105.97	Replace	Replace	No /
62710-47130			QUARTER GLASS RR/RH	1	846.50	25.00	634.87	Replace	Replace	No /
	COMMON		SEALANT W/SCREEN	1	37.00	0.00	37.00	Replace	Replace	No /
		6503707	TYRE	1	126.74	40.00	76.04	Replace	Replace	No /
42611-47140		6505658	WHEEL, DISC	0	1,490.20	25.00	0.00	Replace	Not given	No X
67003-47080		6505486	DOOR RR/RH	1	954.50	100.00	0.00	Replace	Repair	No R
69050-47080			DOOR LOCK RR/RH	1	709.30	25.00	531.98	Replace	Check	No X
69410-33010			DOOR LOCK STRIKER	1	40.50	25.00	30.38	Replace	Check	No X
62940-16060			DUCT ASSY, QUARTER	1	70.40	25.00	52.80	Replace	Replace	No /
89997-30070			ANTENNA, ELECTRICAL LOWER REAR	1	157.40	10.00	141.66	Replace	Replace	No /
TOTAL MATERIALS							12,972.36	6,517.73		
TOTAL MATERIALS(Discounted)							12,972.28	6,517.72		

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check	LT Check
89997-30070		ANTENNA, ELECTRICAL LOWER REAR	1	157.40	10.00	141.66	Replace	Replace	No
TOTAL SUPPLEMENTARY MATERIALS						141.66			

6517.71 /
+ 1400.00 /
+ 2135.00 /

10,052.71 /

- 208 /

8042.18 /

L/S \$8042.18 /

Sebastian
7/6/13

76621.94

SMRT Accident Vehicle Repair Estimates

Section A - To be completed by claims Advisor/Duty officer at Accident Reporting Centre

Reg. No : SHF441J
 Ref. No : TAX/05/18/2011
 Reg. Date : 27/12/2013
 Vehicle Type : TAXI
 Make : TOYOTA PRIUS
 Model : PRIUS
 Name of Driver : CHIA SIEW KEE
 Type of Accident : HEAD TO REAR
 Date / Time of Accident : 01/05/2018 11:00:00 PM
 Accident Reported Date / Time : 03/05/2018 12:00:00 AM
 Surveyor is Required? : Yes
 Survey by :
 Vehicle is Towed Back? : Yes
 Towed Back Date/Time : 03/05/2018
 Replacement Vehicle issued? : No
 Accident Repair Job Card No : 000024095862
 Special Instruction to ARC, if any :
 TOWED TO TP COMPOUND \$90 / SHB8401T
 Prepared Date : 03/05/2018 01:00:17 PM



Sebastian
 4/5/18
 - Ling Sun Repair
 - Question Mark Item
 Photo
 - Photo After Paint

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Section B - To be Completed by Service Advisor, Accident Repair Centre

Chassis No : JTDKN36U00-5719354

Mileage : 0

Work Shop :

Repair Completed Date / Time :

Summary of Repair Estimates

	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Charges :	1,521.00	0.00
Total Spray Painting Charges :	3,132.00	0.00
Total Material Charges :	12,826.85	12,826.85
Other Charges :	2,151.00	0.00
TOTAL :	19,630.85 26762.74	0.00
Lum Sum Total :	19,650.00	0.00
No. of Repair Days :	9.00	0.00
Prepared / Adjusted By :		8 days
Arc / Surveyor Sign Off Date :	04/05/2018 09:20:30 AM	01/01/1900 12:00:00 AM



Prepared / Adjusted Date :

Remarks :

Prepared Date : 04/05/2018 09:18:59 AM

Section C - To be Completed by Admin Assistant, Accident Repair Centre, Upon Completion of Repair

Quotation No :	Invoice No :
Quotation Date :	Invoice Date :
Invoice Amount : 0.00	Prepared Date : 5/4/2018 9:20:22 AM

Part 1 - Labour Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPAIR REAR PORTION	1,521.00	0.00 1200
Total Labour	1,521.00	0.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPSRAY REAR BUMPER	378.00	0.00 200
TO RESPRAY TAIL GATE	378.00	0.00 200
TO RESPRAY TAILGATE OUTSIDE GARNISH	180.00	0.00 100
TO RESPRAY REAR PANEL	180.00	0.00 100
TO RESPRAY REAR SPARE TYRE PANEL	180.00	0.00 100
TO RESPRAY REAR MEMBER,RH	180.00	0.00 50
TO RESPRAY FLOOR CORNER PANEL RH	180.00	0.00 50
TO RESPRAY REAR RH WHEEL HOUSE	180.00	0.00 100
TO RESPRAY BATTERY PANEL	180.00	0.00 50
TO RESPRAY TROUGH BACK DOOR RH	180.00	0.00 7
TO RESPRAY REAR FENDER RH	378.00	0.00 200
TO RESPRAY RIM	180.00	0.00 X
TO RESPRAY REAR DOOR RH	378.00	0.00 200
Total Spray Painting & Panel Beating	3,132.00	0.00

Part 3 - Other Costs - Accident and Accident Repair Related Expenses

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TOWING CHARGE	126.00	0.00 X
TO CHECK WIRING AND SYSTEM FUNCTION	80.00	0.00 30
TO APPLY RUST-PROOFING ON AFFECTED AREA	100.00	0.00 40
TO DO WHEEL ALIGNMENT / TYRE BALANCING	120.00	0.00 X
TO REMOVE AND REFIT TYRE RIM (SPRAYING PURPOSE)	120.00	0.00 X
TO PROVIDE LABOUR & MATERIAL FOR SOLAR FILM (NET)	125.00	0.00 ✓
TO REMOVE & REFIT REAR QUARTER GLASS RH	120.00	0.00 30
TO REMOVE AND REFIT WIRE HARDESS	250.00	0.00 160
TO REMOVE & REFIT EXHAUST	120.00	0.00 50
CHASSIS ALIGNMENT	350.00	0.00 200
TO TEST AND REFIX REVERSE SENSOR SYSTEM	120.00	0.00 30
TO REMOVE AND INSTALL LUGGAGE COMPARTMENT TRIM TO FACILITATE REPAIR.	120.00	0.00 50
TO INSPECT RR LIGHTING, MECHANISMS & WATER TEST RR LIGHTING FOR LEAKAGE	120.00	0.00 30
TO TRANSFER REAR TAILGATE MECHANISM	120.00	0.00 50
TO REPLACE SUNDRY PARTS	100.00	0.00 X
TO WASH AND VACUUM	60.00	0.00 X
Total Other Costs	2,151.00	0.00

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommended	Surveyor Approved	Photos Attached
52159-47905		6505548	BUMPER REAR	1	458.60	25.00	343.95	Replace	Replace ✓ CAC	No
52161-16010			BUMPER CLIPS	10	1.61	25.00	12.07	Replace	Replace ✓ NTC	No
52023-12240		6505547	BUMPER REINFORCEMENT REAR	1	205.70	25.00	154.27	Replace	Replace ✓ DT	No
52015-47050			ARM SUB-ASSY, RR BUMPER RH	1	139.60	25.00	104.70	Replace	Replace ✓ DT	No
52016-47030			ARM SUB-ASSY, RR BUMPER LH	1	139.60	25.00	104.70	Replace	Replace ?	No
			SENSOR REVERSE	1	180.00	0.00	180.00	Replace	Replace ✓ DMC	No
			PIXEL STICKER	2	60.00	0.00	120.00	Replace	Replace ✓ NTC	No
76087-47020		6505618	BUMPER LIP COVER RR/RH	1	118.10	25.00	88.57	Replace	Replace ✓ MS	No
76891-47020		6505619	BUMPER LIP REAR	1	228.90	25.00	171.67	Replace	Replace long / long	No
52591-47021			BUMPER SEAL, RR RH	1	65.70	25.00	49.27	Replace	Replace ?	No
52576-47020		6505550	BUMPER SIDE RETAINER RR/LH	1	94.80	25.00	71.10	Replace	Replace ?	No
52575-47020		6505549	BUMPER SIDE RETAINER RR/RH	1	94.80	25.00	71.10	Replace	Replace ✓ CAC	No
58308-47011			UNDER COVER SUB-ASSY, RR FLOOR	1	514.50	25.00	385.87	Replace	Replace ?	No
17565-42030			SUPPORT, EXHAUST REAR	2	33.60	25.00	50.40	Replace	Replace ?	No
58327-47020			EXHAUST HEAT SHIELD, REAR	1	107.40	25.00	80.55	Replace	Replace ?	No
7430-47380			EXHAUST TAIL PIPE	1	656.20	25.00	492.15	Replace	Replace ?	No
47005-47241			TAILGATE ASY	1	1,007.90	25.00	755.92	Replace	Replace ✓ DT	No
5574-47020			TAIL GATE DOOR GLASS MOULDING, LH	1	29.40	25.00	22.05	Replace	Replace ✓ NTC	No
5573-47080			TAIL GATE DOOR GLASS MOULDING, RH	1	29.40	25.00	22.05	Replace	Replace ✓ NTC	No
5575 - 47030			MOULDING BACK WINDOW, LOWER NO.1	1	29.40	25.00	22.05	Replace	Replace ✓ NTC	No
	COMMON		SEALANT W/SCREEN	3	37.00	0.00	111.00	Replace	Replace ✓ NTC	No
8810-47010			TAILGATE DOOR HINGE LH/RH	1	58.30	25.00	43.72	Replace	Replace X	No
9350-47030			TAILGATE DOOR LOCK	1	444.10	25.00	333.07	Replace	Replace ?	No
9415-47020			TAILGATE LOCK, COVER	1	15.70	25.00	11.77	Replace	Replace ?	No
7881-47022			TAILGATE DOOR WEATHER STRIP	1	353.40	25.00	265.05	Replace	Replace X	No
3801-47070-80			TAILGATE OUTSIDE GARNISH	1	504.90	25.00	378.67	Replace	Replace R	No
5310-47020		6505639	EMBLEM REAR	1	60.30	25.00	45.22	Replace	Replace ✓ NTC	No
5374-47051			NAME PLATE (HYBRID)	1	51.90	25.00	38.92	Replace	Replace ✓ NTC	No

Number	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommended	Surveyor Approved	Photos Attached
75442-47030	NAME PLATE (PRIUS)	1	60.80	25.00	45.60	Replace	Replace	No ✓ NEC
75443-47030	NAME PLATE (TOYOTA)	1	51.90	25.00	38.92	Replace	Replace	No ✓ NEC
COMMO N	SMRT LOGO	1	7.80	0.00	7.80	Replace	Replace	No ✓ NEC
	STICKER DECAL 6555 8888	1	21.60	0.00	21.60	Replace	Replace	No ✓ NEC
58307-47060	6505522 END PANEL	1	602.10	25.00	451.57	Replace	Replace	No ✓ Deform
34718-47031B0	END PANEL COVER, DECK TRIM HOLE	1	46.10	25.00	34.57	Replace	Replace	No
34716-47031B0	END PANEL COVER, DECK TRIM, RR	1	121.10	25.00	90.82	Replace	Replace	No
58336-12090	REINFORCEMENT, RR	1	34.60	25.00	25.95	Replace	Replace	No
COMMO N	4006314 SEALANT SIKAFLEX	1	37.00	0.00	37.00	Replace	Replace	No ✓ NEC
58311-17071	6505523 SPARE TYRE PANEL	1	667.70	25.00	500.77	Replace	Replace	No R
37603-17030	MEMBER SUB-ASSY, RR RH	1	174.10	25.00	130.57	Replace	Replace	No R
38302-17030	FLOOR PANEL RR/RH	1	209.90	25.00	157.42	Replace	Replace	No ✓ Deform
	BATTERY	1	278.00	10.00	250.20	Replace	Replace	No ✓ Deform
4481-17050	BATTERY CLAMP	1	16.10	25.00	12.07	Replace	Replace	No ✓ bl
4440-17030	BATTERY TRAY	1	42.80	25.00	32.10	Replace	Replace	No ✓ Deform
12162-17B20	WIRE, FLOOR, NO.2	1	1,305.40	10.00	1,174.86	Replace	Replace	No
2164-7070	WIRE, FRAME	1	1,680.90	25.00	1,260.67	Replace	Replace	No
1607-7060	PANEL SUB-ASSY, QTR	1	588.40	25.00	441.30	Replace	Replace	No ✓ NEC
4730-7031B2	PANEL ASSY, DECK RH	1	307.00	25.00	230.25	Replace	Replace	No ✓ Deform
8490-7140B0	BOARD ASSY, RR RH	1	379.20	25.00	284.40	Replace	Replace	No
8427-7040	SPACER, RR FLOOR	1	130.60	25.00	97.95	Replace	Replace	No
4997-7020	BOX, DECK FLOOR, LH	1	196.80	25.00	147.60	Replace	Replace	No
8418-7070B0	BOX, DECK FLOOR, COVER LH	1	230.10	25.00	172.57	Replace	Replace	No
8416-7030B3	BOX, RR FLOOR, BOARD	1	679.60	25.00	509.70	Replace	Replace	No
4993-7020	BOX, DECK FLOOR, RR	1	649.70	25.00	487.27	Replace	Replace	No
3415-7030	BOARD, RR FLOOR	1	392.30	25.00	294.22	Replace	Replace	No
2562-7010	TAIL LAMP BRACKET, RH	1	30.70	25.00	23.02	Replace	Replace	No ✓ NEC
1551-7180	6505462 TAIL LAMP RH	1	557.80	10.00	502.02	Replace	Replace	No ✓ NEC
1621-7030	TROUGH, BACK DOOR	1	110.90	25.00	83.17	Replace	Replace	No
1604-7090	FENDER RR/RH	1	766.80	25.00	575.10	Replace	Replace	No ✓

Number				(%)	(%)	(%)	Recommen d	Approved	Attached
	COMMO N	SMRT LOGO	1	7.80	0.00	7.80	Replace	Replace	No ✓ NEC
	COMMO N	STICKER DECAL 6555 8888	1	21.60	0.00	21.60	Replace	Replace	No ✓ NEC
55637- 47021	6505480	FENDER LINER RR/RH	1	141.30	25.00	105.97	Replace	Replace	No ✓ Def
52710- 47130		QUARTER GLASS RR/RH	1	846.50	25.00	634.87	Replace	Replace	No ✓ NEC
	COMMO N	SEALANT W/SCREEN	1	37.00	0.00	37.00	Replace	Replace	No ✓ NEC
	6503707	TYRE 607	1	126.74	0.00	126.74	Replace	Replace	No ✓ PUN
42611- 47140	6505658	WHEEL, DISC	1	1,490.20	25.00	1,117.65	Replace	Replace	No x
57003- 47080	6505486	DOOR RR/RH	1	954.50	25.00	715.87	Replace	Replace	No R
39050- 47080		DOOR LOCK RR/RH	1	709.30	25.00	531.97	Replace	Replace	No 7
39410- 33010		DOOR LOCK STRIKER	1	40.50	25.00	30.37	Replace	Replace	No 7
32940- 16060		DUCT ASSY, QUARTER	1	70.40	25.00	52.80	Replace	Replace	No ✓ Def
TOTAL MATERIALS							16,033.72	16,033.56	
TOTAL MATERIALS(Discounted)							12,826.85	12,826.85	

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check	LT Check
TOTAL SUPPLEMENTARY MATERIALS									

SMRT Accident Vehicle Repair Estimates


4-5-18/14.20

14-5-18/10:20

14-5-18/14:20

Section A - To be completed by claims Advisor/Duty officer at Accident Reporting Centre

Reg. No : SHF441J
Ref. No : TAX/05/18/2011
Reg. Date : 27/12/2013
Vehicle Type : TAXI
Make : TOYOTA PRIUS
Model : PRIUS
Name of Driver : CHIA SIEW KEE
Type of Accident : HEAD TO REAR
Date / Time of Accident : 01/05/2018 11:00:00 PM
Accident Reported Date / Time : 03/05/2018 12:00:00 AM
Surveyor is Required? : Yes
Survey by : Sebastian
Vehicle is Towed Back? : Yes
Towed Back Date/Time : 03/05/2018
Replacement Vehicle issued? : No
Accident Repair Job Card No : 000024095862
Special Instruction to ARC, if any :

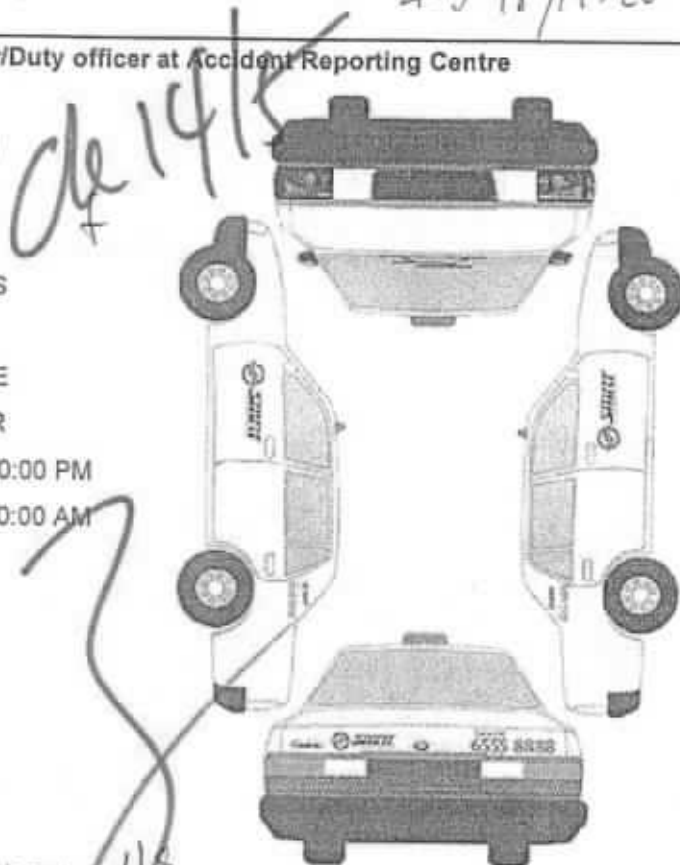

TOWED TO TP COMPOUND \$90 / SHB8401T NTWL 48
BEFORE PAINT PHOTO AND AFTER PAINT, FOR CHECK ITEM AND REPLACE ITEM PLEASE CALL
SURVEYOR SEBASTIAN (LKK) & Email : sebastianyeang@lkkauto.com HP: 90036121
LUMPSUM REPAIR
TYRE = 60%

Prepared Date : 03/05/2018 01:00:17 PM

Gunn

Recording Camera

☐ ☒

Radio Antenna

☐ ☒

1st witness

Date 4-5-18

2nd witness

Date

531213
1 1/4 1/2 3/4 1

QC 17/5/18

531250

18.42 PASS

Vehicle Return Date: 17-5-2018

Vehicle Return Time: 11:45

SMRT staff sign:

Supplementary
* Refer to the Supplementary part list ✓

Section B - To be Completed by Service Advisor, Accident Repair Centre

Chassis No : JTDKN36U00-5719354

Mileage


0

Work Shop :

Repair Completed Date / Time :

Summary of Repair Estimates

	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Charges	1,521.00	1,400.00
Total Spray Painting Charges	3,132.00	1,400.00
Total Material Charges	8,334.70	6,568.42
Other Charges	2,025.00	-1,268.42
TOTAL	15,012.70	8,100.00
Lump Sum Total	0.00	0.00
No. of Repair Days	11.00	10.00
Prepared / Adjusted By		SEBASTIAN (LKK)
Arc / Surveyor Sign Off Date	04/05/2018 09:20:30 AM	04/05/2018 02:11:08 PM

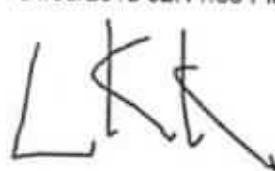

Prepared / Adjusted Date :

Remarks :

Prepared Date : 04/05/2018 09:18:59 AM

Section C - To be Completed by Admin Assistant, Accident Repair Centre, Upon Completion of Repair

Quotation No : QN-1805-0551

Invoice No :

Quotation Date : 23/5

Invoice Date :

Invoice Amount : 0.00

Prepared Date : 5/4/2018 9:20:22 AM

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO CHECK WIRING AND SYSTEM FUNCTION	80.00	30.00 /
TO APPLY RUST-PROOFING ON AFFECTED AREA	100.00	40.00 /
TO DO WHEEL ALIGNMENT / TYRE BALANCING	120.00	0.00
TO REMOVE AND REFIT TYRE RIM (SPRAYING PURPOSE)	120.00	0.00
TO PROVIDE LABOUR & MATERIAL FOR SOLAR FILM (NET)	125.00	125.00 /
TO REMOVE & REFIT REAR QUARTER GLASS RH	120.00	30.00 /
TO REMOVE AND REFIT WIRE HARDESS	250.00	100.00 /
TO REMOVE & REFIT EXHAUST	120.00	50.00 /
CHASSIS ALIGNMENT	350.00	200.00 /
TO TEST AND REFIX REVERSE SENSOR SYSTEM	120.00	30.00 /
TO REMOVE AND INSTALL LUGGAGE COMPARTMENT TRIM TO FACILITATE REPAIR.	120.00	50.00 /
TO INSPECT RR LIGHTING, MECHANISMS & WATER TEST RR LIGHTING FOR LEAKAGE	120.00	30.00 /
TO TRANSFER REAR TAILGATE MECHANISM	120.00	50.00 /
TO REPLACE SUNDRY PARTS	100.00	0.00
TO WASH AND VACUUM	60.00	0.00
Lump Sum Adjustment by Surveyor	0.00	-2,003.42
Total Other Costs	2,025.00	-1,268.42

Section D - Details of Repair Estimates**Part 1 - Labour Works**

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPAIR REAR PORTION	1,521.00	1,400.00 /
Total Labour	1,521.00	1,400.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPSRAY REAR BUMPER	378.00	200.00 /
TO RESPRAY TAIL GATE	378.00	200.00 /
TO RESPRAY TAILGATE OUTSIDE GARNISH	180.00	100.00 /
TO RESPRAY REAR PANEL	180.00	100.00 /
TO RESPRAY REAR SPARE TYRE PANEL	180.00	100.00 /
TO RESPRAY REAR MEMBER,RH	180.00	50.00 /
TO RESPRAY FLOOR CORNER PANEL RH	180.00	50.00 /
TO RESPRAY REAR RH WHEEL HOUSE	180.00	100.00 /
TO RESPRAY BATTERY PANEL	180.00	50.00 /
TO RESPRAY TROUGH BACK DOOR RH	180.00	50.00 /
TO RESPRAY REAR FENDER RH	378.00	200.00 /
TO RESPRAY RIM	180.00	0.00
TO RESPRAY REAR DOOR RH	378.00	200.00 /
Total Spray Painting & Panel Beating	3,132.00	1,400.00

Part 3 - Other Costs - Accident and Accident Repair Related Expenses

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommendation	Surveyor Approved	Photos Attached
75442-47030			NAME PLATE (PRIUS)	1	60.80	25.00	45.60	Replace	Replace	No
75443-47030			NAME PLATE (TOYOTA)	1	51.90	25.00	38.92	Replace	Replace	No
	COMMON		SMRT LOGO	1	7.80	0.00	7.80	Replace	Replace	No
			STICKER DECAL 6555 8888	1	21.60	0.00	21.60	Replace	Replace	No
58307-47060		6505522	END PANEL	1	602.10	25.00	451.57	Replace	Replace	No
64718-47031B0			END PANEL COVER, DECK TRIM HOLE	1	46.10	25.00	34.58	Replace	Replace	No
64716-47031B0			END PANEL COVER, DECK TRIM, RR	1	121.10	25.00	90.83	Replace	Replace	No
58336-12090			REINFORCEMENT, RR	1	34.60	25.00	25.95	Replace	Check	X
	COMMON	4006314	SEALANT SIKAFLEX	1	37.00	0.00	37.00	Replace	Replace	No
58311-47071		6505523	SPARE TYRE PANEL	1	667.70	100.00	0.00	Replace	Repair	L
57603-47030			MEMBER SUB-ASSY, RR RH	1	174.10	100.00	0.00	Replace	Repair	R
58302-47030			FLOOR PANEL RR/RH	1	209.90	25.00	157.42	Replace	Replace	/
			BATTERY	1	278.00	10.00	250.20	Replace	Replace	/
74481-47050			BATTERY CLAMP	1	16.10	25.00	12.07	Replace	Replace	/
74440-47030			BATTERY TRAY	1	42.80	25.00	32.10	Replace	Replace	/
82162-47B20			WIRE, FLOOR, NO.2	1	1,305.40	10.00	1,174.66	Replace	Check	X
82164-47070			WIRE, FRAME	1	1,680.90	25.00	1,260.68	Replace	Check	X
61607-47060			PANEL SUB-ASSY, QTR	1	588.40	25.00	441.30	Replace	Replace	/
64730-47031B2			PANEL ASSY, DECK RH	1	307.00	25.00	230.25	Replace	Replace	/
58490-47140B0			BOARD ASSY, RR RH	1	379.20	25.00	284.40	Replace	Check	X
58427-47040			SPACER, RR FLOOR	1	130.60	25.00	97.95	Replace	Check	X
64997-47020			BOX, DECK FLOOR, LH	1	196.80	25.00	147.60	Replace	Check	X
58418-47070B0			BOX, DECK FLOOR, COVER LH	1	230.10	25.00	172.58	Replace	Check	X
58416-47030B3			BOX, RR FLOOR, BOARD	1	679.60	25.00	509.70	Replace	Check	X
64993-47020			BOX, DECK FLOOR, RR	1	649.70	25.00	487.28	Replace	Check	X
58415-47030			BOARD, RR FLOOR	1	392.30	25.00	294.23	Replace	Check	X
52562-47010			TAIL LAMP BRACKET, RH	1	30.70	25.00	23.02	Replace	Replace	/
81551-47180		6505462	TAIL LAMP RH	1	557.80	10.00	502.02	Replace	Replace	/
61621-47030			TROUGH, BACK DOOR	1	110.90	25.00	83.18	Replace	Check	X
61604-47090			FENDER RR/RH	1	766.80	25.00	575.10	Replace	Replace	/
	COMMON		SMRT LOGO	1	7.80	0.00	7.80	Replace	Replace	/

2457-16

10385 60

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommendation	Surveyor Approved	Photos Attached
52159-47905		6505548	BUMPER REAR	1	458.60	25.00	343.95	Replace	Replace	No ✓
52161-16010			BUMPER CLIPS	10	1.61 (16.10)	25.00	12.07	Replace	Replace	No ✓
52023-12240		6505547	BUMPER REINFORCEMENT REAR	1	205.70	25.00	154.27	Replace	Replace	No ✓
52015-47050			ARM SUB-ASSY, RR BUMPER RH	1	139.60	25.00	104.70	Replace	Replace	No ✓
52016-47030			ARM SUB-ASSY, RR BUMPER LH	1	139.60	25.00	104.70	Replace	Replace	No ✓
			SENSOR REVERSE	1	180.00	0.00	180.00	Replace	Replace	No ✓
			PIXEL STICKER	2	60.00 (120)	0.00	120.00	Replace	Replace	No ✓
76087-47020		6505618	BUMPER LIP COVER RR/RH	1	118.10	25.00	88.57	Replace	Replace	No ✓
76891-47020		6505619	BUMPER LIP REAR	1	228.90	25.00	171.67	Replace	Replace	No ✓
52591-47021			BUMPER SEAL, RR RH	1	65.70	25.00	49.28	Replace	Replace	No ✓
52576-47020		6505550	BUMPER SIDE RETAINER RR/LH	1	94.80	25.00	71.10	Replace	Replace	No ✓
52575-47020		6505549	BUMPER SIDE RETAINER RR/RH	1	94.80	25.00	71.10	Replace	Replace	No ✓
58308-47011			UNDER COVER SUB-ASSY, RR FLOOR	1	514.50	25.00	385.88	Replace	Check	No X
17565-22030			SUPPORT, EXHAUST REAR	2	33.60 (67.20)	25.00	50.40	Replace	Check	No X
58327-47020			EXHAUST HEAT SHIELD, REAR	1	107.40	25.00	80.55	Replace	Check	No X
17430-37380			EXHAUST TAIL PIPE	1	656.20	25.00	492.15	Replace	Check	No X
67005-47241			TAILGATE ASY	1	1,007.90	25.00	755.92	Replace	Replace	No ✓
75574-47020			TAIL GATE DOOR GLASS MOULDING, LH	1	29.40	25.00	22.05	Replace	Replace	No ✓
75573-47080			TAIL GATE DOOR GLASS MOULDING, RH	1	29.40	25.00	22.05	Replace	Replace	No ✓
75575-47030			MOULDING BACK WINDOW, LOWER NO.1	1	29.40	25.00	22.05	Replace	Replace	No ✓
	COMMO N		SEALANT W/SCREEN	3	37.00 (111)	0.00	111.00	Replace	Replace	No ✓
68810-47010			TAILGATE DOOR HINGE LH/RH	0	58.30	25.00	0.00	Replace	Not given	No X
69350-47030			TAILGATE DOOR LOCK	1	444.10	25.00	333.08	Replace	Check	No X
69415-47020			TAILGATE LOCK COVER	1	15.70	25.00	11.78	Replace	Check	No X
67881-47022			TAILGATE DOOR WEATHER STRIP	0	353.40	25.00	0.00	Replace	Not given	No X
76801-47070-B0			TAILGATE OUTSIDE GARNISH	1	504.90	100.00	0.00	Replace	Repair	No ✓
75310-47020		6505639	EMBLEM REAR	1	60.30	25.00	45.22	Replace	Replace	No ✓
75374-47051			NAME PLATE (HYBRID)	1	51.90	25.00	38.92	Replace	Replace	No ✓

2458.62

5902.90

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommendation	Surveyor Approved
	COMMON		STICKER DECAL 6555 8888	1	21.60	0.00	21.60	Replace	Replace
65637-47021		6505480	FENDER LINER RR/RH	1	141.30	25.00	105.97	Replace	Replace
62710-47130			QUARTER GLASS RR/RH	1	846.50	25.00	634.87	Replace	Replace
	COMMON		SEALANT W/SCREEN	1	37.00	0.00	37.00	Replace	Replace
		6503707	TYRE	1	126.74	0.00	126.74	Replace	Replace
42611-47140		6505658	WHEEL, DISC	0	1,490.20	25.00	0.00	Replace	Not given
67003-47080		6505486	DOOR RR/RH	1	954.50	100.00	0.00	Replace	Repair
69050-47080			DOOR LOCK RR/RH	1	709.30	25.00	531.98	Replace	Check
69410-33010			DOOR LOCK STRIKER	1	40.50	25.00	30.38	Replace	Check
62940-18060			DUCT ASSY, QUARTER	1	70.40	25.00	52.80	Replace	Replace
89997-30070			ANTENNA, ELECTRICAL LOWER REAR	1	157.40	10.00	141.66	Replace	Replace
TOTAL MATERIALS							13,023.06		
TOTAL MATERIALS(Discounted)							8,334.70		

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check
89997-30070		ANTENNA, ELECTRICAL LOWER REAR	1	157.40	10.00	141.66	Replace	Rep
TOTAL SUPPLEMENTARY MATERIALS						141.66		

$$\begin{array}{r}
 6568.41 \\
 + 1400.00 \\
 + 2135.00 \\
 \hline
 10,103.41 \\
 - 20\% \\
 \hline
 8082.73
 \end{array}$$

LS \$8100/-

$$\begin{array}{r}
 6015.67 \\
 1400.00 \\
 + 2135.00 \\
 \hline
 9550.67 \\
 - 20\% \\
 \hline
 7640.53 \\
 4/5: \$7650
 \end{array}$$

* Remark : Tyre 60% only

Subscribed
28/5/18

**National Assessment Centre Services**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



Thatcham escribe

NTUC INCOME INSURANCE CO-OPERATIVE LTD Ref: NS/INC18008269/Stbe2

73 BRAS BASAH ROAD

#05-01 NTUC TRADE UNION HOUSESINGAPORE
189556

Date: 19-06-2018



Code: INC4

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SHB 8401T	Veh. Inspected	SHF 441J
Policy No.	5095103893	Coverage (\$)	0.00
Claim No.	MT/0992549-002	Excess (\$)	0.00
Assign From		Assign Date	04/05/2018

2. Vehicle Particulars & Condition

Make & Model	TOYOTA PRIUS	c.c	1798
Engine No.	HIDDEN	Year of Reg.	2013
Chassis No.	JTDKN36U005719354	Colour	MAROON
Odometer	-	Steering	IN ORDER
Brakes	IN ORDER	Modification	NIL
General	FAIR		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	195/65 R15	FALKEN	6 mm
L/H Front Tyre	195/65 R15	FALKEN	6 mm
R/H Rear Tyre	195/65 R15	FALKEN	6 mm
L/H Rear Tyre	195/65 R15	FALKEN	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR O/S PORTION. DAMAGES SEE DETAILS.
--

5. General Information

Accident Date	01/05/2018	Inspection Date	04/05/2018
Survey held at	SMRT AUTOMOTIVE SERVICES PTE LTD 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
--

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	10 Working Days
-------------------------------------	-----------------

**National Assessment Centre Services**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHF 441J

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	NAME PLATE (PRIUS) (DISC 25%)	NECESSARY	60.80	45.60
1	NAME PLATE (TOYOTA) (DISC 25%)	NECESSARY	51.90	38.92
1	END PANEL (DISC 25%)	DEFORMED	602.10	451.57
1	END PANEL COVER, DECK TRIM HOLE (DISC 25%)	DEFORMED	46.10	34.58
1	END PANEL COVER, DECK TRIM, RR (DISC 25%)	DEFORMED	121.10	90.83
1	FLOOR PANEL RR/RH (DISC 25%)	DEFORMED	209.90	157.42
1	BATTERY CLAMP (DISC 25%)	BENT	16.10	12.07
1	BATTERY TRAY (DISC 25%)	DEFORMED	42.80	32.10
1	PANEL SUB-ASSY, QTR (DISC 25%)	NECESSARY	588.40	441.30
1	PANEL ASSY, DECK RH (DISC 25%)	DEFORMED	307.00	230.25
1	TAIL LAMP BRACKET, RH (DISC 25%)	NECESSARY	30.70	23.02
1	FENDER RR/RH (DISC 25%)	DENTED	766.80	575.10
1	BUMPER REAR (DISC 25%)	CRACKED	458.60	343.95
10	BUMPER CLIPS @\$1.61 (DISC 25%)	NECESSARY	16.10	12.07
1	BUMPER REINFORCEMENT REAR (DISC 25%)	DENTED	205.70	154.27
1	ARM SUB-ASSY, RR BUMPER RH (DISC 25%)	BENT	139.60	104.70
1	ARM SUB-ASSY, RR BUMPER LH (DISC 25%)	BENT	139.60	104.70
1	BUMPER LIP COVER RR/RH (DISC 25%)	MISSING	118.10	88.57
1	BUMPER LIP REAR (DISC 25%)	CUT	228.90	171.67
1	BUMPER SEAL, RR RH (DISC 25%)	DEFORMED	65.70	49.28
1	BUMPER SIDE RETAINER RR/LH (DISC 25%)	NECESSARY	94.80	71.10
1	BUMPER SIDE RETAINER RR/RH (DISC 25%)	CRACKED	94.80	71.10
1	TAILGATE ASY (DISC 25%)	DENTED	1,007.90	755.92
1	TAIL GATE DOOR, GLASS MOULDING, LH (DISC 25%)	NECESSARY	29.40	22.05
1	TAIL GATE DOOR GLASS MOULDING, RH (DISC 25%)	NECESSARY	29.40	22.05
1	MOULDING BACK WINDOW, LOWER NO.1 (DISC 25%)	NECESSARY	29.40	22.05
1	EMBLEM REAR (DISC 25%)	NECESSARY	60.30	45.22
1	NAME PLATE (HYBRID) (DISC 25%)	NECESSARY	51.90	38.92
1	FENDER LINER RR/RH (DISC 25%)	DEFORMED	141.30	105.97
1	QUARTER GLASS RR/RH (DISC 25%)	NECESSARY	846.50	634.87

Report Ref No. NS/INC18008269/Stbe2



National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	DUCT ASSY, QUARTER (DISC 25%)	DEFORMED	70.40	52.80
1	BATTERY (DISC 10%)	DEFORMED	278.00	250.20
1	ANTENNA, ELECTRICAL LOWER REAR (DISC 10%)	DAMAGED	157.40	141.66
1	SMRT LOGO (SN)	NECESSARY	7.80	7.80
1	STICKER DECAL 6555 8888 (SN)	NECESSARY	21.60	21.60
1	SEALANT SIKAFLEX (SN)	NECESSARY	37.00	37.00
1	SMRT LOGO (SN)	NECESSARY	7.80	7.80
1	SENSOR REVERSE (SN)	DAMAGED	180.00	180.00
2	PIXEL STICKER @\$60.00 (SN)	NECESSARY	120.00	120.00
3	SEALANT W/SCREEN @\$37.00 (SN)	NECESSARY	111.00	111.00
1	STICKER DECAL 6555 8888 (SN)	NECESSARY	21.60	21.60
1	SEALANT W/SCREEN (SN)	NECESSARY	37.00	37.00
1	TYRE (SN) (60%)	PUNCTURE	126.74	76.04
1	TAIL LAMP RH (DISC 10%)	CRACKED	557.80	502.02
1	REINFORCEMENT, RR	NOT NECESSARY	34.60	-
1	WIRE, FLOOR, NO.2	NOT NECESSARY	1,305.40	-
1	WIRE, FRAME	NOT NECESSARY	1,680.90	-
1	BOARD ASSY, RR RH	NOT NECESSARY	379.20	-
1	SPACER, RR FLOOR	NOT NECESSARY	130.60	-
1	BOX, DECK FLOOR, LH	NOT NECESSARY	196.80	-
1	BOX, DECK FLOOR, COVER LH	NOT NECESSARY	230.10	-
1	BOX, RR FLOOR, BOARD	NOT NECESSARY	679.60	-
1	BOX, DECK FLOOR, RR	NOT NECESSARY	649.70	-
1	BOARD, RR FLOOR	NOT NECESSARY	392.30	-
1	TROUGH, BACK DOOR	NOT NECESSARY	110.90	-
1	UNDER COVER SUB-ASSY, RR FLOOR	NOT NECESSARY	514.50	-
2	SUPPORT, EXHAUST, REAR @\$33.60	NOT NECESSARY	67.20	-
1	EXHAUST HEAT SHIELD, REAR	NOT NECESSARY	107.40	-
1	EXHAUST TAIL PIPE	NOT NECESSARY	656.20	-
1	TAILGATE DOOR HINGE LH / RH	NOT NECESSARY	58.30	-
1	TAILGATE DOOR LOCK	NOT NECESSARY	444.10	-
1	TAILGATE LOCK, COVER	NOT NECESSARY	15.70	-
1	TAILGATE DOOR WEATHER STRIP	NOT NECESSARY	353.40	-

Report Ref No. NS/INC18008269/Stbe2

**National Assessment Centre Services**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	WHEEL DISC	NOT NECESSARY	1,490.20	-
1	SPARE TYRE PANEL	TO REPAIR	667.70	-
1	MEMBER SUB-ASSY, RR RH	TO REPAIR	174.10	-
1	TAILGATE OUTSIDE GARNISH	TO REPAIR	504.90	-
1	DOOR RR/RH	TO REPAIR	954.50	-
1	DOOR LOCK RR/RH	NOT NECESSARY	709.30	-
1	DOOR LOCK STRIKER	NOT NECESSARY	40.50	-
			20,883.94	6,517.74
	LABOUR			
	TO WASH AND VACUUM.	NOT NECESSARY	60.00	-
	THATCHAM STANDARD REPAIR TIME ON BODY WORKS.		3,286.00	2,095.00
	THATCHAM TTS STANDARD SPRAY PAINTING COST AND LABOUR.		3,232.00	1,440.00
	TO REPLACE SUNDRY PARTS.	NOT NECESSARY	100.00	-
			6,678.00	3,535.00
GRAND TOTAL			27,561.94	10,052.74
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION) (CONFIRMED)				8,050.00

Report Ref No. NS/INC18008269/Stbe2

YEANG WAI KEEN

Automotive Assessor

K.K.LAU CPT(RET)**BEng(Hons), B.Bus, MBA, PEng, PE,
MInstAEA, MASME, MIRTE****REGD Auto Consultant-SAE, Licensed Appraiser****DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.