

REF:

NS/ZNC 18008612 / Srbn2

ASSIGNMENT

From:

Date:

Veh No.

S1F 44Y

Yr Regn:

1/11/2017

Estimated Cost:

Type: M.Car / M.Cycle / Bus / Van / Lorry / (Taxi) Prime Mover /

Truck / Trailer or

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

Make:

Toyota Prins 4

c.c. 1798

To Inspect Vehicle No:

Colour

Maroon

A/C: Insured / Std / NI / NA

at Workshop m/s

Sp. Reading

56195

T/Radio: Insured / Std / NI / NA

of

Eng/No:

JTDKB3F4703575474

Insured:

FBL 9539S

Policy No.

5097631701

330118-010619

Claims No.

MT/0993285-003

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 175/65R15

R: "

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Bal. or Market Value:

Front

Rear

IDAC Accident Rpt:

Consistent? : Yes or No

R/Bal. 6 mm

R/Bal. 6 mm

GIA / PR Seen:

Consistent? : Yes or No

L/Bal. 6 mm

L/Bal. 6 mm

Est. Repairs:

days Res.: Yes or No

D.O.A. 5/5/18

D.O.I. 8/5/18

Lum Sum:

% 3 Val.: Yes or No

Survey held at

SMRT

CA / REV / REP. / 24 HRS

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Date:

Person Contacted:

Vehicle: IN / OUT

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

S1F 44Y - CC3 / C/L16018611 / Srg3n2

DA: 300916

TAX/05/18/2036

FBL 9539S - NBA / INC17013153 / Y

DA: 030717

LKK

NTUC

Contim 8668.37 @ 7 days

Red: 6954.37, 51%

FBL 9539S

RECEIVED 01 JUN 2018

Date/Time. File Pass to?

Preli. Report

Days Of Repair: 7

1) typet

Final Report

Resurvey No. of Trip: 1

Date/Time. File Return to?

Survey Fee:

160

Transportation:

35

2)

Add Fee:

Site Insp (\$

) S + RS. SI

Report Format :

TP

Interview (\$

) Photos

Lump Sum / I.B.I. (\$

6688.37

Tech. Invs (\$

) Others

Week-end (\$

TOTAL

195



National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



NTUC INCOME INSURANCE CO-OPERATIVE LTD Ref: NS/INC18008612/Srb			
73 BRAS BASAH ROAD		Date: 10-05-2018	
#05-01 NTUC TRADE UNION HOUSESINGAPORE		Code: INC4	
189556			
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	FBL 9539S	Veh. Inspected	SHF 44Y
Policy No.	5097631701	Coverage (\$)	0.00
Claim No.		Excess (\$)	0.00
Assign From		Assign Date	08/05/2018
2. Vehicle Particulars & Condition			
Make & Model		c.c	0
Engine No.	HIDDEN	Year of Reg.	
Chassis No.		Colour	
Odometer	-	Steering	
Brakes		Modification	
General			
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm
4. Description of Damages			
5. General Information			
Accident Date	05/05/2018	Inspection Date	08/05/2018
Survey held at	SMRT AUTOMOTIVE SERVICES PTE LTD 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			

Hello, NAC_PAYA_UBI_800601

[Change Language](#)
[Change Password](#)
[Log Out](#)

[My Desktop](#)
[Notice of Loss](#)

Policy Query

Policy No. Date of Accident
 Vehicle No.(For Motor)

Select	Policy No.	Policyholder Name	Policyholder NRIC	Product	Cover Type	Vehicle No.	Insured Object	Commence Date	Expiry Date
<input checked="" type="radio"/>	5097631701	NORAZMI BIN HIZAM	S7248100C	GMC	Third Party, Fire & Theft	FBL95395	FBL95395	23/01/2018	01/06/2019

TP Claims against NTUC Income: Follow-Through Survey

S/No	Income Reference	Claimant (Owner / Taxi Company)	Claimant Vehicle No.	Income Vehicle No.	Date of Accident	Time of Accident	Estimate	Tentative repair cost
1	MT/0994491-002	SMRT TAXIS PTE LTD	SMB 1637S	XD 4312T	14/05/2018	14:55	\$ 2,433.00	\$ 1,600.00
2	MT/0993285-003	SMRT TAXIS PTE LTD	SHF 44Y	FBI 9539S	05/05/2018	18:50	\$ 13,642.74	\$ 6,688.36

Claim received from LKK Auto

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	07/05/2018 12:25
Date Of Accident	05/05/2018 18:50
Exact Location Of Accident	SERANGOON ROAD AND ST GEORGE'S ROAD
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SHF44Y
Insured/Policyholder	
Name Of Registered Owner	SMRT TAXIS PTE LTD
Co Reg No	198905369K
Email Address	NOEMAIL
Mobile Phone No	
Alternative Phone No	OFFICE-80000000

Vehicle Particulars

Manufacturer	TOYOTA
Model	PRIUS TAXI-1.8 (A)
Exact Purpose for which vehicle was being used at time of accident	HIRE AND REWARD
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	TAXI

Insurance Company

Name of Insurance Company	MS FIRST CAPITAL INSURANCE LTD
Type Of Coverage	THIRD PARTY FIRE AND/OR THEFT
Fleet Policy	YES
Policy Number	D-18090213MFSH
Cover Note Number	

Driver

Name of Driver	SULAIMAN BIN RISVAN
NRIC No	S1615725B
Date Of Birth	03/11/1963
Occupation	OUTDOOR
Date Of Driving Pass	06/06/1984
Driving Experience	33 YEARS AND 10 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-80000000
Fax Number	
Contact Number	
EMail Address	NOEMAIL

Address	09-656
Postcode	
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OTHER - HIRER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	SIDE SWIPE
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles involved in the accident	
Was any body injured in the Accident?	YES
Was any injured conveyed to hospital by ambulance?	YES
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	2
Passenger 1	NAME: : UNKNOWN GENDER: : MALE

Details of Police Action

Was the accident reported to the police?	YES
If Yes, Please state which Police Station	
Police Station Name	WOODLANDS EAST N.P.C
Police Station Address	ROAD: 3 WOODLANDS DRIVE 63 , POSTCODE: 737890 , COUNTRY: SINGAPORE
Police Station Contact	TEL NO: - FAX NO:
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

SERANGOON ROAD AND ST GEORGE'S ROAD

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	FBL9539S
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	MOTORCYCLE
Name of Driver	NORAZMI BIN HIZAM
NRIC/Passport Number	S7248100C
Contact Number	
Address	
Postcode	

Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)

DETAILS OF OTHER VEHICLE PROPERTY 2

Vehicle Registration Number SDH3884G

Vehicle Make/Model/Colour

Details Of Properties

Vehicle Category PRIVATE CAR

Name of Driver IGNATIUS LEE LIM ANN

NRIC/Passport Number S7703062Z

Contact Number

Address

Postcode

Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)

DETAILS OF INJURED PERSON 1

Name NORAZMI BIN HIZAM

Approximate Age

Injuries Sustain

Injured person in which vehicle? FBL9539S

Were seat belts worn?

Was this injured conveyed to hospital by ambulance? YES

Address

Postcode

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

8. Consent under the Personal Data Protection Act (PDPA)


I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.(collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents(including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.

Policyholder's Signature
Date & Time:


 7/5/18

Driver's Signature
(If driver is not the policyholder)
Date & Time:

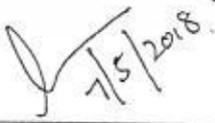 7/5/2018

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

Sketch Plan Pg. 3

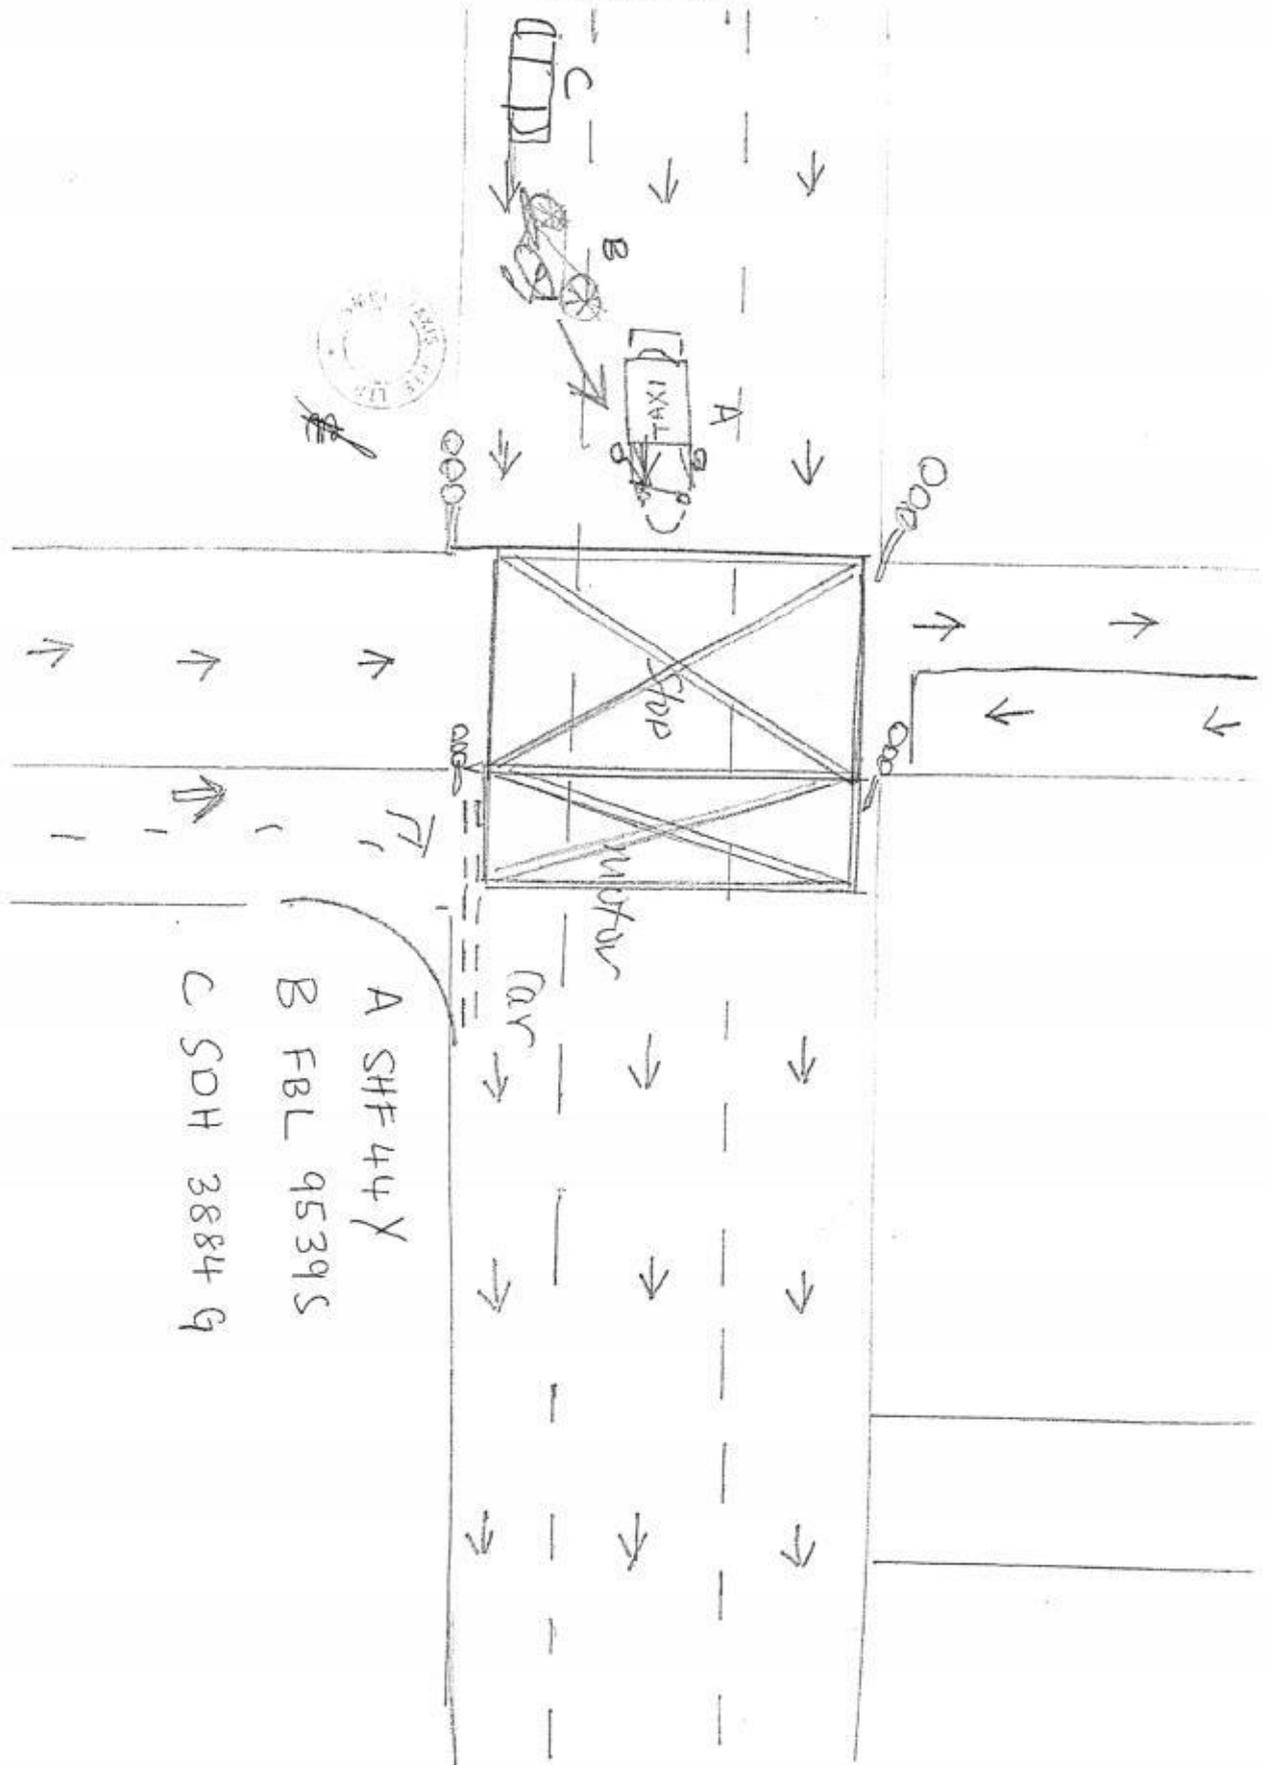

A SHF 44 Y
B FBL 9539 S
C SDH 3884 G



**SINGAPORE
POLICE FORCE**



T/20180505/2149

Police Station Of Origin:
Woodlands East N.P.C.
3 Woodlands Drive 63 SINGAPORE 737890
Tel No: 1800-7679999

2 of 4

Report No. T/20180505/2149

CONTINUATION OF REPORT

Details of Person Involved			
Any Pedestrian Involved: No			
No. of Pedestrians Injured: NIL		Use of Pedestrian Crossing: NA	
Rider			
Name	NORAZMI BIN HIZAM	ID No.	S7248100C
Related Vehicle	FBL9539S (Motorcycle)	Contact No.	NIL
Hospital/Clinic	NIL	Class of Driving Licence & Expiry Date	Class: NIL Date of Expiry: NIL
Date Treatment	NIL	Date Discharge	NIL
No. of Days granted Medical Leave	NIL	Degree of Injury	Slight
Driver			
Name	IGNATIUS LEE LIM ANN	ID No.	S7703062Z
Related Vehicle	SDH3884G (Car)	Contact No.	96360603
Hospital/Clinic	NIL	Class of Driving Licence & Expiry Date	Class: NIL Date of Expiry: NIL
Date Treatment	NIL	Date Discharge	NIL
No. of Days granted Medical Leave	NIL	Degree of Injury	NIL
Driver			
Name	SULAIMAN BIN RISVAN	ID No.	S1615725B
Related Vehicle	SHF44Y (Car)	Contact No.	87160403
Hospital/Clinic	NIL	Class of Driving Licence & Expiry Date	Class: NIL Date of Expiry: NIL
Date Treatment	NIL	Date Discharge	NIL
No. of Days granted Medical Leave	NIL	Degree of Injury	NIL

Brief Details.

On 05/05/18 at about 1850hrs, I was travelling on Serangoon Road with a passenger on my taxi. My vehicle plate number is SHF44Y. Before the traffic junction of Serangoon Road and St George's Road, a motorcycle (vehicle plate number: FBL9539S) suddenly swerved towards my taxi and hit on to the right side of my car. The collision caused the rider to fell off his motorcycle. The right side of my car suffered some scratches and dents. The right side mirror of my car bent after the collision. There was another car (vehicle plate number: SDH3884G) involved in this incident. I am unsure what happened between that car and the motorcycle. The wife of the driver of the other car called for police. Ambulance came down to scene shortly after and the motorcyclist was conveyed to hospital. No one else was injured other than the



**SINGAPORE
POLICE FORCE**



T/20180505/2149

Police Station Of Origin:
Woodlands East N.P.C.
3 Woodlands Drive 63 SINGAPORE 737890
Tel No: 1800-7679999

3 of 4

Report No. T/20180505/2149

CONTINUATION OF REPORT

motorcyclist.



**SINGAPORE
POLICE FORCE**



T/20180505/2149

Police Station Of Origin:
Woodlands East N.P.C.
3 Woodlands Drive 63 SINGAPORE 737890
Tel No: 1800-7679999

4 of 4


Report No. T/20180505/2149

CONTINUATION OF REPORT

Sketch Plan

Informant is not able to provide sketch plan

IMPORTANT: Please attach a copy of your vehicle's Insurance Certificate to this report. If you don't have the certificate with you now, please fax a copy to 65474885 stating the report number as reference.

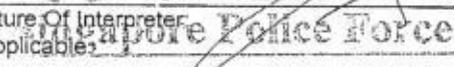Signature Of Officer Recording The Report <small>BN 130</small> J/ CHEN JIAN YU  Signature :	Signature Of Informant: 
Signature Of Interpreter Not applicable 	Date/Time: 05/05/2018 23:07
Officer In Charge Of Case: TP / GIT / Contact No.:	Classification Of Case:
Authentication Stamp NP168	

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Company
Owner ID:	5369K
Vehicle Details	
Vehicle No.:	SHF44Y
Vehicle to be Exported:	No
Intended De-registration Date:	09 May 2018
Vehicle Make:	TOYOTA
Vehicle Model:	PRIUS HYBRID 1.8 CVT
Primary Colour:	Maroon
Manufacturing Year:	2017
Engine No.:	2ZRS100976
Chassis No.:	JTDKB3FU703573474
Maximum Power Output:	90.0 kW (120 bhp)
Open Market Value:	\$29,007.00
Original Registration Date:	01 Nov 2017
First Registration Date:	01 Nov 2017
Transfer Count:	0
Actual ARF Paid:	\$5,000.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	31 Oct 2025
PARF Rebate Amount:	\$3,750.00
Intended COE Rebate Details	
COE Expiry Date:	31 Oct 2025
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	8
PQP Paid:	\$33,596.00
COE Rebate Amount:	\$31,394.00
Total Rebate Amount:	\$35,144.00

Message
Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.

The information contained herein is correct as at 09 May 2018

OK

SMRT Accident Vehicle Repair Estimates

Call

Section A - To be completed by claims Advisor/Duty officer at Accident Reporting Centre

Reg. No : SHF44Y
 Ref. No : TAX/05/18/2036
 Reg. Date : 01/11/2017
 Vehicle Type : TAXI
 Make : TOYOTA PRIUS
 Model : PRIUS4
 Name of Driver : SULAIMAN BIN RISVAN
 Type of Accident : SIDE SWIPE
 Date / Time of Accident : 05/05/2018 06:50:00 PM
 Accident Reported Date / Time : 07/05/2018 12:00:00 AM
 Surveyor is Required? : Yes
 Survey by :
 Vehicle is Towed Back? : Yes
 Towed Back Date/Time : 05/05/2018
 Replacement Vehicle issued? : No
 Accident Repair Job Card No : 000024095926
 Special Instruction to ARC, if any :
 TOWED \$40 / FBL9539S
 Prepared Date : 07/05/2018 12:39:09 PM



*Sebastian
 3/5/18*

- Part by part repair
- Question Mark Item
- Photo
- Photo Before Paint

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Section B - To be Completed by Service Advisor, Accident Repair Centre

Chassis No : JTDKB3FU703573474

Mileage : 0

Work Shop :

Repair Completed Date / Time :

Summary of Repair Estimates

	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Charges	: 1,014.00	0.00
Total Spray Painting Charges	: 1,494.00	0.00
Total Material Charges	: 8,533.42	8,533.42
Other Charges	: 900.00	0.00
TOTAL	: 11,941.42	0.00
Lum Sum Total	: 0.00	0.00
No. of Repair Days	: 6.00	0.00 5 days
Prepared / Adjusted By	:	
Arc / Surveyor Sing Off Date	: 07/05/2018 01:59:23 PM	01/01/1900 12:00:00 AM



Prepared / Adjusted Date :

Remarks :

Prepared Date : 07/05/2018 01:59:11 PM

Section C - To be Completed by Admin Assistant, Accident Repair Centre, Upon Completion of Repair

Quotation No :

Invoice No :

Quotation Date :

Invoice Date :

Invoice Amount : 0.00

Prepared Date : 5/7/2018 1:59:32 PM

Section D - Details of Repair Estimates

Part 1 - Labour Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPAIR RH PORTION	1,014.00	0.00 600
Total Labour	1,014.00	0.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPSRAY FRONT BUMPER	378.00	0.00 200
TO RESPRAY FRONT FENDER RH	378.00	0.00 200
TO RESPRAY RIM	180.00	0.00 * 200
TO RESPRAY FRONT DOOR RH	378.00	0.00 200
TO RESPRAY VIEW MIRROR	180.00	0.00 50
Total Spray Painting & Panel Beating	1,494.00	0.00

Part 3 - Other Costs - Accident and Accident Repair Related Expenses

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TOWING CHARGE	80.00	0.00 X
TO CHECK WIRING AND SYSTEM FUNCTION	80.00	0.00 30
TO APPLY RUST-PROOFING ON AFFECTED AREA	100.00	0.00 30
TO DO WHEEL ALIGNMENT / TYRE BALANCING	120.00	0.00 60
TO TRANSFER DOOR MECHANISM	120.00	0.00 X
TO REMOVE AND REFIX WING MIRROR	120.00	0.00 30
TO REMOVE AND REFIT TYRE RIM (SPRAYING PURPOSE)	120.00	0.00 X
TO REPLACE SUNDRY PARTS	100.00	0.00 X
TO WASH AND VACUUM	60.00	0.00 X
Total Other Costs	900.00	0.00

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommendation	Surveyor Approved	Photos Attached
52119479 62			COVER, FR BUMPER	1	495.50	25.00	371.62	Replace	Replace ✓ CRK	No
52161160 10			CLIPS PIECE, FRT & RR BUMPER	10	1.50	25.00	11.25	Replace	Replace ✓ NCC	No
52115470 50			SUPPORT, FR BUMPER RH	1	76.90	25.00	57.67	Replace	Replace ✓	No
52535500 60			RETAINER, FR BUMPER, LH & RH	1	8.50	25.00	6.37	Replace	Replace X	No
81220470 20			LAMP ASSY, FOG, LH	1	910.20	10.00	819.18	Replace	Replace ✓	No
81145476 91			UNIT, HEADLAMP, RH	1	2,558.90	10.00	2,303.01	Replace	Replace ✓	No
53801470 80			FENDER SUB-ASSY, FR, RH	1	933.10	25.00	699.82	Replace	Replace ✓ DT	No
75374471 40			EMBLEM, SIDE PANEL (HYBRID)	1	52.90	25.00	39.67	Replace	Replace ✓ NEC	No
53875470 70			LINER, FR FENDER, RH	1	198.40	25.00	148.80	Replace	Replace ✓ TN	No
53851470 61			PAD, FR WHEEL RH	1	57.70	25.00	43.27	Replace	Replace ✓	No
			TYRE	1	126.74	0.00	126.74	Replace	Replace X	No
42611- 47450			WHEEL, DISC FRONT	1	1,555.10	25.00	1,166.32	Replace	Replace X	No
42602471 80			CAP SUB-ASSY, WHEEL	1	175.80	25.00	131.85	Replace	Replace ✓ CRK	No
67001471 52			PANEL SUB-ASSY, FRONT DOOR RH	1	1,249.60	25.00	937.20	Replace	Replace R	No
			STICKER DECAL SMRT (DOOR)	1	60.00	0.00	60.00	Replace	Replace ✓ NEC	No
87910474 50			MIRROR ASSY, OUTER REAR VIEW, RH	1	1,373.50	10.00	1,236.15	Replace	Replace ✓ DMG	No
87931474 50			MIRROR OUTER GLASS, RH	1	215.20	25.00	161.40	Replace	Replace ✓ SCR	No
87915470 70A1			COVER, OUTER MIRROR, RH	1	89.50	25.00	67.12	Replace	Replace ✓ NIS	No
81730470 10			LAMP ASSY, SIDE MIRROR TURN SIGNAL, RH	1	162.20	10.00	145.98	Replace	Replace ✓	No
TOTAL MATERIALS								8,533.46	8,533.42	
TOTAL MATERIALS(Discounted)							8,533.42	8,533.42		

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check	LT Check
TOTAL SUPPLEMENTARY MATERIALS									



Tow + 2 Days 16/5
14-5-18/10:37
14-5-18/14:37

SMRT Automotive Service Pte Ltd

60 Woodlands Industrial Park E4, Singapore 757705

FAX Number : 63685592

Estimator Telephone Number : 68662623

Accident Reporting Number : 68662672


Green Attached Supplementary

8-5-18/14:37

SMRT Accident Vehicle Repair Estimates

Section A - To be completed by claims Advisor/Duty officer at Accident Reporting Centre

Reg. No : SHF44Y
 Ref. No : TAX/05/18/2036
 Reg. Date : 01/11/2017
 Vehicle Type : TAXI
 Make : TOYOTA PRIUS
 Model : PRIUS4 8716 0403
 Name of Driver : SULAIMAN BIN RISVAN
 Type of Accident : SIDE SWIPE
 Date / Time of Accident : 05/05/2018 06:50:00 PM
 Accident Reported Date / Time : 07/05/2018 12:00:00 AM
 Surveyor is Required? : Yes
 Survey by : Sebastian
 Vehicle is Towed Back? : Yes
 Towed Back Date/Time : 05/05/2018
 Replacement Vehicle issued? : No
 Accident Repair Job Card No : 000024095926
 Special Instruction to ARC, if any :
 TOWED \$40 / FBL9539S Ntue P/P
 BEFORE PAINT PHOTO ,FOR CHECK ITEM AND REPLACE ITEM PLEASE CALL SURVEYOR SEBASTIAN (LKK)
 & Email :sebastianyeang @lkkauto.com HP:90036121
 Prepared Date : 07/05/2018 12:39:09 PM

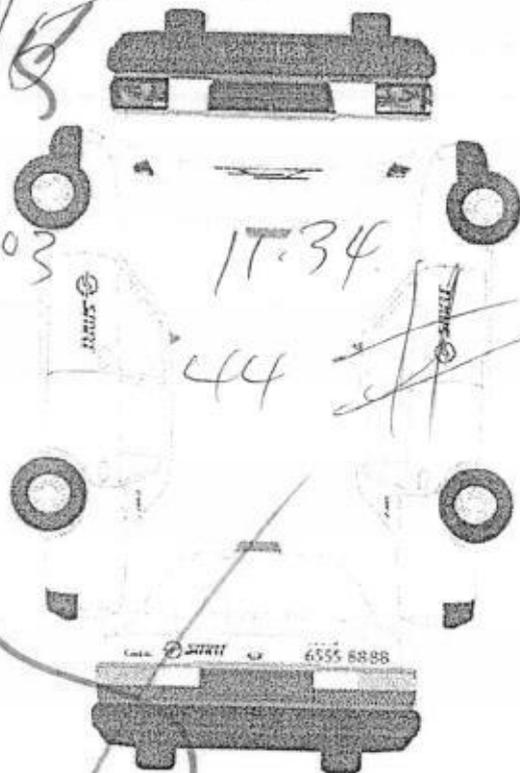


17:10 15-5-18 reject

Reject NCR Hybrid
① emblem side panel (hybrid)
② Petrol not enough 18-5-18 11:24

Recording Camera
 Radio Antenna
 1st witness [Signature] Date 8-5-18
 2nd witness [Signature] Date 15-5-18

Vehicle to Wega Date In: 09/05 Towing: [Signature]
 Time In: 1400 Driver: [Signature]
 Wega Job No: 05/0292
 Vehicle sent to SMRT Date In: 15/5/18 Towing: [Signature]
 Time In: 1440 Driver: [Signature]
 Received by (SMRT): _____

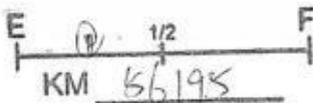

Section B - To be Completed by Service Advisor, Accident Repair Centre

Chassis No : JTDKB3FU703573474 Mileage : 0

Work Shop : Repair Completed Date / Time :

Summary of Repair Estimates

	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Charges	: 1,014.00	600.00
Total Spray Painting Charges	: 1,494.00	650.00
Total Material Charges	: 6,296.80	5,288.36
Other Charges	: 820.00	150.00
TOTAL	: 9,624.80 13642.74	6,688.36
Lump Sum Total	: 0.00	0.00
No. of Repair Days	: 8.00	7.00
Prepared / Adjusted By	:	SEBASTIAN (LKK)
Arc / Surveyor Sing Off Date	: 07/05/2018 01:59:23 PM	08/05/2018 02:37:20 PM



Prepared / Adjusted Date :

Remarks :

Prepared Date : 07/05/2018 01:59:11 PM

Section C - To be Completed by Admin Assistant, Accident Repair Centre, Upon Completion of Repair

Quotation No : QN-1805-0550 Invoice No :
Quotation Date : 23/5 Invoice Date :
Invoice Amount : 0.00 Prepared Date : 5/7/2018 1:59:32 PM

Section D - Details of Repair Estimates

Part 1 - Labour Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPAIR RH PORTION	1,014.00	600.00 /
Total Labour	1,014.00	600.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPSRAY FRONT BUMPER	378.00	200.00 /
TO RESPRAY FRONT FENDER RH	378.00	200.00 /
TO RESPRAY RIM	180.00	0.00 /
TO RESPRAY FRONT DOOR RH	378.00	200.00 /
TO RESPRAY VIEW MIRROR	180.00	50.00 /
Total Spray Painting & Panel Beating	1,494.00	650.00

Part 3 - Other Costs - Accident and Accident Repair Related Expenses

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO CHECK WIRING AND SYSTEM FUNCTION	80.00	30.00 /
TO APPLY RUST-PROOFING ON AFFECTED AREA	100.00	30.00 /
TO DO WHEEL ALIGNMENT / TYRE BALANCING	120.00	60.00 /
TO TRANSFER DOOR MECHANISM	120.00	0.00 /
TO REMOVE AND REFIX WING MIRROR	120.00	30.00 /
TO REMOVE AND REFIT TYRE RIM (SPRAYING PURPOSE)	120.00	0.00 /
TO REPLACE SUNDRY PARTS	100.00	0.00 /
TO WASH AND VACUUM	60.00	0.00 /
Total Other Costs	820.00	150.00

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommended	Surveyor Approved	Photos Attached	
52119479 62			COVER, FR BUMPER	1	495.50	25.00	371.62	Replace	Replace	No /	CRK
52161160 10			CLIPS PIECE, FRT & RR BUMPER	10	1.50	25.00	11.25	Replace	Replace	No /	NEC
52115470 50			SUPPORT, FR BUMPER RH	1	76.90	25.00	57.68	Replace	Replace S	No /	CRK
52535500 60			RETAINER, FR BUMPER, LH & RH	0	8.50	25.00	0.00	Replace	Not given	No X	NW
81220470 20			LAMP ASSY, FOG, LH	1	910.20	10.00	819.18	Replace	Check	No X	NW
81145476 91			UNIT, HEADLAMP, RH	1	2,558.90	10.00	2,303.01	Replace	Replace S	No /	CRK
53801470 80			FENDER SUB-ASSY, FR, RH	1	933.10	25.00	699.82	Replace	Replace	No /	DT
75374471 40			EMBLEM, SIDE PANEL (HYBRID)	1	52.90	25.00	39.67	Replace	Replace	No /	NEC
53875470 70			LINER, FR FENDER, RH	1	198.40	25.00	148.80	Replace	Replace	No /	TN
53851470 61			PAD, FR WHEEL RH	1	57.70	25.00	43.28	Replace	Check	No X	
			TYRE	0	126.74	0.00	0.00	Replace	Not given	No X	NW
42611-47450			WHEEL, DISC FRONT	0	1,555.10	25.00	0.00	Replace	Not given	No X	
42602471 80			CAP SUB-ASSY, WHEEL	1	175.80	25.00	131.85	Replace	Replace	No /	CRK
67001471 52			PANEL SUB-ASSY, FRONT DOOR RH	1	1,249.60	100.00	0.00	Replace	Repair	No R	
			STICKER DECAL SMRT (DOOR)	1	60.00	0.00	60.00	Replace	Replace	No /	NEC
87910474 50			MIRROR ASSY, OUTER REAR VIEW, RH	1	1,373.50	10.00	1,236.15	Replace	Replace	No /	DAG
87931474 50			MIRROR OUTER GLASS, RH	1	215.20	25.00	161.40	Replace	Replace	No /	SCR
87915470 70A1			COVER, OUTER MIRROR, RH	1	89.50	25.00	67.12	Replace	Replace	No /	MS
81730470 10			LAMP ASSY, SIDE MIRROR TURN SIGNAL, RH	1	162.20	10.00	145.98	Replace	Check	No X	NW
TOTAL MATERIALS							13514.74	6,296.82	5,288.37		
TOTAL MATERIALS(Discounted)								6,296.80	5,288.36		

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check	LT Check
TOTAL SUPPLEMENTARY MATERIALS									

5288.36 /
 + 600.00 /
 + 800.00 /

 6688.36 /

Sebastian
 28/5/18

13642.74



National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



Thatcham escribe

NTUC INCOME INSURANCE CO-OPERATIVE LTD Ref: NS/INC18008612/Srbn2			
73 BRAS BASAH ROAD		Date: 05-06-2018	
#05-01 NTUC TRADE UNION HOUSESINGAPORE			
189556		Code: INC4	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	FBL 9539S	Veh. Inspected	SHF 44Y
Policy No.	5097631701	Coverage (\$)	0.00
Claim No.	MT/0993285-003	Excess (\$)	0.00
Assign From		Assign Date	08/05/2018
2. Vehicle Particulars & Condition			
Make & Model	TOYOTA PRIUS 4	c.c	1798
Engine No.	HIDDEN	Year of Reg.	2017
Chassis No.	JTDKB3FU703573474	Colour	MAROON
Odometer	56195	Steering	IN ORDER
Brakes	IN ORDER	Modification	NIL
General	FAIR		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	195/65 R15	YOKOHAMA	6 mm
L/H Front Tyre	195/65 R15	YOKOHAMA	6 mm
R/H Rear Tyre	195/65 R15	YOKOHAMA	6 mm
L/H Rear Tyre	195/65 R15	YOKOHAMA	6 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE O/S BODY. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	05/05/2018	Inspection Date	08/05/2018
Survey held at	SMRT AUTOMOTIVE SERVICES PTE LTD 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		7 Working Days	



National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



Page No.: 1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHF 44Y

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	COVER,FR BUMPER (DISC 25%)	CRACKED	495.50	371.62
10	CLIPS PIECE FRT & RR BUMPER @\$1.50 (DISC 25%)	NECESSARY	15.00	11.25
1	SUPPORT,FR BUMPER RH (DISC 25%)	CRACKED	76.90	57.68
1	FENDER SUB-ASSY,FR,RH (DISC 25%)	DENTED	933.10	699.82
1	EMBLEM,SIDE PANEL (HYBRID) (DISC 25%)	NECESSARY	52.90	39.67
1	LINER,FR FENDER,RH (DISC 25%)	TORN	198.40	148.80
1	CAP SUB-ASSY,WHEEL (DISC 25%)	CRACKED	175.80	131.85
1	MIRROR OUTER GLASS,RH (DISC 25%)	SCRATCHED	215.20	161.40
1	COVER,OUTER MIRROR,RH (DISC 25%)	MISSING	89.50	67.12
1	UNIT,HEADLAMP,RH (DISC 10%)	CRACKED	2,558.90	2,303.01
1	MIRROR ASSY,OUTER REAR VIEW,RH (DISC 10%)	DAMAGED	1,373.50	1,236.15
1	STICKER DECAL SMRT (DOOR)(SN)	NECESSARY	60.00	60.00
1	RETAINER,FR BUMPER,LH & RH	NOT NECESSARY	8.50	-
1	LAMP ASSY,FOG,LH	NOT NECESSARY	910.20	-
1	PAD,FR WHEEL RH	NOT NECESSARY	57.70	-
1	TYRE	NOT NECESSARY	126.74	-
1	WHEEL,DISC FRONT	NOT NECESSARY	1,555.10	-
1	LAMP ASSY,SIDE MIRROR TURN SIGNAL,RH	NOT NECESSARY	162.20	-
1	PANEL SUB-ASSY,FRONT DOOR RH	TO REPAIR	1,249.60	-
			10,314.74	5,288.37
LABOUR				
	TO WASH AND VACUUM.	NOT NECESSARY	60.00	-
	THATCHAM STANDARD REPAIR TIME ON BODY WORKS.		1,574.00	720.00
	THATCHAM TTS STANDARD SPRAY PAINTING COST AND LABOUR.		1,594.00	680.00
	TO REPLACE SUNDRY PARTS.	NOT NECESSARY	100.00	-
			3,328.00	1,400.00
GRAND TOTAL			13,642.74	6,688.37
RECOMMENDED COST OF REPAIRS (CONFIRMED)				6,688.37

Report Ref No. NS/INC18008612/Srbn2

NAC



Page No.:2 of 2

Report Ref No. NS/INC18008612/Srbn2

A handwritten signature in black ink, appearing to read 'YK'.

YEANG WAI KEEN

Automotive Assessor

A handwritten signature in black ink, appearing to read 'K.K. Lau'.

K.K.LAU CPT(RET)

**BEng(Hons),B.Bus,MBA,PEng,PE,
MInstAEA,MASME,MIRTE**

REGD Auto Consultant-SAE, Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.
No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.