

REF:

NS/INC 18008969 / Sgbr

## ASSIGNMENT

From: \_\_\_\_\_ Date: \_\_\_\_\_

Estimated Cost: \_\_\_\_\_

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: \_\_\_\_\_

at Workshop m/s \_\_\_\_\_

of \_\_\_\_\_


Insured: GBD 5726LPolicy No: 5M3337337 150817 - 140818Claims No: MT/0994682-002

Sum Insured: \_\_\_\_\_ Excess: \_\_\_\_\_

(Client's Record)

Make of Veh: \_\_\_\_\_

(Policy Condition)

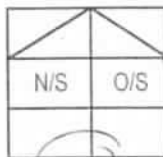Remark: The veh had commenced its  
repair at the time of inspection.

Bal. or Market Value: \_\_\_\_\_

IDAC Accident Report: \_\_\_\_\_ Consistent?: Yes or No

GIA / PR Seen: \_\_\_\_\_ Consistent?: Yes or No

Est. Repairs: 3 days Res.: Yes or No

Lum Sum: \_\_\_\_\_ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: \_\_\_\_\_ Person Contacted: \_\_\_\_\_

Veh No: SHC 4536J Yr Regn: 4/9/14Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Toyota Prius c.c. 1778Colour: Maroon A/C: Insured / Std / NI / NASp. Reading: 446541 T/Radio: Insured / Std / NI / NA

Eng/No: \_\_\_\_\_

C/No: JTDK10364705748527Gen. Cond: Good / Fair / Poor / BurntSteering: In order / Jammed / Leaked / Burnt orBrake: In order / Jammed / Leaked / Burnt orModi: NI / S/Rim / STD A/Rim orTyre Size: F: 175/65R15

R: \_\_\_\_\_

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Falken

Front \_\_\_\_\_ Rear \_\_\_\_\_

R/Bal. 6 mm R/Bal. 6 mmL/Bal. 6 mm L/Bal. 6 mmD.O.A. 14/5/18 D.O.I. 15/5/18Survey held at SMARTDes. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

SHC 4536J - RCB / ALH DB13 3U30 / Zggl  
GBD 5726L - X

DUA: 16120008 TA x / 05/18/2060

Lick

NTUC.

US \$950 Cred \$ 4605.30, 83%

GBD 5726L

RECEIVED 11 JUN 2018

Date/Time, File Pass to?

☐ : Preli. Report☐ : Final Report

Date/Time, File Return to?

2)

Days Of Repair: 3

Resurvey No. of Trip: \_\_\_\_\_

Add Fee: ☐ : Site Insp (\$☐ : Interview (\$☐ : Tech Invs (\$☐ : Weekend (\$Survey Fee: 160

Transportation: \_\_\_\_\_

S + RS \$

Photos 35

Others \_\_\_\_\_

TOTAL

195

Report Format :

Lump Sum / I.B.L. (\$) 71  
950



# National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



NTUC INCOME INSURANCE CO-OPERATIVE LTD Ref: NS/INC18008969/Sqb			
73 BRAS BASAH ROAD			
#05-01 NTUC TRADE UNION HOUSESINGAPORE 189556			
		Date: 17-05-2018	
Code: INC4			
<b>1. Policy Particulars :- THIRD PARTY CLAIM</b>			
Insured Veh.	GBD 5726L	Veh. Inspected	SHC 4536J
Policy No.	5093337337	Coverage (\$)	0.00
Claim No.		Excess (\$)	0.00
Assign From		Assign Date	15/05/2018
<b>2. Vehicle Particulars &amp; Condition</b>			
Make & Model		c.c	0
Engine No.	HIDDEN	Year of Reg.	
Chassis No.		Colour	
Odometer	-	Steering	
Brakes		Modification	
General			
<b>3. Conditions of Tyres</b>			
	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm
<b>4. Description of Damages</b>			
<b>5. General Information</b>			
Accident Date	14/05/2018	Inspection Date	15/05/2018
Survey held at	SMRT AUTOMOTIVE SERVICES PTE LTD 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705		
<b>5a. Remarks</b>			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			

TP Claims against NTUC Income: Follow-Through Survey

S/No	Income Reference	Claimant (Owner / Taxi Company)	Claimant Vehicle No.	Income Vehicle No.	Date of Accident	Estimate	Tentative repair cost
1	MT/0997402-002	COMFORT TRANSPORTATION PTE LTD	SHA 3102U	SIK 4437X	03/06/2018	\$ 2,431.58	\$ 450.00
2	MT/0996966-002	CITYCAB PTE LTD	SHA 8202G	SJF 5615T	01/06/2018	\$ 2,077.44	\$ 1,100.00
3	MT/0997824-001	CITYCAB PTE LTD	SHA 811B	SLH 5573X	30/05/2018	\$ 3,265.96	\$ 2,850.00
4	MT/0994720-002	SMRT TAXI PTE LTD	SHB 5571E	GU 5967J	15/05/2018	\$ 6,170.40	\$ 2,240.23
5	MT/0992549-002	SMRT TAXI PTE LTD	SHF 441J	SHB 8401T	01/05/2018	\$ 26,621.94	\$ 8,100.00
6	MT/0994278-002	SMRT TAXI PTE LTD	SHC 4212T	XE 565B	13/05/2018	\$ 21,016.42	\$ 4,600.00
7	MT/0997827-001	SMRT TAXI PTE LTD	SHC 4382K	SKT 1790K	19/05/2018	\$ 1,449.70	\$ 300.00
8	MT/0994682-002	SMRT TAXI PTE LTD	SHC 4536J	GBD 5726L	14/05/2018	\$ 5,555.30	\$ 950.00
9	MT/0997288-002	COMFORT TRANSPORTATION PTE LTD	SHD 3230S	SJN 6185T	02/06/2018	\$ 2,736.58	\$ 1,302.98
10	MT/0997833-001	COMFORT TRANSPORTATION PTE LTD	SHC 1781L	SJT 1714T	03/06/2018	\$ 5,712.98	\$ 2,300.00
11	MT/0997524-002	COMFORT TRANSPORTATION PTE LTD	SHA 3460K	GBG 4353U	05/06/2018	\$ 2,752.02	\$ 900.00
12	MT/0997717-002	COMFORT TRANSPORTATION PTE LTD	SHC 2931P	GBC 3789Z	05/06/2018	\$ 2,751.20	\$ 1,250.00
13	MT/0996973-002	COMFORT TRANSPORTATION PTE LTD	SHA 3075P	FBE 3401G	01/06/2018	\$ 1,087.44	\$ 508.00
14	MT/0997835-001	COMFORT TRANSPORTATION PTE LTD	SHA 3514P	SJA 2496R	04/06/2018	\$ 2,836.58	\$ 800.00

Claim received from LKK Auto

eBaoTech

General Claim

Hello, NAC\_PAYA\_UBI\_800601

[Change Language](#)[Change Password](#)[Log Out](#)[My Desktop](#)[Notice of Loss](#)

## Policy Query

Policy No.	<input type="text"/>	Date of Accident	<input type="text" value="14/05/2018 13:45"/>						
Vehicle No.(For Motor)	<input type="text" value="GBD5726L"/>								
<input type="button" value="Search"/>									
Select	Policy No.	Policyholder Name	Policyholder NRIC	Product	Cover Type	Vehicle No.	Insured Object	Commence Date	Expiry Date
<input checked="" type="radio"/>	5093337337	AISHWARYA RESTAURANT & CATERING PTE LTD	200601028H	GCV	Preferred Workshop Plan	GBD5726L	GBD5726L	15/08/2017	14/08/2018
				<input type="button" value="Continue"/>					

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

<b>Vehicle Owner Particulars</b>	
Owner ID Type:	Company
Owner ID:	5369K
<b>Vehicle Details</b>	
Vehicle No.:	SHC4536J
Vehicle to be Exported:	No
Intended De-registration Date:	16 May 2018
Vehicle Make:	TOYOTA
Vehicle Model:	PRIUS TAXI (SMRT)
Primary Colour:	Maroon
Manufacturing Year:	2014
Engine No.:	2ZR1401938
Chassis No.:	JTDKN36U705748527
Maximum Power Output:	100.0 kW (134 bhp)
Open Market Value:	\$32,920.00
Original Registration Date:	04 Sep 2014
First Registration Date:	04 Sep 2014
Transfer Count:	0
Actual ARF Paid:	\$8,088.00
<b>Intended PARF Rebate Details</b>	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	03 Sep 2022
PARF Rebate Amount:	\$6,066.00
<b>Intended COE Rebate Details</b>	
COE Expiry Date:	03 Sep 2022
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	8
PQP Paid:	\$50,704.00
COE Rebate Amount:	\$27,244.00
<b>Total Rebate Amount:</b>	<b>\$33,310.00</b>
<b>Message</b>	
Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.	

The information contained herein is correct as at 16 May 2018

OK

## SINGAPORE ACCIDENT STATEMENT

### IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

### ACCIDENT STATEMENT

Date Of Report	14/05/2018 12:43
Date Of Accident	14/05/2018 10:20
Exact Location Of Accident	PIE TOWARDS JURONG (AFTER CLEMENTI EXIT)
Country/State of Loss	SINGAPORE

### DETAILS OF OWN VEHICLE

Vehicle Registration Number	SHC4536J
<b>Insured/Policyholder</b>	
Name Of Registered Owner	SMRT TAXIS PTE LTD
Co Reg No	198905369K
Email Address	NOEMAIL
Mobile Phone No	
Alternative Phone No	OFFICE-80000000

### Vehicle Particulars

Manufacturer	TOYOTA
Model	PRIUS TAXI-1.8 (A)
Exact Purpose for which vehicle was being used at time of accident	HIRE AND REWARD
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	TAXI

### Insurance Company

Name of Insurance Company	MS FIRST CAPITAL INSURANCE LTD
Type Of Coverage	THIRD PARTY FIRE AND/OR THEFT
Fleet Policy	YES
Policy Number	D-18090213MFSH
Cover Note Number	

### Driver

Name of Driver	JUNAIDI BIN NGATI
NRIC No	S7535263H
Date Of Birth	21/11/1975
Occupation	OUTDOOR
Date Of Driving Pass	05/12/1997
Driving Experience	20 YEARS AND 5 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-80000000
Fax Number	
Contact Number	
Email Address	NOEMAIL

Address	08-07
Postcode	
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OTHER - HIRER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

#### General Information of the Accident

Type Of Accident	CHAIN COLLISION
Weather Conditions	DRIZZLING
Road Surface	WET

#### Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles involved in the accident	
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	2
Passenger 1	
	NAME: : UNKNOWN
	GENDER: : MALE

#### Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

#### Circumstances of Accident

I WAS TRAVELLING ALONG PIE TOWARDS JURONG (AFTER CLEMENTI EXIT) WITH ONE PASSENGER (MALE CHINESE) ON BOARD) TRAFFIC WAS HEAVY AND ROAD WAS WET DUE TO DRIZZLE. THERE WAS A STATIONARY LORRY ON THE EXTREME RIGHT LANE CARRYING OUT ROAD WORKS. A VEHICLE INFRONT OF MY TAXI CAME TO A HALT. I SLOWED DOWN AND STOPPED AS WELL. AFTER WHICH I FELT AN IMPACT AT THE REAR OF MY TAXI. A VEHICLE GBD5726L HAD COLLIDED ONTO THE REAR OF MY TAXI. WHEN I ALIGHTED I REALISED THAT IT WAS A CHAIN COLLISION INVOLVING THREE VEHICLES INCLUDING MINE.

#### Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

#### DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	GBD5726L
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	COMMERCIAL VEHICLE
Name of Driver	YAGAPPAN DEVARAJ
NRIC/Passport Number	G3221490N
Contact Number	
Address	
Postcode	


•Insurance Company Name  
Nature Of Damage  
No. Of Passenger (Including Driver)

#### DETAILS OF OTHER VEHICLE PROPERTY 2

Vehicle Registration Number	SHC7954R
Vehicle Make/Model/Colour	
Details Of Properties	CITYCAB
Vehicle Category	TAXI
Name of Driver	UNKNOWN
NRIC/Passport Number	
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	



### SKETCH PLAN

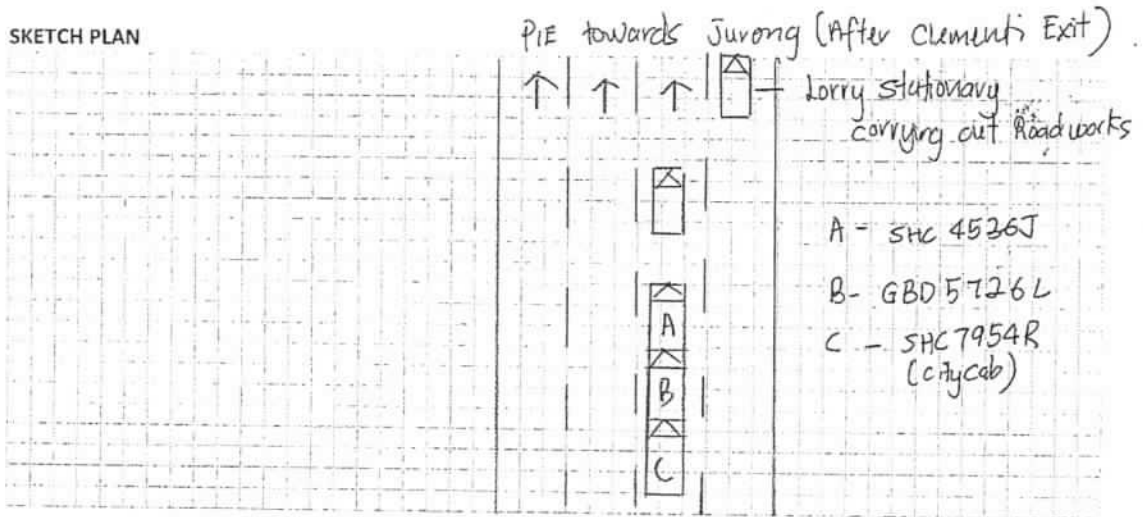

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

[illegible]

## DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature  
Date & Time:

Driver's Signature  
(If driver is not the policyholder)  
Date & Time:

Reporting Centre Personnel's Signature  
Name:  
NRIC/FIN No.:

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My Insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my Insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of :
  - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
  - (ii) investigating the accident and/or my claims;
  - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
  - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
  - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.(collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents(including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
  - (i) to all Insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
  - (ii) for complying with requirements under any regulations, laws or court orders.



Policyholder's Signature  
Date & Time:



Driver's Signature  
(If driver is not the policyholder)  
Date & Time: 14/05/18



Reporting Centre Personnel's Signature  
Name:  
NRIC/FIN No.:

## SMRT Accident Vehicle Repair Estimates

### Section A - To be completed by claims Advisor/Duty officer at Accident Reporting Centre

Reg. No : SHC4536J  
 Ref. No : TAX/05/18/2060  
 Reg. Date : 04/09/2014  
 Vehicle Type : TAXI  
 Make : TOYOTA PRIUS  
 Model : PRIUS  
 Name of Driver : JUNAIDI BIN NGATI  
 Type of Accident : CHAIN COLLISION  
 Date / Time of Accident : 14/05/2018 10:20:00 AM  
 Accident Reported Date / Time : 14/05/2018 12:00:00 AM  
 Surveyor is Required? : Yes  
 Survey by :  
 Vehicle is Towed Back? : No  
 Towed Back Date/Time :  
 Replacement Vehicle issued? : No  
 Accident Repair Job Card No : 000024096054  
 Special Instruction to ARC, if any :  
 GBD5723L - NTUC IDAC  
 Prepared Date : 14/05/2018 12:51:25 PM



Sebastian.  
 15/5/18.  
 - Lump Sum Repair.  
 - Question Mark Item  
 Photo  
 - Photo After Paint

  
 25/5/18.

LKK Auto Consultants hence notify  
 the Repairer of the following:  
 • To resurvey before/after spray painting  
 • To display damaged part(s) during resurvey  
 • Parts prices are subject to confirmation  
 • Third party survey is on a "Without Prejudice" basis  
 • No illegal modification(s) is allowed  
 • Supplementary item(s) must be resurveyed and  
 is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

**Section B - To be Completed by Service Advisor, Accident Repair Centre**

Chassis No : JTDKN36U705748527

Mileage

: 0

Work Shop :

Repair Completed Date / Time :

**Summary of Repair Estimates**

	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Charges	: 845.00	0.00
Total Spray Painting Charges	: 936.00	0.00
Total Material Charges	: 1,909.98	1,948.96
Other Charges	: 700.00	0.00
<b>TOTAL</b>	<b>: 4,390.98</b>	<b>0.00</b>
<b>Lum Sum Total</b>	<b>: 4,400.00</b>	<b>0.00</b>
No. of Repair Days	: 5.00	<del>0.00</del> 3 days
Prepared / Adjusted By	:	
Arc / Surveyor Sing Off Date	: 14/05/2018 03:53:40 PM	01/01/1900 12:00:00 AM



Prepared / Adjusted Date :

Remarks :

Prepared Date : 14/05/2018 03:53:40 PM

**Section C - To be Completed by Admin Assistant, Accident Repair Centre, Upon Completion of Repair**

Quotation No :	Invoice No :
Quotation Date :	Invoice Date :
Invoice Amount :	Prepared Date :

Part 1 --Labour Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPAIR REAR PORTION	845.00	0.00 300
Total Labour	845.00	0.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPSRAY REAR BUMPER	378.00	0.00 200
TO RESPRAY TAIL GATE	378.00	0.00 X
TO RESPRAY BUMPER BEAM	180.00	0.00 7
Total Spray Painting & Panel Beating	936.00	0.00

Part 3 - Other Costs - Accident and Accident Repair Related Expenses

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO CHECK WIRING AND SYSTEM FUNCTION	80.00	0.00 X
TO APPLY RUST-PROOFING ON AFFECTED AREA	100.00	0.00 X
TO TEST AND REFIX REVERSE SENSOR SYSTEM	120.00	0.00 30
TO TRANSFER REAR TAILGATE MECHANISM	120.00	0.00 X
TO REMOVE AND REFIX REAR WINDSCREEN	120.00	0.00 X
TO REPLACE SUNDRY PARTS	100.00	0.00 X
TO WASH AND VACUUM	60.00	0.00 X
Total Other Costs	700.00	0.00

**Part 4 - Spare Parts / Material Usage**

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommended	Surveyor Approved	Photos Attached
2159-7905		6505548	BUMPER REAR	1	458.60	25.00	343.95	Replace	Replace ✓	No <i>CRK</i>
2023-2240		6505547	BUMPER REINFORCEMENT REAR	1	205.70	25.00	154.27	Replace	Replace ✓	No
2016-7030			ARM SUB-ASSY, RR BUMPER LH	1	139.60	25.00	104.70	Replace	Replace ✓	No
2015-7050			ARM SUB-ASSY, RR BUMPER RH	1	139.60	25.00	104.70	Replace	Replace ✓	No
			SENSOR REVERSE	1	180.00	0.00	180.00	Replace	Replace ✓	No <i>ONE</i>
2576-7020		6505550	BUMPER SIDE RETAINER RR/LH	1	94.80	25.00	71.10	Replace	Replace ✓	No
2575-7020		6505549	BUMPER SIDE RETAINER RR/RH	1	94.80	25.00	71.10	Replace	Replace ✓	No
6088-7020		6505617	BUMPER LIP COVER RR/LH	1	72.20	25.00	54.15	Replace	Replace X	No
6087-7020		6505618	BUMPER LIP COVER RR/RH	1	118.10	25.00	88.57	Replace	Replace X	No
6891-7020		6505619	BUMPER LIP REAR	1	228.90	25.00	171.67	Replace	Replace X	No
			PIXEL STICKER	2	60.00	0.00	120.00	Replace	Replace ✓	No <i>NEC</i>
7005-7241			TAILGATE ASY	1	1,007.90	25.00	755.92	Replace	Replace X	No
5574-7020			TAIL GATE DOOR GLASS MOULDING, LH	1	29.40	25.00	22.05	Replace	Replace X	No
5573-7080			TAIL GATE DOOR GLASS MOULDING, RH	1	29.40	25.00	22.05	Replace	Replace ✓	No
	COMMON		SEALANT W/SCREEN	2	37.00	0.00	74.00	Replace	Replace X	No
5575 - 7030			MOULDING BACK WINDOW, LOWER NO.1	1	29.40	25.00	22.05	Replace	Replace X	No
	COMMON		SEALANT W/SCREEN	1	37.00	0.00	37.00	Replace	Replace X	No
5374-7051			NAME PLATE (HYBRID)	1	51.90	25.00	38.92	Replace	Replace X	No
<b>TOTAL MATERIALS</b>							<b>2,436.23</b>	<b>2,436.20</b>		
<b>TOTAL MATERIALS(Discounted)</b>							<b>1,909.98</b>	<b>1,948.96</b>		

**Added Spare Parts / Material Usage After Surveyor Signed off**

Part Number	Portion	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check	LT Check
<b>TOTAL SUPPLEMENTARY MATERIALS</b>									

18-5-18/12:23

18-5-18/16:23

# SMRT Accident Vehicle Repair Estimates

15-5-18/16:23


## Section A - To be completed by claims Advisor/Duty officer at Accident Reporting Centre

Reg. No : SHC4536J  
 Ref. No : TAX/05/18/2060  
 Reg. Date : 04/09/2014  
 Vehicle Type : TAXI  
 Make : TOYOTA PRIUS  
 Model : PRIUS  
 Name of Driver : JUNAIDI BIN NGATI  
 Type of Accident : CHAIN COLLISION  
 Date / Time of Accident : 14/05/2018 10:20:00 AM  
 Accident Reported Date / Time : 14/05/2018 12:00:00 AM  
 Surveyor is Required? : Yes  
 Survey by : Sebastian  
 Vehicle is Towed Back? : No  
 Towed Back Date/Time :  
 Replacement Vehicle issued? : No  
 Accident Repair Job Card No : 000024096054  
 Special Instruction to ARC, if any :

GBD5723L - NTUC IDAC

BEFORE PAINT PHOTO AND AFTER PAINT PHOTO, FOR CHECK ITEM AND REPLACE ITEM PLEASE CALL  
 SURVEYOR SEBASTIAN (LKK) & Email : sebastianyeang@lkkauto.com HP: 90036121  
 LUMPSUM REPAIR

Prepared Date : 14/05/2018 12:51:25 PM

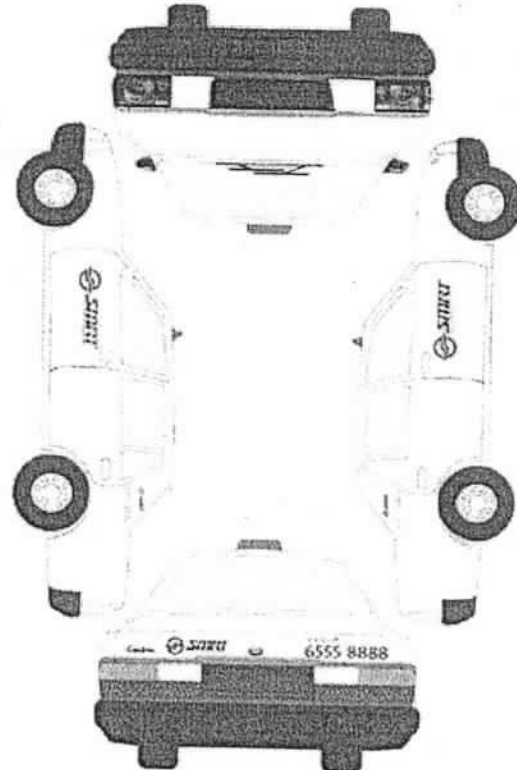

QC 17/5/18 1610 Pass

Recording Camera

☐ ☒

Radio Antenna

☐ ☒

1st witness

Date

15-5-18

2nd witness

Date

Vehicle to Wega Date In:	16/5/18	Towing:	
Time In:	-	Driver:	701
Wega Job No:	05/0509		
Vehicle sent to SMRT Date In:	17-5-2018	Towing:	
Time In:	3.00	Driver:	
Received by (SMRT):	L		

**Section B - To be Completed by Service Advisor, Accident Repair Centre**

Chassis No : JTDKN36U705748527

Mileage : 0

Work Shop :

Repair Completed Date / Time :

**Summary of Repair Estimates**

	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Charges :	845.00	300.00
Total Spray Painting Charges :	936.00	200.00
Total Material Charges :	735.89	643.95
Other Charges :	700.00	-193.95
<b>TOTAL :</b>	<b>3,216.89</b>	<b>950.00</b>
<b>Lump Sum Total :</b>	<b>0.00</b>	<b>0.00</b>
No. of Repair Days :	5.00	3.00 ✓
Prepared / Adjusted By :		SEBASTIAN (LKK)
Arc / Surveyor Sign Off Date :	14/05/2018 03:53:40 PM	15/05/2018 04:23:18 PM



Prepared / Adjusted Date :

Remarks :

Prepared Date : 14/05/2018 03:53:40 PM

**Section C - To be Completed by Admin Assistant, Accident Repair Centre, Upon Completion of Repair**

Quotation No : QN-1805-0441

Invoice No :

Quotation Date : 20/5

Invoice Date :

Invoice Amount :

Prepared Date :



## S ction D - Details of Repair Estimates

### Part 1 - Labour Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPAIR REAR PORTION	845.00	300.00
<b>Total Labour</b>	<b>845.00</b>	<b>300.00</b>

### Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPSRAY REAR BUMPER	378.00	200.00
TO RESPRAY TAIL GATE	378.00	0.00
TO RESPRAY BUMPER BEAM	180.00	0.00
<b>Total Spray Painting &amp; Panel Beating</b>	<b>936.00</b>	<b>200.00</b>

### Part 3 - Other Costs - Accident and Accident Repair Related Expenses

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO CHECK WIRING AND SYSTEM FUNCTION	80.00	0.00
TO APPLY RUST-PROOFING ON AFFECTED AREA	100.00	0.00
TO TEST AND REFIX REVERSE SENSOR SYSTEM	120.00	30.00
TO TRANSFER REAR TAILGATE MECHANISM	120.00	0.00
TO REMOVE AND REFIX REAR WINDSCREEN	120.00	0.00
TO REPLACE SUNDRY PARTS	100.00	0.00
TO WASH AND VACUUM	60.00	0.00
Lump Sum Adjustment by Surveyor	0.00	-223.95
<b>Total Other Costs</b>	<b>700.00</b>	<b>-193.95</b>

# Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommended	Surveyor Approved	Photos Attached
52159-47905		6505548	BUMPER REAR	1	458.60	25.00	343.95	Replace	Replace	No ✓
52023-12240		6505547	BUMPER REINFORCEMENT REAR	1	205.70	25.00	154.28	Replace	Check	No X
52016-47030			ARM SUB-ASSY, RR BUMPER LH	1	139.60	25.00	104.70	Replace	Check	No X
52015-47050			ARM SUB-ASSY, RR BUMPER RH	1	139.60	25.00	104.70	Replace	Check	No X
			SENSOR REVERSE	1	180.00	0.00	180.00	Replace	Replace	No ✓
52576-47020		6505550	BUMPER SIDE RETAINER RR/LH	1	94.80	25.00	71.10	Replace	Check	No X
52575-47020		6505549	BUMPER SIDE RETAINER RR/RH	1	94.80	25.00	71.10	Replace	Check	No X
76088-47020		6505617	BUMPER LIP COVER RR/LH	0	72.20	25.00	0.00	Replace	Not given	No X
76087-47020		6505618	BUMPER LIP COVER RR/RH	0	118.10	25.00	0.00	Replace	Not given	No X
76891-47020		6505619	BUMPER LIP REAR	0	228.90	25.00	0.00	Replace	Not given	No X
			PIXEL STICKER	2	60.00	0.00	120.00	Replace	Replace	No ✓
67005-47241			TAILGATE ASY	0	1,007.90	25.00	0.00	Replace	Not given	No X
75574-47020			TAIL GATE DOOR GLASS MOULDING, LH	0	29.40	25.00	0.00	Replace	Not given	No X
75573-47080			TAIL GATE DOOR GLASS MOULDING, RH	0	29.40	25.00	0.00	Replace	Not given	No X
	COMMO N		SEALANT W/SCREEN	0	37.00	0.00	0.00	Replace	Not given	No X
75575 - 47030			MOULDING BACK WINDOW, LOWER NO.1	0	29.40	25.00	0.00	Replace	Not given	No X
	COMMO N		SEALANT W/SCREEN	0	37.00	0.00	0.00	Replace	Not given	No X
75374-47051			NAME PLATE (HYBRID)	0	51.90	25.00	0.00	Replace	Not given	No X
TOTAL MATERIALS							1,149.83	643.95		
TOTAL MATERIALS(Discounted)							735.89	643.95		

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check	LT Check
TOTAL SUPPLEMENTARY MATERIALS									

643.95 /  
+ 300.00 /  
+ 230.00 /  


---

1173.95 /  
- 202  


---

939.16 /

45 \$950/-

Sebastian  
7/6/18

555.30

**National Assessment Centre Services**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



Thatcham escribe

NTUC INCOME INSURANCE CO-OPERATIVE LTD Ref: NS/INC18008969/Sqbe2

73 BRAS BASAH ROAD

#05-01 NTUC TRADE UNION HOUSESINGAPORE  
189556

Date: 19-06-2018



Code: INC4

**1. Policy Particulars :- THIRD PARTY CLAIM**

Insured Veh.	GBD 5726L	Veh. Inspected	SHC 4536J
Policy No.	5093337337	Coverage (\$)	0.00
Claim No.	MT/0994682-002	Excess (\$)	0.00
Assign From		Assign Date	15/05/2018

**2. Vehicle Particulars & Condition**

Make & Model	TOYOTA PRIUS	c.c	1798
Engine No.	HIDDEN	Year of Reg.	2014
Chassis No.	JTDKN36U705748527	Colour	MAROON
Odometer	446541	Steering	IN ORDER
Brakes	IN ORDER	Modification	NIL
General	FAIR		

**3. Conditions of Tyres**

	Size	Make	Balance
R/H Front Tyre	195/65 R15	FALKEN	6 mm
L/H Front Tyre	195/65 R15	FALKEN	6 mm
R/H Rear Tyre	195/65 R15	FALKEN	6 mm
L/H Rear Tyre	195/65 R15	FALKEN	6 mm

**4. Description of Damages**

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.
--

**5. General Information**

Accident Date	14/05/2018	Inspection Date	15/05/2018
Survey held at	SMRT AUTOMOTIVE SERVICES PTE LTD 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705		

**5a. Remarks**

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
--

**5b. Estimate Days of Repair**

ESTIMATED NORMAL PERIOD FOR REPAIR:	<b>3 Working Days</b>
-------------------------------------	-----------------------

**National Assessment Centre Services**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



Page No.:1 of 2

**ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHC 4536J**

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b><u>REPLACEMENT OF PARTS</u></b>				
1	BUMPER REAR (DISC 25%)	CRACKED	458.60	343.95
1	SENSOR REVERSE (SN)	DAMAGED	180.00	180.00
2	PIXEL STICKER @\$60.00 (SN)	NECESSARY	120.00	120.00
1	BUMPER REINFORCEMENT REAR	NOT NECESSARY	205.70	-
1	ARM SUB-ASSY, RR BUMPER LH	NOT NECESSARY	139.60	-
1	ARM SUB-ASSY, RR BUMPER RH	NOT NECESSARY	139.60	-
1	BUMPER SIDE RETAINER RR/LH	NOT NECESSARY	94.80	-
1	BUMPER SIDE RETAINER RR/RH	NOT NECESSARY	94.80	-
1	BUMPER LIP COVER RR/LH	NOT NECESSARY	72.20	-
1	BUMPER LIP COVER RR/RH	NOT NECESSARY	118.10	-
1	BUMPER LIP REAR	NOT NECESSARY	228.90	-
1	TAILGATE ASY	NOT NECESSARY	1,007.90	-
1	TAIL GATE DOOR GLASS MOULDING, LH	NOT NECESSARY	29.40	-
1	TAIL GATE DOOR GLASS MOULDING, RH	NOT NECESSARY	29.40	-
1	SEALANT W/SCREEN	NOT NECESSARY	37.00	-
1	MOULDING BACK WINDOW, LOWER NO.1	NOT NECESSARY	29.40	-
1	SEALANT W/SCREEN	NOT NECESSARY	37.00	-
1	NAME PLATE (HYBRID)	NOT NECESSARY	51.90	-
			3,074.30	643.95
<b><u>LABOUR</u></b>				
THATCHAM STANDARD REPAIR TIME ON BODY WORKS.			1,285.00	330.00
THATCHAM TTS STANDARD SPRAY PAINTING COST AND LABOUR.			1,036.00	200.00
TO REPLACE SUNDRY PARTS.		NOT NECESSARY	100.00	-
TO WASH AND VACUUM.		NOT NECESSARY	60.00	-
			2,481.00	530.00
<b>GRAND TOTAL</b>			<b>5,555.30</b>	<b>1,173.95</b>
<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION) (CONFIRMED)</b>				<b>950.00</b>

Report Ref No. NS/INC18008969/Sqbe2

Report Ref No. NS/INC18008969/Sqbe2



**YEANG WAI KEEN**

Automotive Assessor



**K.K.LAU CPT(RET)**

**BEng(Hons),B.Bus,MBA,PEng,PE,  
MInstAEA,MASME,MIRTE**

**REGD Auto Consultant-SAE, Licensed Appraiser**

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

**No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.**