


SMRT Accident Vehicle Repair Estimates

Section A - To be completed by claims Advisor/Duty officer at Accident Reporting Centre

Reg. No : SHC4197D
Ref. No : TAX/06/18/2002
Reg. Date : 29/11/2013
Vehicle Type : TAXI
Make : TOYOTA PRIUS
Model : PRIUS
Name of Driver : LEE CHEN SIONG
Type of Accident : HEAD TO REAR
Date / Time of Accident : 01/06/2018 10:00:00 AM
Accident Reported Date / Time : 01/06/2018 12:00:00 AM
Surveyor is Required? : Yes
Survey by :
Vehicle is Towed Back? : No
Towed Back Date/Time :
Replacement Vehicle issued? : No
Accident Repair Job Card No : 000024096382
Special Instruction to ARC,if any :
FV5701R - FWD
Prepared Date : 01/06/2018 12:48:22 PM

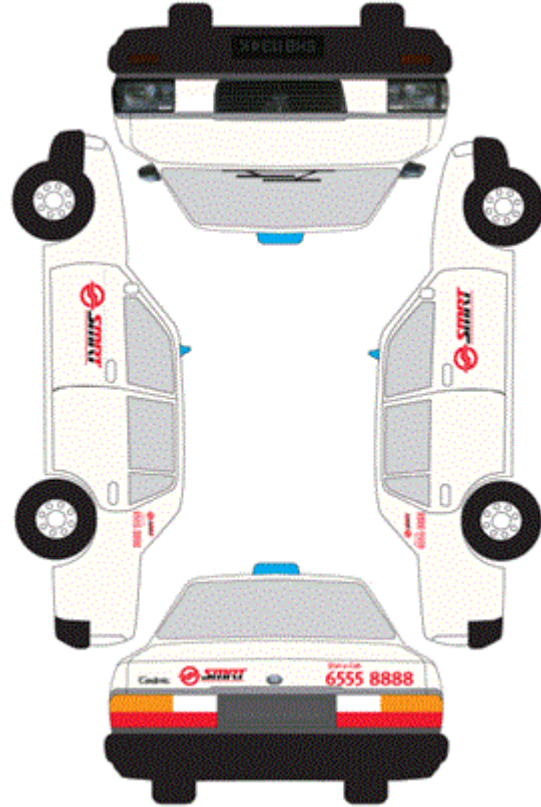

Section B - To be Completed by Service Advisor, Accident Repair Centre

Chassis No : JTDKN36U30-5708848

Mileage : 0

Work Shop :

Repair Completed Date / Time :

Summary of Repair Estimates

	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Charges :	1,014.00	0.00
Total Spray Painting Charges :	2,052.00	0.00
Total Material Charges :	5,758.87	5,758.87
Other Charges :	1,010.00	0.00
TOTAL :	9,834.87	0.00
Lum Sum Total :	9,850.00	0.00
No. of Repair Days :	6.00	0.00
Prepared / Adjusted By :		
Arc / Surveyor Sign Off Date :	01/06/2018 03:44:57 PM	01/06/2018 03:54:08 PM



Prepared / Adjusted Date :

Remarks :

Prepared Date : 01/06/2018 03:40:36 PM

Section C - To be Completed by Admin Assistant, Accident Repair Centre, Upon Completion of Repair

Quotation No :

Invoice No :

Quotation Date :

Invoice Date :

Invoice Amount : 0.00

Prepared Date : 6/1/2018 3:40:47 PM

Section D - Details of Repair Estimates

Part 1 - Labour Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPAIR FRONT PORTION	1,014.00	0.00
Total Labour	1,014.00	0.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPSRAY FRONT BUMPER	378.00	0.00
TO RESPRAY FRONT BUMPER LOWER GRILLE	180.00	0.00
TO REPSRAY FRONT HOOD	378.00	0.00
TO RESPRAY FRONT SUPPORT PANEL	180.00	0.00
TO RESPRAY FRONT FENDER RH	378.00	0.00
TO RESPRAY FRONT FENDER LH	378.00	0.00
TO RESPRAY ARM , FR WIPER , RH	180.00	0.00
Total Spray Painting & Panel Beating	2,052.00	0.00

Part 3 - Other Costs - Accident and Accident Repair Related Expenses

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REMOVE / REFIT WINDSCREEN	120.00	0.00
TO PROVIDE LABOUR & MATERIAL FOR SOLAR FILM (NET)	450.00	0.00
TO CHECK WIRING AND SYSTEM FUNCTION	80.00	0.00
TO APPLY RUST-PROOFING ON AFFECTED AREA	200.00	0.00
TO REPLACE SUNDRY PARTS	100.00	0.00
TO WASH AND VACUUM	60.00	0.00
Total Other Costs	1,010.00	0.00

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommended	Surveyor Approved	Photos Attached
52119-47930		6505517	BUMPER FRT	1	482.00	25.00	361.50	Replace	Replace	No
52127-47903			COVER, FR BUMPER HOLE RH	1	18.50	25.00	13.88	Replace	Replace	No
52611-47080		6505518	BUMPER ENERGY ABSORBER FRT	1	78.80	25.00	59.10	Replace	Replace	No
52021-47023		6505539	BUMPER REINFORCEMENT FRT	1	498.40	25.00	373.80	Replace	Replace	No
57013-47030			ARM SUB-ASSY, FR BUMPER RH	1	250.40	25.00	187.80	Replace	Replace	No
53102-47020		6505541	BUMPER GRILLE SUB-ASSY, LOWER	1	311.10	25.00	233.32	Replace	Replace	No
81210-12230		6505439	FOG LAMP RH	1	295.20	10.00	265.68	Replace	Replace	No
75310-47010		6505638	EMBLEM FRONT	1	86.50	25.00	64.87	Replace	Replace	No
52114-47140			BRACKET, FR BUMPER	1	110.40	25.00	82.80	Replace	Replace	No
			NUMBER PLATE	1	15.00	0.00	15.00	Replace	Replace	No
			NUMBER PLATE FRAME	1	12.00	0.00	12.00	Replace	Replace	No
52115-47040		6505515	BUMPER SUPPORT F/RH	1	76.40	25.00	57.30	Replace	Replace	No
53301-47060		6505555	HOOD PANEL	1	748.10	25.00	561.08	Replace	Replace	No
53395-47020			HOOD END PANEL SEAL	1	35.50	25.00	26.62	Replace	Replace	No
53420-47070			HOOD HINGE LH	1	55.90	25.00	41.93	Replace	Replace	No
53410-47070			HOOD HINGE RH	1	55.90	25.00	41.93	Replace	Replace	No
561014E909			WINDSCREEN FRT	1	1,543.80	25.00	1,157.85	Replace	Replace	No
75533-47050			WINDSCREEN MOULDING FRT	1	57.60	25.00	43.20	Replace	Replace	No
	COMMON		SEALANT W/SCREEN	2	37.00	0.00	74.00	Replace	Replace	No
85211-47100			ARM, FR WIPER, RH	1	296.80	25.00	222.60	Replace	Replace	No
85212-47040			BLADE, FR WIPER, RH	1	86.20	25.00	64.65	Replace	Replace	No
53201-47902			SUPPORT SUB-ASSY	1	1,460.40	25.00	1,095.30	Replace	Replace	No
81130-47500		6505437	HEAD LAMP RH	1	945.20	10.00	850.68	Replace	Replace	No
53801-47050		6505557	FENDER FRT/RH	1	723.40	25.00	542.55	Replace	Replace	No
75374-47051			NAME PLATE (HYBRID)	1	51.90	25.00	38.93	Replace	Replace	No
53875-47030		6505553	FENDER LINER FRT/RH	1	171.70	25.00	128.78	Replace	Replace	No
53802-47050		6505558	FENDER FRT/LH	1	723.40	25.00	542.55	Replace	Replace	No
75374-47051			NAME PLATE (HYBRID)	1	51.90	25.00	38.92	Replace	Replace	No
TOTAL MATERIALS							7,198.61	7,198.59		
TOTAL MATERIALS(Discounted)							5,758.87	5,758.87		

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check	LT Check
TOTAL SUPPLEMENTARY MATERIALS									