


SMRT Accident Vehicle Repair Estimates

Section A - To be completed by claims Advisor/Duty officer at Accident Reporting Centre

Reg. No : SHC4698A
Ref. No : TAX/06/18/2021
Reg. Date : 24/09/2014
Vehicle Type : TAXI
Make : TOYOTA PRIUS
Model : PRIUS
Name of Driver : QUAH PENG ENG
Type of Accident : HEAD TO REAR
Date / Time of Accident : 06/06/2018 10:10:00 AM
Accident Reported Date / Time : 06/06/2018 12:00:00 AM
Surveyor is Required? : Yes
Survey by :
Vehicle is Towed Back? : No
Towed Back Date/Time :
Replacement Vehicle issued? : No
Accident Repair Job Card No : 000024096460
Special Instruction to ARC,if any :
GBH1891Y - ERGO
Prepared Date : 06/06/2018 02:10:13 PM

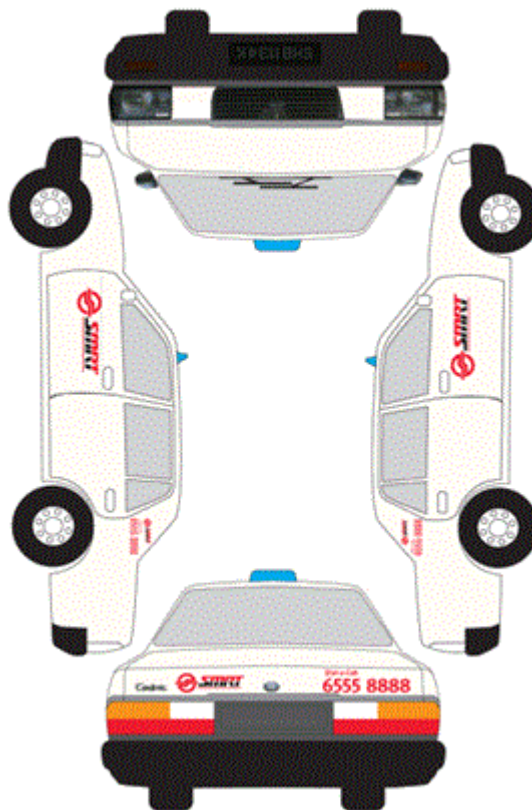

Section B - To be Completed by Service Advisor, Accident Repair Centre

Chassis No : JTDKN36U005751088

Mileage : 0

Work Shop :

Repair Completed Date / Time :

Summary of Repair Estimates

	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Charges :	1,183.00	0.00
Total Spray Painting Charges :	1,674.00	0.00
Total Material Charges :	5,400.59	5,400.59
Other Charges :	1,305.00	0.00
TOTAL :	9,562.59	0.00
Lum Sum Total :	9,550.00	0.00
No. of Repair Days :	7.00	0.00
Prepared / Adjusted By :		
Arc / Surveyor Sign Off Date :	06/06/2018 06:47:02 PM	01/01/1900 12:00:00 AM



Prepared / Adjusted Date :

Remarks :

Prepared Date : 06/06/2018 06:47:02 PM

Section C - To be Completed by Admin Assistant, Accident Repair Centre, Upon Completion of Repair

Quotation No :	Invoice No :
Quotation Date :	Invoice Date :
Invoice Amount :	Prepared Date :

Section D - Details of Repair Estimates**Part 1 - Labour Works**

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPAIR REAR PORTION	1,183.00	0.00
Total Labour	1,183.00	0.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPSRAY REAR BUMPER	378.00	0.00
TO RESPRAY REAR PANEL	180.00	0.00
TO RESPRAY TAIL GATE	378.00	0.00
TO RESPRAY TAILGATE OUTSIDE GARNISH	180.00	0.00
TO RESPRAY SPOILER	180.00	0.00
TO RESPRAY REAR FENDER LH	378.00	0.00
Total Spray Painting & Panel Beating	1,674.00	0.00

Part 3 - Other Costs - Accident and Accident Repair Related Expenses

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO CHECK WIRING AND SYSTEM FUNCTION	80.00	0.00
TO APPLY RUST-PROOFING ON AFFECTED AREA	100.00	0.00
TO TEST AND REFIX REVERSE SENSOR SYSTEM	120.00	0.00
TO TRANSFER REAR TAILGATE MECHANISM	120.00	0.00
TO REMOVE AND REFIX REAR WINDSCREEN	120.00	0.00
TO REMOVE / REFIT SEAT	120.00	0.00
TO REMOVE & REFIT REAR QUARTER GLASS LH	120.00	0.00
TO PROVIDE LABOUR & MATERIAL FOR SOLAR FILM (NET)	125.00	0.00
TO INSPECT RR LIGHTING, MECHANISMS & WATER TEST RR LIGHTING FOR LEAKAGE	120.00	0.00
TO REMOVE AND INSTALL LUGGAGE COMPARTMENT TRIM TO FACILITATE REPAIR.	120.00	0.00
TO REPLACE SUNDRY PARTS	100.00	0.00
TO WASH AND VACUUM	60.00	0.00
Total Other Costs	1,305.00	0.00

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommended	Surveyor Approved	Photos Attached
52159-47905		6505548	BUMPER REAR	1	458.60	25.00	343.95	Replace	Replace	No
52023-12240		6505547	BUMPER REINFORCEMENT REAR	1	205.70	25.00	154.27	Replace	Replace	No
52016-47030			ARM SUB-ASSY, RR BUMPER LH	1	139.60	25.00	104.70	Replace	Replace	No
52015-47050			ARM SUB-ASSY, RR BUMPER RH	1	139.60	25.00	104.70	Replace	Replace	No
			SENSOR REVERSE	1	180.00	0.00	180.00	Replace	Replace	No
52576-47020		6505550	BUMPER SIDE RETAINER RR/LH	1	94.80	25.00	71.10	Replace	Replace	No
52575-47020		6505549	BUMPER SIDE RETAINER RR/RH	1	94.80	25.00	71.10	Replace	Replace	No
76088-47020		6505617	BUMPER LIP COVER RR/LH	1	72.20	25.00	54.15	Replace	Replace	No
76087-47020		6505618	BUMPER LIP COVER RR/RH	1	118.10	25.00	88.57	Replace	Replace	No
76891-47020		6505619	BUMPER LIP REAR	1	228.90	25.00	171.67	Replace	Replace	No
			PIXEL STICKER	2	60.00	0.00	120.00	Replace	Replace	No
58308-47011			UNDER COVER SUB-ASSY, RR FLOOR	1	514.50	25.00	385.87	Replace	Replace	No
58307-47060		6505522	END PANEL	1	602.10	25.00	451.57	Replace	Replace	No
	COMMON	4006314	SEALANT SIKAFLEX	1	37.00	0.00	37.00	Replace	Replace	No
67005-47241			TAILGATE ASY	1	1,007.90	25.00	755.92	Replace	Replace	No
76801-47070-B0			TAILGATE OUTSIDE GARNISH	1	504.90	25.00	378.67	Replace	Replace	No
75374-47051			NAME PLATE (HYBRID)	1	51.90	25.00	38.92	Replace	Replace	No
75442-47030			NAME PLATE (PRIUS)	1	60.80	25.00	45.60	Replace	Replace	No
75443-47030			NAME PLATE (TOYOTA)	1	51.90	25.00	38.92	Replace	Replace	No
75310-47020		6505639	EMBLEM REAR	1	60.30	25.00	45.22	Replace	Replace	No
	COMMON		SMRT LOGO	1	7.80	0.00	7.80	Replace	Replace	No
			STICKER DECAL 6555 8888	1	21.60	0.00	21.60	Replace	Replace	No
75574-47020			TAIL GATE DOOR GLASS MOULDING, LH	1	29.40	25.00	22.05	Replace	Replace	No
75573-47080			TAIL GATE DOOR GLASS MOULDING, RH	1	29.40	25.00	22.05	Replace	Replace	No
	COMMON		SEALANT W/SCREEN	2	37.00	0.00	74.00	Replace	Replace	No
75575 - 47030			MOULDING BACK WINDOW, LOWER NO.1	1	29.40	25.00	22.05	Replace	Replace	No
	COMMON		SEALANT W/SCREEN	1	37.00	0.00	37.00	Replace	Replace	No
64718-47031B0			END PANEL COVER, DECK TRIM HOLE	1	46.10	25.00	34.57	Replace	Replace	No

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommended	Surveyor Approved	Photos Attached
64716-47031B0			END PANEL COVER, DECK TRIM, RR	1	121.10	25.00	90.82	Replace	Replace	No
89997-30070			ANTENNA, ELECTRICAL LOWER REAR	1	157.40	10.00	141.66	Replace	Replace	No
67881-47022			TAILGATE DOOR WEATHER STRIP	1	353.40	25.00	265.05	Replace	Replace	No
64740-47031B2			PANEL ASSY, DECK LH	1	307.00	25.00	230.25	Replace	Replace	No
64730-47031B2			PANEL ASSY, DECK RH	1	307.00	25.00	230.25	Replace	Replace	No
76085-47910		6505620	SPOILER REAR	1	953.70	25.00	715.27	Replace	Replace	No
81006-47011		6505464	3RD BRAKE LAMP	1	231.30	10.00	208.17	Replace	Replace	No
52563-47010			TAIL LAMP BRACKET, LH	1	30.70	25.00	23.02	Replace	Replace	No
52562-47010			TAIL LAMP BRACKET, RH	1	30.70	25.00	23.02	Replace	Replace	No
61602-47091		6505476	FENDER RR/LH	1	766.80	25.00	575.10	Replace	Replace	No
	COMMON		SMRT LOGO	1	7.80	0.00	7.80	Replace	Replace	No
			STICKER DECAL 65558888	1	21.60	0.00	21.60	Replace	Replace	No
62720-47031			QUARTER GLASS RR/LH	1	168.10	25.00	126.07	Replace	Replace	No
	COMMON		SEALANT W/SCREEN	1	37.00	0.00	37.00	Replace	Replace	No
65638-47021		6505477	FENDER LINER RR/LH	1	141.30	25.00	105.97	Replace	Replace	No
52592-47021			BUMPER SEAL, RR LH	1	88.90	25.00	66.67	Replace	Replace	No
TOTAL MATERIALS							6,750.83	6,750.74		
TOTAL MATERIALS(Discounted)							5,400.59	5,400.59		

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check	LT Check
TOTAL SUPPLEMENTARY MATERIALS									