

REF:

CC3/A2618010613/Asber

ASS. REC. BY Adrian King

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____ Excess: \$600/-

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

| | |
|-----|-----|
| | |
| N/S | O/S |
| | |

Bal. or Market Value: _____

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 35 M/S days Res: Yes or No

Lum Sum: _____ % 3 Val: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Veh No: S6565Z Tr Regn: 2017/Nov

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Audi A3 CC 999

Colour: Black A/C: Insured / Std / NI / NA

Sp. Reading: 11603 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: WAUZZZ8V8T1022578

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 205/55R16

R: 205/55R16

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front: _____ Rear: _____

R/Bal: 06 mm R/Bal: 06 mm

L/Bal: 06 mm L/Bal: 06 mm

D.O.A. _____ D.O.I. 11/06/18

Survey held at: Premises

Des. of Damages: Frnt / Rear / O/S / N/S / UIC / Rooftop or

The UIC / Chassis frame / Body Structure affected due to collision.

| Date / Time | Action / Instruction |
|-------------|----------------------|
| | <u>OD AIG.</u> |
| | |

MV: 110K
PV: 49.5K
Nett: 60.7K

RECEIVED 16 AUG 2019

S65 66Z - 03/MH18010613/MY563

Dep: 070314

... the A... moved to check the use number.

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

| Vehicle Details | |
|--------------------------------|--------------------------------------|
| Owner ID Type: | Company |
| Owner ID: | 3181E |
| Vehicle Details | |
| Vehicle No.: | SGS665Z |
| Vehicle to be Exported: | Yes |
| Intended De-registration Date: | 11 Jun 2018 |
| Vehicle Make: | AUDI |
| Vehicle Model: | A3 SEDAN 1.0 TFSI S TRONIC (LED) |
| Primary Colour: | Brown |
| Manufacturing Year: | 2017 |
| Engine No.: | CHZ575902 |
| Chassis No.: | WAUZZZ8VB8J1022578 |
| Maximum Power Output: | 85.0 kW (113 bhp) |
| Open Market Value: | \$23,895.00 |
| Original Registration Date: | 24 Nov 2017 |
| First Registration Date: | 24 Nov 2017 |
| Transfer Count: | 0 |
| Actual ARF Paid: | \$15,453.00 |
| Intended PARF Rebate Details | |
| PARF Eligibility: | Yes |
| PARF Eligibility Expiry Date: | 23 Nov 2027 |
| PARF Rebate Amount: | \$11,589.00 |
| Intended COE Rebate Details | |
| COE Expiry Date: | 23 Nov 2027 |
| COE Category: | A - Car up to 1600cc & 97kW (130bhp) |
| COE Period(Years): | 10 |
| QP Paid: | \$47,112.00 |
| COE Rebate Amount: | \$37,689.00 |
| Total Rebate Amount: | \$49,278.00 |

The information contained herein is correct as at 11 Jun 2018

OK

CHEAPEST CAR INSURANCE RENEWAL

Compare 10+ Insurers. Option of any workshop.   

GET A CHEAPER QUOTE NOW!

FOR SALE BY OWNER

Post an Advertisement
Sell it yourself! Advertise it at just **\$58 until it's SOLD!**

 Post an Ad  Advertiser Login  Ways of Selling

New 5 Years Coe Renewal Toyota Vios 1.5A

 \$2500 Downpayment Monthly From \$580 Onwards. Lowest 3.68%APR GV Cars Financing by Credit Mutual StarAd 

PRIME MOTOR & LEASING

(SEMI) YOUR CREDIT ENHANCER'S PTC LTD GROUP OF COMPANIES

With over 200 units of vehicles to choose from, ranging from all European to Japanese Makes. 

Browse by Category  Save Search  Print Sort by Date Posted  20 results/page 

6 vehicles **Search** Audi A3  Advanced Search  Search  View All

| Make | Model | Price | Depreciation | Reg Date | Eng Cap | Mileage | Veh Type | Status |
|------|-------|-------|--------------|----------|---------|---------|----------|-----------|
| Audi | A3 | Any | Any | 2017 | Any | Any | Any | Available |

 **Audi A3 Sedan 1.0A TFSI S-tronic** **\$116,800** **\$12,400 /yr** **25-Feb-2017** **999 cc** **-** **Luxury** **Available**

Come With Audi Virtual Cockpit And Navigation. \$2000 Republic Auto Warranty Service Credit, Almost Brand New Condition And Well Taken Care By 1 Owner. Please Call To Arrange An Appointment For Viewing...

Republic Auto
 Posted: 11-Jun-2018 Tags: 2017 Audi A3, Audi A3, Audi, A3, Used Audi

 **Audi A3 Sedan 1.0A TFSI S-tronic** **\$108,999** **\$11,350 /yr** **29-Apr-2017** **999 cc** **5,000 km** **Luxury** **Available**

Fully Serviced And Maintained By Premium Automobiles. 5 Years Warranty From Audi Agent Premium Automobiles. Limited Management Unit. Please Sms/Call Mobile For More Details Before It's Gone!

Premium Automobiles 
 Posted: 23-May-2018 Tags: 2017 Audi A3, Audi A3, Audi, A3, Used Audi

 **Audi A3 Sedan 1.4A TFSI S-tronic Ambiente** **\$102,800** **\$10,520 /yr** **26-May-2017** **1,394 cc** **23,000 km** **Luxury** **Available**

Yes You Are The Lucky One! This Is The Newest! And At 1.4L Engine! All A3 Are Usually 1.0L. More Powerful Than The A3 1.0L And Fuel Economy!


 Posted: 22-Apr-2018 Tags: 2017 Audi A3, Audi A3, Audi, A3, Used Audi

 **Audi A3 Sportback 1.0A TFSI S-tronic** **\$108,999** **\$11,280 /yr** **31-May-2017** **999 cc** **5,000 km** **Hatchback** **Available**

Management Unit, Genuine Low Mileage Of 5000km, 1 Owner Only, 5 Years Premium Automobiles Warranty Till May 2022. Cosmos Blue A3 Sportback. Powerful And Fuel Efficient Engine. Responsive Dual Clutch ...

Premium Automobiles
 Posted: 23-May-2018 Tags: 2017 Audi A3, Audi A3, Audi, A3, Used Audi

[Car Buying](#) |
 [Car Selling](#) |
 [Car Ownership](#) |
  Bidded Carplates For Sale

[Car Aftermarket](#) |
 [On The Move](#) |
 [Lifestyle](#)

 **Audi A3 Cabriolet 1.4A TFSI S-tronic** **\$146,151** **\$14,440 /yr** **10-Jul-2017** **1,395 cc** **6,648 km** **Sports** **Available**

95% In House Loan Approval Just Arrived! \$40k Huge Savings From Brand New. 2017 New Facelifted A3 Lifestyle Cabriolet, 3 Years Warranty From Premium Auto. Mileage Clock Only 6600km, 100% New Car Cond...

Dosh Car
 Posted: 02-Jun-2018 Tags: 2017 Audi A3, Audi A3, Audi, A3, Used Audi

 **Audi A3 Sedan 1.0A TFSI S-tronic** **\$104,000** **\$10,130 /yr** **25-Nov-2017** **999 cc** **8,200 km** **Luxury** **Available**

Spent \$1K For 3 Layer Kube Bond Ceramic Coating. Solar Film On Window Glasses, Front And Rear Camera. Floor Mat Etc Schedule A Test Drive Today. Viewing Is Strictly By Appointment Only.

Carro 
 Posted: 01-Jun-2018 Tags: 2017 Audi A3, Audi A3, Audi, A3, Used Audi

REF:

CC3/A2H18010613/Asber

ASS. REQ. BY Adrian King

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No _____

Claims No. _____

Sum Insured: _____ Excess: \$600/-

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

| | |
|-----|-----|
| | |
| N/S | O/S |
| | |

Bal. or Market Value: _____

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 35 M/S days Res.: Yes or No

Lum Sum: _____ % 3 Val: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: _____ Person Contacted: _____

Veh No: 36565Z Yr Regn: 2017/Nov

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or _____

Make: Audi A3 cc 999

Colour: Blueck A/C: Insured / Std / NI / NA

Sp. Reading: 11603 T/Radio: Insured / Std / NI / NA

Eng/No: _____

Cr/No: WJAU228V8J1022578

Gen. Cond: Good / Fair / Poor / BurntSteering: Inorder / Jammed / Leaked / Burnt orBrake: Inorder / Jammed / Leaked / Burnt orModi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 205/55R16

R: 205/55R16

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or _____

Front _____ Rear _____

R/Bal: 06 mm R/Bal: 06 mm

L/Bal: 06 mm L/Bal: 06 mm

D.O.A. _____ D.O.I. 11/06/18

Survey held at Premium

Des. of Damages: Fr / Rear / O/S / N/S (UIC) / Rooftop or

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

OD AIG

*

MV: 110K
PV: 493K
Nett: 60TK

RECEIVED 16 AUG 2019

365 665Z - 03/MH18010613/MJY303

03/07/2018

- 14/06/18 @ 11:05 a.m. revised IA to Chee Heng via memo.
 14/06/18 @ 11:05 a.m. mandate requested authorization to chee Heng via memo 201
 29/06/18 @ 15:09 p.m. mandate approved by Andy Fong.
 29/06/18 @ 16:41 p.m. revert authorised repair to Nora (opower) via email.
 15/07/19 Confirmed P/R \$ 69,684.60 @ 35 days with Adrian. 11
 (\$50,530.40 Red - #2%)

Recovery No. of Trip - 4

16/03/19 file pass to typist

211

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

| | |
|--------------------------------|--------------------------------------|
| Owner ID Type: | Company |
| Owner ID: | 3181E |
| Vehicle No.: | SG5665Z |
| Vehicle to be Exported: | Yes |
| Intended De-registration Date: | 11 Jun 2018 |
| Vehicle Make: | AUDI |
| Vehicle Model: | A3 SEDAN 1.0 TFSI S TRONIC (LED) |
| Primary Colour: | Brown |
| Manufacturing Year: | 2017 |
| Engine No.: | CHZ575902 |
| Chassis No.: | WAUZZZ8V8J1022578 |
| Maximum Power Output: | 85.0 kW (113 bhp) |
| Open Market Value: | \$23,895.00 |
| Original Registration Date: | 24 Nov 2017 |
| First Registration Date: | 24 Nov 2017 |
| Transfer Count: | 0 |
| Actual ARF Paid: | \$15,453.00 |
| PARF Eligibility: | Yes |
| PARF Eligibility Expiry Date: | 23 Nov 2027 |
| PARF Rebate Amount: | \$11,589.00 |
| COE Expiry Date: | 23 Nov 2027 |
| COE Category: | A - Car up to 1600cc & 97kW (130bhp) |
| COE Period(Years): | 10 |
| QP Paid: | \$47,112.00 |
| COE Rebate Amount: | \$37,689.00 |
| Total Rebate Amount: | \$49,278.00 |

The information contained herein is correct as at 11 Jun 2018

OK

CHEAPEST CAR INSURANCE RENEWAL

Compare 10+ Insurers. Option of any workshop.

GET A CHEAPER QUOTE NOW!

FOR SALE BY OWNER

Post an Advertisement
Sell it yourself! Advertise it at just **\$58 until it's SOLD!**

[Post an Ad](#) |
 [Advertiser Login](#) |
 [Ways of Selling](#)

New 5 Years Coe Renewal Toyota Vios 1.5A

\$2500 Downpayment Monthly From \$580 Onwards. Lowest 3.68% P.A. @GV Cars Financing

SKY A1

PRIME MOTOR & LEASING

With over 200 units of vehicles to choose from, ranging from all European to Japanese Makes.

Browse by Category Save Search Print Sort by Date Posted | 20 results/page

6 vehicles **Search** Audi A3 Advanced Search Search View All

Make Model Price Depreciation Reg Date Eng Cap Mileage Veh Type Status

| Search Selection | Audi A3 | Any | Any | 2017 | Any | Any | Any | Available |
|------------------|---------|-----|-----|------|-----|-----|-----|-----------|
|------------------|---------|-----|-----|------|-----|-----|-----|-----------|



Audi A3 Sedan 1.0A TFSI S-tronic | \$116,800 | \$12,400 /yr | 25-Feb-2017 | 999 cc | - | Luxury | Available

Come With Audi Virtual Cockpit And Navigation. \$2000 Republic Auto Warranty Service Credit, Almost Brand New Condition And Well Taken Care By 1 Owner. Please Call To Arrange An Appointment For Viewing...

Republic Auto
 Posted: 11-Jun-2018 | Tags: 2017 Audi A3, Audi A3, Audi, A3, Used Audi



Audi A3 Sedan 1.0A TFSI S-tronic | \$108,999 | \$11,350 /yr | 29-Apr-2017 | 999 cc | 9,000 km | Luxury | Available

Fully Serviced And Maintained By Premium Automobiles. 5 Years Warranty From Audi Agent Premium Automobiles. Limited Management Unit. Please Sms/Call Mobile For More Details Before It's Gone!

Premium Automobiles **PREMIUM**
 Posted: 23-May-2018 | Tags: 2017 Audi A3, Audi A3, Audi, A3, Used Audi



Audi A3 Sedan 1.4A TFSI S-tronic Ambiente | \$102,800 | \$10,520 /yr | 26-May-2017 | 1,394 cc | 23,000 km | Luxury | Available

Yes You Are The Lucky One! This Is The Newest! And At 1.4L Engine! All A3 Are Usually 1.0L. More Powerful Than The A3 1.0L And Fuel Economy!

DIRECT OWNER
 Posted: 22-Apr-2018 | Tags: 2017 Audi A3, Audi A3, Audi, A3, Used Audi



Audi A3 Sportback 1.0A TFSI S-tronic | \$108,999 | \$11,280 /yr | 31-May-2017 | 999 cc | 5,000 km | Hatchback | Available

Management Unit, Genuine Low Mileage Of 5000km. 1 Owner Only, 5 Years Premium Automobiles Warranty Till May 2022. Cosmos Blue A3 Sportback. Powerful And Fuel Efficient Engine. Responsive Dual Clutch ...

Premium Automobiles
 Posted: 23-May-2018 | Tags: 2017 Audi A3, Audi A3, Audi, A3, Used Audi

- Car Buying
- Car Selling
- Car Ownership
- Car Aftermarket
- On The Move
- Lifestyle

\$22,338 Bidded Carlates For Sale!



Audi A3 Cabriolet 1.4A TFSI S-tronic | \$148,151 | \$14,440 /yr | 10-Jul-2017 | 1,395 cc | 6,648 km | Sports | Available

95% In House Loan Approval Just Arrived! \$40K Huge Savings From Brand New. 2017 New Facelifted A3 Lifestyle Cabriolet, 3 Years Warranty From Premium Auto. Mileage Clock Only 6600km, 100% New Car Cond...

Desh Car
 Posted: 02-Jun-2018 | Tags: 2017 Audi A3, Audi A3, Audi, A3, Used Audi



Audi A3 Sedan 1.0A TFSI S-tronic | \$104,000 | \$10,130 /yr | 25-Nov-2017 | 999 cc | 8,200 km | Luxury | Available

Spent \$1K For 3 Layer Kube Bond Ceramic Coating. Solar Film On Window Glasses, Front And Rear Camera. Floor Mat Etc Schedule A Test Drive Today. Viewing Is Strictly By Appointment Only.

Carro **COMPLETED**
 Posted: 01-Jun-2018 | Tags: 2017 Audi A3, Audi A3, Audi, A3, Used Audi

Shirley Hiew (LKK Auto)

From: Fong, Andy-SY <Andy-SY.Fong@aig.com>
Sent: Wednesday, 20 June 2018 9:39 PM
To: 'SUR'; Adrian Ling (LKKAuto)
Cc: Sim, Priscilla-LK; Koh, Victor-CK; Nora Khai
Subject: SGS665Z / 7385438466SG / DOA 03 June 2018

Dear LKK

Premium Automobiles has reverted that they are able to undertake OD repairs to SGS665Z at \$69,684.60 instead of Total Loss.

Please kindly contact Nora to liaise on the matter.

Andy Fong
AIG
Claims Technical Control Manager
Singapore | Hong Kong
AIG Asia Pacific Insurance Pte. Ltd.

78 Shenton Way #08-16 Singapore 079120
Tel +(65) 6419 1708|M: +(65) 9138 1785
Andy-SY.Fong@AIG.com | www.AIG.com.sg

Follow us:



Get up to 15% OFF your AIG vehicle insurance premium and stand a chance to win amazing prizes when you download AIG On the Go [now!](#)

IMPORTANT NOTICE:

The information in this email (and any attachments) is confidential. If you are not the intended recipient, you must not use or disseminate the information. If you have received this email in error, please immediately notify me by "Reply" command and permanently delete the original and any copies or printouts thereof. Although this email and any attachments are believed to be free of any virus or other defect that might affect any computer system into which it is received and opened, it is the responsibility of the recipient to ensure that it is virus free and no responsibility is accepted by American International Group, Inc. or its subsidiaries or affiliates either jointly or severally, for any loss or damage arising in any way from its use.

Shirley Hiew (LKK Auto)

From: Nora Khai <nora.khai@premiumauto.com.sg>
Sent: Thursday, 21 June 2018 12:51 PM
To: 'Shirley Hiew (LKK Auto)'; 'Claims Dept'
Cc: sur@lkkauto.com
Subject: RE: SGS665Z OD (AIG)/ DOA 03 June 2018

Dear Shirley,

Yes this is based on the given parts and labors.

Thank you.

Best regards,

Norazima Khairuddin
Claims Manager

Premium Automobiles Pte Ltd (Reg No 199902271W)
55 Ubi Road 1 Road Singapore 408699
p. +65 6388 2323 d. +65 6768 9827 f. +65 6841 1183
e. nora.khai@premiumauto.com.sg w. www.audi.com.sg
Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223



Email Disclaimer

This email, including any attachment, is confidential and may also be privileged.
If you have received it in error, please notify us immediately by reply email and then delete this message from your system.
Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you.

From: Shirley Hiew (LKK Auto) [mailto:ShirleyHiew@lkkauto.com]
Sent: 21 June, 2018 9:40 AM
To: 'Nora Khai'; 'Claims Dept'
Cc: sur@lkkauto.com
Subject: SGS665Z OD (AIG)/ DOA 03 June 2018

Dear Nora/Jeffery,

According insurance, you has reverted that you are able to undertake OD repairs to SGS665Z at \$69,684.60.

Please confirm the above matter.

Thank you.

Best Regards,

Shirley Hiew | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: Sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

View Received Message

This mail is associated with :

***SGS665Z (7385438466SG)**
OD
Jun 3 2018 4:00AM
[MODA HOLDINGS PTE LTD]
Premium Automobiles Pte Ltd

[Reply](#) [Reply All](#) [Mark as Unread](#) [Print Message](#) [Delete Message](#) [Forward](#)

From AIG Asia Pacific Insurance Pte. Ltd. (AIG_SG), sent on 29/06/2018 15:09 PM.
To LKK_HQ
Subject Alert - Adj Mandate Approved (\$69684.60) - SGS665Z - Claim Handler: Loo, Tong Shing

Approved:69684.60:Revised and FINAL. please commence OD repairs. All damaged, check and supplementary items to be quantified with clear damage photos.

DOCUMENTS SUMMARY

There are no documents.

Shirley Hiew (LKK Auto)

From: Nora Khai <nora.khai@premiumauto.com.sg>
Sent: Friday, 29 June 2018 5:03 PM
To: 'Shirley Hiew (LKK Auto)'; 'Claims Dept'
Cc: sur@lkkauto.com
Subject: RE: SGS665Z OD (AIG)/ DOA 03 June 2018

Dear Shirley,

Yes . Noted with thanks.

Best Regards,

Norazima Khairuddin
Claims Manager

Premium Automobiles Pte Ltd (Reg No 19990221W)
55 Ubi Road 1 Road Singapore 408699
p. +65 6388 2323 d. +65 6768 9827 f. +65 6841 1183
e. nora.khai@premiumauto.com.sg w. www.audi.com.sg
Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223



Email Disclaimer

This email, including any attachment, is confidential and may also be privileged.
If you have received it in error, please notify us immediately by reply email and then delete this message from your system.
Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you.

From: Shirley Hiew (LKK Auto) [mailto:ShirleyHiew@lkkauto.com]
Sent: 29 June, 2018 4:41 PM
To: 'Nora Khai'; 'Claims Dept'
Cc: sur@lkkauto.com
Subject: RE: SGS665Z OD (AIG)/ DOA 03 June 2018

Dear Nora,

As Spoken, instructed by our client, please proceed at repair cost not exceeding \$69,684.60 (inclusive supplementary) to repair the insured vehicle
SGS 665Z (Excess \$ 600/-) on part by part basis.

If there are any check items or supplementary items please inform our office's Assignment Team at Tel: 6741 8434 to arrange our surveyor for inspection.

Shirley Hiew (LKK Auto)

From: Shirley Hiew (LKK Auto) <ShirleyHiew@lkkauto.com>
Sent: Friday, 29 June 2018 4:41 PM
To: 'Nora Khai'; 'Claims Dept'
Cc: sur@lkkauto.com
Subject: RE: SGS665Z OD (AIG)/ DOA 03 June 2018

Dear Nora,

As Spoken, instructed by our client, please proceed at repair cost not exceeding \$69,684.60 (inclusive supplementary) to repair the insured vehicle
SGS 665Z (Excess \$ 600/-) on part by part basis.

If there are any check items or supplementary items please inform our office's Assignment Team at Tel: 6741 8434 to arrange our surveyor for inspection.

All supplementary items and unconfirm items are subjected to further approval from insurance company before completion of the repair.

*Our client reserve their right **not to pay** if there is no valid approval obtained before repair.

Thank you.

Best Regards,

Shirley Hiew | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: Sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Nora Khai [mailto:nora.khai@premiumauto.com.sg]
Sent: Friday, 22 June 2018 9:31 AM
To: 'Shirley Hiew (LKK Auto)' <ShirleyHiew@lkkauto.com>; 'Claims Dept' <claims@premiumauto.com.sg>
Cc: sur@lkkauto.com
Subject: RE: SGS665Z OD (AIG)/ DOA 03 June 2018

Dear Shirley,

Please inform Andy, we counter proposed to \$63K. Lets us know soonest possible if this is ok because owner is eager to have his car repair.

Thank you.

Best Regards,

Norazima Khairuddin
Claims Manager

Premium Automobiles Pte Ltd (Reg No 199902271W)
55 Ubi Road 1 Road Singapore 408699
p. +65 6388 2323 d. +65 6768 9827 f. +65 6841 1183
e. nora.khai@premiumauto.com.sg w. www.audi.com.sg
Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223



Email Disclaimer

This email, including any attachment, is confidential and may also be privileged. If you have received it in error, please notify us immediately by reply email and then delete this message from your system. Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you.

From: Shirley Hiew (LKK Auto) [<mailto:ShirleyHiew@lkkauto.com>]
Sent: 22 June, 2018 9:25 AM
To: 'Nora Khai'; 'Claims Dept'
Cc: sur@lkkauto.com
Subject: RE: SGS665Z OD (AIG)/ DOA 03 June 2018

Dear Nora,

As spoken, kindly check the repair cost whether you are able to repair the vehicle not over \$ 60,000.00 .

Thank you.

Best Regards,

Shirley Hiew | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Nora Khai [<mailto:nora.khai@premiumauto.com.sg>]
Sent: Thursday, 21 June 2018 12:51 PM
To: 'Shirley Hiew (LKK Auto)' <ShirleyHiew@lkkauto.com>; 'Claims Dept' <claims@premiumauto.com.sg>
Cc: sur@lkkauto.com
Subject: RE: SGS665Z OD (AIG)/ DOA 03 June 2018

Dear Shirley,

Yes this is based on the given parts and labors.

Thank you.

Best regards,

Norazima Khairuddin
Claims Manager

Premium Automobiles Pte Ltd (Reg No 199902271W)

55 Ubi Road 1 Road Singapore 408699

p. +65 6388 2323 d. +65 6768 9827 f. +65 6841 1183

e. nora.khai@premiumauto.com.sg w. www.audi.com.sg

Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223



Email Disclaimer

This email, including any attachment, is confidential and may also be privileged.

If you have received it in error, please notify us immediately by reply email and then delete this message from your system.

Please do not copy, it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you

From: Shirley Hiew (LKK Auto) [<mailto:ShirleyHiew@lkkauto.com>]

Sent: 21 June, 2018 9:40 AM

To: 'Nora Khai'; 'Claims Dept'

Cc: sur@lkkauto.com

Subject: SGS665Z OD (AIG)/ DOA 03 June 2018

Dear Nora/Jeffery,

According insurance, you has reverted that you are able to undertake OD repairs to SGS665Z at \$69,684.60.

Please confirm the above matter.

Thank you.

Best Regards,

Shirley Hiew | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

View Received Message

This mail is associated with :

***SGS665Z (7385438466SG)**

OD

Jun 3 2018 4:00AM

[MODA HOLDINGS PTE LTD]

Premium Automobiles Pte Ltd

[Reply](#) [Reply All](#) [Mark as Unread](#) [Print Message](#) [Delete Message](#) [Forward](#)

From AIG Asia Pacific Insurance Pte. Ltd. (AIG_SG), sent on 29/06/2018 15:09 PM.

To LKK_HQ

Subject Alert - Adj Mandate Approved (S\$69684.60) - SGS665Z - Claim Handler: Loo, Tong Shing

Approved:69684.60;Revised and FINAL. please commence OD repairs. All damaged, check and supplementary items to be quantified with clear damage photos

DOCUMENTS SUMMARY

There are no documents.

View Received Message

This mail is associated with :

***SGS665Z (73854384665G)**
OD
Jun 3 2018 4:00AM
[MODA HOLDINGS PTE LTD]
Premium Automobiles Pte Ltd

[Reply](#) [Reply All](#) [Mark as Unread](#) [Print Message](#) [Delete Message](#) [Forward](#)

From AIG Asia Pacific Insurance Pte. Ltd. (AIG_SG), sent on 28/06/2018 16:32 PM.
To LKK_HQ
Subject Alert - Adj Mandate Approved (S\$63000.00) - SGS665Z - Claim Handler: Loo, Tong Shing

Approved:63000.00:please commence OD repairs. All damaged, check and supplementary items to be quantified with clear damage photos

DOCUMENTS SUMMARY

There are no documents.

View Received Message

This mail is associated with :

***SGS665Z (7385438466SG)**
OD
Jun 3 2018 4:00AM
[MODA HOLDINGS PTE LTD]
Premium Automobiles Pte Ltd

[Reply](#) [Reply All](#) [Mark as Unread](#) [Print Message](#) [Delete Message](#) [Forward](#)

From AIG Asia Pacific Insurance Pte. Ltd. (AIG_SG), sent on 26/06/2018 16:09 PM.
To LKK_HQ
Subject Alert - Adj Mandate Approved (S\$60722.00) - SGS665Z - Claim Handler: Loo, Tong Shing

Approved:60722.00;Max permissible repair limit at \$60,722.00

DOCUMENTS SUMMARY

There are no documents.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To: AIG Asia Pacific Insurance Pte. Ltd.
AIG Building
78 Shenton Way #07-16
Singapore 079120

From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn: Loo, Tong Shing

Date: 28 Jun 2018

Preliminary Advice

| | | | |
|--------------------|--|-------------------------|--------------|
| Vehicle No | : SGS665Z | Accident Date | : 03/06/2018 |
| Make | : AUDI A3 | Policy No. | : 1700078903 |
| Assignment Date | : 11/06/2018 | Excess | : S\$600.00 |
| Date of Inspection | : 11/06/2018 | Est. Duration of Repair | : 21 days |
| Inspection At | : Premium Automobiles Pte Ltd (UBI) 55 Ubi Road 1 Singapore 408699 | | |

Point of Impact / General Description of Damages

The vehicle sustained impact / damages front portion & undercarriage and parts claimed are consistent to the accident.

| | | | |
|-----------------------------|------|------------|---------------------------------|
| Repairer's Estimate (Gross) | :S\$ | 109,883.00 | 120,235 |
| Revised Amount | :S\$ | 79,979.00 | include supplementary 90,331.00 |
| Check Items (Estimated) | :S\$ | 10,749.00 | |
| Total | :S\$ | 90,728.00 | |
| Lump Sum Repair | :S\$ | | |

Total Loss Consideration

| | | | |
|--|------|------------|-----------------------------|
| New for Old Value | :S\$ | 119,999.00 | |
| Pre-Accident Value | :S\$ | 110,000.00 | |
| COE / PARF Rebate | :S\$ | 49,278.00 | |
| Salvage Value | :S\$ | | |
| Margin for Repair <i>(New for Old)</i> | :S\$ | 70,721.00 | (NEW CAR VALUE MINUS RESIDU |
| | | 60,722.00 | (MARKET VALUE MINUS RESIDU/ |

Remarks

- (X) The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.
- () The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.
- (X) Other comments : REPAIRER ASKING REPAIR COST \$ 63,000.00

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607196R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To: AIG Asia Pacific Insurance Pte. Ltd.
AIG Building
78 Shenton Way #07-16
Singapore 079120

From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn: Loh, Chee-Heng

Date: 14 Jun 2018

Preliminary Advice

| | | | |
|--------------------|--|-------------------------|--------------|
| Vehicle No | : SGS665Z | Accident Date | : 03/06/2018 |
| Make | : AUDI A3 | Policy No. | : 1700078903 |
| Assignment Date | : 11/06/2018 | Excess | : S\$0.00 |
| Date of Inspection | : 11/06/2018 | Est. Duration of Repair | : 21 days |
| Inspection At | : Premium Automobiles Pte Ltd (UBI) 55 Ubi Road 1 Singapore 408699 | | |

Point of Impact / General Description of Damages

The vehicle sustained impact / damages front portion & undercarriage and parts claimed are consistent to the accident.

| | | |
|-----------------------------|------|---------------------------------|
| Repairer's Estimate (Gross) | :S\$ | 85,314.00 |
| Revised Amount | :S\$ | 79,979.00 include supplementary |
| Check Items (Estimated) | :S\$ | 10,749.00 |
| Total | :S\$ | 90,728.00 |

Lump Sum Repair :S\$

Total Loss Consideration

| | | |
|--------------------|------|------------|
| New for Old Value | :S\$ | |
| Pre-Accident Value | :S\$ | 110,000.00 |
| COE / PARF Rebate | :S\$ | 49,278.00 |
| Salvage Value | :S\$ | |
| Margin for Repair | :S\$ | 60,722.00 |

Remarks

- () The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.
- (x) The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.
- (X) Other comments : Repairer asking \$100,000.00 to repair the vehicle.

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

| ACCIDENT STATEMENT | |
|--|--------------------------------------|
| Date Of Report | 04/06/2018 18:56 |
| Date Of Accident | 03/06/2018 04:00 |
| Exact Location Of Accident | BEDOK ROAD / JALAN NIPAH |
| Country/State of Loss | SINGAPORE |
| DETAILS OF OWN VEHICLE | |
| Vehicle Registration Number | SGS665Z |
| Insured/Policyholder | |
| Name Of Registered Owner | MODA HOLDINGS PTE LTD |
| Co Reg No | 198303181E |
| Email Address | IRIS@MODAHOLDINGS.COM |
| Mobile Phone No | (LOCAL) +65-98210101 |
| Alternative Phone No | OFFICE-98210101 |
| Vehicle Particulars | |
| Manufacturer | AUDI |
| Model | A3 SEDAN 1.0 TFSI 8V |
| Exact Purpose for which vehicle was being used at time of accident | PRIVATE USE |
| Are you claiming under your own insurance policy for repair to your vehicle? | YES |
| If No, Please state action to be taken | |
| Vehicle Category | PRIVATE CAR |
| Insurance Company | |
| Name of Insurance Company | AIG ASIA PACIFIC INSURANCE PTE. LTD. |
| Type Of Coverage | COMPREHENSIVE |
| Fleet Policy | NO |
| Policy Number | 1700078903 |
| Cover Note Number | |
| Driver | |
| Name of Driver | CHONG YUEE HNG, BLAIR |
| NRIC No | S9723007B |
| Date Of Birth | 25/06/1997 |
| Occupation | INDOOR |
| Date Of Driving Pass | 17/11/2015 |
| Driving Experience | 2 YEARS AND 6 MONTHS |
| Gender | MALE |
| Mobile Number | (LOCAL) +65-97886460 |
| Fax Number | |
| Contact Number | |
| Email Address | BCYH97@GMAIL.COM |

| | |
|---|----------------------|
| Address | 14 BEDOK RIA TERRACE |
| Postcode | 489742 |
| Was driver an employee of the Insured's Company | NO |
| If No, Relationship of the Driver with the Insured | OTHER - GRANDSON |
| Vehicle Registration Number of Driver's Own Vehicle | - |
| | - |
| | - |
| Insurance Company of Driver's Own Vehicle | - |
| | - |
| | - |

General Information of the Accident

| | |
|--------------------|------------------------|
| Type Of Accident | COLLIDED INTO PROPERTY |
| Weather Conditions | CLEAR |
| Road Surface | DRY |

Other Information

| | |
|---|-----|
| Was any foreign vehicle involved in this accident? | NO |
| Number of vehicles involved in the accident | |
| Was any body injured in the Accident? | NO |
| Was any injured conveyed to hospital by ambulance? | |
| Was any other material or property damaged? | YES |
| I have been approached by unknown person(s) soliciting/offering accident claims assistance. | NO |
| Number of Passengers (Including Driver) | 1 |

Details of Police Action

| | |
|---|----|
| Was the accident reported to the police? | NO |
| If Yes, Please state which Police Station | |
| Was notice of intended Prosecution given? | NO |
| If Yes, against whom? | |

Circumstances of Accident

I WAS TRAVELLING ALONG BEDOK ROAD AND WAS ABOUT TO MAKE A LEFT TURN INTO JALAN NIPAH TO GO HOME. WHEN I WAS MAKING THE TURN, I SAW A MOVING ANIMAL ON THE ROAD. I TRIED TO AVOID IT AND ENDED DRIVING UP THE CURB.

Attachment(s)

| | |
|---|-----|
| Are accident photos available for attachment? | YES |
| Was there any video captured by Car Camera? | NO |
| Was there any audio recorded? | NO |

DETAILS OF OTHER VEHICLE PROPERTY 1

| | |
|-------------------------------------|------------|
| Vehicle Registration Number | |
| Vehicle Make/Model/Colour | |
| Details Of Properties | CURB |
| Vehicle Category | NA/UNKNOWN |
| Name of Driver | |
| NRIC/Passport Number | |
| Contact Number | |
| Address | |
| Postcode | |
| Insurance Company Name | |
| Nature Of Damage | |
| No. Of Passenger (Including Driver) | |

Accident Photo





CERTIFICATE OF INSURANCE

AUDI AUTO PROTECTOR PRIVATE VEHICLE

Name of Policyholder : MODA HOLDINGS PTE LTD
Period of Insurance : 24 Nov 2017 To 23 Nov 2018
Engine No. : CHZ575902
Chassis No. : WAUZZZ8V8J1022578

Vehicle No. : SGS665Z
Policy No. : 1700078903
Endorsement No. :
Issued Date : 27 Nov 2017

ABOUT THE COVER

Make/Model : AUDI A3 Sedan 1.0 TFSI S tronic
Engine Capacity/Tonnage : 999,00 CC
Driver Restriction : NA
Sum Insured : Market Value
Off Peak Car : No
First Year of Registration : 2017
Insuring with COE/PARF : Yes

Person or Classes of Persons Entitled to Drive* :

Any person who is driving on the Policyholder's order or with their permission.
 This Policy will indemnify the Policyholder or any authorised driver only if he/she meets the specified age condition.

You have to pay an additional sum of \$3,000 as "Young and/or Inexperienced Driver Excess" ("YIDR") if You are or Your Authorised Driver (named or unnamed) is under the age of 23 and/or has less than 2 years' driving experience.

Age Condition : All Age Condition

Limitation as to use* :

Use only for social, domestic and pleasure purposes and for the Policyholder's business.
 This Policy does not cover use for hire or reward, driving tuition, driving test, racing, pace-making, reliability trial or speed-testing, the carriage of goods other than samples in connection with any trade or business or use for any purpose in connection with Motor Trade.

Loss of Use

* Limitations rendered inoperative by Section 6 of the Motor Vehicles (Third-Party Risks and Compensation) Act (Cap. 189) and Section 95 of the Road Transport Act, 1987 (Malaysia), are not to be included under these headings.

EXCESS

Section 1

Fire - \$0 Own Damage - \$600 Theft - \$0 Flood Cover - \$0

Section 2

Property Damage - \$0

Windscreen : \$100

Named Driver and Excess (where applicable)

APPROVED REPORTING CENTRES/AUTHORISED REPAIRERS (FOR CLAIMS RELATED REPAIRS)

1 Audi Customer Service Center Add: 55 Ubi Road 1 Singapore 408699 63662323

For other Approved Reporting Centres/AIG Authorized Repairers, please contact our 24-hour accident emergency hotline at +65 6338 6200. Alternatively, you may refer to AIG website www.aig.com.sg or AIG SG Mobile App. Simply search and download "AIG SG" from iTunes or Google Play.

IMPORTANT NOTES

Hire Purchase Company/Employer's Loan: DBS BANK LTD

We hereby certify that the policy to which this Certificate of Insurance relates is issued in accordance with the provisions of the Motor Vehicles(Third Party Risks and Compensation) Act (Cap. 189), Part IV of the Road Transport Act, 1987 (Malaysia) and Motor Vehicles (Third Party Risks) Rules, 1953 (Malaysia).

0504125207

PREMIUM LEASING - SLEE

261 ALEXANDRA ROAD AUDI CUSTOMER SERVICE CENTRE
 SINGAPORE 159938

Underwritten by AIG Asia Pacific Insurance Pte. Ltd.

AIG Asia Pacific Insurance Pte. Ltd.
 AUTHORISED REPRESENTATIVE
 Ong Guan Yee

REPUBLIC OF SINGAPORE DRIVING LICENCE



Licence Number: S9723007B

Name: CHONG YUEE HNG, BLAIR

Birth Date: 25 Jun 1997

Issue Date: 17 Nov 2015



SG
50

YOU ARE LICENSED TO DRIVE VEHICLES IN THE FOLLOWING CLASS(ES)

EFFECTIVE DATE

Class 3 Motor Cars \leq 3000kg with \leq 7 passengers, exclusive of the driver; and other motor vehicles \leq 2500kg 17 Nov 2015

NP 42BA

97886460



Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Telefax

Estimate : Accident Repairs
Workshop : Ubi Road 1
Contact No : 6366 2323
Fax No : 6841 1183
Reference : PA/OD/0662/2018/GW
Date : 7-Jun-18

Vehicle IN workshop. Kindly arrange for survey.

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Owner's Name : MODA HOLDINS PTE LTD
Address : 14 Bedok Ria Terrace
Singapore 489742

Telephone : HP +65 98210101
Type of Claim : Own Damage Claim
Policy No. : 1700078903
Vehicle No : **SGS 665 Z**
Model Code : Audi A3 Sedan 1.0 TFSI
Model / Year : Nov-17
Engine No : CHZ 575902
Chassis No : WAUZZZ8V8J1022578
Mileage : -
Date In :
Liability : -
Excess Cost : -
Estimated By : Johnny Boo / Allan Wu
Accident Date : 3-Jun-18
Place of Accident : BEDOK ROAD / JALAN NIPAH

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel: 6366 2323 Fax: 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SGS 665 Z.

| <u>S/N</u> | <u>Nature of Jobs</u> | <u>Estimated Charges</u> | <u>Surveyor's Recommendation</u> |
|------------|--|----------------------------|----------------------------------|
| 7 | To renew engine assy, transfer gearbox and attached components. | S/N \$ 3,600.00 | ✓ |
| 8 | To renew full exhaust system. | S/N \$ 600.00 | ✓ |
| 9 | To dismantle and renew rear suspension assy. | S/N \$ 2,800.00 | ✓ |
| 10 | To respray front bumper, rhs front fender, rhs front door, rhs sill panel, A-pillar and door entrance. To carry out joint sealer works and stone chip treatment. | S 3,600.00 3300 | |
| 11 | To renew rhs front and rear rims with tyres. carry out wheel alignment. | S/N \$ 320.00 | ✓ |
| 12 | To carry out diagnostic check. | S/N \$ 768.00 | ✓ |
| | SUB - LABOUR CHARGES | : \$ 25,128.00 | |

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SGS 665 Z.

| <u>S/N</u> | <u>Nature of Jobs</u> | <u>Estimated Charges</u> | <u>Surveyor's Recommendation</u> |
|---------------------------|---|-----------------------------|----------------------------------|
| 1 | To remove and transfer front wire harness for headlights, horns, fog lamps, outside temperature sensor and headlight washer assy. | S/N \$ 360.00 | ✓ |
| 2 | To remove and transfer aircon condenser, radiator, additional cooler, electrical fans and control unit. To carry out vacuum/ regas and to pressurise cooling system. | S/N \$ 1,000.00 | ✓ |
| 3 | To remove and transfer rhs front doot's multi-lock system and power window devices. | S/N \$ 280.00 | X |
| 4 | To remove and reinstall rhs front seat assy, ABCD pillar trims, sill trims, floor carpets, electronic components and fuse trays. Disengage rhs seat belt and head airbag. | S/N \$ 1,800.00 | X |
| 5 | To dismantle front bumper, rhs front fender and rhs front door. Cut out and weld rhs sill panel. Renew front lock carrier and align to position. Renew front bumper, rhs front fender and rhs front door. Re-organise front crash management components. Reinstall all parts removed. | \$ 7,200.00 4000 | |
| 6 | To dismantle and renew front suspension assy. | S/N \$ 2,800.00 | ✓ |
| SUB-LABOUR CHARGES | | : \$ 13,440.00 | |

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No.SGS 665 Z.

| S/N | Parts Description | Damage Parts & Prices | |
|--------------------|--|-----------------------|-----------|
| | | S/NETT | REMARKS |
| 1 | FRONT BUMPER <i>Distorted</i> | S 1,739.00 | ✓ 1391.20 |
| 2 | FRONT BUMPER GUIDE SECTION-LH/RH <i>2il Rngd</i> 2 | S 66.00 | 33 25.84 |
| 3 | FRONT BUMPR GRILLE-CENTRE <i>Distorted</i> | S 140.00 | ✓ 112.00 |
| 4 | FRONT BUMPER CLOSING ELEMENT-LOWER CENTRE <i>Distorted</i> | S 460.00 | ✓ 368.00 |
| 5 | FRONT BUMPER CLOSING ELEMENT-RH <i>Not Nec</i> | S 254.00 | ✓ X |
| 6 | FRONT BUMPER COVER TRIM-RH/LH <i>Distorted</i> 2 | S 280.00 | ✓ 223.20 |
| 7 | ADAPTER FRONT WHEEL HOUSING LINER-LH/RH <i>Not Nec</i> 2 | S 64.00 | ? X |
| 8 | RADIATOR GRILLE <i>ould</i> | S 1,239.00 | ✓ 991.20 |
| 9 | SIGN "CAUTION" <i>Not Nec</i> | S 12.00 | ✓ X |
| 10 | FRONT FENDER-RH <i>Distorted</i> | S 746.00 | ✓ 596.80 |
| 11 | FRONT FENDER BRACKET-RH <i>Not Nec</i> | S 24.00 | ? X |
| 12 | FRONT FENDER CENTRE BRACKET-RH <i>Not Nec</i> | S 34.00 | ? X |
| 13 | FRONT FENDER BRACE-RH <i>Not Nec</i> | S 84.00 | ? X |
| 14 | FENDER ATTACHEMENT PARTS <i>Not Nec</i> | S 62.00 | ? X |
| 15 | FRONT WHEEL HOUSING LINER-RH <i>ton</i> | S 151.00 | ✓ 120.80 |
| 16 | WHEEL HOSUING LINER ATTACHMENT PARTS <i>Not Nec</i> | S 77.00 | ✓ X |
| 17 | FRONT FENDER CLOSING ELEMENT-RH <i>Not Nec</i> | S 29.00 | ? X |
| 18 | FRONT FENDER INSULATION-RH <i>Rngd</i> | S 36.00 | ✓ 28.32 |
| 19 | FRONT DOOR-RH <i>Rngd</i> | S 2,190.00 | + |
| 20 | FRONT OUTER DOOR SEAL-RH <i>Not Nec</i> | S 139.00 | + |
| SPARE PARTS | | S 7,826.00 | ✓ |

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No.SGS 665 Z.

| S/N | Parts Description | Damage Parts & Prices | |
|--------------------|--|-----------------------|-----------------|
| | | S/NETT | REMARKS |
| 21 | BONDING AGENT | S | 43.00 ✓ |
| 22 | CLEANING SOLUTION | S | 64.00 ✓ |
| 23 | FRONT DOOR ATTACHEMENT PARTS | S | 206.00 ✓ |
| 24 | FRONT DOOR CATCH | S | 92.00 ✓ |
| 25 | DATA PLATE FOR TYRE PRESSURE | S | 25.00 ✓ |
| 26 | SECTIONAL PART- SIDE MEMBER TRIM-RH <i>Right</i> | S | 2,038.00 ✓ |
| 27 | DATA TAG <i>Not Nec</i> | S | 406.00 ✓ X |
| 28 | LOCK CARRIER WITH MOUNTING <i>Cracked</i> | S | 638.00 ✓ 510 |
| 29 | AIR GUIDIE-LH/RH <i>Right</i> | 2 S | 40.00 ✓ 31.84 |
| 30 | A/C CONDENSOR <i>Revised</i> | S | 500.00 ✓ 399.60 |
| 31 | REFRIGERANT LINE (A/C CONDENSOR CUT-OFF POINT) <i>but</i> | S | 582.00 ✓ 465.60 |
| 32 | REFRIGERANT LINE (A/C COMPRESSOR>A/C CONDENSER) <i>not N/A NRC</i> | S | 447.00 ✓ X |
| 33 | ADDITIONAL RADIATOR <i>Revised</i> | S | 799.00 ✓ 639.20 |
| 34 | ADDITIONAL RADIATOR BRACKET <i>Not Nec</i> | 2 S | 75.00 ✓ X |
| 35 | BUSH-LOWER <i>Not Nec</i> | 2 S | 17.00 ✓ X |
| 36 | RADIATOR <i>Revised</i> | S | 828.00 ✓ 662.40 |
| 37 | COOLANT CONCENTRATE <i>n</i> | 2 S | 133.00 ✓ 146.88 |
| 38 | RADIATOR FAN WITH FAN RING <i>Cracked</i> | S | 1,425.00 ✓ 1140 |
| 39 | NOISE INSULATION <i>ton</i> | S | 226.00 ✓ 130.80 |
| 40 | UNDERBODY CLADDING NOISE UNSULATION <i>ton</i> | | TBC ✓ |
| SPARE PARTS | | S | 8,584.00 ✓ |

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel: 6366 2323 Fax: 6841 1183

Telefax

Material List for Accident Vehicle Regn No.SGS 665 Z.

| S/N | Parts Description | Damage Parts & Prices | |
|--------------------|---|-----------------------|----------------------------------|
| | | S/NETT | REMARKS |
| 41 | CENTER UNDERBODY COVER to be Not Nec | S | 11.00 X |
| 42 | UNDERBODY TRIM-RH to be | S | 152.00 121.60 |
| 43 | ASSEMBLY CARRIER to be Bent | S | 890.00 ? 711.60 |
| 44 | BONDED RUBBER BUSHES to be end | S | 90.00 ? 71.36 |
| 45 | PENDULUM SUPPORT to be end | S | 81.00 ? 64.48 |
| 46 | GEAR BOX MOUNTING to be torn | S | 234.00 ? 186.90 |
| 47 | ENGINE MOUNTING to be torn | S | 212.00 ? 169.20 |
| 48 | ENGINE SUPPORT to be Bent | S | 198.00 ? 158 |
| 49 | TRACK CONTROL ARM-LH/RH to be Bent RH | 2 S | 640.00 320 256 |
| 50 | STABILIZER to be Bent | S | 354.00 ✓ 282.80 |
| 51 | WHEEL BEARING HOUSING-LH/RH to be Bent and | 2 S | 1,014.00 ? 811.20 |
| 52 | WHEEL BEARING WITH ASSEMBLY to be Bent and | 2 S | 758.00 ? 606.40 |
| 53 | GUIDE JOINT-LH/RH to be Bent | 2 S | 222.00 ? 177.60 |
| 54 | COUPLING ROD to be Bent | S | 170.00 ? 135.68 |
| 55 | GAS SHOCK ABSORBER to be Bent | 2 S | 485.00 ? 446 388 |
| 56 | DEEP GROOVE BALL THRUST BEARING to be Bent and | 2 S | 81.00 ? 64.16 |
| 57 | DRIVE SHAFT -LH/RH to be Bent | 2 S | 4,262.00 2131 1710.40 |
| 58 | STEERING GEAR to be Bent | S | 4,290.00 ✓ 3432.00 |
| 59 | REPAIR SET FOR STEERING BOX to be Bent | S | 41.00 ✓ 32.24 |
| 60 | TRACK ROD to be Bent | 2 S | 164.00 ? 130.56 |
| SPARE PARTS | | S | 14,349.00 ✓ |

All charges are not inclusive of GST.

Legend: Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel: 6366 2323 Fax: 6841 1183

Telefax

Material List for Accident Vehicle Regn No.SGS 665 Z.

| S/N | Parts Description | Damage Parts & Prices | |
|--------------------|---|-----------------------|---------------------------------|
| | | S/NETT | REMARKS |
| 61 | TIE ROD END-LH/RH <i>211 Best.</i> | 2 S | 226.00 ? 90 |
| 62 | PROTECTIVE SLEEVE <i>new</i> | 2 S | 34.00 ? X |
| 63 | ALUMINIUM RIM <i>at</i> | 2 S | 1,318.00 659.1054.41 |
| 64 | RUBBER VALVE <i>new</i> | 10 S | 28.00 ? X |
| 65 | REAR AXLE BEAM <i>Best.</i> | S | 1,843.00 ? 1484.80 |
| 66 | REAR AXLE BEARING BRACKET-RH <i>new</i> | S | 180.00 ? X |
| 67 | STUB AXLE <i>new</i> | S | 250.00 ? X |
| 68 | WHEEL BEARING WITH ASSEMBLY <i>and</i> | S | 387.00 ? 309.60 |
| 69 | GAS SHOCK ABSORBER <i>new</i> | 2 S | 434.00 ? X |
| 70 | BASE ENGINE <i>used</i> | S | 14,602.00 11768 |
| 71 | NEEDLE BEARING <i>new</i> | S | 23.00 ? X |
| 72 | ENGINE OIL <i>in</i> | S | 290.00 232 |
| 73 | V-BELT <i>2x</i> | S | 42.00 ? 33.28 |
| 74 | A/C COMPRESSOR <i>used</i> | S | 2,110.00 1688 |
| 75 | EXHAUST PIPE | S | 3,416.00 + |
| 76 | EXHAUST CLAMP | S | 45.00 + |
| 77 | EXHAUST DUAL CLIP | S | 50.00 + |
| 78 | EXHAUST BRACKET | S | 47.00 + |
| 79 | RETAINER EXHAUST PIPE | S | 52.00 + |
| 80 | FORNT SILENCER | S | 442.00 + |
| SPARE PARTS | | | |
| | | | <u>\$ 25,819.00</u> |

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No.SGS 665 Z.

| S/N | Parts Description | | Damage P S/NETT |
|-----------------------------|---------------------|----------|-----------------------------------|
| 81 | PIPE CONNECTOR | 2 | \$ 50.00 + |
| 82 | DUAL CLAMP EXHAUST | | \$ 53.00 + |
| 83 | REAR SILENCER | Not done | \$ 643.00 + |
| 84 | HOSE | 2 Int. | \$ 57.00 + 45.28 ✓ |
| 85 | FRONT NO. PLATE | New | S/N \$ 25.00 ✓ |
| 86 | ACRYLIC SEALER | 2 | S/N \$ 180.00 + |
| 87 | CAVITY WAX | | S/N \$ 140.00 + |
| 88 | STONE CHIP | New | S/N \$ 180.00 + |
| 89 | METAL FILLER POWDER | | S/N \$ 280.00 + 611.20 |
| 90 | SUNDRIES | New | \$ 2,000.00 → 611.20 |
| TOTAL SPARE PARTS | | : | \$ 60,186.00 |
| TOTAL LABOUR CHARGES | | : | \$ 25,128.00 |
| GRAND TOTAL | | : | \$ 85,314.00 |

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

115195.72

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Name : Adrian Lij
Surveyed Date : 11/06/18
Authorised Date :
Excess Cost :
Liability :
Remarks : Not Authorised, 21 Days.

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

Please Note : This estimate is based on visual inspection of the affected vehicle. Should we require further labour charges and spare parts in the progress of repair, we shall inform you accordingly. For inspection of vehicle, please refer to Ms Norah Khai at Tel:6768 9828 for appointment.

Yours faithfully,
Premium Automobiles Pte Ltd

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant

Premium Automobiles Pte Ltd

55 Ubi Road 1, Singapore 408699

Tel : (65) 6366 2323 Fax : (65) 6841 1183

Supplementary Estimate 1

GST Reg No. 19-9902271-W

| AIG Asia Pacific Insurance Pte Ltd 78 Shenton Way #07-16 AIG Building Singapore 079120 Attn: Mr. Adrian Ling - Motor Claims Dept Tel: 6841 0055 - Fax: 6256 4315 | | Estimate No. PA/OD/0662/2018/GW Date 13-Jun-18 Service Advisor Jeffery Tan Pages 1 Regn No SGS 665 Z Model No Audi A3 Sedan 1.0 TFSI | |
|--|---|---|--------------|
| Quantity | Description | Unit Price | Amount |
| Parts | | | |
| 1 | FRONT BUMPER GRILLE - LH/RH <i>Damaged</i> | 2 \$ 328.00 | <i>26240</i> |
| 2 | TYRE - RH FRONT / REAR <i>rear punctured, front cut</i> | 2 \$ 590.00 | |
| | | \$ 918.00 | |
| GRAND TOTAL | | | |

Adrian Ling
ALS

For Premium Automobiles Pte Ltd



[Handwritten Signature]

Authorised Signature

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
 Signature: _____
 Date: _____

Premium Automobiles Pte Ltd

55 Ubi Road 1, Singapore 408699

Tel : (65) 6366 2323 Fax : (65) 6841 1183

Supplementary Estimate 1

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd
 78 Shenton Way
 #07-16 AIG Building
 Singapore 079120
Attn: Mr. Adrian Ling - Motor Claims Dept
Tel: 6841 0055 - Fax: 6256 4315

Estimate No. PA/OD/0662/2018/GW
Date 13-Jun-18
Service Advisor Jeffery Tan
Pages 1
Regn No SGS 665 Z
Model No Audi A3 Sedan 1.0 TFSI

| Quantity | Description | Unit Price | Amount |
|---------------|---|---------------------|--------|
| Parts | | | |
| 1 | 7 speed gearbox <i>damaged</i> | \$ 15,385.00 ✓ | 12,308 |
| 2 | Transmission fluid <i>new</i> | \$ 120.00 ✓ | 96 |
| 3 | Gearbox oil seal <i>not new</i> | \$ 64.00 ✓ | x |
| | | \$ 15,569.00 | |
| LABORS | | | |
| 1 | To place vehicle on Car-O-Liner and carry out first measurement. (Special Nett) | \$ 800.00 ✓ | |
| 2 | To set up vehicle on Car-O-Liner repair bench. (Special Nett) | \$ 2,400.00 ✓ | |
| 3 | To repair & align both front chassis frame to specification of origin. | \$ 3,000.00 ✓ | |
| 4 | To renew gearbox assy. Carry out adaptation. (Special Nett) | \$ 2,800.00 ✓ | |
| TOTAL | | \$ 24,569.00 | |

For Premium Automobiles Pte Ltd



 Authorised Signature

Adrian Ling

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before safe storage/painting
- To disclose damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

[Signature]

Acknowledged by Repairer
 Signature: _____
 Date: _____

Premium Automobiles Pte Ltd

55 Ubi Road 1, Singapore 408699

Tel : (65) 6366 2323 Fax : (65) 6841 1183

Supplementary Estimate 3

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Attn: Mr. Adrian Ling - Motor Claims Dept
Tel: 6841 0055 - Fax: 6256 4315

Estimate No. PA/OD/0662/2018/GW
Date 26-Jul-18
Service Advisor Jeffery Tan
Pages 1
Regn No SGS 665 Z
Model No Audi A3 Sedan 1.0 TFSI

| Quantity | Description | Unit Price | Amount |
|--------------|-------------------------------|-----------------|----------|
| Parts | | | |
| 1 | Timing belt kit set | S 127.00 | ✓ 79.28 |
| 2 | Engine oil seals and gasket | S 235.00 | ✓ 93.36 |
| 3 | Engine valve cover repair set | S 195.00 | ✓ 155.76 |
| TOTAL | | S 557.00 | |

For Premium Automobiles Pte Ltd

Adrian Ling

Authorised Signature

S.S.

LIQ Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Premium Automobiles Pte Ltd

55 Ubi Road 1, Singapore 408699

Tel : (65) 6366 2323 Fax : (65) 6841 1183

Supplementary Estimate 4

GST Reg No. 19-9902271-W

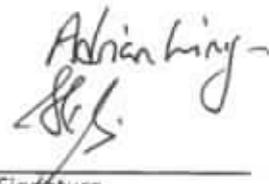
AIG Asia Pacific Insurance Pte Ltd
 78 Shenton Way
 #07-16 AIG Building
 Singapore 079120
Attn: Mr. Adrian Ling - Motor Claims Dept
Tel: 6841 0055 - Fax: 6256 4315

Estimate No. PA/OD/0662/2018/GW
Date 26-Jul-18
Service Advisor Jeffery Tan
Pages 1
Regn No SGS 665 Z
Model No Audi A3 Sedan 1.0 TFSI

| Quantity | Description | Unit Price | Amount |
|---------------|---|--------------------|------------|
| Parts | | | |
| 1 | UNDERCARRIAGE PAN ATTACHMENT PARTS <i>new</i> | \$ 96.00 | ✓ 96.00 |
| 2 | RADIATOR TOP HOSE <i>Damaged</i> | \$ 26.00 | ✓ 26.00 |
| 3 | ABSORBER MOUNTING - RHS <i>Damaged</i> | \$ 181.00 | ✓ 181.00 |
| 4 | DIPSTICK <i>Damaged</i> | \$ 27.00 | ✓ 27.00 |
| 5 | RADIATOR LOWER HOSE <i>cut</i> | \$ 121.00 | ✓ 121.00 |
| 6 | CAMSHAFT TIMING ADJUSTER <i>Damaged</i> | \$ 1,894.00 | ✓ 1,894.00 |
| 7 | A/C HOSE <i>Bent</i> | \$ 450.00 | ✓ 450.00 |
| 8 | HEADLIGHT - RHS <i>crushed</i> | \$ 4,888.00 | ✓ 4,888.00 |
| 9 | CAMSHAFT ADJUSTER ATTACHMENT PARTS <i>Damaged</i> | \$ 77.00 | ✓ 77.00 |
| 10 | TIMING BELT ROLLER | \$ 80.00 | ✓ 80.00 |
| 11 | TIMING BELT ADJUSTER | \$ 124.00 | ✓ 124.00 |
| 12 | TIMING BELT <i>Damaged</i> | \$ 181.00 | ✓ 181.00 |
| 13 | WATER PUMP BELT | \$ 34.00 | ✓ 34.00 |
| 14 | TIMING BELT BEARING | \$ 23.00 | ✓ 23.00 |
| 15 | RADIATOR TOP BRACKET <i>new</i> | \$ 75.00 | ✓ 75.00 |
| Labour | | | |
| 1 | To remove and replace camshaft adjuster. To carry out ignition timing calibration and to adjust to spec. (Special Nett) | \$ 600.00 | ✓ 600.00 |
| TOTAL | | \$ 8,877.00 | |

LKK Auto Consultants hence notify the Repairer the following:
 For Premium Automobiles Pte Ltd

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- All repairs/operations is allowed
- All damaged parts must be resurveyed and must be final approval from Insurance Company

Adrian Ling


Authorized Signature

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Telefax

Estimate : Accident Repairs
Workshop : Ubi Road 1
Contact No : 6366 2323
Fax No : 6841 1183
Reference : PA/OD/0662/2018/GW
Date : 7-Jun-18

Vehicle IN workshop. Kindly arrange for survey.

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way
#07-16 AIG Building
Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Owner's Name : MODA HOLDINS PTE LTD
Address : 14 Bedok Ria Terrace
Singapore 489742

Telephone : HP +65 98210101
Type of Claim : Own Damage Claim
Policy No. : 1700078903
Vehicle No : **SGS 665 Z**
Model Code : Audi A3 Sedan 1.0 TFSI
Model / Year : Nov-17
Engine No : CHZ 575902
Chassis No : WAUZZZ8V8J1022578
Mileage : -
Date In :
Liability : -
Excess Cost : -
Estimated By : Johnny Boo / Allan Wu
Accident Date : 3-Jun-18
Place of Accident : BEDOK ROAD / JALAN NIPAH

*repair proposed
Ho days*

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SGS 665 Z.

| S/N | Nature of Jobs | | Estimated Charges | Surveyor's Recommendation |
|-----|--|--------|---------------------|---------------------------|
| 7 | To renew engine assy, transfer gearbox and attached components. | S/N \$ | 3,600.00 | \$ 3,600.00 |
| 8 | To renew full exhaust system. | S/N \$ | 600.00 | \$ 600.00 |
| 9 | To dismantle and renew rear suspension assy. | S/N \$ | 2,800.00 | \$ 2,800.00 |
| 10 | To respray front bumper, rhs front fender, rhs front door, rhs sill panel, A-pillar and door entrance. To carry out joint sealer works and stone chip treatment. | \$ | 3,600.00 | \$ 3,300.00 |
| 11 | To renew rhs front and rear rims with tyres. carry out wheel alignment. | S/N \$ | 320.00 | \$ 320.00 |
| 12 | To carry out diagnostic check. | S/N \$ | 768.00 | \$ 768.00 |
| 13 | Additional Labour supplementary | \$ | 9,600.00 | \$ 9,600.00 |
| | SUB - LABOUR CHARGES | : | \$ 34,728.00 | \$ 29,148.00 |

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SGS 665 Z.

| S/N | Nature of Jobs | Estimated Charges | Surveyor's Recommendation |
|-----|---|-----------------------|---------------------------|
| 1 | To remove and transfer front wire harness for headlights, horns, fog lamps, outside temperature sensor and headlight washer assy. | S/N \$ 360.00 | \$ 360.00 |
| 2 | To remove and transfer aircon condenser, radiator, additional cooler, electrical fans and control unit. To carry out vacuum/ regas and to pressurise cooling system. | S/N \$ 1,000.00 | \$ 1,000.00 |
| 3 | To remove and transfer rhs front doot's multi-lock system and power window devices. | S/N \$ 280.00 | |
| 4 | To remove and reinstall rhs front seat assy, ABCD pillar trims, sill trims, floor carpets, electronic components and fuse trays. Disengage rhs seat belt and head airbag. | S/N \$ 1,800.00 | |
| 5 | To dismantle front bumper, rhs front fender and rhs front door. Cut out and weld rhs sill panel. Renew front lock carrier and align to position. Renew front bumper, rhs front fender and rhs front door. Re-organise front crash management components. Reinstall all parts removed. | \$ 7,200.00 | \$ 4,000.00 |
| 6 | To dismantle and renew front suspension assy. | S/N \$ 2,800.00 | \$ 2,800.00 |
| | SUB-LABOUR CHARGES | : \$ 13,440.00 | \$ 8,160.00 |

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No.SGS 665 Z.

| S/N | Parts Description | Damage Parts & Prices | |
|-----|---|-----------------------|--------------------|
| | | S/NETT | REMARKS |
| 1 | FRONT BUMPER | \$ 1,739.00 | \$ 1,391.20 |
| 2 | FRONT BUMPER GUIDE SECTION-LH/RH | 2 \$ 66.00 | \$ 25.84 |
| 3 | FRONT BUMPR GRILLE-CENTRE | \$ 140.00 | \$ 112.00 |
| 4 | FRONT BUMPER CLOSING ELEMENT-LOWER CENTRE | \$ 460.00 | \$ 368.00 |
| 5 | FRONT BUMPER CLOSING ELEMENT-RH | \$ 254.00 | |
| 6 | FRONT BUMPER COVER TRIM-RH/LH | 2 \$ 280.00 | \$ 223.20 |
| 7 | ADAPTER FRONT WHEEL HOUSING LINER-LH/RH | 2 \$ 64.00 | |
| 8 | RADIATOR GRILLE | \$ 1,239.00 | \$ 991.20 |
| 9 | SIGN "CAUTION" | \$ 12.00 | |
| 10 | FRONT FENDER-RH | \$ 746.00 | \$ 596.80 |
| 11 | FRONT FENDER BRACKET-RH | \$ 24.00 | |
| 12 | FRONT FENDER CENTRE BRACKET-RH | \$ 34.00 | |
| 13 | FRONT FENDER BRACE-RH | \$ 84.00 | |
| 14 | FENDER ATTACHEMENT PARTS | \$ 62.00 | |
| 15 | FRONT WHEEL HOUSING LINER-RH | \$ 151.00 | \$ 120.80 |
| 16 | WHEEL HOSUING LINER ATTACHMENT PARTS | \$ 77.00 | |
| 17 | FRONT FENDER CLOSING ELEMENT-RH | \$ 29.00 | |
| 18 | FRONT FENDER INSULATION-RH | \$ 36.00 | \$ 28.32 |
| 19 | FRONT DOOR-RH | \$ 2,190.00 | |
| 20 | FRONT OUTER DOOR SEAL-RH | \$ 139.00 | |
| | SPARE PARTS | \$ 7,826.00 | \$ 3,857.36 |

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No.SGS 665 Z.

| S/N | Parts Description | Damage Parts & Prices | |
|--------------------|---|-----------------------|-------------|
| | | S/NETT | REMARKS |
| 21 | BONDING AGENT | \$ 43.00 | |
| 22 | CLEANING SOLUTION | \$ 64.00 | |
| 23 | FRONT DOOR ATTACHEMENT PARTS | \$ 206.00 | |
| 24 | FRONT DOOR CATCH | \$ 92.00 | |
| 25 | DATA PLATE FOR TYRE PRESSURE | \$ 25.00 | |
| 26 | SECTIONAL PART- SIDE MEMBER TRIM-RH | \$ 2,038.00 | |
| 27 | DATA TAG | \$ 406.00 | |
| 28 | LOCK CARRIER WITH MOUNTING | \$ 638.00 | \$ 510.00 |
| 29 | AIR GUDIE-LH/RH | 2 \$ 40.00 | \$ 31.84 |
| 30 | A/C CONDENSOR | \$ 500.00 | \$ 399.60 |
| 31 | REFRIGERANT LINE (A/C CONDENSOR CUT-OFF POINT) | \$ 582.00 | \$ 465.60 |
| 32 | REFRIGERANT LINE (A/C COMPRESSOR>A/C CONDENSER) | \$ 447.00 | |
| 33 | ADDITIONAL RADIATOR | \$ 799.00 | \$ 639.20 |
| 34 | ADDITIONAL RADIATOR BRACKET | 2 \$ 75.00 | |
| 35 | BUSH-LOWER | 2 \$ 17.00 | |
| 36 | RADIATOR | \$ 828.00 | \$ 662.40 |
| 37 | COOLANT CONCENTRATE | 2 \$ 133.00 | \$ 146.88 |
| 38 | RADIATOR FAN WITH FAN RING | \$ 1,425.00 | \$ 1,140.00 |
| 39 | NOISE INSULATION | \$ 226.00 | \$ 180.80 |
| 40 | UNDERBODY CLADDING NOISE UNSULATION | | TBC |
| SPARE PARTS | | \$ 8,584.00 | \$ 4,176.32 |

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No.SGS 665 Z.

| S/N | Parts Description | Damage Parts & Prices | |
|--------------------|---------------------------------|-----------------------|--------------------|
| | | S/NETT | REMARKS |
| 41 | CENTER UNDERBODY COVER | \$ 11.00 | |
| 42 | UNDERBODY TRIM-RH | \$ 152.00 | \$ 121.60 |
| 43 | ASSEMBLY CARRIER | \$ 890.00 | \$ 711.60 |
| 44 | BONDED RUBBER BUSHES | \$ 90.00 | \$ 71.36 |
| 45 | PENDULUM SUPPORT | \$ 81.00 | \$ 64.48 |
| 46 | GEAR BOX MOUNTING | \$ 234.00 | \$ 186.80 |
| 47 | ENGINE MOUNTING | \$ 212.00 | \$ 169.20 |
| 48 | ENGINE SUPPORT | \$ 198.00 | \$ 158.00 |
| 49 | TRACK CONTROL ARM-LH/RH | 2 \$ 640.00 | \$ 256.00 |
| 50 | STABILIZER | \$ 354.00 | \$ 282.80 |
| 51 | WHEEL BEARING HOUSING-LH/RH | 2 \$ 1,014.00 | \$ 811.20 |
| 52 | WHEEL BEARING WITH ASSEMBLY | 2 \$ 758.00 | \$ 606.40 |
| 53 | GUIDE JOINT-LH/RH | 2 \$ 222.00 | \$ 177.60 |
| 54 | COUPLING ROD | \$ 170.00 | \$ 135.68 |
| 55 | GAS SHOCK ABSORBER | 2 \$ 485.00 | \$ 388.00 |
| 56 | DEEP GROOVE BALL THRUST BEARING | 2 \$ 81.00 | \$ 64.16 |
| 57 | DRIVE SHAFT -LH/RH | 2 \$ 4,262.00 | \$ 1,710.40 |
| 58 | STEERING GEAR | \$ 4,290.00 | \$ 3,432.00 |
| 59 | REPAIR SET FOR STEERING BOX | \$ 41.00 | \$ 32.24 |
| 60 | TRACK ROD | 2 \$ 164.00 | \$ 130.56 |
| SPARE PARTS | | \$ 14,349.00 | \$ 9,510.08 |

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No.SGS 665 Z.

| S/N | Parts Description | Damage Parts & Prices | |
|--------------------|------------------------------|-----------------------|-------------------------------|
| | | S/NETT | REMARKS |
| 61 | TIE ROD END-LH/RH | 2 \$ | 226.00 \$ 90.00 |
| 62 | PROTEVTIVE SLEEVE | 2 \$ | 34.00 |
| 63 | ALUMINIUM RIM | 2 \$ | 1,318.00 \$ 1,054.40 |
| 64 | RUBBER VALVE | 10 \$ | 28.00 |
| 65 | REAR AXLE BEAM | \$ | 1,843.00 \$ 1,484.80 |
| 66 | REAR AXLE BEARING BRACKET-RH | \$ | 180.00 |
| 67 | STUB AXLE | \$ | 250.00 |
| 68 | WHEEL BEARING WITH ASSEMBLY | \$ | 387.00 \$ 309.60 |
| 69 | GAS SHOCK ABSORBER | 2 \$ | 434.00 |
| 70 | BASE ENGINE | \$ | 14,602.00 \$ 11,708.00 |
| 71 | NEEDLE BEARING | \$ | 23.00 |
| 72 | ENGINE OIL | \$ | 290.00 \$ 232.00 |
| 73 | V-BELT | \$ | 42.00 \$ 33.28 |
| 74 | A/C COMPRESSOR | \$ | 2,110.00 \$ 1,688.00 |
| 75 | EXHAUST PIPE | \$ | 3,416.00 |
| 76 | EXHAUST CLAMP | \$ | 45.00 |
| 77 | EXHAUST DUAL CLIP | \$ | 50.00 |
| 78 | EXHAUST BRACKET | \$ | 47.00 |
| 79 | RETAINER EXHAUST PIPE | \$ | 52.00 |
| 80 | FORNT SILENCER | \$ | 442.00 |
| SPARE PARTS | | \$ | 25,819.00 \$ 16,600.08 |

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No.SGS 665 Z.

| S/N | Parts Description | Damage Parts & Prices | |
|-----|-----------------------------|-----------------------|---------------------|
| | | S/NETT | REMARKS |
| 81 | PIPE CONNECTOR | \$ 50.00 | |
| 82 | DUAL CLAMP EXHAUST | \$ 53.00 | |
| 83 | REAR SILENCER | \$ 643.00 | |
| 84 | HOSE | \$ 57.00 | \$ 45.28 |
| 85 | FRONT NO. PLATE | S/N \$ 25.00 | \$ 25.00 |
| 86 | ACRYLIC SEALER | S/N \$ 180.00 | |
| 87 | CAVITY WAX | S/N \$ 140.00 | |
| 88 | STONE CHIP | S/N \$ 180.00 | |
| 89 | METAL FILLER POWDER | S/N \$ 280.00 | |
| 90 | SUNDRIES | \$ 2,000.00 | \$ 611.20 |
| 91 | SUPPLEMENTARY PARTS | \$ 25,321.00 | \$ 20,203.84 |
| | TOTAL SPARE PARTS | \$ 85,507.00 | \$ 55,029.16 |
| | TOTAL LABOUR CHARGES | \$ 34,728.00 | \$ 29,148.00 |
| | GRAND TOTAL | \$ 120,235.00 | \$ 84,177.16 |

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles Pte Ltd

55 Ubi Road 1, Singapore 408699

Tel : (65) 6366 2323 Fax : (65) 6841 1183



Supplementary Estimate 1

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Attn: Mr. Adrian Ling - Motor Claims Dept
Tel: 6841 0055 - Fax: 6256 4315

Estimate No. PA/OD/0662/2018/GW
Date 13-Jun-18
Service Advisor Jeffery Tan
Pages 1
Regn No SGS 665 Z
Model No Audi A3 Sedan 1.0 TFSI

| Quantity | Description | Unit Price | Amount |
|----------------------|---|---------------------|---------------------|
| Parts | | | |
| 1 | 7 speed gearbox | \$ 15,385.00 | \$ 12,308.00 |
| 2 | Transmission fluid | \$ 120.00 | \$ 95.00 |
| 3 | Gearbox oil seal | \$ 64.00 | |
| Total parts | | \$ 15,569.00 | \$ 12,404.00 |
| LABORS | | | |
| 1 | To place vehicle on Car-O-Liner and carry out first measurement. (Special Nett) | \$ 800.00 | \$ 800.00 |
| 2 | To set up vehicle on Car-O-Liner repair bench. (Special Nett) | \$ 2,400.00 | \$ 2,400.00 |
| 3 | To repair & align both front chassis frame to specification of origin. | \$ 3,000.00 | \$ 3,000.00 |
| 4 | To renew gearbox assy. Carry out adaptation. (Special Nett) | \$ 2,800.00 | \$ 2,800.00 |
| Total Labours | | \$ 9,000.00 | \$ 9,000.00 |
| TOTAL | | \$ 24,569.00 | \$ 21,404.00 |

For Premium Automobiles Pte Ltd

Authorised Signature

Premium Automobiles Pte Ltd

55 Ubi Road 1, Singapore 408699

Tel : (65) 6366 2323 Fax : (65) 6841 1183



Supplementary Estimate 2

GST Reg No. 19-9902271-W

| AIG Asia Pacific Insurance Pte Ltd 78 Shenton Way #07-16 AIG Building Singapore 079120 Attn: Mr. Adrian Ling - Motor Claims Dept Tel: 6841 0055 - Fax: 6256 4315 | | Estimate No. Date Service Advisor Pages Regn No Model No | PA/OD/0662/2018/GW 13-Jun-18 Jeffery Tan 1 SGS 665 Z Audi A3 Sedan 1.0 TFSI |
|---|-----------------------------|---|--|
| Quantity | Description | Unit Price | Amount |
| Parts | | | |
| 1 | FRONT BUMPER GRILLE - LH/RH | 2 \$ 328.00 | \$ 262.40 |
| 2 | TYRE - RH FRONT / REAR | 2 \$ 590.00 | \$ 590.00 |
| GRAND TOTAL | | \$ 918.00 | \$852.40 |

For Premium Automobiles Pte Ltd

Authorised Signature

Premium Automobiles Pte Ltd

55 Ubi Road 1, Singapore 408699

Tel : (65) 6366 2323 Fax : (65) 6841 1183



Supplementary Estimate 3

GST Reg No. 19-9902271-W

| | |
|--|---|
| AIG Asia Pacific Insurance Pte Ltd 78 Shenton Way #07-16 AIG Building Singapore 079120 Attn: Mr. Adrian Ling - Motor Claims Dept Tel: 6841 0055 - Fax: 6256 4315 | Estimate No. PA/OD/0662/2018/GW Date 26-Jul-18 Service Advisor Jeffery Tan Pages 1 Regn No SGS 665 Z Model No Audi A3 Sedan 1.0 TFSI |
|--|---|

| Quantity | Description | Unit Price | Amount |
|--------------|-------------------------------|------------------|-----------------|
| Parts | | | |
| 1 | Timing belt kit set | \$ 127.00 | \$ 79.28 |
| 2 | Engine oil seals and gasket | \$ 235.00 | \$ 93.36 |
| 3 | Engine valve cover repair set | \$ 195.00 | \$ 155.76 |
| TOTAL | | \$ 557.00 | \$328.40 |

For Premium Automobiles Pte Ltd

Authorised Signature

Premium Automobiles Pte Ltd

55 Ubi Road 1, Singapore 408699

Tel : (65) 6366 2323 Fax : (65) 6841 1183

Supplementary Estimate 4

GST Reg No. 19-9902271-W

| | | |
|--|---|--|
| AIG Asia Pacific Insurance Pte Ltd 78 Shenton Way #07-16 AIG Building Singapore 079120 Attn: Mr. Adrian Ling - Motor Claims Dept Tel: 6841 0055 - Fax: 6256 4315 | Estimate No. Date Service Advisor Pages Regn No Model No | PA/OD/0662/2018/GW 26-Jul-18 Jeffery Tan 1 SGS 665 Z Audi A3 Sedan 1.0 TFSI |
|--|---|--|

| Quantity | Description | Unit Price | Amount |
|----------------------|---|--------------------|-------------------|
| <u>Parts</u> | | | |
| 1 | UNDERCARRIAGE PAN ATTACHMENT PARTS | \$ 96.00 | \$ 76.16 |
| 2 | RADIATOR TOP HOSE | \$ 26.00 | \$ 20.32 |
| 3 | ABSORBER MOUNTING - RHS | \$ 181.00 | \$ 144.80 |
| 4 | DIPSTICK | \$ 27.00 | \$ 22.16 |
| 5 | RADIATOR LOWER HOSE | \$ 121.00 | \$ 96.40 |
| 6 | CAMSHAFT TIMING ADJUSTER | \$ 1,894.00 | \$ 1,515.20 |
| 7 | A/C HOSE | \$ 450.00 | \$ 360.00 |
| 8 | HEADLIGHT - RHS | \$ 4,888.00 | \$ 3,910.40 |
| 9 | CAMSHAFT ADJUSTER ATTACHMENT PARTS | \$ 77.00 | \$ 60.88 |
| 10 | TIMING BELT ROLLER | \$ 80.00 | \$ 64.00 |
| 11 | TIMING BELT ADJUSTER | \$ 124.00 | \$ 99.20 |
| 12 | TIMING BELT | \$ 181.00 | \$ 144.80 |
| 13 | WATER PUMP BELT | \$ 34.00 | \$ 27.20 |
| 14 | TIMING BELT BEARING | \$ 23.00 | \$ 18.16 |
| 15 | RADIATOR TOP BRACKET | \$ 75.00 | \$ 59.36 |
| Total parts | | \$ 8,277.00 | \$ 6,619.04 |
| <u>Labour</u> | | | |
| 1 | To remove and replace camshaft adjuster. To carry out ignition timing calibration and to adjust to spec. (Special Nett) | \$ 600.00 | \$ 600.00 |
| Total labours | | \$ 600.00 | \$ 600.00 |
| TOTAL | | \$ 8,877.00 | \$7,219.04 |

For Premium Automobiles Pte Ltd

 Authorised Signature

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Name :
Surveyed Date :
Authorised Date :
Excess Cost :
Liability :
Remarks :

Please Note : This estimate is based on visual inspection of the affected vehicle.
Should we require further labour charges and spare parts in the progress of repair, we shall inform you accordingly.
For inspection of vehicle, please refer to Ms Norah Khai at
Tel:6768 9828 for appointment.

Yours faithfully,
Premium Automobiles Pte Ltd

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant

Premium Automobiles

9

AIG Asia Pacific Insurance Pte Ltd
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Attn: Motor Claims Dept
Yr Ref: SGS 665 Z

Norah Khai
6768 9911
6841 1183
Nora.khai@premiumauto.com.sg
Body & Paint Dept
PA/OD/0662/2018/MAS

7 Jan 2019

from
Telephone +65-
Telefax +65-
EMail
Our department
Our Ref
Your Ref
Date

Dear Sir,

RE: INSURANCE CLAIM FOR SGS 665 Z Audi A3 Sedan 1.0

With reference to the above-mentioned vehicle, no. **SGS 665 Z**, claimant, **Moda Holdings Pte Ltd**, please find the related document per attached.

1. A copy of the Original invoice no. 85013311 – S\$73,920.52
2. A copy of the Discharge Voucher duly signed by client.

Based on the above document, we would appreciate you could expedite the payment soonest possible.

If you require any further clarification, please do not hesitate to contact me at 6768 9911.

Regards

This is a computer-generated document. No signature is required.

Norah Khai
Claims Dept

Encls

AIG – SGS 665 Z

total pages

Premium Automobiles Pte Ltd
Showroom
9 Leng Kee Road
Singapore 159090
Telephone (65) 6566 1111
Telefax (65) 6471 3733

Service & Parts Centres
55 Ubi Rd 1
Singapore 408699
Telephone (65) 6336 2323
Telefax (65) 684 11183



Premium Automobiles Pte Ltd

Audi Centre Singapore
281 Alexandra Road
Singapore 119938
Main Telephone: 6334 2222
Main Telefax: 6471 5733

Alexandra Service Centre
281 Alexandra Road
Singapore 119938
Telephone: 6334 2222
Telefax: 6471 1025

UBI Service Centre
55 Ubi Road 1
Singapore 408722

Customer Service
Service Appointment
Address Service
Telephone: 6788 2222

6364 2222
6828 1233
customer.care@premiumautoc.com.sg

INS TAX INVOICE
Company Reg No. 199902271W
GST Reg. No. 199902271W

Page 1 16:13

| | | |
|---|--|---|
| AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120 | Invoice: 85013311 Date: 21/12/2018 Order: SGS0665Z Term: 30 | Account : A0006 (T 0) AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 |
|---|--|---|

Regn No: SGS0665Z Regn Date: 24/11/2017 Mileage: 14445 WIP NO: 12555
Model: A3 SEDAN 1.0 Chassis: WAUZZZ8V8J1022578 Engine: CHZ 575902 Dept: U
VSB No:
You have been assisted by:- UB-Jiayee (43)

| | | Details | Qty | Unit Price | Amount |
|---|--------|---|-----------|------------|-----------|
| S | SUBLET | To carry out contractual LIMIT repair basis as agreed | 69,684.60 | 1.00 | 69,684.60 |
| Q | EXC | Insurance Excess/Liability | -600.00 | 1.00 | -600.00 |

Parts 0.00
Labour 0.00
Sublet 69,684.60
Menus 0.00
Lubricant 0.00

Sub-Total 69,084.60
7% GST 4,835.92
Grand Total 73,920.52



Received by

For & on behalf of
Premium Automobiles Pte Ltd

Customer

Premium Automobiles

Telefax

to
AIG Asia Pacific Insurance Pte Ltd
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Motor Claims Dept
Yr Ref: SGS 665 Z

Norah Khai
6768 9828
6841 1183

Body Repair
PA/OD/0662/2018/KS
4TH September 2018

from
Telephone +65-
Telefax +65-
Mobile +65-
Our department
Your Claim Ref
Our Ref
Date

total pages

RE : CLAIM – OWNER’S SATISFACTION/DISCHARGE VOUCHER

Make & Model : Audi A3 Sedan 1.0 TFSI
Vehicle Chassis No. : WAUZZZ8V8J1022578
Vehicle Regn No. : **SGS 665 Z**
Vehicle Mileage : **12555**
Vehicle Owner : MODA HOLDINGS PTE LTD
Certificate No : 1700078903
Policy Excess : S\$ 642.00 (Inclusive GST)
Accident Date : 3RD June 2018
Place : Bedok Road / Jalan Nipah
Repair Cost : **\$ 73,920.52**
WIP No. : 12555
Repairer's Name : Premium Automobiles Pte Ltd

Premium Automobiles Pte Ltd
Showroom
9 Leng Kee Road
Singapore 159090
Telephone (65) 6566 1111
Telefax (65) 6471 3733

Service & Parts Centres
55 Ubi Road 1
Singapore 408699
Telephone (65) 6366 2323
Telefax (65) 6841 1183

I/We certify that the vehicle has been fully repaired to my entire satisfaction and that payment of the repairer's charges that are claimable under the policy will be deemed in full and final settlement of my claim.

Owner / Insured Signature :



Time :

Date :

4/12/18

Premium Automobiles

Telefax

¹⁰
AIG Asia Pacific Insurance Pte Ltd
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Motor Claims Dept
Yr Ref: SGS 665 Z

Norah Khai
6768 9828
6841 1183

Body Repair
PA/OD/0662/2018/KS
4TH September 2018

from
Telephone +65-
Telefax +65-
Mobile +65-
Our department
Your Claim Ref
Our Ref
Date

total pages

RE : CLAIM – OWNER'S SATISFACTION/DISCHARGE VOUCHER

Make & Model : Audi A3 Sedan 1.0 TFSI
Vehicle Chassis No. : WAUZZZ8V8J1022578
Vehicle Regn No. : **SGS 665 Z**
Vehicle Mileage : 12555
Vehicle Owner : MODA HOLDINGS PTE LTD
Certificate No : 1700078903
Policy Excess : S\$ 642.00 (Inclusive GST)
Accident Date : 3RD June 2018
Place : Bedok Road / Jalan Nipah
Repair Cost : \$ 73,920.50
WIP No. : 12555
Repairer's Name : Premium Automobiles Pte Ltd

Premium Automobiles Pte Ltd
Showroom
9 Leng Kee Road
Singapore 159090
Telephone (65) 6566 1111
Telefax (65) 6471 3733

Service & Parts Centres
55 Ubi Road 1
Singapore 408699
Telephone (65) 6366 2323
Telefax (65) 6841 1183

I/We certify that the vehicle has been fully repaired to my entire satisfaction and that payment of the repairer's charges that are claimable under the policy will be deemed in full and final settlement of my claim.

Owner / Insured Signature :



Time :

Date :

4/12/18

AUDI AUTO PROTECTOR PRIVATE VEHICLE

Name of Policyholder : MODA HOLDINGS PTE LTD
 Period of Insurance : 24 Nov 2017 To 23 Nov 2018
 Engine No. : CHZ575902
 Chassis No. : WAUZZZ8V8J1022578

Vehicle No. : SGS665Z
 Policy No. : 1700078903
 Endorsement No. :
 Issued Date : 27 Nov 2017

ABOUT THE COVER

Make/Model : AUDI A3 Sedan 1.0 TFSI S tronic
 Engine Capacity/Tonnage : 999.00 CC Sum Insured : Market Value First Year of Registration : 2017
 Driver Restriction : NA Off Peak Car : No Insuring with COE/PARF : Yes

Person or Classes of Persons Entitled to Drive* :

Any person who is driving on the Policyholder's order or with their permission.
 This Policy will indemnify the Policyholder or any authorised driver only if he/she meets the specified age condition.

You have to pay an additional sum of \$3,000 as "Young and/or Inexperienced Driver Excess" ("YIDR") if You are or Your Authorised Driver (named or unnamed) is under the age of 23 and/or has less than 2 years' driving experience.

Age Condition : All Age Condition

Limitation as to use* :

Use only for social, domestic and pleasure purposes and for the Policyholder's business.
 This Policy does not cover use for hire or reward, driving tuition, driving test, racing, pace-making, reliability trial or speed-testing, the carriage of goods other than samples in connection with any trade or business or use for any purpose in connection with Motor Trade.

Loss of Use

* Limitations rendered inoperative by Section 8 of the Motor Vehicles (Third-Party Risks and Compensation) Act (Cap. 189) and Section 95 of the Road Transport Act, 1987 (Malaysia), are not to be included under these headings.

EXCESS

Section 1
 Fire - \$0 Own Damage - \$600 Theft - \$0 Flood Cover - \$0

Section 2
 Property Damage - \$0

Windscreen : \$100

Named Driver and Excess (where applicable)

APPROVED REPORTING CENTRES/AUTHORISED REPAIRERS (FOR CLAIMS RELATED REPAIRS)

1. Audi Customer Service Center Add: 55 Ubi Road 1 Singapore 408699 63662323

For other Approved Reporting Centres/AIG Authorised Repairers, please contact our 24-hour accident emergency hotline at +65 6338 6200. Alternatively, you may refer to AIG website www.aig.com.sg or AIG SG Mobile App. Simply search and download "AIG SG" from iTunes or Google Play.

IMPORTANT NOTES

Hire Purchase Company/Employer's Loan: DBS BANK LTD

We hereby certify that the policy to which this Certificate of Insurance relates is issued in accordance with the provisions of the Motor Vehicles(Third Party Risks and Compensation) Act (Cap. 189), Part IV of the Road Transport Act, 1987 (Malaysia) and Motor Vehicles (Third Party Risks) Rules, 1959 (Malaysia).

0504125207

PREMIUM LEASING - SLEE
 281 ALEXANDRA ROAD AUDI CUSTOMER SERVICE CENTRE
 SINGAPORE 159938

Underwritten by AIG Asia Pacific Insurance Pte. Ltd.



AIG Asia Pacific Insurance Pte. Ltd.
 AUTHORISED REPRESENTATIVE

Cheryl Qian Yee

...CLAIM SUBFOLDER...(Pending for Survey Report)

| CLAIM SUBFOLDER TRACKING | | | | | | | |
|--------------------------|-------------|---------------|--|---|---|-------------|---|
| Case | Notified | Est Submitted | Adj Assigned | Adj Rpt | Adj Submitted | Ins Auth'ed | Status |
| Main | 09 Jun 2018 | | 11 Jun 2018 17:32 Edit Adj Rpt | S\$69,684.60 Edit Estimates | S\$69,684.60 View Rpt | | Pending for Survey Report Cancel Case |

| Main | Reference | Claim Details | Documents | Show All | | | | | |
|---|--|------------------------|---|----------------|----------------|--------------------|---------------------|-------------------|--------------|
| CLAIM SUBFOLDER DETAILS [Created by insurer] | | | | | | | | | |
| Insured: | MODA HOLDINGS PTE LTD , Co. Reg. No.: 198303181E | | | | | | | | |
| Vehicle Reg. No.: | SGS665Z | Date of Loss: | 03/06/2018 04:00 - :59 [6 Months and 10 Days From LTA Reg Date (Man Yr)] | | | | | | |
| Claim Type: | OD / 7385438466SG | Policy/Cover Note No.: | 1700078903 (Comprehensive) | | | | | | |
| | | Excess: | S\$600.00 | | | | | | |
| Repairer: | Premium Automobiles Pte Ltd (UBI) 55 Ubi Road 1, 408699 Ubi - Tel: 67689828/9827/9911 | | | | | | | | |
| Handling Insurer: | AIG Asia Pacific Insurance Pte. Ltd. (SG) - Tel: 65-6419-3000 ... [Handled by Loo, Tong Shing] TongShing.Loo@aig.com | | | | | | | | |
| Adjuster: | LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by ADRIAN LING] ... [Final Rpt due 21/06/2018] | | | | | | | | |
| Driver/Custodian: | CHONG YUEE HNG, BLAIR (20 / Male) , NRIC: S9723007B, Tel: +6597886460 Email: BCYH97@GMAIL.COM | | | | | | | | |
| ASSOCIATED MAIL RECEIVED View All Compose Case Mail | | | | | | | | | |
| <ul style="list-style-type: none"> • AIG_SG (15/08/2019): Alert - Adj Mandate Approved (S\$69684.60) - SGS665Z - Claim Handler: Loo, Tong S... • AIG_SG (29/06/2018): Alert - Adj Mandate Approved (S\$69684.60) - SGS665Z - Claim Handler: Loo, Tong S... • AIG_SG (28/06/2018): Alert - Adj Mandate Approved (S\$63000.00) - SGS665Z - Claim Handler: Loo, Tong S... • AIG_SG (26/06/2018): Alert - Adj Mandate Approved (S\$60722.00) - SGS665Z - Claim Handler: Loo, Tong S... • AIG_SG (21/06/2018): Alert - Adj Mandate Maintained - SGS665Z - Claim Handler: Loo, Tong Shing • AIG_SG (20/06/2018): Alert - Adj Mandate Maintained - SGS665Z - Claim Handler: Loo, Tong Shing • AIG_SG (14/06/2018): Alert - Adj Mandate Maintained - SGS665Z - Claim Handler: Loo, Tong Shing • AIG_SG (14/06/2018): SGS665Z / OD / 03/06/2018 / Coverage & Excess update | | | | | | | | | |
| ALL ASSOCIATED TASKS View All Search Tasks Create New Task Complete | | | | | | | | | |
| Due Date | Priority | Type | Task Group | Subject | Handler | Assigned By | Completed On | Created On | Done? |
| No results. | | | | | | | | | |

Claim Documents

*SGS665Z (7385438466SG)
 OD
 Jun 3 2018 4:00AM
 [MODA HOLDINGS PTE LTD]
 Premium Automobiles Pte Ltd

| Upload Documents | | | Upload Photos | | | Compose New Letter | | | Upload Video | | | Upload Audio | | | View <input type="button" value="View in Browser"/> | |
|---------------------------|-----------------|-----------------------------------|---------------|--|--|--------------------|--|--|--------------|--|--|--------------|--|-------------------------------------|---|--|
| Video | | | | | | | | | | | | | 1 per page | <input checked="" type="checkbox"/> | | |
| No | Finalized On | LKK Auto Consultants Pte Ltd (HQ) | | | | | | | | | | Thumbnail | Print | | | |
| 1 | 14/06/18 18:01 | Video - Other | | | | | | | | | | | Load AVI | | | |
| Assessment Reports | | | | | | | | | | | | | 1 per page | <input checked="" type="checkbox"/> | | |
| No | Finalized On | LKK Auto Consultants Pte Ltd (HQ) | | | | | | | | | | Thumbnail | Print | | | |
| 1 | 14/06/18 10:06 | Adjuster Immediate Advice | | | | | | | | | | | Load HTM | | | |
| 2 | 14/06/18 11:05 | Adjuster Immediate Advice | | | | | | | | | | | Load HTM | | | |
| 3 | 28/06/18 13:31 | Adjuster Immediate Advice | | | | | | | | | | | Load HTM | | | |
| Photos/Images | | | | | | | | | | | | | 3 per page | <input checked="" type="checkbox"/> | | |
| No | Relabel/Reorder | LKK Auto Consultants Pte Ltd (HQ) | | | | | | | | | | Thumbnail | Print | | | |
| 1 | 14/06/18 17:58 | General View | | | | | | | | | | | Load JPG <input checked="" type="checkbox"/> | | | |
| 2 | 14/06/18 17:58 | Chassis Number | | | | | | | | | | | Load JPG <input checked="" type="checkbox"/> | | | |
| 3 | 14/06/18 17:58 | General View | | | | | | | | | | | Load JPG <input checked="" type="checkbox"/> | | | |
| 4 | 14/06/18 17:58 | General View | | | | | | | | | | | Load JPG <input checked="" type="checkbox"/> | | | |
| 5 | 14/06/18 17:58 | General View | | | | | | | | | | | Load JPG <input checked="" type="checkbox"/> | | | |
| 6 | 14/06/18 17:58 | General View | | | | | | | | | | | Load JPG <input checked="" type="checkbox"/> | | | |
| 7 | 14/06/18 17:58 | General View | | | | | | | | | | | Load JPG <input checked="" type="checkbox"/> | | | |
| 8 | 14/06/18 17:58 | General View | | | | | | | | | | | Load JPG <input checked="" type="checkbox"/> | | | |
| 9 | 14/06/18 17:58 | General View | | | | | | | | | | | Load JPG <input checked="" type="checkbox"/> | | | |
| 10 | 14/06/18 17:58 | General View | | | | | | | | | | | Load JPG <input checked="" type="checkbox"/> | | | |
| 11 | 14/06/18 17:58 | General View | | | | | | | | | | | Load JPG <input checked="" type="checkbox"/> | | | |
| 12 | 14/06/18 17:58 | General View | | | | | | | | | | | Load JPG <input checked="" type="checkbox"/> | | | |
| 13 | 14/06/18 17:58 | General View | | | | | | | | | | | Load JPG <input checked="" type="checkbox"/> | | | |
| 14 | 14/06/18 17:58 | General View | | | | | | | | | | | Load JPG <input checked="" type="checkbox"/> | | | |
| 15 | 14/06/18 17:58 | General View | | | | | | | | | | | Load JPG <input checked="" type="checkbox"/> | | | |
| 16 | 14/06/18 17:58 | General View | | | | | | | | | | | Load JPG <input checked="" type="checkbox"/> | | | |
| 17 | 14/06/18 17:58 | General View | | | | | | | | | | | Load JPG <input checked="" type="checkbox"/> | | | |
| 18 | 14/06/18 17:58 | General View | | | | | | | | | | | Load JPG <input checked="" type="checkbox"/> | | | |
| 19 | 14/06/18 17:58 | General View | | | | | | | | | | | Load JPG <input checked="" type="checkbox"/> | | | |
| 20 | 14/06/18 17:58 | General View | | | | | | | | | | | Load JPG <input checked="" type="checkbox"/> | | | |
| 21 | 14/06/18 17:58 | General View | | | | | | | | | | | Load JPG <input checked="" type="checkbox"/> | | | |
| 22 | 14/06/18 17:58 | General View | | | | | | | | | | | Load JPG <input checked="" type="checkbox"/> | | | |
| 23 | 14/06/18 17:58 | General View | | | | | | | | | | | Load JPG <input checked="" type="checkbox"/> | | | |
| 24 | 14/06/18 17:58 | General View | | | | | | | | | | | Load JPG <input checked="" type="checkbox"/> | | | |
| 25 | 14/06/18 17:58 | General View | | | | | | | | | | | Load JPG <input checked="" type="checkbox"/> | | | |
| 26 | 14/06/18 17:58 | General View | | | | | | | | | | | Load JPG <input checked="" type="checkbox"/> | | | |
| 27 | 14/06/18 17:58 | General View | | | | | | | | | | | Load JPG <input checked="" type="checkbox"/> | | | |
| 28 | 14/06/18 17:58 | General View | | | | | | | | | | | Load JPG <input checked="" type="checkbox"/> | | | |
| 29 | 14/06/18 17:58 | General View | | | | | | | | | | | Load JPG <input checked="" type="checkbox"/> | | | |
| 30 | 14/06/18 17:58 | General View | | | | | | | | | | | Load JPG <input checked="" type="checkbox"/> | | | |

| Video | | | 1 per page | <input checked="" type="checkbox"/> |
|-------|----------------|-----------------------------------|------------|-------------------------------------|
| No | Finalized On | LKK Auto Consultants Pte Ltd (HQ) | Thumbnail | Print |
| 31 | 14/06/18 17:58 | General View | | <input checked="" type="checkbox"/> |
| 32 | 14/06/18 17:58 | General View | | <input checked="" type="checkbox"/> |
| 33 | 14/06/18 17:58 | General View | | <input checked="" type="checkbox"/> |
| 34 | 14/06/18 17:58 | General View | | <input checked="" type="checkbox"/> |
| 35 | 14/06/18 17:58 | General View | | <input checked="" type="checkbox"/> |
| 36 | 14/06/18 17:58 | General View | | <input checked="" type="checkbox"/> |
| 37 | 14/06/18 17:58 | General View | | <input checked="" type="checkbox"/> |
| 38 | 14/06/18 17:58 | General View | | <input checked="" type="checkbox"/> |
| 39 | 14/06/18 17:58 | General View | | <input checked="" type="checkbox"/> |
| 40 | 14/06/18 17:58 | General View | | <input checked="" type="checkbox"/> |
| 41 | 14/06/18 17:58 | General View | | <input checked="" type="checkbox"/> |
| 42 | 14/06/18 17:58 | General View | | <input checked="" type="checkbox"/> |
| 43 | 14/06/18 17:58 | General View | | <input checked="" type="checkbox"/> |
| 44 | 14/06/18 17:58 | General View | | <input checked="" type="checkbox"/> |
| 45 | 14/06/18 17:58 | General View | | <input checked="" type="checkbox"/> |
| 46 | 14/06/18 17:58 | General View | | <input checked="" type="checkbox"/> |
| 47 | 14/06/18 17:58 | General View | | <input checked="" type="checkbox"/> |
| 48 | 14/06/18 17:58 | General View | | <input checked="" type="checkbox"/> |
| 49 | 14/06/18 17:58 | General View | | <input checked="" type="checkbox"/> |
| 50 | 14/06/18 17:58 | General View | | <input checked="" type="checkbox"/> |
| 51 | 14/06/18 17:58 | General View | | <input checked="" type="checkbox"/> |
| 52 | 14/06/18 17:58 | General View | | <input checked="" type="checkbox"/> |
| 53 | 14/06/18 17:58 | General View | | <input checked="" type="checkbox"/> |
| 54 | 14/06/18 17:58 | General View | | <input checked="" type="checkbox"/> |
| 55 | 14/06/18 17:58 | General View | | <input checked="" type="checkbox"/> |
| 56 | 14/06/18 17:58 | General View | | <input checked="" type="checkbox"/> |
| 57 | 14/06/18 17:58 | General View | | <input checked="" type="checkbox"/> |
| 58 | 14/06/18 17:58 | General View | | <input checked="" type="checkbox"/> |
| 59 | 14/06/18 17:58 | General View | | <input checked="" type="checkbox"/> |
| 60 | 14/06/18 17:58 | General View | | <input checked="" type="checkbox"/> |
| 61 | 14/06/18 17:58 | General View | | <input checked="" type="checkbox"/> |
| 62 | 14/06/18 17:58 | General View | | <input checked="" type="checkbox"/> |
| 63 | 14/06/18 17:58 | General View | | <input checked="" type="checkbox"/> |
| 64 | 14/06/18 17:58 | General View | | <input checked="" type="checkbox"/> |
| 65 | 14/06/18 17:58 | General View | | <input checked="" type="checkbox"/> |
| 66 | 14/06/18 17:58 | General View | | <input checked="" type="checkbox"/> |
| 67 | 14/06/18 17:58 | General View | | <input checked="" type="checkbox"/> |
| 68 | 14/06/18 17:59 | General View | | <input checked="" type="checkbox"/> |
| 69 | 14/06/18 17:59 | General View | | <input checked="" type="checkbox"/> |
| 70 | 14/06/18 17:59 | General View | | <input checked="" type="checkbox"/> |
| 71 | 14/06/18 17:59 | General View | | <input checked="" type="checkbox"/> |
| 72 | 14/06/18 17:59 | General View | | <input checked="" type="checkbox"/> |
| 73 | 14/06/18 17:59 | General View | | <input checked="" type="checkbox"/> |
| 74 | 14/06/18 17:59 | General View | | <input checked="" type="checkbox"/> |
| 75 | 14/06/18 17:59 | General View | | <input checked="" type="checkbox"/> |
| 76 | 14/06/18 17:59 | General View | | <input checked="" type="checkbox"/> |
| 77 | 08/07/19 17:15 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 78 | 08/07/19 17:15 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 79 | 08/07/19 17:15 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 80 | 08/07/19 17:15 | Reinspection Photo | | <input checked="" type="checkbox"/> |

| Video | | | 1 per page | <input checked="" type="checkbox"/> |
|-------|----------------|-----------------------------------|--|-------------------------------------|
| No | Finalized On | LKK Auto Consultants Pte Ltd (HQ) | Thumbnail | Print |
| 81 | 08/07/19 17:15 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 82 | 08/07/19 17:15 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 83 | 08/07/19 17:15 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 84 | 08/07/19 17:15 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 85 | 08/07/19 17:15 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 86 | 08/07/19 17:15 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 87 | 08/07/19 17:15 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 88 | 08/07/19 17:15 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 89 | 08/07/19 17:15 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 90 | 08/07/19 17:15 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 91 | 08/07/19 17:15 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 92 | 08/07/19 17:15 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 93 | 08/07/19 17:15 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 94 | 08/07/19 17:15 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 95 | 08/07/19 17:15 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 96 | 08/07/19 17:15 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 97 | 08/07/19 17:15 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 98 | 08/07/19 17:15 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 99 | 08/07/19 17:16 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 100 | 08/07/19 17:16 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 101 | 08/07/19 17:16 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 102 | 08/07/19 17:16 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 103 | 08/07/19 17:16 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 104 | 08/07/19 17:16 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 105 | 08/07/19 17:16 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 106 | 08/07/19 17:16 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 107 | 08/07/19 17:16 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 108 | 08/07/19 17:16 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 109 | 08/07/19 17:16 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 110 | 08/07/19 17:16 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 111 | 08/07/19 17:16 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 112 | 08/07/19 17:16 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 113 | 08/07/19 17:16 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 114 | 08/07/19 17:16 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 115 | 08/07/19 17:16 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 116 | 08/07/19 17:16 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 117 | 08/07/19 17:16 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 118 | 08/07/19 17:16 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 119 | 08/07/19 17:16 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 120 | 08/07/19 17:16 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 121 | 08/07/19 17:16 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 122 | 08/07/19 17:16 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 123 | 08/07/19 17:16 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 124 | 08/07/19 17:16 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 125 | 08/07/19 17:16 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 126 | 08/07/19 17:16 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 127 | 08/07/19 17:16 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 128 | 08/07/19 17:16 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 129 | 08/07/19 17:16 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |
| 130 | 08/07/19 17:16 | Reinspection Photo | <input checked="" type="checkbox"/> Load JPG | <input checked="" type="checkbox"/> |

| Video | | | 1 per page | <input checked="" type="checkbox"/> |
|-------|----------------|-----------------------------------|------------|-------------------------------------|
| No | Finalized On | LKK Auto Consultants Pte Ltd (HQ) | Thumbnail | Print |
| 131 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 132 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 133 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 134 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 135 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 136 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 137 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 138 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 139 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 140 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 141 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 142 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 143 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 144 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 145 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 146 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 147 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 148 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 149 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 150 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 151 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 152 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 153 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 154 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 155 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 156 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 157 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 158 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 159 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 160 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 161 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 162 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 163 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 164 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 165 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 166 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 167 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 168 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 169 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 170 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 171 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 172 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 173 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 174 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 175 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 176 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 177 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 178 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 179 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 180 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |

| Video | | | 1 per page | <input checked="" type="checkbox"/> |
|---------------|-----------------|--|------------|-------------------------------------|
| No | Finalized On | LKK Auto Consultants Pte Ltd (HQ) | Thumbnail | Print |
| 181 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 182 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 183 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 184 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 185 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 186 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 187 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 188 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 189 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 190 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 191 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 192 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 193 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 194 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 195 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 196 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 197 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 198 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 199 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 200 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 201 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 202 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 203 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 204 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 205 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 206 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 207 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 208 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 209 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 210 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 211 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 212 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 213 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 214 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| 215 | 08/07/19 17:16 | Reinspection Photo | | <input checked="" type="checkbox"/> |
| Documentation | | | 1 per page | <input checked="" type="checkbox"/> |
| No | Relabel/Reorder | LKK Auto Consultants Pte Ltd (HQ) | Thumbnail | Print |
| 1 | 13/06/18 17:51 | INTERVIEW FORM & UNDERTAKING LETTER | | |
| 2 | 14/06/18 10:04 | ESTIMATE | | |
| 3 | 14/06/18 10:04 | DRIVING LICENSE | | |
| 4 | 14/06/18 10:04 | SUPPLEMENTARY | | |
| 5 | 14/06/18 13:09 | IC 1 | | |
| 6 | 14/06/18 13:09 | IC 2 | | |
| 7 | 28/06/18 12:52 | NEW CAR PRICE | | |
| 8 | 24/10/18 09:32 | SUPPLEMENTARY 2.pdf | | |
| 9 | 24/10/18 09:32 | SUPPLEMENTARY 3 .pdf | | |
| 10 | 30/10/18 12:10 | SUPPLEMENTARY 4.pdf | | |
| 11 | 15/07/19 11:10 | ESTIMATE & SUPP MARKED.pdf | | |
| 12 | 15/07/19 16:50 | Microsoft Outlook - EMAIL FROM AIG.pdf | | |
| 13 | 16/08/19 09:44 | Workshop Invoice | | |
| 14 | 16/08/19 09:44 | Discharge Voucher | | |

Linked Accident Report Documents

| | | | View | View in Browser |
|---------------------------|----------------|-----------------------------------|------------|-------------------------------------|
| Assessment Reports | | | 1 per page | <input checked="" type="checkbox"/> |
| No | Finalized On | Premium Automobiles Pte Ltd (UBI) | Thumbnail | Print |
| 1 | 04/06/18 19:32 | Accident Statement | Load HTML | <input type="checkbox"/> |
| Photos/Images | | | 3 per page | <input checked="" type="checkbox"/> |
| No | Finalized On | Premium Automobiles Pte Ltd (UBI) | Thumbnail | Print |
| 1 | 04/06/18 19:25 | Accident Photo | Load JPG | <input checked="" type="checkbox"/> |
| 2 | 04/06/18 19:25 | Accident Photo | Load JPG | <input checked="" type="checkbox"/> |
| 3 | 04/06/18 19:25 | Accident Photo | Load JPG | <input checked="" type="checkbox"/> |
| 4 | 04/06/18 19:25 | Accident Photo | Load JPG | <input checked="" type="checkbox"/> |
| 5 | 04/06/18 19:25 | Accident Photo | Load JPG | <input checked="" type="checkbox"/> |
| 6 | 04/06/18 19:25 | Accident Photo | Load JPG | <input checked="" type="checkbox"/> |
| 7 | 04/06/18 19:25 | Accident Photo | Load JPG | <input checked="" type="checkbox"/> |
| 8 | 04/06/18 19:25 | Accident Photo | Load JPG | <input checked="" type="checkbox"/> |
| 9 | 04/06/18 19:25 | Accident Photo | Load JPG | <input checked="" type="checkbox"/> |
| 10 | 04/06/18 19:25 | Accident Photo | Load JPG | <input checked="" type="checkbox"/> |
| 11 | 04/06/18 19:25 | Accident Photo | Load JPG | <input checked="" type="checkbox"/> |
| 12 | 04/06/18 19:25 | Accident Photo | Load JPG | <input checked="" type="checkbox"/> |
| 13 | 04/06/18 19:25 | Accident Photo | Load JPG | <input checked="" type="checkbox"/> |
| 14 | 04/06/18 19:25 | Accident Photo | Load JPG | <input checked="" type="checkbox"/> |
| 15 | 04/06/18 19:25 | Accident Photo | Load JPG | <input checked="" type="checkbox"/> |
| 16 | 04/06/18 19:25 | Accident Photo | Load JPG | <input checked="" type="checkbox"/> |
| 17 | 04/06/18 19:25 | Accident Photo | Load JPG | <input checked="" type="checkbox"/> |
| Documentation | | | 1 per page | <input checked="" type="checkbox"/> |
| No | Finalized On | Premium Automobiles Pte Ltd (UBI) | Thumbnail | Print |
| 1 | 04/06/18 19:19 | Sketch Plan | Load JPG | <input checked="" type="checkbox"/> |
| 2 | 04/06/18 19:19 | Sketch Plan #2 | Load JPG | <input checked="" type="checkbox"/> |

Documents Checklist

| DOCUMENTS CHECKLIST | Reset | Save | Print |
|---|-------|------|-------|
| There are no document checklists configured. | | | |
| Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ) | | | |
| <div style="border: 1px solid black; width: 100%; height: 100%;"></div> | | | |
| Show Remarks To: <input type="checkbox"/> Handling Insurer <small>Note: Remarks are private unless you show it to other parties.</small> | | | |

LKK Auto Consultants Pte Ltd (Co Reg. No: 199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way #08-16
Singapore 079120

Our File No: CC3/AIG18010613/ASBE2

Date: 16/08/2019

REFERENCE

Insured/Claimant: MODA HOLDINGS PTE LTD Policy No: 1700078903
Date of Loss: 03/06/2018 Nature of Claim: OD Claim No: 7385438466SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SGS665Z**
Make & Model: AUDI A3, 999cc TFSI (A) Engine No: LTA1801896
Reg. Date: 24/11/2017 (Man. Year: 2017) Chassis No: WAUZZZ8V8J1022578
Colour: Black Odometer: 11603 km
Engine Capacity: 999 cc
Market Value/New Car Price: S\$110,000.00
Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 205/55 R16 Rear Tyre Size: 205/55 R16
Front Left Side: Goodyear 6 mm Rear Left Side: Goodyear 6 mm
Front Right Side: Goodyear 6 mm Rear Right Side: Goodyear 6 mm

The above values represent the remaining tyre treads depth

| COST OF CLAIMS | Repairer's | Adjuster's | Difference | Diff % |
|--|-------------------|------------------|------------------|--------------|
| Parts | 80,467.72 | 55,029.16 | 25,438.56 | 31.61 |
| Miscellaneous Items | 0.00 | 0.00 | 0.00 | |
| Labour | 34,728.00 | 29,148.00 | 5,580.00 | 16.07 |
| Paintwork Labour | 0.00 | 0.00 | 0.00 | |
| Towing | 0.00 | 0.00 | 0.00 | |
| Calculated Gross Total (S\$) | 115,195.72 | 84,177.16 | 31,018.56 | 26.93 |
| Approved Total (Overridden) (S\$) | | 69,684.60 | | |
| - Excess (S\$) | 600.00 | 600.00 | 0.00 | 0.00 |
| (S\$) | 114,595.72 | 69,084.60 | 45,511.12 | 39.71 |
| + GST 7.00/7.00% (S\$) | 8,021.70 | 4,835.92 | 3,185.78 | 39.71 |
| Nett Amount (S\$) | 122,617.42 | 73,920.52 | 48,696.90 | 39.71 |

INSPECTION

Date of Assignment: 11/06/2018
Date Inspected: 11/06/2018 Inspected At: Premium Automobiles Pte Ltd (UBI)
55 Ubi Road 1
Singapore 408699
Estimated Period of Repair: 35.0 days

Adjuster: ADRIAN LING

Manager: Hiew May Fung

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

| No. | Qty | Part No. | Particulars | Condition | Repairer's | Amount |
|-----|-----|----------|--|---------------|-------------|--------------|
| 1 | 1 | | *FRONT BUMPER | Distorted | 1,739.00 FS | *1,391.20 FS |
| 2 | 1 | | *FRONT BUMPER GUIDE SECTION - LH / RH | O/S Damaged | 66.00 FS | *25.84 FS |
| 3 | 1 | | *FRONT BUMPER GRILLE - CENTRE | Distorted | 140.00 FS | *112.00 FS |
| 4 | 1 | | *FRONT BUMPER CLOSING ELEMENT - LOWER CENTRE | Distorted | 460.00 FS | *368.00 FS |
| 5 | 1 | | *FRONT BUMPER CLOSING ELEMENT - RH | Not Necessary | 254.00 FS | *- FS |
| 6 | 2 | | *FRONT BUMPER COVER TRIM - RH / LH | Distorted | 280.00 FS | *223.20 FS |
| 7 | 2 | | *ADAPTER FRONT WHEEL HOUSING LINER - LH / RH | Not Necessary | 64.00 FS | *- FS |
| 8 | 1 | | *RADIATOR GRILLE | Cracked | 1,239.00 FS | *991.20 FS |
| 9 | 1 | | *SIGN CAUTION | Not Necessary | 12.00 FS | *- FS |
| 10 | 1 | | *FRONT FENDER - RH | Buckled | 746.00 FS | *596.80 FS |
| 11 | 1 | | *FRONT FENDER BRACKET - RH | Not Necessary | 24.00 FS | *- FS |
| 12 | 1 | | *FRONT FENDER CENTRE BRACKET - RH | Not Necessary | 34.00 FS | *- FS |
| 13 | 1 | | *FRONT FENDER BRACE - RH | Not Necessary | 84.00 FS | *- FS |
| 14 | 1 | | *FENDER ATTACHMENT PARTS | Not Necessary | 62.00 FS | *- FS |
| 15 | 1 | | *FRONT WHEEL HOUSING LINER - RH | Torn | 151.00 FS | *120.80 FS |
| 16 | 1 | | *WHEEL HOUSING LINER ATTACHMENT PARTS | Not Necessary | 77.00 FS | *- FS |
| 17 | 1 | | *FRONT FENDER CLOSING ELEMENT - RH | Not Necessary | 29.00 FS | *- FS |
| 18 | 1 | | *FRONT FENDER INSULATION - RH | Damaged | 36.00 FS | *28.32 FS |
| 19 | 1 | | *FRONT DOOR - RH | Repair | 2,190.00 FS | *- FS |
| 20 | 1 | | *FRONT OUTER DOOR SEAL - RH | Not Necessary | 139.00 FS | *- FS |
| 21 | 1 | | *BONDING AGENT | Not Necessary | 43.00 FS | *- FS |
| 22 | 1 | | *CLEANING SOLUTION | Not Necessary | 64.00 FS | *- FS |
| 23 | 1 | | *FRONT DOOR ATTACHMENT PARTS | Not Necessary | 206.00 FS | *- FS |
| 24 | 1 | | *FRONT DOOR CATCH | Not Necessary | 92.00 FS | *- FS |
| 25 | 1 | | *DATA PLATE FOR TYRE PRESSURE | Not Necessary | 25.00 FS | *- FS |
| 26 | 1 | | *SECTIONAL PART - SIDE MEMBER TRIM - RH | Repair | 2,038.00 FS | *- FS |
| 27 | 1 | | *DATA TAG | Not Necessary | 406.00 FS | *- FS |
| 28 | 2 | | *AIR GUIDE - LH / RH | Damaged | 40.00 FS | *31.84 FS |
| 29 | 1 | | *A/C CONDENSOR | Dented | 500.00 FS | *399.60 FS |
| 30 | 1 | | *REFRIGERANT LINE (A/C CONDENSOR CUT-OFF POINT) | Bent | 582.00 FS | *465.60 FS |
| 31 | 1 | | *REFRIGERANT LINE (A/C COMPRESSOR>A/C CONDENSER) | Not Necessary | 447.00 FS | *- FS |
| 32 | 1 | | *ADDITIONAL RADIATOR | Distorted | 799.00 FS | *639.20 FS |
| 33 | 2 | | *ADDITIONAL RADIATOR BRACKET | Not Necessary | 75.00 FS | *- FS |
| 34 | 2 | | *BUSH-LOWER | Not Necessary | 17.00 FS | *- FS |
| 35 | 1 | | *RADIATOR | Distorted | 828.00 FS | *662.40 FS |
| 36 | 2 | | *COOLANT CONCENTRATE | Necessary | 146.88 FS | *146.88 FS |
| 37 | 1 | | *RADIATOR FAN WITH FAN RING | Cracked | 1,425.00 FS | *1,140.00 FS |
| 38 | 1 | | *NOISE INSULATION | Torn | 226.00 FS | *180.80 FS |
| 39 | 1 | | *UNDERBODY CLADDING NOISE UNSULATION (NPA) | Torn | 0.00 FS | *- FS |
| 40 | 1 | | *CENTER UNDERBODY COVER | Not Necessary | 11.00 FS | *- FS |
| 41 | 1 | | *UNDERBODY TRIM - RH | Torn | 152.00 FS | *121.60 FS |
| 42 | 1 | | *ASSEMBLY CARRIER | Bent | 890.00 FS | *711.60 FS |
| 43 | 1 | | *BONDED RUBBER BUSHES | Damaged | 90.00 FS | *71.36 FS |
| 44 | 1 | | *PENDULUM SUPPORT | Damaged | 81.00 FS | *64.48 FS |

Report was unsubmitted during this print-out.

| No. | Qty | Part No. | Particulars | Condition | Repairer's | Amount |
|-----|-----|----------|----------------------------------|--------------------------|--------------|---------------|
| 45 | 1 | | *GEAR BOX MOUNTING | Torn | 234.00 FS | *186.80 FS |
| 46 | 1 | | *ENGINE MOUNTING | Torn | 212.00 FS | *169.20 FS |
| 47 | 1 | | *ENGINE SUPPORT | Bent | 198.00 FS | *158.00 FS |
| 48 | 1 | | *TRACK CONTROL ARM - LH / RH | O/S Bent | 640.00 FS | *256.00 FS |
| 49 | 1 | | *STABILIZER | Bent | 354.00 FS | *282.80 FS |
| 50 | 2 | | *WHEEL BEARING HOUSING - LH / RH | Damaged | 1,014.00 FS | *811.20 FS |
| 51 | 2 | | *WHEEL BEARING WITH ASSEMBLY | Damaged | 758.00 FS | *606.40 FS |
| 52 | 2 | | *GUIDE JOINT - LH / RH | Bent | 222.00 FS | *177.60 FS |
| 53 | 1 | | *COUPLING ROD | Bent | 170.00 FS | *135.68 FS |
| 54 | 2 | | *DEEP GROOVE BALL THRUST BEARING | Damaged | 81.00 FS | *64.16 FS |
| 55 | 1 | | *DRIVE SHAFT - LH / RH | O/S Bent | 4,262.00 FS | *1,710.40 FS |
| 56 | 1 | | *STEERING GEAR | Cracked | 4,290.00 FS | *3,432.00 FS |
| 57 | 1 | | *REPAIR SET FOR STEERING BOX | Necessary | 41.00 FS | *32.24 FS |
| 58 | 2 | | *TRACK ROD | Bent | 164.00 FS | *130.56 FS |
| 59 | 1 | | *TIE ROD END - LH / RH | O/S Bent | 226.00 FS | *90.00 FS |
| 60 | 2 | | *PROTEVTIVE SLEEVE | Not Necessary | 34.00 FS | *- FS |
| 61 | 2 | | *ALUMINIUM RIM | Cut | 1,318.00 FS | *1,054.40 FS |
| 62 | 10 | | *RUBBER VALVE | Not Necessary | 28.00 FS | *- FS |
| 63 | 1 | | *REAR AXLE BEAM | Bent | 1,843.00 FS | *1,484.80 FS |
| 64 | 1 | | *REAR AXLE BEARING BRACKET - RH | Not Necessary | 180.00 FS | *- FS |
| 65 | 1 | | *STUB AXLE | Not Necessary | 250.00 FS | *- FS |
| 66 | 1 | | *WHEEL BEARING WITH ASSEMBLY | Damaged | 387.00 FS | *309.60 FS |
| 67 | 2 | | *GAS SHOCK ABSORBER | Not Necessary | 434.00 FS | *- FS |
| 68 | 1 | | *BASE ENGINE | Cracked | 14,602.00 FS | *11,708.00 FS |
| 69 | 1 | | *NEEDLE BEARING | Not Necessary | 23.00 FS | *- FS |
| 70 | 1 | | *ENGINE OIL | Necessary | 290.00 FS | *232.00 FS |
| 71 | 1 | | *V-BELT | Cut | 42.00 FS | *33.28 FS |
| 72 | 1 | | *A/C COMPRESSOR | Cracked | 2,110.00 FS | *1,688.00 FS |
| 73 | 1 | | *EXHAUST PIPE | Not Necessary | 3,416.00 FS | *- FS |
| 74 | 1 | | *EXHAUST CLAMP | Not Necessary | 45.00 FS | *- FS |
| 75 | 1 | | *EXHAUST DUAL CLIP | Not Necessary | 50.00 FS | *- FS |
| 76 | 1 | | *EXHAUST BRACKET | Not Necessary | 47.00 FS | *- FS |
| 77 | 1 | | *RETAINER EXHAUST PIPE | Not Necessary | 52.00 FS | *- FS |
| 78 | 1 | | *FORNT SILENCER | Not Necessary | 442.00 FS | *- FS |
| 79 | 1 | | *PIPE CONNECTOR | Not Necessary | 50.00 FS | *- FS |
| 80 | 1 | | *DUAL CLAMP EXHAUST | Not Necessary | 53.00 FS | *- FS |
| 81 | 1 | | *REAR SILENCER | Not Necessary | 643.00 FS | *- FS |
| 82 | 1 | | *HOSE | Cut | 57.00 FS | *45.28 FS |
| 83 | 1 | | *FRONT NO. PLATE | Necessary | 25.00 FS | *25.00 FS |
| 84 | 1 | | *ACRYLIC SEALER | Not Necessary | 180.00 FS | *- FS |
| 85 | 1 | | *CAVITY WAX | Not Necessary | 140.00 FS | *- FS |
| 86 | 1 | | *STONE CHIP | Not Necessary | 180.00 FS | *- FS |
| 87 | 1 | | *METAL FILLER POWDER | Not Necessary | 280.00 FS | *- FS |
| 88 | 1 | | *SUNDRIES | Necessary | 2,000.00 FS | *611.20 FS |
| 89 | 2 | | *GAS SHOCK ABSORBER | Bent | 485.00 FS | *388.00 FS |
| 90 | 1 | | *LOCK CARRIER WITH MOUNTING | Cracked | 638.00 FS | *510.00 FS |
| 91 | 2 | | *FRONT BUMPER GRILLE - LH / RH | Damaged | 262.40 FS | *262.40 FS |
| 92 | 2 | | *TYRE - RH FRONT / REAR | Rear Punctured/Front Cut | 590.00 FS | *590.00 FS |
| 93 | 1 | | *7 SPEED GEARBOX | Damaged | 12,308.00 FS | *12,308.00 FS |
| 94 | 1 | | *TRANSMISSION FLUID | Necessary | 96.00 FS | *96.00 FS |
| 95 | 1 | | *GEARBOX OIL SEAL | Not Necessary | 64.00 FS | *- FS |
| 96 | 1 | | *SET TIMING BELT KIT | Necessary | 79.28 FS | *79.28 FS |

Report was unsubmitted during this print-out.

| No. | Qty | Part No. | Particulars | Condition | Repairer's | Amount | |
|-----|-----|----------|-------------------------------------|-----------|--------------------------|------------------|------------------|
| 97 | 1 | | *ENGINE OIL SEALS AND GASKET | Necessary | 93.36 FS | *93.36 FS | |
| 98 | 1 | | *SET ENGINE VALVE COVER REPAIR | Necessary | 155.76 FS | *155.76 FS | |
| 99 | 1 | | *UNDERCARRIAGE PAN ATTACHMENT PARTS | Necessary | 76.16 FS | *76.16 FS | |
| 100 | 1 | | *RADIATOR TOP HOSE | Damaged | 20.32 FS | *20.32 FS | |
| 101 | 1 | | *ABSORBER MOUNTING - RHS | Damaged | 144.80 FS | *144.80 FS | |
| 102 | 1 | | *DIPSTICK | Damaged | 22.16 FS | *22.16 FS | |
| 103 | 1 | | *RADIATOR LOWER HOSE | Cut | 96.40 FS | *96.40 FS | |
| 104 | 1 | | *CAMSHAFT TIMING ADJUSTER | Damaged | 1,515.20 FS | *1,515.20 FS | |
| 105 | 1 | | *A/C HOSE | Bent | 360.00 FS | *360.00 FS | |
| 106 | 1 | | *HEADLIGHT - RHS | Cracked | 3,910.40 FS | *3,910.40 FS | |
| 107 | 1 | | *CAMSHAFT ADJUSTER ATTACHMENT PARTS | Damaged | 60.88 FS | *60.88 FS | |
| 108 | 1 | | *TIMING BELT ROLLER | Damaged | 64.00 FS | *64.00 FS | |
| 109 | 1 | | *TIMING BELT ADJUSTER | Damaged | 99.20 FS | *99.20 FS | |
| 110 | 1 | | *TIMING BELT | Damaged | 144.80 FS | *144.80 FS | |
| 111 | 1 | | *WATER PUMP BELT | Damaged | 27.20 FS | *27.20 FS | |
| 112 | 1 | | *TIMING BELT BEARING | Damaged | 18.16 FS | *18.16 FS | |
| 113 | 1 | | *RADIATOR TOP BRACKET | Necessary | 59.36 FS | *59.36 FS | |
| | | | | | Total Parts (S\$) | 80,467.72 | 55,029.16 |

F=Franchise part. S=SpcNett.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

| No | Particulars | Lab.Type | Repairer's | Amount |
|--------------------------------|--|----------|------------------|------------------|
| Labour Items | | | | |
| 1 | TO REMOVE AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS, FOG LAMPS, OUTSIDE TEMPERATURE SENSOR AND HEADLIGHT WASHER ASSY | New | 360.00 | 360.00 |
| 2 | TO REMOVE AND TRANSFER AIRCON CONDENSER, RADIATOR, ADDITIONAL COOLER, ELECTRICAL FANS AND CONTROL UNIT. TO CARRY OUT VACUUM / REGAS AND TO PRESSURISE COOLING SYSTEM | New | 1,000.00 | 1,000.00 |
| 3 | TO REMOVE AND TRANSFER RHS FRONT DOORS MULTI-LOCK SYSTEM AND POWER WINDOW DEVICES | New | 280.00 | 0.00 |
| 4 | TO REMOVE AND REINSTALL RHS FRONT SEAT ASSY, ABCD PILLAR TRIMS, SILL TRIMS, FLOOR CARPETS, ELECTRONIC COMPONENTS AND FUSE TRAYS. DISENGAGE RHS SEAT BELT AND HEAD AIRBAG | New | 1,800.00 | 0.00 |
| 5 | TO DISMANTLE FRONT BUMPER, RHS FRONT FENDER AND RHS FRONT DOOR. CUT OUT AND WELD RHS SILL PANEL. RENEW FRONT LOCK CARRIER AND ALIGN TO POSITION. RENEW FRONT BUMPER, RHS FRONT FENDER AND RHS FRONT DOOR. RE-ORGANISE FRONT CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED | New | 7,200.00 | 4,000.00 |
| 6 | TO DISMANTLE AND RENEW FRONT SUSPENSION ASSY | New | 2,800.00 | 2,800.00 |
| 7 | TO RENEW ENGINE ASSY, TRANSFER GEARBOX AND ATTACHED COMPONENTS | New | 3,600.00 | 3,600.00 |
| 8 | TO RENEW FULL EXHAUST SYSTEM | New | 600.00 | 600.00 |
| 9 | TO DISMANTLE AND RENEW REAR SUSPENSION ASSY | New | 2,800.00 | 2,800.00 |
| 10 | TO RESPRAY FRONT BUMPER, RHS FRONT FENDER, RHS FRONT DOOR, RHS SILL PANEL, A-PILLAR AND DOOR ENTRANCE. TO CARRY OUT JOINT SEALER WORKS AND STONE CHIP TREATMENT | New | 3,600.00 | 3,300.00 |
| 11 | TO RENEW RHS FRONT AND REAR RIMS WITH TYRES. CARRY OUT WHEEL ALIGNMENT | New | 320.00 | 320.00 |
| 12 | TO CARRY OUT DIAGNOSTIC CHECK | New | 768.00 | 768.00 |
| 13 | TO PLACE VEHICLE ON CAR-O-LINER AND CARRY OUT FIRST MEASUREMENT | New | 800.00 | 800.00 |
| 14 | TO SET UP VEHICLE ON CAR-O-LINER REPAIR BENCH | New | 2,400.00 | 2,400.00 |
| 15 | TO REPAIR & ALIGN BOTH FRONT CHASSIS FRAME TO SPECIFICATION OF ORIGIN | New | 3,000.00 | 3,000.00 |
| 16 | TO RENEW GEARBOX ASSY. CARRY OUT ADAPTATION | New | 2,800.00 | 2,800.00 |
| 17 | TO REMOVE AND REPLACE CAMSHAFT ADJUSTER. TO CARRY OUT IGNITION TIMING CALLIBRATION AND TO ADJUST TO SPEC | New | 600.00 | 600.00 |
| Gross Labour Cost (S\$) | | | 34,728.00 | 29,148.00 |

Report was unsubmitted during this print-out.

< END OF ESTIMATES >