


SMRT Accident Vehicle Repair Estimates

Section A - To be completed by claims Advisor/Duty officer at Accident Reporting Centre

Reg. No : SHF1039G
Ref. No : TAX/06/18/2042
Reg. Date : 23/12/2014
Vehicle Type : TAXI
Make : TOYOTA PRIUS
Model : PRIUS
Name of Driver : NG TECK LIANG DANNY
Type of Accident : HEAD TO REAR
Date / Time of Accident : 10/06/2018 04:10:00 AM
Accident Reported Date / Time : 11/06/2018 12:00:00 AM
Surveyor is Required? : Yes
Survey by :
Vehicle is Towed Back? : Yes
Towed Back Date/Time : 10/06/2018
Replacement Vehicle issued? : No
Accident Repair Job Card No : 000024096521
Special Instruction to ARC,if any :
TOWED \$60 / SHA7803D (COMFORT) - III
Prepared Date : 11/06/2018 01:02:39 PM

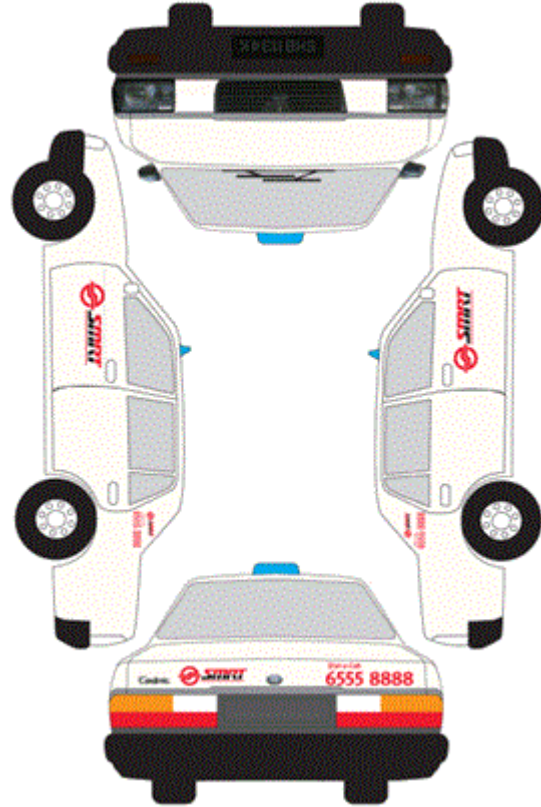

Section B - To be Completed by Service Advisor, Accident Repair Centre

Chassis No : JTDKN36U605754948

Mileage : 0

Work Shop :

Repair Completed Date / Time :

Summary of Repair Estimates

	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Charges :	1,014.00	0.00
Total Spray Painting Charges :	1,314.00	0.00
Total Material Charges :	4,143.06	4,143.06
Other Charges :	1,080.88	0.00
TOTAL :	7,551.94	0.00
Lum Sum Total :	7,550.00	0.00
No. of Repair Days :	6.00	0.00
Prepared / Adjusted By :		
Arc / Surveyor Sign Off Date :	11/06/2018 06:29:42 PM	01/01/1900 12:00:00 AM



Prepared / Adjusted Date :

Remarks :

Prepared Date : 11/06/2018 06:29:07 PM

Section C - To be Completed by Admin Assistant, Accident Repair Centre, Upon Completion of Repair

Quotation No :	Invoice No :
Quotation Date :	Invoice Date :
Invoice Amount :	Prepared Date :

Section D - Details of Repair Estimates

Part 1 - Labour Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPAIR RH REAR PORTION	1,014.00	0.00
Total Labour	1,014.00	0.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPSRAY REAR BUMPER	378.00	0.00
TO RESPRAY REAR PANEL	180.00	0.00
TO RESPRAY TAIL GATE	378.00	0.00
TO RESPRAY REAR FENDER RH	378.00	0.00
Total Spray Painting & Panel Beating	1,314.00	0.00

Part 3 - Other Costs - Accident and Accident Repair Related Expenses

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TOWING CHARGE	84.00	0.00
TO CHECK WIRING AND SYSTEM FUNCTION	80.00	0.00
TO APPLY RUST-PROOFING ON AFFECTED AREA	100.00	0.00
TO DO WHEEL ALIGNMENT / TYRE BALANCING	120.00	0.00
TO REMOVE & REFIT EXHAUST	120.00	0.00
TO PROVIDE LABOUR & MATERIAL FOR ADVERTISEMENT STICKER(NET)	296.88	0.00
TO TEST AND REFIX REVERSE SENSOR SYSTEM	120.00	0.00
TO REPLACE SUNDRY PARTS	100.00	0.00
TO WASH AND VACUUM	60.00	0.00
Total Other Costs	1,080.88	0.00

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommended	Surveyor Approved	Photos Attached
52159-47905		6505548	BUMPER REAR	1	458.60	25.00	343.95	Replace	Replace	No
52161-16010			BUMPER CLIPS	10	1.61	25.00	12.07	Replace	Replace	No
76087-47020		6505618	BUMPER LIP COVER RR/RH	1	118.10	25.00	88.57	Replace	Replace	No
76891-47020		6505619	BUMPER LIP REAR	1	228.90	25.00	171.67	Replace	Replace	No
52023-12240		6505547	BUMPER REINFORCEMENT REAR	1	205.70	25.00	154.27	Replace	Replace	No
52016-47030			ARM SUB-ASSY, RR BUMPER LH	1	139.60	25.00	104.70	Replace	Replace	No
52015-47050			ARM SUB-ASSY, RR BUMPER RH	1	139.60	25.00	104.70	Replace	Replace	No
			SENSOR REVERSE	1	180.00	0.00	180.00	Replace	Replace	No
			PIXEL STICKER	2	60.00	0.00	120.00	Replace	Replace	No
52591-47021			BUMPER SEAL, RR RH	1	65.70	25.00	49.27	Replace	Replace	No
52576-47020		6505550	BUMPER SIDE RETAINER RR/LH	1	94.80	25.00	71.10	Replace	Replace	No
52575-47020		6505549	BUMPER SIDE RETAINER RR/RH	1	94.80	25.00	71.10	Replace	Replace	No
58308-47011			UNDER COVER SUB-ASSY, RR FLOOR	1	514.50	25.00	385.87	Replace	Replace	No
67005-47241			TAILGATE ASY	1	1,007.90	25.00	755.92	Replace	Replace	No
75374-47051			NAME PLATE (HYBRID)	1	51.90	25.00	38.92	Replace	Replace	No
58307-47060		6505522	END PANEL	1	602.10	25.00	451.57	Replace	Replace	No
	COMMON	4006314	SEALANT SIKAFLEX	1	37.00	0.00	37.00	Replace	Replace	No
58327-47020			EXHAUST HEAT SHIELD, REAR	1	107.40	25.00	80.55	Replace	Replace	No
17430-37380			EXHAUST TAIL PIPE	1	656.20	25.00	492.15	Replace	Replace	No
17565-22030			SUPPORT, EXHAUST REAR	2	33.60	25.00	50.40	Replace	Replace	No
52562-47010			TAIL LAMP BRACKET, RH	1	30.70	25.00	23.02	Replace	Replace	No
81551-47180		6505462	TAIL LAMP RH	1	557.80	10.00	502.02	Replace	Replace	No
61604-47090			FENDER RR/RH	1	766.80	25.00	575.10	Replace	Replace	No
	COMMON		SMRT LOGO	1	7.80	0.00	7.80	Replace	Replace	No
			STICKER DECAL 6555 8888	1	21.60	0.00	21.60	Replace	Replace	No
65637-47021		6505480	FENDER LINER RR/RH	1	141.30	25.00	105.97	Replace	Replace	No
62940-16060			DUCT ASSY, QUARTER	1	70.40	25.00	52.80	Replace	Replace	No
		6503707	TYRE	1	126.74	0.00	126.74	Replace	Replace	No
TOTAL MATERIALS							5,178.89	5,178.83		
TOTAL MATERIALS(Discounted)							4,143.06	4,143.06		

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check	LT Check
TOTAL SUPPLEMENTARY MATERIALS									