

REF: CC3/ALH/801162/Arber

ASSIGNMENT

Front Date: \_\_\_\_\_  
 Estimated \_\_\_\_\_  
 OD / TP / WS / TP RES / OD RES / EVA / INV / MV  
 To Inspect Vehicle No \_\_\_\_\_  
 at Workshop m/s \_\_\_\_\_  
 of \_\_\_\_\_  
 Insured:  
 Policy No. 2100498699-01  
 Claims No. 909845791656  
 Sum Insured: \_\_\_\_\_ Excess: \$0.00  
 (Client's Record)  
 Make of Veh: \_\_\_\_\_  
 (Policy Condition)  
 Remark: The veh had commenced its repair at the time of inspection.  
 Bal. or Market Value: \_\_\_\_\_  
 IDAC Accident Rpt: \_\_\_\_\_ Consistent? : Yes or No  
 GIA / PR Seen \_\_\_\_\_ Consistent? : Yes or No  
 Est. Repairs: 16 days Res: Yes or No  
 Lum Sum: \_\_\_\_\_ % 3 Val: Yes or No  
 CA / REV / REP. / 24 HRS  
 Date \_\_\_\_\_ Person Contacted: \_\_\_\_\_  
 Vehicle: IN / OUT

N/S	O/S

Veh No: SLK5927T Yr Regn: 2017, Jan.  
 Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /  
 Truck / Trailer or \_\_\_\_\_  
 Make: Audi A6 CC 1758  
 Colour: Black A/C: Insured / Std / NI / NA  
 Sp. Reading: 44928 T/Radio: Insured / Std / NI / NA  
 Eng/No: \_\_\_\_\_  
 C/No: WAU222461HN047901.  
 Gen. Cond: Good / Fair / Poor / Burnt  
 Steering: In order / Jammed / Leaked / Burnt or  
 Brake: In order / Jammed / Leaked / Burnt or  
 Mod: Nil / S/Rim / STD A/Rim or  
 Tyre Size: F: 255/35R20  
 R: 255/35R20.  
 BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU (PIR) / SUMI /  
 TOYO / YOKO or \_\_\_\_\_  
 Front Rear  
 R/Bal: 06 mm R/Bal: 06 mm  
 L/Bal: 06 mm L/Bal: 06 mm  
 D.O.A. \_\_\_\_\_ D.O.I. 19/06/18  
 Survey held at Premium  
 Des. of Damages: Frnt / Rear / O/S / N/S / UIC / Rooftop or  
 The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
	OD ALG. 20/6/18 Report from merimen
	20/6/18 Mimi inform can authorize to proceed for repair
	25/6/18 mandate supplementary for
	4/7/18 Supplementary approved
	7/11/18 confirm with Mr Boo \$52,461.20 @ 16 days
	Red: \$36,128.90, 41%.
	RECEIVED 12 NOV 2018

Date/Time, File Pass 107  : Prel. Report  
 11 typist  : Final Report  
 Date/Time, File Return 507  
 Days Of Repair: 16  
 Resurvey No. of Trip: 1  
 Add Fee:  Site Insp (\$)  
 Interview (\$)  
 Tech. Insp (\$)  
 Workshop (\$)  
 Report Format: Op  
 Lump Sum / I.B.L. (\$): 52,461.20  
 Survey Fee: 200  
 Transportation: 0 + 100 = 100  
 Phone: 10  
 Other: 210

Note: This document has not been finalised.

**LKK Auto Consultants Pte Ltd** (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park  
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

To: AIG Asia Pacific Insurance Pte. Ltd.  
AIG Building  
78 Shenton Way #07-16  
Singapore 079120

From: LKK Auto Consultants Pte Ltd  
51 Ubi Ave 1 #01-25  
Paya Ubi Industrial Park  
Singapore 408933

Attn: Dally Amri, Mimi Zarina

Date: 20 Jun 2018

**Preliminary Advice**

Vehicle No	: SLK5927T	Accident Date	: 13/06/2018
Make	: AUDI A6	Policy No.	: 2100498699-01
Assignment Date	: 20/06/2018	Excess	: S\$0.00
Date of Inspection	: 19/06/2018	Est. Duration of Repair	: 16.00
Inspection At	: PREMIUM AUTOMOBILES PTE LTD (UBI) 55 UBI ROAD 1 SINGAPORE 408699		

**Point of Impact / General Description of Damages**

The vehicle sustained impact / damages front and rear portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	78,316.00
Revised Amount	:S\$	48,684.00
Check Items (Estimated)	:S\$	7,824.00
Total	:S\$	56,508.00

Lump Sum Repair :S\$

**Total Loss Consideration**

New for Old Value	:S\$	
Pre-Accident Value	:S\$	155,000.00
COE / PARF Rebate	:S\$	74,953.00
Salvage Value	:S\$	
Margin for Repair	:S\$	80,047.00

**Remarks**

- ( X ) The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.
- ( ) The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.
- ( ) Other comments :

**Janice Lee (LKKAuto)**

---

**From:** Dally Amri, Mimi Zarina <MimiZarina.DallyAmri@aig.com>  
**Sent:** Wednesday, June 20, 2018 1:06 PM  
**To:** Janice Lee (LKKAuto)  
**Subject:** RE: #9098457916SG001#027#OD claim\_SLK5927T DOA; 13/06/2018

Dear Janice

Can proceed with repair.

Thank you.

Regards,

Mimi Zarina @ Mimi  
AIG

---

**From:** Janice Lee (LKKAuto) [mailto:JaniceLee@lkkauto.com]  
**Sent:** Wednesday, June 20, 2018 12:01 PM  
**To:** Dally Amri, Mimi Zarina  
**Subject:** RE: #9098457916SG001#027#OD claim\_SLK5927T DOA; 13/06/2018

Dear Mimi,

Preliminary has submitted in Merimen. Refer to the email below, does it means this vehicle can proceed for repair or just for the activation?

Thank you.

Best Regards,

**Jannice Lee (Ms)** | Case Handler

**LKK Auto Consultants Pte Ltd**

Phone: 6256-3561 | email: [janicelee@lkkauto.com](mailto:janicelee@lkkauto.com) | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

---

**From:** Dally Amri, Mimi Zarina [mailto:MimiZarina.DallyAmri@aig.com]  
**Sent:** Wednesday, June 20, 2018 11:56 AM  
**To:** Claims <[claims@premiumauto.com.sg](mailto:claims@premiumauto.com.sg)>  
**Cc:** SUR <[sur@lkkauto.com](mailto:sur@lkkauto.com)>  
**Subject:** RE: #9098457916SG001#027#OD claim\_SLK5927T DOA; 13/06/2018

Dear Tony

OD claim approved please activate the replacement car.

Thank you.

Regards,

Mimi Zarina @ Mimi  
AIG

---

**From:** Claims [<mailto:claims@premiumauto.com.sg>]  
**Sent:** Wednesday, June 20, 2018 11:54 AM  
**To:** Dally Amri, Mimi Zarina  
**Cc:** 'SUR'; [claims@premiumauto.com.sg](mailto:claims@premiumauto.com.sg)  
**Subject:** RE: #9098457916SG001#027#OD claim\_SLK5927T DOA; 13/06/2018

Dear Mimi,

Update me on repair approval, so that we can assist owner to activate the replacement car.

Thank you.

Best Regards,  
**Tony Foong**  
Claims Advisor

**Premium Automobiles Pte Ltd** (Reg No 199902271W)  
55 Ubi Road 1 Road Singapore 408699  
p. +65 6388 2323 d. +65 6768 9828 f. +65 6841 1183  
e. [claims@premiumauto.com.sg](mailto:claims@premiumauto.com.sg) w. [www.audi.com.sg](http://www.audi.com.sg)  
**Audi Showroom, Audi Centre** 281 Alexandra Road Singapore 159938 p. +65 6836 2223



[http://www.audi.com.sg/sea/brand/sg/audi\\_promotions/promotions/car\\_promotions/new-audi-q2-2017.html](http://www.audi.com.sg/sea/brand/sg/audi_promotions/promotions/car_promotions/new-audi-q2-2017.html)

**Email Disclaimer**

This email, including any attachment, is confidential and may also be privileged.  
If you have received it in error, please notify us immediately by reply email and then delete this message from your system.  
Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you

---

**From:** Dally Amri, Mimi Zarina [<mailto:MimiZarina.DallyAmri@aig.com>]  
**Sent:** Wednesday, 20 June, 2018 10:56 AM  
**To:** Claims <[claims@premiumauto.com.sg](mailto:claims@premiumauto.com.sg)>  
**Cc:** 'SUR' <[sur@lkkauto.com](mailto:sur@lkkauto.com)>  
**Subject:** RE: #9098457916SG001#027#OD claim\_SLK5927T DOA; 13/06/2018

Dear LKK

Confirm coverage done.

Please assist insured on replacement car as soon as possible.

Thank you.

Regards,

Mimi Zarina @ Mimi  
AIG

---

**From:** Claims [<mailto:claims@premiumauto.com.sg>]  
**Sent:** Wednesday, June 20, 2018 10:44 AM  
**To:** Dally Amri, Mimi Zarina  
**Cc:** [claims@premiumauto.com.sg](mailto:claims@premiumauto.com.sg); 'SUR'  
**Subject:** RE: #9098457916SG001#027#OD claim\_SLK5927T DOA; 13/06/2018

Dear Dally,

Thanks for informing us. Kindly check with LKK for the for report.

Aside to LKK,

Kindly assist expedite to submit the report to AIG.

Best Regards,  
**Tony Foong**  
Claims Advisor

**Premium Automobiles Pte Ltd** (Reg No 199902271W)  
55 Ubi Road 1 Road Singapore 408699  
p. +65 6388 2323 d. +65 6768 9828 f. +65 6841 1183  
e. [claims@premiumauto.com.sg](mailto:claims@premiumauto.com.sg) w. [www.audi.com.sg](http://www.audi.com.sg)  
Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223



[http://www.audi.com.sg/sea/brand/sg/audi\\_promotions/promotions/car\\_promotions/new-audi-q2-2017.html](http://www.audi.com.sg/sea/brand/sg/audi_promotions/promotions/car_promotions/new-audi-q2-2017.html)

**Email Disclaimer**

This email, including any attachment, is confidential and may also be privileged.  
If you have received it in error, please notify us immediately by reply email and then delete this message from your system.  
Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you

**From:** Dally Amri, Mimi Zarina [<mailto:MimiZarina.DallyAmri@aig.com>]  
**Sent:** Wednesday, 20 June, 2018 10:30 AM  
**To:** [claims@premiumauto.com.sg](mailto:claims@premiumauto.com.sg)  
**Subject:** #9098457916SG001#027#OD claim\_SLK5927T DOA; 13/06/2018

Dear Sir

Spoken to insured, he requested for courtesy car however when we checked in merimen claim have yet open as OD claim. Due to that AIG unable to confirm coverage.

Informed by insured that Audi mentioned AIG has yet assign surveyor to inspect the car and claim that Audi already submitted the claim to AIG.

Please expedite this case and revert.

Thank you.

Regards,

**Mimi Zarina @ Mimi**  
**AIG**  
Express Claims Adjuster  
Claims Operations | AIG Shared Services

**IMPORTANT NOTICE:**

The information in this email (and any attachments hereto) is confidential and may be protected by legal privileges and work product immunities. If you are not the intended recipient, you must not use or disseminate the information. Receipt by anyone other than the intended recipient is not a waiver of any attorney-client or work product privilege. If you have received this email in error, please immediately notify me by "Reply" command and permanently delete the original and any copies or printouts thereof. Although this email and any attachments are believed to be free of any virus or other defect that might affect any computer system into which it is received and opened, it is the responsibility of the recipient to ensure that it is virus free and no responsibility is accepted by American International Group, Inc. or its subsidiaries or affiliates either jointly or severally, for any loss or damage arising in any way from its use.

[MimiZarina.DallyAmri@aig.com](mailto:MimiZarina.DallyAmri@aig.com) | [www.AIG.com](http://www.AIG.com)

**IMPORTANT NOTICE:**

The information in this email (and any attachments) is confidential. If you are not the intended recipient, you must not use or disseminate the information. If you have received this email in error, please immediately notify me by "Reply" command and permanently delete the original and any copies or printouts thereof. Although this email and any attachments are believed to be free of any virus or other defect that might affect any computer system into which it is received and opened, it is the responsibility of the recipient to ensure that it is virus free and no responsibility is accepted by American International Group, Inc. or its subsidiaries or affiliates either jointly or severally, for any loss or damage arising in any way from its use.

**IMPORTANT NOTICE:**

The information in this email (and any attachments) is confidential. If you are not the intended recipient, you must not use or disseminate the information. If you have received this email in error, please immediately notify me by "Reply" command and permanently delete the original and any copies or printouts thereof. Although this email and any attachments are believed to be free of any virus or other defect that might affect any computer system into which it is received and opened, it is the responsibility of the recipient to ensure that it is virus free

and no responsibility is accepted by American International Group, Inc. or its subsidiaries or affiliates either jointly or severally, for any loss or damage arising in any way from its use.

**IMPORTANT NOTICE:**

The information in this email (and any attachments) is confidential. If you are not the intended recipient, you must not use or disseminate the information. If you have received this email in error, please immediately notify me by "Reply" command and permanently delete the original and any copies or printouts thereof. Although this email and any attachments are believed to be free of any virus or other defect that might affect any computer system into which it is received and opened, it is the responsibility of the recipient to ensure that it is virus free and no responsibility is accepted by American International Group, Inc. or its subsidiaries or affiliates either jointly or severally, for any loss or damage arising in any way from its use.

**IMPORTANT NOTICE:**

The information in this email (and any attachments) is confidential. If you are not the intended recipient, you must not use or disseminate the information. If you have received this email in error, please immediately notify me by "Reply" command and permanently delete the original and any copies or printouts thereof. Although this email and any attachments are believed to be free of any virus or other defect that might affect any computer system into which it is received and opened, it is the responsibility of the recipient to ensure that it is virus free and no responsibility is accepted by American International Group, Inc. or its subsidiaries or affiliates either jointly or severally, for any loss or damage arising in any way from its use.

## Janice Lee (LKKAuto)

---

**From:** Janice Lee (LKKAuto)  
**Sent:** Wednesday, June 20, 2018 2:06 PM  
**To:** 'Claims Dept'  
**Cc:** SUR  
**Subject:** RE: SLK 5927 T Own Damage Claims (Vehicle IN)

Dear Sir,

As instructed by our client, please proceed to repair the insured vehicle **SLK 5927T (excess \$0.00/-)**.

If there are any check items or supplementary items please inform our office's Assignment Team at Tel: 6741 8434 to arrange our surveyor for inspection.

All supplementary items and unconfirm items are subjected to further approval from insurance company before completion of the repair.

\*Our client reserve their right **not to pay** if there is no valid approval obtained before repair.

Thank you.

Best Regards,

**Jannice Lee (Ms)** | Case Handler

**LKK Auto Consultants Pte Ltd**

Phone: 6256-3561 | email: [janicelee@lkkauto.com](mailto:janicelee@lkkauto.com) | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

---

**From:** Claims Dept [mailto:[claims@premiumauto.com.sg](mailto:claims@premiumauto.com.sg)]

**Sent:** Tuesday, June 19, 2018 3:52 PM

**To:** SUR <[sur@lkkauto.com](mailto:sur@lkkauto.com)>

**Cc:** 'Claims Dept' <[claims@premiumauto.com.sg](mailto:claims@premiumauto.com.sg)>

**Subject:** SLK 5927 T Own Damage Claims (Vehicle IN)

Dear all,

Kindly assist in the Own Damage Claim approval for the above mentioned vehicle.

Survey was carried out earlier this afternoon.

Many thanks!

Best regards,  
**Jeffery Tan**

**Premium Automobiles Pte Ltd** (Reg No 199902271W)  
55 Ubi Road 1 Road Singapore 408699  
p. +65 6388 2323 d. +65 6768 9911 f. +65 6841 1183  
e. [claims@premiumauto.com.sg](mailto:claims@premiumauto.com.sg) w. [www.audi.com.sg](http://www.audi.com.sg)

# LKK Auto Consultants Pte Ltd (Co.Reg.No:199607196R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park  
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To: AIG Asia Pacific Insurance Pte. Ltd.  
AIG Building  
78 Shenton Way #07-16  
Singapore 079120

From: LKK Auto Consultants Pte Ltd  
51 Ubi Ave 1 #01-25  
Paya Ubi Industrial Park  
Singapore 408933

Attn: Dally Amri, Mimi Zarina

Date: 25 Jun 2018

## Preliminary Advice

Vehicle No	: SLK5927T	Accident Date	: 13/06/2018
Make	: AUDI A6	Policy No.	: 2100498699-01
Assignment Date	: 20/06/2018	Excess	: S\$0.00
Date of Inspection	: 19/06/2018	Est. Duration of Repair	: 16.00
Inspection At	: PREMIUM AUTOMOBILES PTE LTD (UBI) 55 UBI ROAD 1 SINGAPORE 408699		

### Point of Impact / General Description of Damages

The vehicle sustained impact / damages front and rear portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	85,432.00	(Include Supplementary \$7,116.00)
Revised Amount	:S\$	55,800.00	(Include Supplementary \$7,116.00)
Check Items (Estimated)	:S\$	7,824.00	
Total	:S\$	63,624.00	
Lump Sum Repair	:S\$		

### **Total Loss Consideration**

New for Old Value	:S\$	
Pre-Accident Value	:S\$	155,000.00
COE / PARF Rebate	:S\$	74,953.00
Salvage Value	:S\$	
Margin for Repair	:S\$	80,047.00

### Remarks

- ( X ) The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage.
- ( ) The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.
- ( ) Other comments : Please note that the repair cost include supplementary \$7,116.00.

# LKK Auto Consultants Pte Ltd (Co.Reg.No:189607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park  
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To: AIG Asia Pacific Insurance Pte. Ltd.  
AIG Building  
78 Shenton Way #07-16  
Singapore 079120

From: LKK Auto Consultants Pte Ltd  
51 Ubi Ave 1 #01-25  
Paya Ubi Industrial Park  
Singapore 408933

Attn: Dally Amri, Mimi Zarina

Date: 02 Jul 2018

## Preliminary Advice

Vehicle No	: SLK5927T	Accident Date	: 13/06/2018
Make	: AUDI A6	Policy No.	: 2100498699-01
Assignment Date	: 20/06/2018	Excess	: S\$0.00
Date of Inspection	: 19/06/2018	Est. Duration of Repair	: 16.00
Inspection At	: PREMIUM AUTOMOBILES PTE LTD (UBI) 55 UBI ROAD 1 SINGAPORE 408699		

### Point of Impact / General Description of Damages

The vehicle sustained impact / damages front and rear portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	88,590.00	(Include supplementary \$3,158.00)
Revised Amount	:S\$	58,358.00	(Include supplementary \$3,158.00)
Check Items (Estimated)	:S\$	7,824.00	
Total	:S\$	66,182.00	
Lump Sum Repair	:S\$		

### **Total Loss Consideration**

New for Old Value	:S\$	
Pre-Accident Value	:S\$	155,000.00
COE / PARF Rebate	:S\$	74,953.00
Salvage Value	:S\$	
Margin for Repair	:S\$	80,047.00

### Remarks

- ( X ) The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage.
- ( ) The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.
- ( X ) Other comments : Please note that the repair cost include supplementary \$3,158.00

## Print Received Message

This mail is associated with :

**\*SLK5927T (9098457916SG)**

OD

Jun 13 2018 9:45AM

[LEE SAN SAN SUSANNA]  
Premium Automobiles Pte Ltd

**From** AIG Asia Pacific Insurance Pte. Ltd. (AIG\_SG), sent on 04/07/2018 20:06 PM.  
**To** LKK\_HQ  
**Subject** Alert - Adj Mandate Approved (S\$66182.00) - SLK5927T - Claim Handler: Dally Amri, Mimi Zarina

Approved:66182.00.

## SINGAPORE ACCIDENT STATEMENT

### IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

### ACCIDENT STATEMENT

Date Of Report	13/06/2018 20:21
Date Of Accident	13/06/2018 09:45
Exact Location Of Accident	ALONG PIE BEFORE KALLANG
Country/State of Loss	SINGAPORE

### DETAILS OF OWN VEHICLE

Vehicle Registration Number	SLK5927T
<b>Insured/Policyholder</b>	
Name Of Registered Owner	LEE SAN SAN SUSANNA
NRIC No	S1814979F
Email Address	NOEMAIL
Mobile Phone No	(LOCAL) +65-97765730
Alternative Phone No	OTHERS-67463592

### Vehicle Particulars

Manufacturer	AUDI
Model	A6-1.8 TFSI S-TRONIC (C7) (A)
Exact Purpose for which vehicle was being used at time of accident	PRIVATE USE
Are you claiming under your own insurance policy for repair to your vehicle?	YES
If No, Please state action to be taken	
Vehicle Category	PRIVATE CAR

### Insurance Company

Name of Insurance Company	AIG ASIA PACIFIC INSURANCE PTE. LTD.
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	2100498699-01
Cover Note Number	

### Driver

Name of Driver	LEE CHEE MING
NRIC No	S7472190G
Date Of Birth	05/04/1974
Occupation	INDOOR
Date Of Driving Pass	19/06/1995
Driving Experience	22 YEARS AND 11 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-97765730
Fax Number	
Contact Number	
Email Address	NOEMAIL

Address	APT BLK 932 TAMPINES ST 91 #06-391
Postcode	S520932
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	SPOUSE
Vehicle Registration Number of Driver's Own Vehicle	-
Insurance Company of Driver's Own Vehicle	-

#### General Information of the Accident

Type Of Accident	CHAIN COLLISION
Weather Conditions	CLEAR
Road Surface	DRY

#### Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles involved in the accident	
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

#### Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

#### Circumstances of Accident

THE ACCIDENT HAPPEN ON ALONG PIE BEFORE KALLANG TOTAL 5 CARS INVOLVE CHAIN COLLISION & MY CAR IS THE 4TH CAR

#### Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

#### DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SLF9573E
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	PRIVATE CAR
Name of Driver	
NRIC/Passport Number	
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

#### DETAILS OF OTHER VEHICLE PROPERTY 2

Vehicle Registration Number	SLN1833R
-----------------------------	----------

Vehicle Make/Model/Colour

Details Of Properties

Vehicle Category PRIVATE CAR

Name of Driver

NRIC/Passport Number

Contact Number

Address

Postcode

Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)

**DETAILS OF OTHER VEHICLE PROPERTY 3**

Vehicle Registration Number SGT8602Y

Vehicle Make/Model/Colour

Details Of Properties

Vehicle Category PRIVATE CAR

Name of Driver

NRIC/Passport Number

Contact Number

Address

Postcode

Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)

**DETAILS OF OTHER VEHICLE PROPERTY 4**

Vehicle Registration Number SLM8928K

Vehicle Make/Model/Colour

Details Of Properties

Vehicle Category PRIVATE CAR

Name of Driver

NRIC/Passport Number

Contact Number

Address

Postcode

Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)

## Sketch Plan

### SKETCH PLAN

#### IMPORTANT NOTICE

1. Please report **correctly** the details of the accident to speed up the claims process.
2. This form must be **completed by the Policyholder and/or the Authorized Driver**.
3. Information provided must be as **truthful and accurate as possible**. Any willful misrepresentation or withholding of material facts may allow insurance companies to **repudiate policy liability**.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
  - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
  - (ii) investigating the accident and/or my claims;
  - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
  - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages), and/or
  - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes").
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes;
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims;
- (e) the information so collected under (d) above may be shared / disclosed:
  - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
  - (ii) for complying with requirements under any regulations, laws or court orders.

Policyholder's Signature  
Date & Time:

Driver's Signature  
(If driver is not the policyholder)  
Date & Time:

13/6/13


Reporting Centre Personnel's Signature

Name: E. J. Fong  
NRC/IN No.: 020401473



Sketch Plan #2

SKETCH PLAN

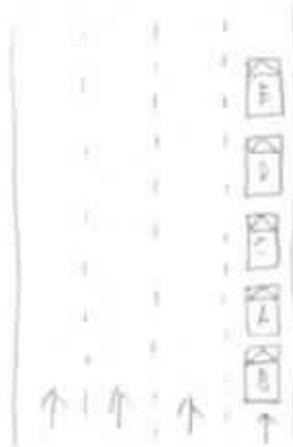

- A: SLK 5927T
- B: SLF 95 73E
- C: SIN 1833R
- D: SGT 8602Y
- E: SLM 8928K

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

The Accident Happen on Along PIE Betac Highway

Total 5 cars involve chain collision & my car

is fourth car.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature  
Date & Time:

Driver's Signature  
(if driver is not the policyholder)  
Date & Time: 13/6/2018



Reporting Centre Personnel's Signature  
Name: Tsey Fong  
NIC/ID No: 62442021K

Accident Photo



REPUBLIC OF SINGAPORE  
IDENTITY-CARD NO. S7472190G



Name  
LAU CHEE MING  
劉智銘

Race  
CHINESE

Date of Birth  
05-04-1974 Sex  
M

Country of Birth  
MALAYSIA



REPUBLIC OF SINGAPORE DRIVING LICENCE

Licence Number S7472190G

Name  
LAU CHEE MING

Birth Date 05 Apr 1974

Issue Date 05 May 2003

104455068




A8013007



NRIC No. S7472190G



Nationality  
MALAYSIAN

Street Name Tampines

APT BLK 932 TAMPINES STREET 91 #06-391  
SINGAPORE 520932

NRIC No: S7472190G Date: 27/09/2012 No: 7157811  
SINGAPORE 370054

YOU ARE LICENSED TO DRIVE VEHICLES IN THE FOLLOWING CLASSES

CLASS	DESCRIPTION	EXPIRES DATE
Class 2B	Motorcycles not exceeding 200 cc	19 Jun 1995
Class 3	Motor Cars and Motor Tractors the weight of which unladen does not exceed 2500 kilograms	19 Jun 1995

Licence No: S7472190G



NP 428A



> Back to OneMotoring

## Enquire PARF/COE Rebate for Registered Vehicle

Owner ID Type:	Singapore NRIC
Owner ID:	4979F
Vehicle No.:	SLK5927T
Vehicle to be Exported:	Yes
Intended De-registration Date:	19 Jun 2018
Vehicle Make:	AUDI
Vehicle Model:	A6 1.8 TFSI ULTRA (PI) (NAV)
Primary Colour:	Black
Manufacturing Year:	2016
Engine No.:	CYG017047
Chassis No.:	WAUZZZ4G1HN047901
Maximum Power Output:	140.0 kW (187 bhp)
Open Market Value:	\$40,436.00
Original Registration Date:	20 Jan 2017
First Registration Date:	20 Jan 2017
Transfer Count:	0
Actual ARF Paid:	\$43,611.00
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	19 Jan 2027
PARF Rebate Amount:	\$32,708.00
COE Expiry Date:	19 Jan 2027
COE Category:	B - Car above 1600cc or 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$52,807.00
COE Rebate Amount:	\$42,245.00
<b>Total Rebate Amount:</b>	<b>\$74,953.00</b>

The information contained herein is correct as at 19 Jun 2018

OK

**SELL USED CAR PARTS & ACCESSORIES online!**

**FOR SALE BY OWNER**  
**Post an Advertisement**  
 Sell it yourself! Advertise it at just **\$58 until it's SOLD!**  
 Post an Ad | Advertiser Login | Ways of Selling

**New 5 Years Coe Renewal Toyota Wish 1.8A**  
 \$2800 Downpayment Monthly From \$688 Onwards. Lowest 3.68%PA@GV Cars Financing  
 StarAd

**KA-HUP**  
**VALUE FOR MONEY**  
**VALUE FOR TIME**  
**A PEACE OF MIND**  
**HOTLINE: 6741 9997** [View Our Cars](#)

Browse by Category Save Search Print Sort by Date Posted | 20 results/page

5 vehicles | Search  [Advanced Search](#) [Search](#) [View All](#)

Search Selection: audi a6 | Any | Any | 2017 | Any | Any | Any | Available

**Audi A6 1.8A TFSI Ultra S-tronic** | \$172,000 | \$17,270 /yr | 27-Feb-2017 | 1,798 cc | 19,000 km | Luxury | Available

1 Owner. Absolutely Brilliant Condition. Accident Free And Always Parked Under Shelter. High Loan Available, 5 Years Warranty With 5 Years Free Servicing. Call Now!

Posted: 02-Jun-2018 | Tags: 2017 Audi A6, Audi A6, Audi, A6, Used Audi

**Audi A6 1.8A TFSI Ultra S-tronic S-Line** | \$162,888 | \$15,970 /yr | 19-Apr-2017 | 1,798 cc | 9,000 km | Luxury | Available

Luxurious Violet-Blue Warped With Clear Beige Leather Seats. Unique S-Line Unit. Ultra Edition With Built-In Navi Plus With Auto Park Assist. Feel The Comfort And Powerful Turbocharged Producing 187sh...

Posted: 19-Jun-2018 | Tags: 2017 Audi A6, Audi A6, Audi, A6, Used Audi

**Audi A6 Avant 1.8A TFSI S-tronic** | \$169,999 | \$16,230 /yr | 28-Apr-2017 | 1,798 cc | 5,000 km | Stationwagon | Available

Fully Serviced And Maintained By Premium Automobiles. Extended Warranty Up To 5 Years From Date Of Registration For Selected Unit. Management Unit. Please SMS Or Call Mobile For More Details And Arran...

Posted: 08-Jun-2018 | Tags: 2017 Audi A6, Audi A6, Audi, A6, Used Audi

**Audi A6 1.8A TFSI Ultra S-tronic** | \$162,999 | \$15,940 /yr | 28-Apr-2017 | 1,798 cc | 7,000 km | Luxury | Available

Management Unit. Genuine Low Mileage Of 6000km Only. Dual-Clutch Gearbox For Greater Power Responsiveness. Fully Serviced And Maintained By Premium Automobiles. 5 Years Warranty Till April 2022 From A...

Posted: 16-May-2018 | Tags: 2017 Audi A6, Audi A6, Audi, A6, Used Audi

[Car Buying](#) | [Car Selling](#) | [Car Ownership](#) | [Car Aftermarket](#) | [On The Move](#) | [Lifestyle](#)

**\$2235E** **Added Carriates For Sale!**

**Audi A6 1.8A TFSI Ultra S-tronic** | \$172,999 | \$16,900 /yr | 29-May-2017 | 1,798 cc | 9,000 km | Luxury | Available

Management Unit. Genuine Low Mileage Of 9000km Only. Dual-Clutch Gearbox For Greater Power Responsiveness. Fully Serviced And Maintained By Premium Automobiles. 5 Years Warranty Till May 2022 From Aud...

Posted: 19-Jun-2018 | Tags: 2017 Audi A6, Audi A6, Audi, A6, Used Audi

Save this search criteria. to get email alerts whenever a match is found. [Save Search](#)

For old advertisements, view [Expired ads](#)

20 results/page

# Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

## Telefax

Estimate : Accident Repairs  
Workshop : Ubi Road 1  
Contact No : 6366 2323  
Fax No : 6841 1183  
Reference : PA/OD/0691/2018/GW  
Date : 16-Jun-18

Vehicle IN workshop. Kindly arrange for survey.

## AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Owner's Name : Ms. Lee San San Susanna  
Address : Apt Blk 932 Tampines St 91  
#06-391  
Singapore 520932  
Telephone : (HP) 97765730  
Type of Claim : Own Damage Claims  
Policy No. : 2100498699-01  
Vehicle No : **SLK 5927 T**  
Model Code : Audi A6 1.8 TFSI S- Tronic  
Model / Year :  
Engine No :  
Chassis No :  
Mileage :  
Date In :  
Liability : -  
Excess Cost : -  
Estimated By : Johnny Boo / Allan Wu  
Accident Date : 13-Jun-18  
Place of Accident : Along PIE Before Kallang

# Premium Automobiles

55 Ubi Road 1, Singapore 408699  
Tel : 6366 2323 Fax : 6841 1183

## Telefax

### Estimated Labour Charges for Accident Vehicle SLK 5927 T.

S/N	Nature of Jobs	Estimated Charges
1	To remove and transfer front wire harness for headlights, horns, fog lamps, outside temperature sensor, headlight washer assy and front parking aid.	S/N \$ 480.00 ✓
2	To remove and renew aircon condensor, radiator, charged air cooler, electrical fans and control unit. To carry out vacuum/regas and to pressurise cooling system.	S/N \$ 1,100.00 ✓
3	To dismantle front bumper, both front fenders and bonnet. Renew front lock carrier and align to position. Renew front bumper, both front fenders, bonnet and headlights. Re-organise front crash management components. Reinstall all parts removed.	\$ <del>6,300.00</del> 1500.
4	✓ ✓ ✓ To respray front bumper, both fenders and bonnet.	\$ <del>3,300.00</del> 2200
<b>TOTAL LABOUR CHARGES - FRONT</b>		<b>: \$ 11,180.00</b>

# Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

## Telefax

### Material List for Accident Vehicle Regn No. SLK 5927 T.

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
1	FRONT BUMPER <i>ashed</i>	\$ 2,650.00	✓ 2120
2	FRONT BUMPER GRILLE-LOWER CENTRE <i>not new</i>	\$ 112.00	x
3	FRONT BUMPER LOCKING CLIP <i>front new</i>	14 \$ 48.00	x } x
4	FRONT BUMPER CLOSING ELEMENT	\$ 188.00	x
5	RADIATOR COVER <i>ashed</i>	\$ 32.00	✓ 24.96
6	FRONT BUMPER FIXING PARTS <i>new</i>	\$ 464.00	x
7	FOAM FILLER PIECE <i>ashed</i>	\$ 203.00	✓ 162.40
8	FRONT BUMPER SIDE REINFORCEMENT <i>Best</i>	\$ 702.00	— 561.60
9	FRONT BUMPDR HOLDER BRACKET-LH/RH <i>new</i>	2 \$ 446.00	+ "
10	FRONT BUMPER COVER <i>ashed</i>	\$ 105.00	✓ 84.00
11	SIGN " CUTION " <i>new</i>	\$ 12.00	✓ 9.28
12	FRONT SENSOR-INNER	2 \$ 392.00	x
13	FRONT SENSOR SUPPORT-LH/RH <i>front new</i>	2 \$ 118.00	x
14	FRONT BUMPER GUIDE SECTION-LH/RH <i>not new</i>	2 \$ 64.00	x } x
15	FRONT FENDER LH/RH <i>Regis</i>	2 \$ 2,440.00	x
16	FRONT FENDER ATTACHMENT PARTS <i>new new</i>	2 \$ 175.00	x
17	FRONT STONE GUARD FILM-LH/RH <i>new</i>	2 \$ 210.00	✓ 167.20
18	FRONT FENDER BRACE-LH/RH <i>front new</i>	2 \$ 144.00	x
19	FRONT WHEEL SPOILER-LH/RH	2 \$ 464.00	x } x
20	FRONT AIR GUIDE GRILLE-LH/RH <i>new new</i>	2 \$ 868.00	x
<b>SUB-TOTAL SPARE PARTS CHARGES - FRONT</b>		<b>\$ 9,837.00</b>	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

# Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

## Telefax

### Material List for Accident Vehicle Regn No. SLK 5927 T.

S/N	Parts Description	Damage Parts & Prices		REMARKS
		S/NETT		
21	FRONT AIR GUIDE GRILLE COVER-LH/RH <i>not in</i>	2	\$ 88.00	+ , X
22	LED HEADLIGHT-LH/RH <i>ct</i>	2	\$ 16,772.00	✓ 13417.60
23	HEADLIGHT MOUNTING-LH/RH <i>part 2nd condition</i>	2	\$ 206.00	✓ 82.40
24	HEADLIGHT LIFT CYLINDER-LH/RH <i>not in</i>	2	\$ 416.00	+ , X
25	BONNET <i>Buckard</i>		\$ 4,771.00	✓ 3816.80
26	BONNET ATTACHMENT PARTS <i>the new</i>		\$ 153.00	X
27	BONNET CATCH HOOK <i>2</i>		\$ 122.00	X
28	FRONT BONNET LOCK BAR <i>from</i>	2	\$ 87.00	+
29	BONNET LID LOCK	2	\$ 376.00	+
30	RADIATOR LOCK CARRIER <i>the new</i>		\$ 1,024.00	X
31	AIR GUIDE-LH/RH <i>the new</i>	2	\$ 48.00	+
32	INTERCOOLER <i>from</i>		\$ 492.00	+
33	A/C CONDENSER		\$ 683.00	+
34	RADIATOR <i>not in</i>		\$ 752.00	+
35	RADIATOR RUBBER BUSH-UPPER <i>2</i>	2	\$ 12.00	+
36	RADIATOR RUBBER BUSH-CENTER <i>from</i>	2	\$ 17.00	+
37	RADIATOR RUBBER BUSH-LOWER	2	\$ 23.00	+
38	READY-MIX COOLANT <i>the new</i>	4	\$ 82.00	✓
39	TWIN FAN RING <i>not in</i>		\$ 226.00	+
40	RADIATOR FAN	2	\$ 1,439.00	+
<b>SUB-TOTAL SPARE PARTS CHARGES - FRONT :</b>			<b>\$ 27,789.00</b>	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

# Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

## Telefax

### Material List for Accident Vehicle Regn No. SLK 5927 T.

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
41	FRONT NO.PLATE <i>best</i>	S/N \$ 25.00 ✓	<i>25.00</i>
42	RADIATOR GRILLE <i>covered</i>	S/N \$ 1,697.00 ✓	<i>1357.60</i>
<b>TOTAL SPARE PARTS CHARGES - FRONT</b>		<b>: \$ 39,348.00</b>	
<b>TOTAL LABOUR CHARGES - FRONT</b>		<b>: \$ 11,180.00</b>	
<b>GRAND TOTAL - FRONT</b>		<b>: \$ 50,528.00</b>	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

# Premium Automobiles

55 Ubi Road 1, Singapore 408699  
Tel : 6366 2323 Fax : 6841 1183

## Telefax

### Estimated Labour Charges for Accident Vehicle SLK 5927 T.

<u>S/N</u>	<u>Nature of Jobs</u>	<u>Estimated Charges</u>
1	To remove and transfer rear parking aid and rear lid kick sensor assy. Check function and renew according to damage.	S/N \$ 360.00 ✓
2	To remove and transfer rear lid's convenience lock system and wire harness for tail lights.	S/N \$ 280.00 ✓
3	To dislodge and reinstall rear wire harness for tail lights, battery manager, fuse and relay trays, electrical and audio components.	S/N \$ 480.00 ✓
4	To dismantle rear bumper and rear lid. Cut out and weld rear outer and inner rear cross panels. Re-align rear lock carrier and renew rear bumper and rear lid. Re-organise rear crash management components. Reinstall all parts removed.	\$ <del>4,200.00</del> 3000 ✓
5	To respray rear bumper, rear lid and end panelling. To carry out joint sealer works and stone chip treatment.	\$ <del>2,400.00</del> 1650 ✓
6	To carry out diagnostic check.	S/N \$ 192.00 ✓
<b>SUB-TOTAL LABOUR CHARGES - (REAR)</b>		<b>: \$ <u>7,912.00</u></b>

# Premium Automobiles

55 Ubi Road 1, Singapore 408699  
Tel : 6366 2323 Fax : 6841 1183

## Telefax

### Material List for Accident Vehicle Regn No.SLK 5927 T.

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
1	REAR BUMPER <i>Distorted</i>	S	2,519.00 ✓ 2015.20
2	REAR BUMPER FIXING PARTS <i>Not New</i>	S	234.00 ✗
3	REAR BUMPER SPOILER <i>Distorted</i>	S	416.00 ✓ 332.80
4	REAR BUMPER SECURING STRIP <i>Not New</i>	S	191.00 ✗
5	REAR SENSOR <i>2-2 Not New</i>	4 S	842.00 ✗
6	REAR BUMPER CLOSING ELEMENT-LH/RH <i>Not New</i>	2 S	138.00 ✗
7	REAR BUMPER WIRING <i>Not New</i>	S	603.00 ✗
8	REAR BUMPER CARRIER <i>Best</i>	S	851.00 ✓ 680.40
9	REAR BUMPER SEAL-LH/RH <i>new in</i>	2 S	24.00 ✓ 5
10	REAR BUMPER GUDIE SECTION-LH/RH <i>Not New</i>	2 S	56.00 ✗
11	REAR BUMPER CONNECTION PIECE <i>Not New</i>	2 S	21.00 ✗
12	REAR BUMPER UPPER GUDIE SECTION-LH/RH <i>Not New</i>	2 S	92.00 ✗
13	REAR BUMPER GUIDE PROFILE-LH/RH <i>Damaged.</i>	2 S	114.00 ✓ 45.28
14	REAR BUMPER GUIDE SECTION-CENTER <i>Cracked</i>	S	91.00 ✓ 72.32
15	REAR BUMPER HOLDING STRAP-LH/RH <i>Not New</i>	2 S	108.00 ✗
16	EXHAUST TAIL PIPE TRIM-LH/RH <i>Not New</i>	2 S	994.00 ✗
17	BOOT LID CONTROL UNIT <i>Not New</i>	S	372.00 ✗
18	TAILGATE SENSOR LINE <i>Not New</i>	S	184.00 ✗
19	CABLE TERMINAL <i>Not New</i>	13 S	84.00 ✗
21	REAR LID <i>Distorted</i>	S	2,485.00 ✓ 1988.00
<b>SUB-TOTAL SPARE PARTS - REAR</b>		:	<b>\$ 10,419.00</b>

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

# Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

## Telefax

### Material List for Accident Vehicle Regn No.SLT 5927 T.

S/N	Parts Description	Damage Parts & Prices		REMARKS	
		S/NETT			
21	REAR LID BRACKET <i>Not new</i>	S	30.00	X	
22	REAR LID HINGE-LH/RH <i>Not New</i>	2 S	400.00	X	
23	PUSH BUTTON FOR LID LOCK ACTUATOR <i>Not new</i>	S	1,181.00	X	
24	FLAP GASKET <i>Not new</i>	S	181.00	X	
25	REAR LID STOP BUFFER <i>Not new</i>	4 S	5.00	X	
26	REAR LID LOCK <i>Not new</i>	S	170.00	X	
27	REAR LID LOCK COVER <i>Not New</i>	S	7.00	X	
28	STRIKER PLATE <i>Not New</i>	S	550.00	X	
29	PACKING ADHESIVE <i>new</i>	S	15.00	✓	11.60
30	AUDI EMBLEM	S	108.00	✓	86.00
31	INSCRIPTION "A6" <i>2</i>	S	83.00	✓	66.16
32	INSCRIPTION "TFSI"	S	83.00	✓	66.16
33	REAR LID DECORATIVE FILM <i>new</i>	S	317.00	✓	253.20
34	LED TAIL LIGHT-LH/RH <i>cut</i>	2 S	2,188.00	✓	1750.40
35	TAIL LIGHT TRIM-LH/RH <i>cut</i>	2 S	52.00	✓	40.16
36	REAR CROSS PANEL <i>Distorted</i>	S	274.00	✓	219.20
37	REAR CROSS PANEL REINFORCEMENT <i>Distorted</i>	S	639.00	✓	511.20
38	REAR CROSS PANEL CONNECTING PLATE-LH/RH <i>Not new</i>	S	78.00	X	
39	REAR CROSS PANEL TRIM <i>Del</i>	S	116.00	✓	92.80
40	SPARE WHEEL WELL <i>Not new</i>	S	202.00	X	
<b>SUB-TOTAL SPARE PARTS - REAR</b>		:	<b>\$ 6,679.00</b>		

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

# Premium Automobiles

55 Ubi Road 1, Singapore 408699  
Tel : 6366 2323 Fax : 6841 1183

## Telefax

### Material List for Accident Vehicle Regn No.SLT 5927 T.

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
41	LUGGAGE COMPARTMENT FLOOR <i>Rehind</i>	\$ 577.00	✓ 461.20
42	LUGGAGE COMPARTMENT TRIM-LH <i>not in</i>	\$ 676.00	+
43	REAR NO.PLATE <i>Best</i>	S/N \$ 25.00	✓ 25
44	ACRYLIC SEALER <i>2</i>	S/N \$ 180.00	✓ 180.00
45	CAVITY WAX <i>Jan</i>	S/N \$ 140.00	✓ 140.00
46	STONE CHIP	S/N \$ 180.00	✓ 180.00
47	SUNDRIES <i>Nec</i>	\$ 1,000.00	? 136.24
<b>TOTAL SPARE PARTS - REAR</b>		<b>: \$ 19,876.00</b>	
<b>TOTAL LABOUR CHARGES - REAR</b>		<b>: \$ 7,912.00</b>	
<b>GRAND TOTAL - REAR</b>		<b>: \$ 27,788.00</b>	
<b>GRAND TOTAL - FRONT/REAR</b>		<b>: \$ 78,316.00</b>	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

24/11/06

**LMC Auto Centres hence notify the Receiver of the following:**

- To be done before/after spray painting
- To be done during assembly
- To be done during painting
- To be done during 'pre-assembly'
- No damage to be done to the vehicle and its components
- Supplements, etc. to be provided and is subject to final approval from insurance Company

**Acknowledged by Receiver**

Signature: \_\_\_\_\_

Date: \_\_\_\_\_

# Premium Automobiles

55 Ubi Road 1, Singapore 408699  
Tel : 6366 2323 Fax : 6841 1183

## Telefax

Name : *Adrian King*  
Surveyed Date : *19/06/18*  
Authorised Date :  
Excess Cost :  
Liability :  
Remarks : *Not Authorised, 16 Days*

**Please Note** : This estimate is based on visual inspection of the affected vehicle. Should we require further labour charges and spare parts in the progress of repair, we shall inform you accordingly. For inspection of vehicle, please refer to Ms Norah Khai at Tel:6768 9828 for appointment.

Yours faithfully,  
Premium Automobiles Pte Ltd

<b>LKK Auto Cons:</b>	<b>Price notify</b>
<b>the Repairer</b>	
• Total repair cost	
• Total repair cost	
• Third party	Free cost basis
• No Excess cost	
• Supplemental costs	is subject to final approval from Insurance Company
<b>Acknowledged by Repairer</b>	
<b>Signature:</b>	
<b>Date:</b>	

Johnny Boo  
Body Repair Manager

Allan Wu  
Claims Consultant

# Premium Automobiles Pte Ltd

55 Ubi Road 1, Singapore 408699

Tel : (65) 6366 2323 Fax : (65) 6841 1183

## Supplementary Estimate 2

GST Reg No. 19-9902271-W

<b>AIG Asia Pacific Insurance Pte Ltd</b> 78 Shenton Way #07-16 AIG Building Singapore 079120 <b>Attn: Mr. Adrian Ling - Motor Claims Dept</b> <b>Tel: 6841 0055 - Fax: 6256 4315</b>	<b>Estimate No.</b> PA/OD/0691/2018/GW <b>Date</b> 27-Jun-18 <b>Service Advisor</b> Jeffery Tan <b>Pages</b> 1 <b>Regn No</b> SLK 5927 T <b>Model No</b> Audi A6 1.8 TFSI S- Tronic
--	--

Quantity	Description	Unit Price	Amount
<b>Parts</b>			
1	AIR GUIDE - RHS <i>2nd</i>	\$ 24.00	18.64
2	A/C CONDENSER <i>Best</i>	\$ 683.00	546.00
3	RADIATOR <i>Best</i>	\$ 752.00	601.50
4	RUBBER BUSH <i>me</i>	6 \$ 52.00	40.00
5	PREMIX COOLANT <i>me</i>	\$ 82.00	65.28
6	FRONT BUMPER GUIDE - LHS <i>2nd NW</i>	\$ 57.00	
7	HOLDING STRAP - LHS/RHS <i>DM</i>	\$ 108.00	85.93
		<b>\$ 1,758.00</b>	
<b>LABORS</b>			
1	To repair and respray LHS rear fender.	\$ <del>1,400.00</del> <i>800</i>	
<b>TOTAL</b>		<b>\$ 3,158.00</b>	

For Premium Automobiles Pte Ltd




Authorised Signature

**LKK Auto Consultants** hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer  
 Signature:  
 Date:

2814-04

# Premium Automobiles Pte Ltd

55 Ubi Road 1, Singapore 408699

Tel: (65) 6366 2323 Fax: (65) 6841 1183

## Supplementary Estimate 1

GST Reg No. 19-9902271-W

**AIG Asia Pacific Insurance Pte Ltd**  
 78 Shenton Way  
 #07-16 AIG Building  
 Singapore 079120  
**Attn: Mr. Adrian Ling - Motor Claims Dept**  
**Tel: 6841 0055 - Fax: 6256 4315**

**Estimate No.** PA/OD/0691/2018/GW  
**Date** 21-Jun-18  
**Service Advisor** Jeffery Tan  
**Pages** 1  
**Regn No** SLK 5927 T  
**Model No** Audi A6 1.8 TFSI S- Tronic

Quantity	Description	Unit Price	Amount
<b>Parts</b>			
1	AIRBAG CONTROL UNIT	\$ 796.00	✓ 1206.40
2	FRONT CRASH SENSOR	\$ 522.00	✓ 1111.20
3	FRONT SEATBELT - LHS	\$ 1,215.00	✓ 973.00
4	FRONT SEATBELT - RHS	\$ 956.00	✓ 764.80
5	SEATBELT ADJUSTER	\$ 311.00	✓ 248.80
6	BATTERY CUT-OFF PROTECTION FUSE	\$ 516.00	✓ 412.80
		<b>\$ 4,316.00</b>	
<b>LABORS</b>			
1	To dismantle centre console assy, renew airbag control unit, both front seat belts and battery cut off fuse. (Special Nett)	\$ 2,800.00	✓
<b>TOTAL</b>		<b>\$ 7,116.00</b>	

For Premium Automobiles Pte Ltd



*Adrian Ling*

Authorised Signature

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

*Please dismantle and allow resurvey of above-mentioned items.*

1976 84

## Offboard Diagnostic Information System

## Diagnostic protocol(Short)

20.06.2018 15:09

XML\_to\_HTML\_Main.xsl Version: 4.41.2 from 20.02.2017

### General information

Order number: ---

Protocol type: Guided fault finding  
 Protocol status: Intermediate protocol

#### Workshop information

Serial number of diagnostic tester:  
 Hardware platform:  
 Operating system:  
 VCI type:  
 VCI connecting type:  
 Communication path:  
 Importer number:  
 Dealer/dealership number:  
 Dealership identifier:

c58d8c311bfd2a7dc55ca92835f89c5  
 STD PC (LENOVO / 20FCA003SG)  
 Windows 7  
 VAS 5054 (082145725)  
 Bluetooth  
 CAN/K-line  
 771  
 00102

Status of contract:

(manual input)  
 Authorised dealer

#### Software versions:

Offboard Diagnostic Information System Service:  
 Main feature:  
 More:

Offboard Diagnostic Information System Service Patch 4.1.4  
 38.0.10

#### Vehicle:

Brand:  
 Type:  
 Model year:  
 Variant:  
 Engine code:  
 Registration number:  
 Vehicle identification number (automatic):  
 Vehicle identification number (manual):  
 Mileage (km):  
 ASAM project name  
 ASAM project version

Audi  
 Audi A6 2011>  
 2017 (H)  
 Saloon  
 CAEB 2.0i TFSI / 155kW  
 (ElsaPro is not available)  
 WAUZZZ4G1HN047901  
 WAUZZZ4G1HN047901  
 44928  
 AU57X  
 31053.2.395

### Diagnostic session

Start of diagnosis: 20.06.2018 15:05  
 End of diagnosis: 20.06.2018 15:09

Time required (TU): 18

Mouse click Diagnostic sessionDiagnostic start upDiagnostic endFunction key: 20/14.6.17  
 Keyboard enter Diagnostic sessionDiagnostic start upDiagnostic endFunction key: 20.6.2018

#### Diagnostic data used:

GFF DIBB brand: A  
 GFF DIBB version: 2017.05.00  
 GFF DIBB language: en\_GB  
 GFF technical version: 2.11.13  
 Base DIBB version: 2017.3.20.AutoGenerated  
 Base DIBB language: en\_GB  
 DTC\_Exclusion Version: 11.0.0

#### Global variables:

Error messages outside guided fault finding:

### Initial system test with fault memory entries

Address: 0042 System name: 42 - Door electronics, driver side Protocol variant: KWP2000/TP20 (Ereignisse: 0)

Identification:

Address: 0052 System name: 52 - Door electronics, passenger side Protocol variant: KWP2000/TP20 (Ereignisse: 0)

Identification:

Address: 0001 System name: 01 - Engine electronics (UDS) Protocol variant: UDS/ISOTP (Ereignisse: 3)

Identification:

Event memory entries:

Address: 0052 System name: 52 - Door electronics, rear left Protocol variant: KWP2000/TP20 (Ereignisse: 0)

Identification:

Address: 0072 System name: 72 - Door electronics, rear right Protocol variant: KWP2000/TP20 (Ereignisse: 0)

Identification:

Address: 0053 System name: 53 - Parking brake Protocol variant: UDS/ISOTP (Ereignisse: 2)

Identification:

Event memory entries:

Address: 0005 System name: 05 - Drive authorisation system Protocol variant: KWP2000/TP20 (Ereignisse: 2)

Identification:

Event memory entries:

Address: 0016 System name: 16 - Steering wheel electronics Protocol variant: KWP2000/TP20 (Ereignisse: 0)

Identification:

Address: 0046 System name: 46 - Convenience system central module Protocol variant: KWP2000/TP20 (Ereignisse: 1)

Identification:

Event memory entries:

Address: 0015 System name: 15 - Airbag Protocol variant: UDS/ISOTP (Ereignisse: 6)

Identification:

Event memory entries:

Entry in fault memory

Number:

Fault type 2:

Symptom:

Status:

B10061B: Driver side seat belt tension igniter Resistance too high  
active/static  
9438747  
10001001

Standard ambient conditions:

Entry in fault memory

Number:

Fault type 2:

Symptom:

Status:

B10071B: Front passenger side seat belt tension igniter  
Resistance too high  
active/static  
9439003  
10001001

Standard ambient conditions:

Entry in fault memory

Number:

Fault type 2:

Symptom:

Status:

B10131B: Driver side belt force limiter igniter Resistance too high  
active/static  
9442075  
10001001

Standard ambient conditions:

Entry in fault memory

Number:

Fault type 2:

Symptom:

Status:

B10141B: Front passenger side belt force limiter igniter Resistance  
too high  
active/static  
9442331  
10001001

Standard ambient conditions:

Entry in fault memory

Number:

Fault type 2:

Symptom:

Status:

B10151B: Igniter for battery interrupt Resistance too high  
active/static  
9442587  
10001001

Standard ambient conditions:

Entry in fault memory

Number:

Fault type 2:

B102900: Rear crash data stored  
passive/sporadic

## Janice Lee (LKKAUTO)

---

**From:** Claims Dept <claims@premiumauto.com.sg>  
**Sent:** Thursday, June 21, 2018 12:52 PM  
**To:** Janice Lee (LKKAUTO)  
**Cc:** SUR; Adrian Ling (LKKAUTO); 'Claims Dept'  
**Subject:** RE: SLK 5927 T Own Damage Claims (Vehicle IN)  
**Attachments:** SAftersales18062112541.pdf; SAftersales18062112540.pdf

Dear all,

Kindly forward the estimate to Adrian for his kind reference.

Attached the supplementary list and the Fault code print out for his kind reference.

Many thanks!

Best regards,  
Jeffery Tan

**Premium Automobiles Pte Ltd** (Reg No 199902271W)  
55 Ubi Road 1 Road Singapore 408699  
p. +65 6388 2323 d. +65 6768 9911 f. +65 6841 1183  
e. claims@premiumauto.com.sg w. www.audi.com.sg  
Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223



**Email Disclaimer**

This email, including any attachment, is confidential and may also be privileged.  
If you have received it in error, please notify us immediately by reply email and then delete this message from your system.  
Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you

---

**From:** Janice Lee (LKKAUTO) [mailto:JaniceLee@lkkauto.com]  
**Sent:** Wednesday, 20 June, 2018 2:06 PM  
**To:** Claims Dept <claims@premiumauto.com.sg>  
**Cc:** SUR <sur@lkkauto.com>  
**Subject:** RE: SLK 5927 T Own Damage Claims (Vehicle IN)

Dear Sir,

As instructed by our client, please proceed to repair the insured vehicle **SLK 5927T (excess \$0.00/-)**.

# Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

## Telefax

Estimate : Accident Repairs  
Workshop : Ubi Road 1  
Contact No : 6366 2323  
Fax No : 6841 1183  
Reference : PA/OD/0691/2018/GW  
Date : 16-Jun-18

Vehicle IN workshop. Kindly arrange for survey.

### AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way  
#07-16 AIG Building  
Singapore 079120

Hi Adrian

16 days of repairs - ok - jb - 30 Aug 18

Attn: Mr. Adrian Ling - Motor Claims Dept  
Tel: 6841 0055 - Fax: 6256 4315

Owner's Name : Ms. Lee San San Susanna  
Address : Apt Blk 932 Tampines St 91  
#06-391  
Singapore 520932  
Telephone : (HP) 97765730  
Type of Claim : Own Damage Claims  
Policy No. : 2100498699-01  
Vehicle No : **SLK 5927 T**  
Model Code : Audi A6 1.8 TFSI S- Tronic  
Model / Year :  
Engine No :  
Chassis No :  
Mileage :  
Date In :  
Liability : -  
Excess Cost : -  
Estimated By : Johnny Boo / Allan Wu  
Accident Date : 13-Jun-18  
Place of Accident : Along PIE Before Kallang

# Premium Automobiles

55 Ubi Road 1, Singapore 408699  
Tel : 6386 2323 Fax : 6841 1183

## Telefax

### Estimated Labour Charges for Accident Vehicle SLK 5927 T.

S/N	Nature of Jobs	Estimated Charges	
1	To remove and transfer front wire harness for headlights, horns, fog lamps, outside temperature sensor, headlight washer assy and front parking aid.	S/N \$ 480.00	\$ 480.00
2	To remove and renew aircon condensor, radiator, charged air cooler, electrical fans and control unit. To carry out vacuum/regas and to pressurise cooling system.	S/N \$ 1,100.00	\$ 1,100.00
3	To dismantle front bumper, both front fenders and bonnet. Renew front lock carrier and align to position. Renew front bumper, both front fenders, bonnet and headlights. Re-organise front crash management components. Reinstall all parts removed.	\$ 6,300.00	\$ 1,500.00
4	<i>Added labour charges - see attached 21 Jun 18 (1)</i>	\$ 2,800.00	\$ 2,800.00
6	To respray front bumper, both fenders and bonnet.	\$ 3,300.00	\$ 2,200.00
<b>TOTAL LABOUR CHARGES - FRONT</b>		<b>\$ 13,980.00</b>	<b>\$ 8,080.00</b>

# Premium Automobiles

55 Ubi Road 1, Singapore 408699  
Tel : 6366 2323 Fax : 6841 1183

## Telefax

### Material List for Accident Vehicle Regn No. SLK 5927 T.

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
1	FRONT BUMPER	\$ 2,650.00	\$ 2,120.00
2	FRONT BUMPER GRILLE-LOWER CENTRE	\$ 112.00	
3	FRONT BUMPER LOCKING CLIP	14 \$ 48.00	
4	FRONT BUMPER CLOSING ELEMENT	\$ 188.00	
5	RADIATOR COVER	\$ 32.00	\$ 24.96
6	FRONT BUMPER FIXING PARTS	\$ 464.00	
7	FOAM FILLER PIECE	\$ 203.00	\$ 162.40
8	FRONT BUMPER SIDE REINFORCEMENT	\$ 702.00	\$ 561.60
9	FRONT BUMPDR HOLDER BRACKET-LH/RH	2 \$ 446.00	
10	FRONT BUMPER COVER	\$ 105.00	\$ 84.00
11	SIGN " CUTION "	\$ 12.00	\$ 9.28
12	FRONT SENSOR-INNER	2 \$ 392.00	
13	FRONT SENSOR SUPPORT-LH/RH	2 \$ 118.00	
14	FRONT BUMPER GUIDE SECTION-LH/RH	2 \$ 64.00	
15	FRONT FENDERLH/RH	2 \$ 2,440.00	
16	FRONT FENDER ATTACHMENT PARTS	2 \$ 175.00	
17	FRONT STONE GUARD FILM-LH/RH	2 \$ 210.00	\$ 167.20
18	FRONT FENDER BRACE-LH/RH	2 \$ 144.00	
19	FRONT WHEEL SPOILER-LH/RH	2 \$ 464.00	
20	FRONT AIR GUIDE GRILLE-LH/RH	2 \$ 868.00	
<b>SUB-TOTAL SPARE PARTS CHARGES - FRONT :</b>		<b>\$ 9,837.00</b>	<b>\$ 3,129.44</b>

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved  
Spare parts are Special Nett.

# Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

## Telefax

### Material List for Accident Vehicle Regn No. SLK 5927 T.

S/N	Parts Description	c/f	Damage Parts & Prices	
			S/NETT	REMARKS
				\$ 3,129.44
21	FRONT AIR GUIDE GRILLE COVER-LH/RH	2	\$ 88.00	
22	LED HEADLIGHT-LH/RH	2	\$ 16,772.00	\$ 13,417.60
23	HEADLIGHT MOUNTING-LH/RH	2	\$ 206.00	\$ 82.40
24	HEADLIGHT LIFT CYLINDER-LH/RH	2	\$ 416.00	
25	BONNET		\$ 4,771.00	\$ 3,816.80
26	BONNET ATTACHMENT PARTS		\$ 153.00	
27	BONNET CATCH HOOK		\$ 122.00	
28	FRONT BONNET LOCK BAR	2	\$ 87.00	
29	BONNET LID LOCK	2	\$ 376.00	
30	RADIATOR LOCK CARRIER		\$ 1,024.00	
31	AIR GUIDE-LH/RH	2	\$ 48.00	
32	INTERCOOLER		\$ 492.00	
33	A/C CONDENSER		\$ 683.00	
34	RADIATOR		\$ 752.00	
35	RADIATOR RUBBER BUSH-UPPER	2	\$ 12.00	
36	RADIATOR RUBBER BUSH-CENTER	2	\$ 17.00	
37	RADIATOR RUBBER BUSH-LOWER	2	\$ 23.00	
38	READY-MIX COOLANT	4	\$ 82.00	
39	TWIN FAN RING		\$ 226.00	
40	RADIATOR FAN	2	\$ 1,439.00	
<b>SUB-TOTAL SPARE PARTS CHARGES - FRONT :</b>			<b>\$ 27,789.00</b>	<b>\$ 20,446.24</b>

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

# Premium Automobiles

55 Ubi Road 1, Singapore 408699  
Tel : 6366 2323 Fax : 6841 1183

## Telefax

### Material List for Accident Vehicle Regn No. SLK 5927 T.

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
			\$ 20,446.24
		<i>c/f</i>	
41	FRONT NO.PLATE	S/N \$ 25.00	\$ 25.00
42	Added parts - see attached 21 Jun 18	\$ 5,778.00	\$ 4,204.80
44	RADIATOR GRILLE	S/N \$ 1,697.00	\$ 1,357.60
	<b>TOTAL SPARE PARTS CHARGES - FRONT</b>	<b>: \$ 45,126.00</b>	<b>\$ 26,033.64</b>
	<b>TOTAL LABOUR CHARGES - FRONT</b>	<b>: \$ 13,980.00</b>	<b>\$ 8,080.00</b>
	<b>GRAND TOTAL - FRONT</b>	<b>: \$ 59,106.00</b>	<b>\$ 34,113.64</b>

All charges are not inclusive of GST.

Legend :      Remarks (OK) = Approved, Remarks (X) = Not approved  
Spare parts are Special Nett.

# Premium Automobiles

55 Ubi Road 1, Singapore 408699  
Tel : 6366 2323 Fax : 6841 1183

## Telefax

### Estimated Labour Charges for Accident Vehicle SLK 5927 T.

S/N	Nature of Jobs	Estimated Charges		
	<i>Labour front c/f</i>		\$	8,080.00
1	To remove and transfer rear parking aid and rear lid kick sensor assy. Check function and renew according to damage.	S/N \$ 360.00	\$	360.00
2	To remove and transfer rear lid's convenience lock system and wire harness for tail lights.	S/N \$ 280.00	\$	280.00
3	To dislodge and reinstall rear wire harness for tail lights, battery manager, fuse and relay trays, electrical and audio components.	S/N \$ 480.00	\$	480.00
4	To dismantle rear bumper and rear lid. Cut out and weld rear outer and inner rear cross panels. Re-align rear lock carrier and renew rear bumper and rear lid. Re-organise rear crash management components. Reinstall all parts removed.	\$ 4,200.00	\$	3,000.00
5	To respray rear bumper, rear lid and end panelling. To carry out joint sealer works and stone chip treatment .	\$ 2,400.00	\$	1,650.00
5a	<i>Added labour - see attached 27 Jun 18 (2)</i>	\$ 1,400.00	\$	800.00
6	To carry out diagnostic check.	S/N \$ 192.00	\$	192.00
	<b>SUB-TOTAL LABOUR CHARGES - (REAR)</b>	<b>: \$ 9,312.00</b>	<b>\$</b>	<b>14,842.00</b>

# Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

## Telefax

### Material List for Accident Vehicle Regn No.SLK 5927 T.

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
	<i>materials front c/f</i>		\$ 26,033.64
1	REAR BUMPER	\$ 2,519.00	\$ 2,015.20
2	REAR BUMPER FIXING PARTS	\$ 234.00	
3	REAR BUMPER SPOILER	\$ 416.00	\$ 332.80
4	REAR BUMPER SECURING STRIP	\$ 191.00	
5	REAR SENSOR	4 \$ 842.00	
6	REAR BUMPER CLOSING ELEMENT-LH/RH	2 \$ 138.00	
7	REAR BUMPER WIRING	\$ 603.00	
8	REAR BUMPER CARRIER	\$ 851.00	\$ 680.40
9	REAR BUMPER SEAL-LH/RH	2 \$ 24.00	
10	REAR BUMPER GUDIE SECTION-LH/RH	2 \$ 56.00	
11	REAR BUMPER CONNECTION PIECE	2 \$ 21.00	
12	REAR BUMPER UPPER GUDIE SECTION-LH/RH	2 \$ 92.00	
13	REAR BUMPER GUIDE PROFILE-LH/RH	2 \$ 114.00	\$ 45.28
14	REAR BUMPER GUIDE SECTION-CENTER	\$ 91.00	\$ 72.32
15	REAR BUMPER HOLDING STRAP-LH/RH	2 \$ 108.00	
16	EXHAUST TAIL PIPE TRIM-LH/RH	2 \$ 994.00	
17	BOOT LID CONTROL UNIT	\$ 372.00	
18	TAILGATE SENSOR LINE	\$ 184.00	
19	CABLE TERMINAL	13 \$ 84.00	
21	REAR LID	\$ 2,485.00	\$ 1,988.00
	<b>SUB-TOTAL SPARE PARTS - REAR</b>	<b>\$ 10,419.00</b>	<b>\$ 31,167.64</b>

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

# Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

## Telefax

### Material List for Accident Vehicle Regn No.SLT 5927 T.

S/N	Parts Description	Damage Parts & Prices				
		S/NETT	REMARKS			
				<i>c/t</i>	\$	31,167.64
21	REAR LID BRACKET	\$	30.00			
22	REAR LID HINGE-LH/RH	2 \$	400.00			
23	PUSH BUTTON FOR LID LOCK ACTUATOR	\$	1,181.00			
24	FLAP GASKET	\$	181.00			
25	REAR LID STOP BUFFER	4 \$	5.00			
26	REAR LID LOCK	\$	170.00			
27	REAR LID LOCK COVER	\$	7.00			
28	STRIKER PLATE	\$	550.00			
29	PACKING ADHESIVE	\$	15.00	\$		11.60
30	AUDI EMBLEM	\$	108.00	\$		86.00
31	INSCRIPTION "A6"	\$	83.00	\$		66.16
32	INSCRIPTION "TFSI"	\$	83.00	\$		66.16
33	REAR LID DECORATIVE FILM	\$	317.00	\$		253.20
34	LED TAIL LIGHT-LH/RH	2 \$	2,188.00	\$		1,750.40
35	TAIL LIGHT TRIM-LH/RH	2 \$	52.00	\$		40.16
36	REAR CROSS PANEL	\$	274.00	\$		219.20
37	REAR CROSS PANEL REINFORCEMENT	\$	639.00	\$		511.20
38	REAR CROSS PANEL CONNECTING PLATE-LH/RH	2 \$	78.00			
39	REAR CROSS PANEL TRIM	\$	116.00	\$		92.80
40	SPARE WHEEL WELL	\$	202.00			
<b>SUB-TOTAL SPARE PARTS - REAR</b>		<b>\$</b>	<b>6,679.00</b>	<b>\$</b>		<b>34,264.52</b>

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

# Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

## Telefax

### Material List for Accident Vehicle Regn No.SLT 5927 T.

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
			\$ 34,264.52
	<i>c/f</i>		
41	LUGGAGE COMPARTMENT FLOOR	\$ 577.00	\$ 461.20
42	LUGGAGE COMPARTMENT TRIM-LH	\$ 676.00	
43	REAR NO.PLATE	S/N \$ 25.00	\$ 25.00
44	ACRYLIC SEALER	S/N \$ 180.00	\$ 180.00
45	CAVITY WAX	S/N \$ 140.00	\$ 140.00
46	STONE CHIP	S/N \$ 180.00	\$ 180.00
47	<i>Added parts - see attached 27 JUN 18</i>	\$ 2,852.00	\$ 2,232.24
48	SUNDRIES	\$ 1,000.00	\$ 136.24
	<b>TOTAL SPARE PARTS - REAR</b>	<b>\$ 22,728.00</b>	<b>\$ 37,619.20</b>
	<b>TOTAL LABOUR CHARGES - REAR</b>	<b>\$ 9,312.00</b>	<b>\$ 14,842.00</b>
	<b>GRAND TOTAL - REAR</b>	<b>\$ 32,040.00</b>	<b>\$ 52,461.20</b>

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

# Premium Automobiles Pte Ltd

55 Ubi Road 1, Singapore 408699

Tel : (65) 6366 2323 Fax : (65) 6841 1183

## Supplementary Estimate 1

GST Reg No. 19-9902271-W

<b>AIG Asia Pacific Insurance Pte Ltd</b> 78 Shenton Way #07-16 AIG Building Singapore 079120 <b>Attn: Mr. Adrian Ling - Motor Claims Dept</b> Tel: 6841 0055 - Fax: 6256 4315	<b>Estimate No.</b> PA/OD/0691/2018/GW <b>Date</b> 21-Jun-18 <b>Service Advisor</b> Jeffery Tan <b>Pages</b> 1 <b>Regn No</b> SLK 5927 T <b>Model No</b> Audi A6 1.8 TFSI S- Tronic
---	--

Quantity	Description	Unit Price	Amount
<b>Parts</b>			
1	AIRBAG CONTROL UNIT	\$ 2,258.00	\$ 1,806.40
2	FRONT CRASH SENSOR	\$ 522.00	\$ 1,044.00
3	FRONT SEATBELT - LHS	\$ 1,215.00	\$ 972.00
4	FRONT SEATBELT - RHS	\$ 956.00	\$ 764.80
5	SEATBELT ADJUSTER	\$ 311.00	\$ 248.80
6	BATTERY CUT-OFF PROTECTION FUSE	\$ 516.00	\$ 412.80
		<b>\$ 5,778.00</b>	<b>\$ 4,204.80</b>
<b>LABORS</b>			
1	To dismantle centre console assy, renew airbag control unit, both front seat belts and battery cut off fuse. (Special Nett)	\$ 2,800.00	\$ 2,800.00
	<b>TOTAL</b>	<b>\$ 8,578.00</b>	<b>\$ 7,004.80</b>

For Premium Automobiles Pte Ltd

\_\_\_\_\_  
Authorised Signature

# Premium Automobiles Pte Ltd

55 Ubi Road 1, Singapore 408699

Tel : (65) 8366 2323 Fax : (65) 6841 1183

## Supplementary Estimate 2

GST Reg No. 19-9902271-W

**AIG Asia Pacific Insurance Pte Ltd**  
 78 Shenton Way  
 #07-16 AIG Building  
 Singapore 079120  
**Attn: Mr. Adrian Ling - Motor Claims Dept**  
**Tel: 6841 0055 - Fax: 6256 4315**

**Estimate No.** PA/OD/0691/2018/GW  
**Date** 27-Jun-18  
**Service Advisor** Jeffery Tan  
**Pages** 1  
**Regn No** SLK 5927 T  
**Model No** Audi A6 1.8 TFSI S- Tronic

Quantity	Description	Unit Price	Amount
<b>Parts</b>			
1	AIR GUIDE - RHS	\$ 24.00	\$ 18.64
2	A/C CONDENSER	\$ 683.00	\$ 546.00
3	RADIATOR	\$ 752.00	\$ 601.20
4	RUBBER BUSH	\$ 52.00	\$ 40.00
5	PREMIX COOLANT	\$ 82.00	\$ 65.28
6	FRONT BUMPER GUIDE - LHS	\$ 57.00	
7	HOLDING STRAP - LHS/RHS	\$ 108.00	\$ 85.92
8 (A)	Lhs taillamp <i>cracked.</i>	\$ 1,094.00	\$ 875.20
		<b>\$2,852.00</b>	<b>\$ 2,232.24</b>
<b>LABORS</b>			
1	To repair and respray LHS rear fender.	\$ 1,400.00	\$ 800.00
	<b>TOTAL</b>	<b>\$ 4,252.00</b>	<b>\$ 3,963.44</b>

For Premium Automobiles Pte Ltd

\_\_\_\_\_  
 Authorised Signature

## Janice Lee (LKKAuto)

---

**From:** Janice Lee (LKKAuto)  
**Sent:** Wednesday, November 07, 2018 2:45 PM  
**To:** 'Boo seng yak'; Adrian Ling (LKKAuto); SUR; Carrine Leong;  
jiayee.yap@premiumauto.com.sg; Chang Chee Sing  
**Subject:** RE: FINAL REVISION - SLK5927T - OD IG - SURVEYED 19 JUN 18

Dear Mr. Boo,

Confirm \$52,461.20 @ 16 days

\*Kindly send us the DV and invoice for our early closure

Thank you.

Best Regards,

**Jannice Lee (Ms)** | Case Handler

**LKK Auto Consultants Pte Ltd**

Phone: 6256-3561 | email: [janicelee@lkkauto.com](mailto:janicelee@lkkauto.com) | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

**From:** Boo seng yak [mailto:boojohnny@gmail.com]  
**Sent:** Thursday, August 30, 2018 4:28 PM  
**To:** Adrian Ling (LKKAuto) <[adrianling@lkkauto.com](mailto:adrianling@lkkauto.com)>; SUR <[sur@lkkauto.com](mailto:sur@lkkauto.com)>; Janice Lee (LKKAuto) <[JaniceLee@lkkauto.com](mailto:JaniceLee@lkkauto.com)>; Carrine Leong <[carrine.leong@premiumauto.com.sg](mailto:carrine.leong@premiumauto.com.sg)>; jiayee.yap@premiumauto.com.sg; Chang Chee Sing <[claims@premiumauto.com.sg](mailto:claims@premiumauto.com.sg)>  
**Subject:** FINAL REVISION - SLK5927T - OD IG - SURVEYED 19 JUN 18

Hi Adrian and all,

Revised estimate is attached.

Please confirm repair cost of \$52,461.20 @ 16 days of repairs.

Your early closure is well appreciated.

Best regards - jb

# Premium Automobiles

**AIG Asia Pacific Insurance Pte Ltd**  
78 Shenton Way  
#07-16 AIG Building  
Singapore 079120  
**Attn: Motor Claims Dept**  
**Yr Ref: SLK 5927 T**

Norah Khai  
6768 9911  
6841 1183  
Nora.khai@premiumauto.com.sg  
Body & Paint Dept  
PA/OD/0691/2018/MAS

10 Nov 2018

Dear Sir,

**RE: INSURANCE CLAIM FOR SLK 5927 T, Audi A6 1.8 TFSIS-Tro**

With reference to the above-mentioned vehicle, no **SLK 5927 T**, claimant, **Ms. Lee San San Susanna**, please find the related document per attached.

1. A copy of the Original invoice no. 85013114 – S\$56,133.48
2. A copy of the Discharge Voucher duly signed by client.

Based on the above document, we would appreciate you could expedite the payment soonest possible.

If you require any further clarification, please do not hesitate to contact me at 6768 9911.

Regards

This is a computer-generated document. No signature is required.

Norah Khai  
Claims Dept

Encls

AIG – SLK 5927 T

from  
Telephone +65-  
Telefax +65-  
EMail  
Our department  
Our Ref  
Your Ref  
Date

total pages

Premium Automobiles Pte Ltd  
Showroom  
9 Leng Kee Road  
Singapore 159090  
Telephone (65) 6566 1111  
Telefax (65) 6471 3733

Service & Parts Centres  
55 Ubi Rd 1  
Singapore 408699  
Telephone (65) 6336 2323  
Telefax (65) 684 11183



# Premium Automobiles Pte Ltd

**Audi Centre Singapore**  
281 Alexandra Road  
Singapore 159998  
Main Telephone: 6392 2223  
Main Telefax: 6471 3133

**Alexandra Service Centre**  
281 Alexandra Road  
Singapore 159998  
Telephone: 6392 2223  
Telefax: 6471 1023

**Ubi Service Centre**  
55 Ubi Road 1  
Singapore 408861  
Telephone: 6392 1111

**Customer Service**  
Service Appointment: 6392 2223  
24-hour Breakdown Service: 9628 1233  
Email: customer.care@premiumcarauto.com.sg

**INS TAX INVOICE**  
Company Reg. No. 199902271W  
GST Reg. No. 199902271W

Page 1 15:41

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120	Invoice: 85013114 Date : 09/11/2018 Order : SLK5927T Term : 30	Account: A0006 (T 0) AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
---	---	--

Regn No.: SLK5927T (V 32044) Regn Date: 20/01/2017 Mileage: 46902 WIP No.: 13657

Model: AG 1.8 TFSI S tronic 4GC068 (N Chassis: WRUZZ4G1HM047901 Engine: CYG 017047 Dept: U

USB No.:

You have been assisted by :- UB-Jiayee ( 11 )

		Details	Qty	Unit Price	Amount
S	SUBLET	M: TO SUPPLY VEHICLE NUMBER PLATE	50.00	1.00	50.00
S	BODYWORK	M: TO REMOVE AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS, FOG LAMPS, OUTSIDE TEMPERATURE SENSOR, HEADLIGHT WASHER ASSY AND FRONT PARKING AID.	400.00	1.00	400.00
S	BODYWORK	M: TO REMOVE AND RENEW AIRCON CONDENSER, RADIATOR, CHARGED AIR COOLER, ELECTRICAL FANS AND CONTROL UNIT. TO CARRY OUT VACUUM/REGAS AND TO PRESSURISE COOLING SYSTEM	1100.00	1.00	1,100.00
S	BODYWORK	M: TO DISMANTLE FRONT BUMPER, BOTH FRONT FENDERS AND BONNET. REALIGN FRONT LOCK CARRIER TO POSITION. RENEW FRONT BUMPER, BONNET AND HEADLIGHT. REPAIR BOTH FRONT FENDER. REORGANISE FRONT CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED	1500.00	1.00	1,500.00

Sub-Total

7% GST

**Grand Total**



# Premium Automobiles Pte Ltd

Audi Centre Singapore  
281 Alexandra Road  
Singapore 159936  
Main Telephone 6471 3733  
Fax 6471 3733

Alexandra Service Centre  
281 Alexandra Road  
Singapore 159936  
Telephone 6388 2222  
Telex 6475 1023

UBI Service Centre  
55 Ubi Road 1  
Singapore 408722  
Telephone 6385 1234

Customer Service  
Service Appointment 6388 2222  
Hour Breakdown Service 9628 1233  
Email customer.care@premiumauto.com.sg

**INS TAX INVOICE**  
Company Reg. No. 199902271W  
GST Reg. No. 199902271W

Page 2 15:41

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120	Invoice: 85013114 Date : 09/11/2018 Order : SLK5927T Term : 30	Account: A0006 (T 0) AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
---	---	--

Regn No.: SLK5927T (V 32044) Regn Date: 20/01/2017 Mileage: 46902 WIP No.: 13657

Model: A6 1.8 TFSI S tronic 4GC066 (N Chassis: WAUZZZ4G1H0047901 Engine: CYG 017047 Dept: U

USB No.:

You have been assisted by :- UB-Jiayee ( 11 )

	Details	Qty	Unit Price	Amount
S	BODYWORK M: TO RESPRAY FRONT BUMPER, BOTH FRONT FENDER AND BONNET.	2200.00	1.00	2,200.00
S	BODYWORK M: TO REMOVE AND TRANSFER REAR PARKING AID AND REAR LID KICK SENSOR ASSY. CHECK FUNCTION AND RENEW ACCORDING TO DAMAGES	360.00	1.00	360.00
S	BODYWORK M: TO REMOVE AND TRANSFER REAR LID'S CONVENIENCE LOCK SYSTEM AND WIRE HARNESS FOR TAIL LIGHTS	280.00	1.00	280.00
S	BODYWORK M: TO DISLodge AND REINSTALL REAR WIRE HARNESS FOR TAIL LIGHTS, BATTERY MANAGER, FUSE AND RELAY TRAYS, ELECTRICAL AND AUDIO COMPARTMENT	460.00	1.00	460.00
S	BODYWORK M: TO DISMANTLE REAR BUMPER AND REAR LID. CUT OUT AND WELD REAR OUTER AND INNER REAR CROSS PANELS. REALIGN REAR LOCK CARRIER AND RENEW REAR BUMPER	3000.00	1.00	3,000.00
Sub-Total				
7% GST				
Grand Total				



# Premium Automobiles Pte Ltd

Audi Centre Singapore  
281 Alexandra Road  
Singapore 159958  
Mobi Telephone: 6874 2223  
Main Telefax: 6471 3733  
Page 4 15:41

Alexandra Service Centre  
281 Alexandra Road  
Singapore 159958  
Telephone: 6388 2223  
Telefax: 6475 1023

UBI Service Centre  
55 Ubi Road 1  
Singapore 408722  
Telephone: 6388 2223  
Telefax: 6477 1127

Customer Service  
Service Appointment: 6344 2323  
24 Hour Breakdown Service: 9828 1223  
Email: customer.care@premiumauto.com.sg

**INS TAX INVOICE**  
Company Reg. No. 199902271W  
GST Reg. No. 199902271W

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120	Invoice: 85013114 Date : 09/11/2018 Order : SLK5927T Term : 30	Account: A0006 (T 0) AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
---	---	--

Regn No.: SLK5927T (V 32044) Regn Date: 20/01/2017 Mileage: 46902 WIP No.: 13657

Model: AG 1.8 TFSI S tronic 40C06G (N Chassis: WAUZZZ4G1H0047901 Engine: CYG 017047 Dept: U

USB No.:

You have been assisted by :- UB-Jiayee ( 11 )

		Details		Qty	Unit Price	Amount
X	A4H0959655H	MODULE (SK) (A)	Less 020%	1.00	2258.00	1,886.40
X	A4G8857705F V04	SEAT BELT (SK) (A)	Less 020%	1.00	1215.00	972.00
X	A4G8857706M V04	SEAT BELT (SK) (A)	Less 020%	1.00	956.00	764.80
X	A4G8853651AET194	GRILLE	Less 020%	1.00	1697.00	1,357.60
X	A4G5945095E	TAIL LIGHT	Less 020%	1.00	1094.00	875.20
X	A4G5945093E	TAIL LIGHT	Less 020%	1.00	1094.00	875.20
X	A4G5945094E	TAIL LIGHT	Less 020%	1.00	1094.00	875.20
X	A4G8941774J	HEADLIGHT	Less 020%	1.00	8386.00	6,788.80
X	A4G8941773J	HEADLIGHT	Less 020%	1.00	8386.00	6,788.80
X	A4G5827023C	LTD	Less 020%	1.00	2485.00	1,988.00
X	A4G8887061D	COVER	Less 020%	1.00	105.00	84.00
X	A8K0121251AG	RADIATOR	Less 020%	1.00	751.50	601.20
X	A4G8887521T 9B9	SPOILER	Less 020%	1.00	416.00	332.80
X	A4G8260403D	CONDENSER	Less 020%	1.00	682.50	546.00
X	A4G5863471C 4PK	TRIM PANEL (SK) (A)	Less 020%	1.00	116.00	92.80
X	A4G8887550G	FOAM INSER	Less 020%	1.00	203.00	162.40
X	A4G5813331	REINFORCEM	Less 020%	1.00	539.00	511.20
X	A4G5813307	REAR APRON	Less 020%	1.00	274.00	219.20
Sub-Total						
7% GST						
Grand Total						



# Premium Automobiles Pte Ltd

Audi Centre Singapore  
281 Alexandra Road  
Singapore 119938  
Main Telephone: 6334 2223  
Main Telefax: 6471 2723  
Page 3 15:41

Alexandra Service Centre  
281 Alexandra Road  
Singapore 119938  
Telephone: 6334 2223  
Telefax: 6471 1023

UBI Service Centre  
55 Ubi Road 1  
Singapore 408722  
Telephone: 6334 2223  
Telefax: 6471 1723

Customer Service  
Service Appointment: 6394 2323  
24 Hour Breakdown Service: 6528 1223  
Email: customer.care@premiumauto.com.sg

**INS TAX INVOICE**  
Company Reg. No. 199902271W  
GST Reg. No. 199902271W

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120	Invoice: 85813114 Date : 09/11/2018 Order : SLK5927T Term : 30	Account: A0006 (T 0) AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
---	---	--

Regn No.: SLK5927T (V 32044) Regn Date: 20/01/2017 Mileage: 46902 WIP No.: 13657

Model: A6 1.8 TFSI S tronic 460866 (N Chassis: WAUZZZ461H0847901 Engine: CYG 017047 Dept: U

USB No.:

You have been assisted by :- UB-Jiayee ( 11 )

		Details	Qty	Unit Price	Amount
S	BODYWORK	FRONT REAR LID, REORGANISE REAR CRASH MANAGEMENT COMPONENTS, REINSTALL ALL PARTS REMOVED M:	1650.00	1.00	1,650.00
S	BODYWORK	TO RESPRAY REAR BUMPER, REAR LID AND END PANNELLING, TO CARRY OUT JOINT SEALER WORKS AND STONE CHIP TREATMENT M:	192.00	1.00	192.00
S	BODYWORK	TO CARRY OUT DIAGNOSTIC CHECK M:	500.00	1.00	500.00
S	BODYWORK	TO SUPPLY ACRYLIC SEALER, CAVITY WAX AND STONE CHIP M:	2800.00	1.00	2,800.00
S	BODYWORK	TO DISMANTLE CENTRE CONSOLE ASSY, RENEW AIRBAG CONTROL UNIT, BOTH FRONT SEAT BELTS AND BATTERY CUT OFF FUSE M:	800.00	1.00	800.00
X	A465863463F 44H	PLATFORM (Ger) (A) Less 020%	1.00	576.50	461.20
Sub-Total					
7% GST					
Grand Total					



# Premium Automobiles Pte Ltd

Audi Centre Singapore  
281 Alexandra Road  
Singapore 159938  
Main Telephone: 6878 2227  
Main Telefax: 6471 3733

Alexandra Service Centre  
281 Alexandra Road  
Singapore 159938  
Telephone: 6888 2223  
Telefax: 6475 1823

UBi Service Centre  
55 Ubi Road 1  
Singapore 408722  
Telephone: 6746 2223  
Telefax: 6746 1823

Customer Service  
Service Appointment: 6346 2223  
Four Breakdown Service: 9628 1223  
Email: customer.care@premiumaudi.com.sg

**INS TAX INVOICE**  
Company Reg. No. 199902271W  
GST Reg. No. 199902271W

Page 5 15:41

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120	Invoice: 85013114 Date : 09/11/2018 Order : SLK5927T Term : 30	Account: A0006 (T 0) AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
---	---	--

Regn No.: SLK5927T (V 32044) Regn Date: 20/01/2017 Mileage: 46902 WIP No.: 13657

Model: A6 1.8 TFSI S tronic 460866 (N Chassis: WAUZZZ4G1H0047901 Engine: CYG 017047 Dept: U

VSB No.:

You have been assisted by :- UB-Jiayee ( 11 )

		Details		Qty	Unit Price	Amount
X	A465807309	BRACKET	Less 820%	1.00	680.50	680.40
X	A460807113A	BEAM	Less 820%	1.00	702.00	561.60
X	AG A13040M2	PREMIX-COOLANT	Less 820%	4.00	20.40	65.28
X	A460823029A	HOOD	Less 820%	1.00	4771.00	3,816.80
X	A460807065RSGRU	COVER	Less 820%	1.00	2650.00	2,120.00
X	A465807067H GRU	COVER	Less 820%	1.00	2519.00	2,015.20
X	A4E0260749B	WASHER	Less 820%	1.00	4.20	3.36
X	A000979940	CONNECTOR ( WHITE )	Less 820%	1.00	9.00	7.20
X	A000979019EA	WIRES	Less 820%	1.00	20.20	16.16
X	A8J0915459	FUSE UNIT	Less 820%	1.00	516.00	412.80
X	A4H0121268	MOUNTING	Less 820%	2.00	11.10	17.76
X	A4F0853741 2ZZ	INSCRIPTION 'A6'	Less 820%	1.00	82.70	66.16
X	A468807329	STRAP	Less 820%	1.00	53.70	42.96
X	A468807330	STRAP (SK)	Less 820%	1.00	53.70	42.96
X	A8X0853737A 2ZZ	INSCRIPTION 'TFSI'	Less 820%	1.00	82.70	66.16
X	A465853742 2ZZ	AUDI SIGN	Less 820%	1.00	107.50	86.00
X	A460805608A	MOUNTING	Less 820%	1.00	103.00	82.40
X	A465807393D	PIECE	Less 820%	1.00	56.60	45.28
Sub-Total						
7% GST						
Grand Total						



# Premium Automobiles Pte Ltd

Audi Centre Singapore  
281 Alexandra Road  
Singapore 119988  
Main Telephone: 6394 2223  
Main Telefax: 6471 2733

Alexandra Service Centre  
281 Alexandra Road  
Singapore 119988  
Telephone: 6394 2223  
Telefax: 6471 1023

Ubi Service Centre  
55 Ubi Road 1  
Singapore 408722  
Telephone: 6382 1133

Customer Service  
Service Appointment: 6394 2323  
6528 1233  
Hour Breakdown Service  
Email: [customers\\_care@premiumauto.com.sg](mailto:customers_care@premiumauto.com.sg)

**INS TAX INVOICE**  
Company Reg. No. 199902271W  
GST Reg. No. 199902271W

Page 6 15:41

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120	Invoice: 85813114 Date : 09/11/2018 Order : SLK5927T Term : 30	Account: A0006 (T 0) AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
---	---	--

Regn No.: SLK5927T (V 32044) Regn Date: 20/01/2017 Mileage: 46982 WTP No.: 13657

Model: A6 1.8 TFSI S tronic 460868 0M Chassis: WAUZZZ4G1H0047901 Engine: CYB 017047 Dept: U

USB No.:

You have been assisted by :- UB-Jiayee ( 11 )

		Details		Qty	Unit Price	Amount
X	A8K0121275C	MOUNTING	Less 020%	2.00	5.60	8.96
X	A4H0121276	MOUNTING	Less 020%	2.00	8.30	13.28
X	A8E0085163	CLIP	Less 020%	2.00	1.30	2.88
X	A8D0053419F	PACKING	Less 020%	1.00	14.50	11.60
X	A4G0090905	FOIL	Less 020%	1.00	104.50	83.60
X	A4G5007458A	GUIDE	Less 020%	1.00	90.40	72.32
X	A4E0260749A	WASHER	Less 020%	1.00	3.20	2.56
X	A4G0027310	CLIP	Less 020%	2.00	2.10	3.36
X	A7H0020096	SEAL	Less 020%	1.00	2.30	1.84
X	A4H0027589B	BUMPER	Less 020%	2.00	2.20	3.52
X	A8T0057833	ADJUSTMECH	Less 020%	2.00	155.50	248.80
X	A4G5019161A	TRIM	Less 020%	1.00	64.20	51.36
X	A4G0053037D	COVER	Less 020%	1.00	31.20	24.96
X	A4G5945256A	TRIM	Less 020%	1.00	25.10	20.08
X	A4G5945254	TRIM (SIO (A)	Less 020%	1.00	25.10	20.08
X	A8K0010520A	PLATE	Less 020%	1.00	11.60	9.28
X	A4G0090906	FOIL	Less 020%	1.00	104.50	83.60
X	A4G0121284BT	AIR DUCT	Less 020%	1.00	23.30	18.64

Sub-Total

7% GST

Grand Total



# Premium Automobiles Pte Ltd

Audi Centre Singapore  
281 Alexandra Road  
Singapore 119938  
Main Telephone: 6874 2221  
Fax: 6471 3711  
Page 7 15:41

Alexandra Service Centre  
281 Alexandra Road  
Singapore 119938  
Telephone: 6888 2221  
Telefax: 6475 1033

Ubi Service Centre  
55 Ubi Road 1  
Singapore 408722  
Telephone: 6788 2488  
Fax: 681 1122

Customer Service  
Service Appointment: 6384 2323  
Hour Breakdown Service: 6828 1233  
Email: customer.care@premiumauto.com.sg

**INS TAX INVOICE**  
Company Reg. No. 199902271M  
GST Reg. No. 199902271M

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120	Invoice: 85013114 Date : 09/11/2018 Order : SLK5927T Term : 30	Account: 00006 (T 0) AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
---	---	--

Regn No.: SLK5927T (V 32044) Regn Date: 20/01/2017 Mileage: 46902 WTP No.: 13657

Model: A6 1.8 TFSI S tronic 4GD066 (N Chassis: WAUZZZ4G1H0047901 Engine: CYG 017047 Dept: U

USB No.:

You have been assisted by :- UB-Jiayee ( 11 )

	Details			Qty	Unit Price	Amount
1	A46S94S255A	TRIM	Less 020%	1.00	25.10	20.08
1	A46S94S253	TRIM	Less 020%	1.00	25.10	20.08
1	A4HT001506A	BOLT	Less 020%	2.00	1.40	2.24
1	AN 10442003	BOLT	Less 020%	2.00	0.50	0.80
1	AN 10347204	BOLT	Less 020%	2.00	1.00	1.60
1	A46S853927 2Z1	MOLDING	Less 020%	1.00	316.50	253.20

Parts 37,069.20  
Labour 0.00  
Sublet 15,392.00  
Menus 0.00  
Lubricant 0.00

Sub-Total 52,461.20  
7% GST 3,672.28  
Grand Total 56,133.48



Received by

For & on behalf of  
Premium Automobiles Pte Ltd

Customer

# Premium Automobiles

## Telefax

to **AIG Asia Pacific Insurance Pte Ltd**  
78 Shenton Way  
#07-16 AIG Building  
Singapore 079120  
**Motor Claims Dept**  
**Yr Ref: SLK5927T**

Norah Khai  
6768 9828  
6841 1183

Body Repair

PA/OD/0691/2018/TF  
11 July 2018

from  
Telephone +65-  
Telefax +65-  
Mobile +65-  
Our department  
Your Claim Ref  
Our Ref  
Date

1 total pages

**RE : CLAIM – OWNER'S SATISFACTION/DISCHARGE VOUCHER**

**Make & Model** : Audi A6 1.8 TFSI S tronic  
**Vehicle Chassis No.** : WAUZZZ4G1HN047901  
**Vehicle Regn No.** : **SLK 5927 T**  
**Vehicle Mileage** : 44934 KM  
**Vehicle Owner** : Ms. Lee San San Susanna  
**Certificate No** : 2100498699  
**Policy Excess** : NIL  
**Accident Date** : 13 June 2018  
**Place** : Alone PIE bef Kallang  
**Repair Cost** : \$ 56,133.48  
**WIP No.** : 13657  
**Repairer's Name** : Premium Automobiles Pte Ltd

Premium Automobiles Pte Ltd  
Showroom  
9 Leng Kee Road  
Singapore 159090  
Telephone (65) 6566 1111  
Telefax (65) 6471 3733

Service & Parts Centres  
55 Ubi Road 1  
Singapore 408699  
Telephone (65) 6366 2323  
Telefax (65) 6841 1183

I/We certify that the vehicle has been fully repaired to my entire satisfaction and that payment of the repairer's charges that are claimable under the policy will be deemed in full and final settlement of my claim.

**Owner / Insured Signature** :   
**Time** : \_\_\_\_\_  
**Date** : 11/7/18

REPUBLIC OF SINGAPORE  
IDENTITY CARD NO. S7472190G



Name  
**LAU CHEE MING**  
**劉智銘**  
Race  
**CHINESE**  
Date of Birth  
**05-04-1974** Sex  
**M**  
Country of Birth  
**MALAYSIA**

REPUBLIC OF SINGAPORE DRIVING LICENCE



License Number **S7472190G**  
Name  
**LAU CHEE MING**  
Birth Date **05 Apr 1974**  
Issue Date **05 May 2003**



ADD13807



NRIC No. **S7472190G**

Nationality  
**MALAYSIAN**

APT BLK 932 TAMPINES STREET 91 #06-391  
SINGAPORE 520932  
NRIC No: S7472190G Date: 27/09/2012 No: 7157811  
SINGAPORE 370064

YOU ARE LICENSED TO DRIVE VEHICLES IN THE FOLLOWING CLASSES

CLASS	DESCRIPTION	ISSUE DATE
Class 2B	Motorcycle's not exceeding 200 cc	19 Jun 1996
Class 3	Motor Cars and Motor Tractors the weight of which unladen does not exceed 2500 kilograms	19 Jun 1996



NP 428A

## AUDI AUTO PROTECTOR PRIVATE VEHICLE

Policy No. : 2100498699-01  
 Period of Insurance : 20 Jan 2018 to 19 Jan 2019

Issued Date : 08 Dec 2017

## ABOUT THE POLICYHOLDER

Name of Policyholder : LEE SAN SAN SUSANNA  
 Address : APT BLK 932 TAMPINES STREET 91  
 #06-391  
 SINGAPORE 520932  
 Occupation/Nature of Business : Proprietor/Business Owner/Company Owner

## ABOUT THE VEHICLE

Registration No. : SLK5927T Engine Capacity/Tonnage : 1,798.00 CC  
 Chassis No. : WAUZZZ4G1HN047901 Engine No. : CYG017047  
 Seating Capacity : 5 First Year of Registration : 2017 Body Type : Sedan  
 Make/Model : AUDI A5 1.8 TFSI ULTRA  
 Hire Purchase Company/Employer's Loan : United Overseas Bank Limited

## ABOUT THE COVER

Sum Insured : Market Value Off Peak Car : No  
 Driver Restriction : NA Insuring with COE/PARF : Yes

## Person or Classes of Persons Entitled to Drive :

a) The Policyholder  
 b) Any other person who is driving on the Policyholder's order or with his/her permission  
 This Policy will indemnify the Policyholder or any authorised driver only if he/she meets the specified age condition.

You have to pay an additional sum of \$3,000 as "Young and/or Inexperienced Driver Excess" (YIDR) if You are of Your Authorised Driver (named or unnamed) is under the age of 23 and/or has less than 2 years' driving experience.

Age Condition : All Age Condition

Limitation as to use :

Use only for social, domestic and pleasure purposes and for the Policyholder's business. This Policy does not cover use for hire or reward, driving tuition, driving test, racing, pace-making, reliability trial or speed-testing, the carriage of goods other than samples in connection with any trade or business or use for any purpose in connection with Motor Trade.

## Other Key Policy Benefits :

Act of God, Strike, Riots and Civil Commotions, PA to Authorised Driver / Unnamed Passengers - \$10000, Dealer - AIG Authorised Workshops, PA Insured - \$100000, Fixture and Accessories (Cosmetic) - \$5000, Silver Film - \$1150, New For Old (36 months), In-Car Camera Excess Waiver, Glass Roof/ Moon Roof/ Sun Roof/ Panoramic Glass Roof, Loss of Use 1800cc - 2000cc Optional

## EXCESS

Section 1  
 Fire - \$0, Own Damage - \$800, Theft - \$0, Flood Cover - \$0

Section 2  
 Property Damage - \$0

Windscreen : \$100

Named Driver  
 LEE SAN SAN SUSANNA - \$800 (Own Damage)

## PREMIUM

Premium : \$ 1,714.37  
 GST (7%) : \$ 120.01

Total : \$ 1,834.38

Your Premium includes the following discount(s):

Safe Driver Discount - 5.00%, Group Discount - 10.00%, No Claim Discount - 50%

## ...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING							
Case	Nobified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'ed	Status
Main	13 Jun 2018		20 Jun 2018 10:43 <a href="#">Edit Adj Rpt</a>	<b>S\$52,461.20</b> <a href="#">Edit Estimates</a>	<b>S\$52,461.20</b> <a href="#">View Rpt</a>		<b>Pending for Survey Report</b> <a href="#">Cancel Case</a>

Main	Reference	Claim Details	Documents	Show All					
<b>CLAIM SUBFOLDER DETAILS</b>		[Created by insurer]							
Insured:	LEE SAN SAN SUSANNA, ID: S1814979F, Tel: +6597765730								
Vehicle Reg. No.:	SLK5927T	Date of Loss:	13/06/2018 09:00 - :59 [16 Months and 24 Days From LTA Reg Date (Man Yr)]						
Claim Type:	OD / 9098457916SG	Policy/Cover Note No.:	2100498699-01 (Comprehensive) Coverage: 20/01/2018 - 19/01/2019						
		Excess:	S\$0.00						
Repairer:	Premium Automobiles Pte Ltd (UBI) 55 Ubi Road 1, 408699 Ubi - Tel: 67689828/9827/9911								
Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd. (SG) - Tel: 65-6419-3000 ... [Handled by Dally Amri, Mimi Zarina] MimiZarina.DallyAmri@aig.com								
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by ADRIAN LING] ... [Final Rpt due 29/06/2018]								
Driver/Custodian:	LEE CHEE MING (44 / Male), NRIC: S7472190G, Tel: +6597765730								
<b>ASSOCIATED MAIL RECEIVED</b>			<a href="#">View All</a>	<a href="#">Compose Case Mail</a>					
<ul style="list-style-type: none"> <li>AIG_SG (04/07/2018): Alert - Adj Mandate Approved (S\$66182.00) - SLK5927T - Claim Handler: Dally Amri...</li> <li>AIG_SG (02/07/2018): Alert - Adj Mandate Maintained - SLK5927T - Claim Handler: Dally Amri, Mimi Zari...</li> <li>AIG_SG (25/06/2018): Alert - Adj Mandate Approved (S\$63624.00) - SLK5927T - Claim Handler: Dally Amri...</li> <li>AIG_SG (20/06/2018): Alert - Adj Mandate Approved (S\$48684.00) - SLK5927T - Claim Handler: Dally Amri...</li> <li>AIG_SG (20/06/2018): SLK5927T / OD / 13/06/2018 / Coverage &amp; Excess update</li> </ul>									
<b>ALL ASSOCIATED TASKS</b>			<a href="#">View All</a>	<a href="#">Search Tasks</a>					
			<a href="#">Create New Task</a>	<a href="#">Complete</a>					
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

## Claim Documents

\*SLK5927T (9098457916SG)  
 OD  
 Jun 13 2018 9:45AM  
 [LEE SAN SAN SUSANNA]  
 Premium Automobiles Pte Ltd

<a href="#">Upload Documents</a>   <a href="#">Upload Photos</a>   <a href="#">Compose New Letter</a>   <a href="#">Upload Video</a>   <a href="#">Upload Audio</a>			View	View in Browser
<b>Assessment Reports</b>			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	20/06/18 11:52	<b>Adjuster Immediate Advice</b>	Load HTM	<input type="checkbox"/>
2	25/06/18 12:35	<b>Adjuster Immediate Advice</b>	Load HTM	<input type="checkbox"/>
3	02/07/18 10:29	<b>Adjuster Immediate Advice</b>	Load HTM	<input type="checkbox"/>
<b>Photos/Images</b>			3 per page	<input checked="" type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	20/06/18 12:16	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
2	20/06/18 12:16	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
3	20/06/18 12:16	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
4	20/06/18 12:16	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
5	20/06/18 12:16	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
6	20/06/18 12:16	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
7	20/06/18 12:16	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
8	20/06/18 12:16	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
9	20/06/18 12:16	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
10	20/06/18 12:16	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
11	20/06/18 12:16	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
12	20/06/18 12:16	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
13	20/06/18 12:16	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
14	20/06/18 12:16	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
15	20/06/18 12:16	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
16	20/06/18 12:16	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
17	20/06/18 12:16	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
18	20/06/18 12:16	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
19	20/06/18 12:16	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
20	20/06/18 12:16	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
21	20/06/18 12:16	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
22	20/06/18 12:16	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
23	20/06/18 12:16	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
24	20/06/18 12:16	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
25	20/06/18 12:16	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
26	20/06/18 12:16	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
27	20/06/18 12:16	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
28	20/06/18 12:16	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
29	20/06/18 12:16	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
30	20/06/18 12:16	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
31	20/06/18 12:16	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
32	20/06/18 12:16	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>
33	20/06/18 12:16	<b>General View</b>	Load JPG	<input checked="" type="checkbox"/>

Assessment Reports			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
34	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
35	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
36	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
37	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
38	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
39	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
40	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
41	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
42	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
43	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
44	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
45	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
46	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
47	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
48	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
49	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
50	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
51	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
52	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
53	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
54	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
55	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
56	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
57	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
58	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
59	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
60	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
61	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
62	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
63	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
64	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
65	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
66	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
67	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
68	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
69	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
70	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
71	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
72	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
73	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
74	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
75	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
76	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
77	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
78	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
79	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
80	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
81	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
82	20/06/18 12:16	General View		<input checked="" type="checkbox"/>
83	20/06/18 12:16	General View		<input checked="" type="checkbox"/>

Assessment Reports			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
84	20/06/18 12:16	General View	 Load JPG	<input checked="" type="checkbox"/>
85	20/06/18 12:16	General View	 Load JPG	<input checked="" type="checkbox"/>
86	20/06/18 12:16	General View	 Load JPG	<input checked="" type="checkbox"/>
87	20/06/18 12:16	General View	 Load JPG	<input checked="" type="checkbox"/>
88	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
89	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
90	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
91	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
92	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
93	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
94	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
95	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
96	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
97	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
98	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
99	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
100	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
101	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
102	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
103	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
104	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
105	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
106	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
107	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
108	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
109	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
110	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
111	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
112	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
113	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
114	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
115	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
116	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
117	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
118	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
119	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
120	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
121	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
122	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
123	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
124	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
125	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
126	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
127	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
128	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
129	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
130	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
131	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
132	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
133	02/07/18 13:54	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>

Assessment Reports			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
134	02/07/18 13:54	Reinspection Photo		<input checked="" type="checkbox"/>
135	02/07/18 13:54	Reinspection Photo		<input checked="" type="checkbox"/>
136	02/07/18 13:54	Reinspection Photo		<input checked="" type="checkbox"/>
137	02/07/18 13:54	Reinspection Photo		<input checked="" type="checkbox"/>
138	02/07/18 13:54	Reinspection Photo		<input checked="" type="checkbox"/>
139	02/07/18 13:54	Reinspection Photo		<input checked="" type="checkbox"/>
140	02/07/18 13:54	Reinspection Photo		<input checked="" type="checkbox"/>
141	02/07/18 13:54	Reinspection Photo		<input checked="" type="checkbox"/>
142	02/07/18 13:54	Reinspection Photo		<input checked="" type="checkbox"/>
143	02/07/18 13:54	Reinspection Photo		<input checked="" type="checkbox"/>
144	02/07/18 13:54	Reinspection Photo		<input checked="" type="checkbox"/>
145	05/11/18 12:53	Reinspection Photo		<input checked="" type="checkbox"/>
146	05/11/18 12:53	Reinspection Photo		<input checked="" type="checkbox"/>
147	05/11/18 12:53	Reinspection Photo		<input checked="" type="checkbox"/>
148	05/11/18 12:53	Reinspection Photo		<input checked="" type="checkbox"/>
149	05/11/18 12:53	Reinspection Photo		<input checked="" type="checkbox"/>
150	05/11/18 12:53	Reinspection Photo		<input checked="" type="checkbox"/>
151	05/11/18 12:53	Reinspection Photo		<input checked="" type="checkbox"/>
152	05/11/18 12:53	Reinspection Photo		<input checked="" type="checkbox"/>
153	05/11/18 12:53	Reinspection Photo		<input checked="" type="checkbox"/>
154	05/11/18 12:53	Reinspection Photo		<input checked="" type="checkbox"/>
155	05/11/18 12:53	Reinspection Photo		<input checked="" type="checkbox"/>
156	05/11/18 12:53	Reinspection Photo		<input checked="" type="checkbox"/>
157	05/11/18 12:53	Reinspection Photo		<input checked="" type="checkbox"/>
158	05/11/18 12:53	Reinspection Photo		<input checked="" type="checkbox"/>
159	05/11/18 12:53	Reinspection Photo		<input checked="" type="checkbox"/>
160	05/11/18 12:53	Reinspection Photo		<input checked="" type="checkbox"/>
161	05/11/18 12:53	Reinspection Photo		<input checked="" type="checkbox"/>
162	05/11/18 12:53	Reinspection Photo		<input checked="" type="checkbox"/>
163	05/11/18 12:53	Reinspection Photo		<input checked="" type="checkbox"/>
164	05/11/18 12:53	Reinspection Photo		<input checked="" type="checkbox"/>
165	05/11/18 12:53	Reinspection Photo		<input checked="" type="checkbox"/>
166	05/11/18 12:53	Reinspection Photo		<input checked="" type="checkbox"/>
167	05/11/18 12:53	Reinspection Photo		<input checked="" type="checkbox"/>
168	05/11/18 12:53	Reinspection Photo		<input checked="" type="checkbox"/>
169	05/11/18 12:53	Reinspection Photo		<input checked="" type="checkbox"/>
170	05/11/18 12:53	Reinspection Photo		<input checked="" type="checkbox"/>
171	05/11/18 12:53	Reinspection Photo		<input checked="" type="checkbox"/>
172	05/11/18 12:53	Reinspection Photo		<input checked="" type="checkbox"/>
173	05/11/18 12:53	Reinspection Photo		<input checked="" type="checkbox"/>
174	05/11/18 12:53	Reinspection Photo		<input checked="" type="checkbox"/>
175	05/11/18 12:53	Reinspection Photo		<input checked="" type="checkbox"/>
176	05/11/18 12:53	Reinspection Photo		<input checked="" type="checkbox"/>
177	05/11/18 12:53	Reinspection Photo		<input checked="" type="checkbox"/>
178	05/11/18 12:53	Reinspection Photo		<input checked="" type="checkbox"/>
179	05/11/18 12:53	Reinspection Photo		<input checked="" type="checkbox"/>
180	05/11/18 12:53	Reinspection Photo		<input checked="" type="checkbox"/>
181	05/11/18 12:53	Reinspection Photo		<input checked="" type="checkbox"/>
182	05/11/18 12:53	Reinspection Photo		<input checked="" type="checkbox"/>
183	05/11/18 12:53	Reinspection Photo		<input checked="" type="checkbox"/>

Assessment Reports			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
184	05/11/18 12:53	Reinspection Photo		Load JPG <input checked="" type="checkbox"/>
185	05/11/18 12:53	Reinspection Photo		Load JPG <input checked="" type="checkbox"/>
186	05/11/18 12:53	Reinspection Photo		Load JPG <input checked="" type="checkbox"/>
187	05/11/18 12:53	Reinspection Photo		Load JPG <input checked="" type="checkbox"/>
188	05/11/18 12:53	Reinspection Photo		Load JPG <input checked="" type="checkbox"/>
189	05/11/18 12:53	Reinspection Photo		Load JPG <input checked="" type="checkbox"/>
190	05/11/18 12:53	Reinspection Photo		Load JPG <input checked="" type="checkbox"/>
Documentation			1 per page	<input checked="" type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	20/06/18 12:15	SLK 5927T ESTIMATE		Load PDF
2	20/06/18 12:15	SLK 5927T NRIC AND DL		Load PDF
3	20/06/18 12:15	Singapore Accident Statement		Load PDF
4	25/06/18 12:26	SLK 5927T FAULT CODE		Load PDF
5	25/06/18 12:26	SLK 5927T SUPPLEMENTARY		Load PDF
6	02/07/18 10:17	SLK 5927T SUPPLEMENTARY 2		Load PDF
7	06/12/18 09:12	Workshop Invoice		Load PDF
8	06/12/18 09:12	Discharge Voucher		Load PDF

### Linked Accident Report Documents

Assessment Reports			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
1	13/06/18 20:42	Accident Statement		Load HTM
Photos/Images			3 per page	<input checked="" type="checkbox"/>
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
1	13/06/18 20:41	Accident Photo		Load JPG <input checked="" type="checkbox"/>
2	13/06/18 20:41	Accident Photo		Load JPG <input checked="" type="checkbox"/>
3	13/06/18 20:41	Accident Photo		Load JPG <input checked="" type="checkbox"/>
4	13/06/18 20:41	Accident Photo		Load JPG <input checked="" type="checkbox"/>
5	13/06/18 20:41	Accident Photo		Load JPG <input checked="" type="checkbox"/>
6	13/06/18 20:41	Accident Photo		Load JPG <input checked="" type="checkbox"/>
7	13/06/18 20:41	Accident Photo		Load JPG <input checked="" type="checkbox"/>
8	13/06/18 20:41	Accident Photo		Load JPG <input checked="" type="checkbox"/>
9	13/06/18 20:41	Accident Photo		Load JPG <input checked="" type="checkbox"/>
10	13/06/18 20:41	Accident Photo		Load JPG <input checked="" type="checkbox"/>
11	13/06/18 20:41	Accident Photo		Load JPG <input checked="" type="checkbox"/>
12	13/06/18 20:41	Accident Photo		Load JPG <input checked="" type="checkbox"/>
Documentation			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	Premium Automobiles Pte Ltd (UBI)	Thumbnail	Print
1	13/06/18 20:38	Sketch Plan		Load JPG <input checked="" type="checkbox"/>
2	13/06/18 20:38	Sketch Plan #2		Load JPG <input checked="" type="checkbox"/>

### Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			

**Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)**

**Show Remarks To:**  Handling Insurer

Note: Remarks are private unless you show it to other parties.

## LKK Auto Consultants Pte Ltd (Co.Reg No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park  
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

### VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.  
AIG Building, 78 Shenton Way #07-16  
Singapore 079120

**Our File No:** CC3/AIG18011162/ARBE2  
**Date:** 06/12/2018

#### REFERENCE

Insured/Claimant:	LEE SAN SAN SUSANNA	Policy No:	2100498699-01	
Date of Loss:	13/06/2018	Nature of Claim:	OD	Claim No: 9098457916SG

#### DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SLK5927T	Engine No:	CYG017047
Make & Model:	AUDI A6, 1.8 TFSI S-tronic (C7) (A)	Chassis No:	WAUZZZ4G1HN047901
Reg. Date:	20/01/2017 (Man. Year: 2016)	Odometer:	44928 km
Colour:	Black		
Engine Capacity:	1798 cc		
Market Value/New Car Price:	S\$155,000.00		
Sum Insured (S\$):	<b>Market Value/New Car Price</b>		

#### CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

#### CONDITION OF TYRES

Front Tyre Size:	255/35 R20	Rear Tyre Size:	255/35 R20
Front Left Side:	Pirelli 6 mm	Rear Left Side:	Pirelli 6 mm
Front Right Side:	Pirelli 6 mm	Rear Right Side:	Pirelli 6 mm

*The above values represent the remaining tyre treads depth*

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	66,240.04	37,619.20	28,620.84	43.21
Miscellaneous Items	0.00	0.00	0.00	
Labour	23,292.00	14,842.00	8,450.00	36.28
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Gross Total (S\$)</b>	<b>89,532.04</b>	<b>52,461.20</b>	<b>37,070.84</b>	<b>41.41</b>
<b>+ GST 7.00/7.00% (S\$)</b>	<b>6,267.24</b>	<b>3,672.28</b>	<b>2,594.96</b>	<b>41.41</b>
<b>Nett Amount (S\$)</b>	<b>95,799.28</b>	<b>56,133.48</b>	<b>39,665.80</b>	<b>41.41</b>

#### INSPECTION

Date of Assignment:	20/06/2018		
Date Inspected:	19/06/2018	Inspected At:	Premium Automobiles Pte Ltd (UBI) 55 Ubi Road 1 Singapore 408699
Estimated Period of Repair:	16.0 days		

**Adjuster:** ADRIAN LING

**Manager:** Janice Lee Si Hua

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*



## REPAIR DETAILS

## Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Distorted	2,650.00 FS	*2,120.00 FS
2	1		*FRONT BUMPER GRILLE - LOWER CENTRE	Not Necessary	112.00 FS	*- FS
3	14		*FRONT BUMPER LOCKING CLIP	Not Necessary	48.00 FS	*- FS
4	1		*FRONT BUMPER CLOSING ELEMENT	Not Necessary	188.00 FS	*- FS
5	1		*RADIATOR COVER	Cracked	32.00 FS	*24.96 FS
6	1		*FRONT BUMPER FIXING PARTS	Not Necessary	464.00 FS	*- FS
7	1		*FOAM FILLER PIECE	Deformed	203.00 FS	*162.40 FS
8	1		*FRONT BUMPER SIDE REINFORCEMENT	Bent	702.00 FS	*561.60 FS
9	2		*FRONT BUMPER HOLDER BRACKET - LH/RH	Not Necessary	446.00 FS	*- FS
10	1		*FRONT BUMPER COVER	Deformed	105.00 FS	*84.00 FS
11	1		*SIGN CUTION	Necessary	12.00 FS	*9.28 FS
12	2		*FRONT SENSOR - INNER	Not Necessary	392.00 FS	*- FS
13	2		*FRONT SENSOR SUPPORT - LH/RH	Not Necessary	118.00 FS	*- FS
14	2		*FRONT BUMPER GUIDE SECTION - LH/RH	Not Necessary	64.00 FS	*- FS
15	2		*FRONT FENDER LH / RH	Repair	2,440.00 FS	*- FS
16	2		*FRONT FENDER ATTACHMENT PARTS	Not Necessary	175.00 FS	*- FS
17	2		*FRONT STONE GUARD FILM - LH/RH	Necessary	210.00 FS	*167.20 FS
18	2		*FRONT FENDER BRACE - LH/RH	Not Necessary	144.00 FS	*- FS
19	2		*FRONT WHEEL SPOILER - LH/RH	Not Necessary	464.00 FS	*- FS
20	2		*FRONT AIR GUIDE GRILLE - LH/RH	Not Necessary	868.00 FS	*- FS
21	2		*FRONT AIR GUIDE GRILLE COVER - LH/RH	Not Necessary	88.00 FS	*- FS
22	2		*LED HEADLIGHT - LH/RH	Cut	16,772.00 FS	*13,417.60 FS
23	1		*HEADLIGHT MOUNTING - LH/RH	O/S Damaged	206.00 FS	*82.40 FS
24	2		*HEADLIGHT LIFT CYLINDER - LH/RH	Not Necessary	416.00 FS	*- FS
25	1		*BONNET	Buckled	4,771.00 FS	*3,816.80 FS
26	1		*BONNET ATTACHMENT PARTS	Not Necessary	153.00 FS	*- FS
27	1		*BONNET CATCH HOOK	Not Necessary	122.00 FS	*- FS
28	2		*FRONT BONNET LOCK BAR	Not Necessary	87.00 FS	*- FS
29	2		*BONNET LID LOCK	Not Necessary	376.00 FS	*- FS
30	1		*RADIATOR LOCK CARRIER	Not Necessary	1,024.00 FS	*- FS
31	2		*AIR GUIDE - LH/RH	Not Necessary	48.00 FS	*- FS
32	1		*INTERCOOLER	Not Necessary	492.00 FS	*- FS
33	1		*A/C CONDENSER	Not Necessary	683.00 FS	*- FS
34	1		*RADIATOR	Not Necessary	752.00 FS	*- FS
35	2		*RADIATOR RUBBER BUSH - UPPER	Not Necessary	12.00 FS	*- FS
36	2		*RADIATOR RUBBER BUSH - CENTER	Not Necessary	17.00 FS	*- FS
37	2		*RADIATOR RUBBER BUSH - LOWER	Not Necessary	23.00 FS	*- FS
38	4		*READY-MIX COOLANT	Not Necessary	82.00 FS	*- FS
39	1		*TWIN FAN RING	Not Necessary	226.00 FS	*- FS
40	2		*RADIATOR FAN	Not Necessary	1,439.00 FS	*- FS
41	1		*FRONT NO PLATE	Bent	25.00 FS	*25.00 FS
42	1		*RADIATOR GRILLE	Cracked	1,697.00 FS	*1,357.60 FS
43	1		*REAR BUMPER	Distorted	2,519.00 FS	*2,015.20 FS
44	1		*REAR BUMPER FIXING PARTS	Not Necessary	234.00 FS	*- FS
45	1		*REAR BUMPER SPOILER	Distorted	416.00 FS	*332.80 FS
46	1		*REAR BUMPER SECURING STRIP	Not Necessary	191.00 FS	*- FS
47	4		*REAR SENSOR	Not Necessary	842.00 FS	*- FS
48	2		*REAR BUMPER CLOSING ELEMENT - LH/RH	Not Necessary	138.00 FS	*- FS
49	1		*REAR BUMPER WIRING	Not Necessary	603.00 FS	*- FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
50	1		*REAR BUMPER CARRIER	Bent	851.00 FS	*680.40 FS
51	2		*REAR BUMPER SEAL - LH/RH	Not Necessary	24.00 FS	*- FS
52	2		*REAR BUMPER GUIDE SECTION - LH/RH	Not Necessary	56.00 FS	*- FS
53	2		*REAR BUMPER CONNECTION PIECE	Not Necessary	21.00 FS	*- FS
54	2		*REAR BUMPER UPPER GUIDE SECTION - LH/RH	Not Necessary	92.00 FS	*- FS
55	2		*REAR BUMPER GUIDE PROFILE - LH/RH	Damaged	114.00 FS	*45.28 FS
56	1		*REAR BUMPER GUIDE SECTION - CENTER	Cracked	91.00 FS	*72.32 FS
57	2		*REAR BUMPER HOLDING STRAP - LH/RH	Not Necessary	108.00 FS	*- FS
58	2		*EXHAUST TAIL PIPE TRIM - LH/RH	Not Necessary	994.00 FS	*- FS
59	1		*BOOT LID CONTROL UNIT	Not Necessary	372.00 FS	*- FS
60	1		*TAILGATE SENSOR LINE	Not Necessary	184.00 FS	*- FS
61	13		*CABLE TERMINAL	Not Necessary	84.00 FS	*- FS
62	1		*REAR LID	Distorted	2,485.00 FS	*1,988.00 FS
63	1		*REAR LID BRACKET	Not Necessary	30.00 FS	*- FS
64	2		*REAR LID HINGE - LH/RH	Not Necessary	400.00 FS	*- FS
65	1		*PUSH BOTTON FOR LID LOCK ACTUATOR	Not Necessary	1,181.00 FS	*- FS
66	1		*FLAP GASKET	Not Necessary	181.00 FS	*- FS
67	4		*REAR LID STOP BUFFER	Not Necessary	5.00 FS	*- FS
68	1		*REAR LID LOCK	Not Necessary	170.00 FS	*- FS
69	1		*REAR LID LOCK COVER	Not Necessary	7.00 FS	*- FS
70	1		*STRIKER PLATE	Not Necessary	550.00 FS	*- FS
71	1		*PACKING ADHESIVE	Necessary	15.00 FS	*11.60 FS
72	1		*AUDI EMBLEM	Necessary	108.00 FS	*86.00 FS
73	1		*INSCRIPTION A6	Necessary	83.00 FS	*66.16 FS
74	1		*INSCRIPTION TFSI	Necessary	83.00 FS	*66.16 FS
75	1		*REAR LID DECORATIVE FILM	Necessary	317.00 FS	*253.20 FS
76	2		*LED TAIL LIGHT - LH/RH	Cut	2,188.00 FS	*1,750.40 FS
77	2		*TAIL LIGHT TRIM - LH/RH	Cut	52.00 FS	*40.16 FS
78	1		*REAR CROSS PANEL	Distorted	274.00 FS	*219.20 FS
79	1		*REAR CROSS PANEL REINFORCEMENETY	Distorted	639.00 FS	*511.20 FS
80	2		*REAR CROSS PANEL CONNECTION PLATE - LH/RH	Not Necessary	78.00 FS	*- FS
81	1		*REAR CROSS PANEL TRIM	Deformed	116.00 FS	*92.80 FS
82	1		*SPARE WHEEL WELL	Not Necessary	202.00 FS	*- FS
83	1		*LUGGAGE COMPARTMENT FLOOR	Deformed	577.00 FS	*461.20 FS
84	1		*LUGGAGE COMPARTMENT TRIM - LH	Not Necessary	676.00 FS	*- FS
85	1		*REAR NO. PLATE	Bent	25.00 FS	*25.00 FS
86	1		*ACRYLIC SEALER	Necessary	180.00 FS	*180.00 FS
87	1		*CAVITY WAX	Necessary	140.00 FS	*140.00 FS
88	1		*STONE CHIP	Necessary	180.00 FS	*180.00 FS
89	1		*SUNDRIES	Necessary	1,000.00 FS	*136.24 FS
90	1		*AIR GUIDE - RHS	Damaged	18.64 FS	*18.64 FS
91	1		*A/C CONDENSER	Bent	546.00 FS	*546.00 FS
92	1		*RADIATOR	Bent	601.20 FS	*601.20 FS
93	1		*RUBBER BUSH	Necessary	40.00 FS	*40.00 FS
			(6PCS)			
94	1		*PREMIX COOLANT	Necessary	65.28 FS	*65.28 FS
95	1		*FRONT BUMPER GUIDE - LHS	Not Necessary	57.00 FS	*- FS
96	1		*HOLDING STRAP - LHS/RHS	Damaged	85.92 FS	*85.92 FS
97	1		*AIRBAG CONTROL UNIT	Activated	1,806.40 FS	*1,806.40 FS
98	2		*FRONT CRASH SENSOR	Not Necessary	522.00 FS	*- FS
99	1		*FRONT SEATBELT - LHS	Activated	972.00 FS	*972.00 FS
100	1		*FRONT SEATBELT - RHS	Activated	764.80 FS	*764.80 FS
101	2		*SEATBELT ADJUSTER	Activated	248.80 FS	*248.80 FS
102	1		*BATTERY CUT - OFF PROTECTION FUSE	Activated	412.80 FS	*412.80 FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
103	1		*LHS TAILLAMP	Cracked	875.20 FS	*875.20 FS
F=Franchise part. S=SpcNett.						
				<b>Total Parts (S\$)</b>	<b>66,240.04</b>	<b>37,619.20</b>

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<b>Labour Items</b>				
1	TO REMOVE AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS, FOG LAMPS, OUTSIDE TEMPERATURE SENSOR, HEADLIGHT WASHER ASSY AND FRONT PARKING AID	New	480.00	480.00
2	TO REMOVE AND RENEW AIRCON CONDENSOR, RADIATOR, CHARGED AIR COOLER, ELECTRICAL FANS AND CONTROL UNIT. TO CARRY OUT VACUUM / REGAS AND TO PRESSURISE COOLING SYSTEM	New	1,100.00	1,100.00
3	TO DISMANTLE FRONT BUMPER, BOTH FRONT FENDERS AND BONNE. RENEW FRONT LOCK CARRIER AND ALIGN TO POSITION. RENEW FRONT BUMPER, BOTH FRONT FENDERS, BONNET AND HEADLIGHTS. RE-ORGANISE FRONT CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED	New	6,300.00	1,500.00
4	TO RESPRAY FRONT BUMPER, BOTH FENDERS AND BONNET	New	3,300.00	2,200.00
5	TO REMOVE AND TRANSFER REAR PARKING AID AND REAR LID KICK SENSOR ASSY. CHECK FUNCTION AND RENEW ACCORDNG TO DAMAGE	New	360.00	360.00
6	TO REMOVE AND TRANSFER REAR LIDS CONVENIENCE LOCK SYSTEM AND WIRE HARNESS FOR TAIL LIGHTS	New	280.00	280.00
7	TO DISLodge AND REINSTALL REAR WIRE HARNESS FOR TAIL LIGHTS, BATTERY MANAGER, FUSE AND RELAY TRAYS, ELECTRICAL AND AUDIO COMPONENTS	New	480.00	480.00
8	TO DISMANTLE REAR BUMPER AND REAR LID. CUT OUT AND WELD REAR OUTER AND INNER REAR CROSS PANELS. RE-ALIGN REAR LOCK CARRIER AND RENEW REAR BUMPER AND REAR LID. RE-ORGANISE REAR CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED	New	4,200.00	3,000.00
9	TO RESPRAY REAR BUMPER, REAR LID AND END PANELLING. TO CARRY OUT JOINT SEALER WORKS AND STONE CHIP TREATMENT	New	2,400.00	1,650.00
10	TO CARRY OUT DIAGNOSTIC CHECK	New	192.00	192.00
11	TO REPAIR AND RESPRAY LHS REAR FENDER	New	1,400.00	800.00
12	TO DISMANTLE CENTRE CONSOLE ASSY, RENEW AIRBAG CONTROL UNIT, BOTH FRONT SEAT BELTS AND BATTERY CUT OFF FUSE	New	2,800.00	2,800.00
<b>Gross Labour Cost (\$\$)</b>			<b>23,292.00</b>	<b>14,842.00</b>

Report was unsubmitted during this print-out.

< END OF ESTIMATES >