

**PROGRESSIVE
AUTOMOTIVE PTE LTD
BLK 3022A UBI ROAD 1
#01-45/46
SINGAPORE 408716
Email: progauto@progauto.
com.sg**

**Claim Reference: TP 0618-5117
Assessment Number: PA001554
Version: PROGRESS/1**

**Full Report - V1
Registration: SJR8220R
Printed: 27/06/2018 11:50**

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	Ray Lin	Date of Incident:	20/06/2018
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	AXA Insurance S'pore Pte Ltd	Repairs Authorised:	TBA
Claim Reference:	TP 0618-5117	Estimated Repair Time:	
Policy Number:	GA349963/1	Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:	True	Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	HONDA
Model:	Freed
Sub Model:	G
Model Sheet Number:	HFD 07
Registration:	SJR8220R
Registration Month:	July
Registration Year:	2009
VIN Number:	
Manufacture Year:	2008
Odometer:	123597
Colour:	Other
Engine Number:	
Fuel Level:	%

Model Specs

AIR CONDITIONING	TOUCHSCREEN
1.5 LTR 65 KW	CRUISE CONTROL
TAILGATE OPENING	TWO COAT METALLIC
PREPARE OFF VEHICLE	

*Not Allowed
after
Take photo before
painting
9/7/18
4chry.*

Vehicle Condition

Vehicle Status

Pre-Accident Condition:	Fair
Steering:	

Brakes Pedal Travel:	
Place of Inspection:	
Pre-Accident Damage:	

Tyres Condition:	Fair
Tread Depth LHF:	
Tread Depth LHR:	
Damage Areas:	

Severity of Impact:	
Vehicle Status on Inspection:	

Date of Inspection: 26/06/2018

Inspected Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and approved by Insurance Company

Tread Depth RHF:

Tread Depth RHR:

Direction of Impact:

Acknowledged by Repairer



Signature:

Date:

PROGRESSIVE AUTOMOTIVE PTE LTD

Claim Reference: TP 0618-5117
Assessment Number: PA001554
Version: PROGRESS/1

Full Report - V1
Registration: SJR8220R
Printed: 27/06/2018 11:50

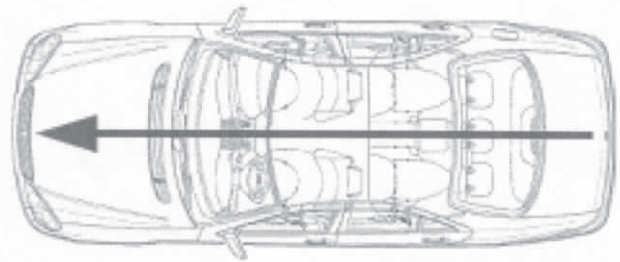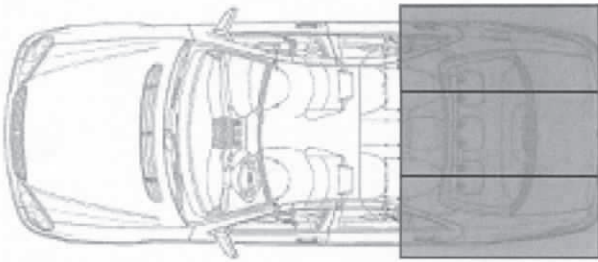

Addresses

Repairer

Name : PROGRESSIVE
Address :
Post Code :

Cost Summary

Total Labour	\$1,075.50
Total Paint/Material	\$241.03
Total Parts	\$1,771.00
Total of Additional Costs	\$402.00
Excess:	TBA
Grand Total Exc GST:	\$3,489.53
7 % GST:	\$244.27
Grand Total Inc GST:	\$3,733.80

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$45.00/HR
Price/Dent = \$45.00/HR

Repair /

Guide Number Repair Details

		WU	Cost Price (\$)
NO NUMBER	R + R L/INDICATOR	2.0	9.00
NO NUMBER	R + R L/R SIDE PANEL TRIM	2.0	9.00
NO NUMBER	RENEW L/RR BUMPER SUPPORT	1.0	4.50
NO NUMBER	R + R TAILGATE SEAL	3.0	13.50
NO NUMBER	RENEW REAR PANEL	8.0	36.00
NO NUMBER	RENEW REAR BUMPER	5.0	22.50
	INCLUDES: BUMPER AND ALL		
	REQUIRED ATTACHED PARTS R + R		
NO NUMBER	RENEW TAILGATE	25.0	112.50
	INCLUDES: TAILGATE, REAR SCREEN AND		
	REQUIRED ATTACHED PARTS R + R.		
	ADJUST TAILGATE.		
NO NUMBER	R + R R/INDICATOR	2.0	9.00
NO NUMBER	R + R R/R SIDE PANEL TRIM	2.0	9.00
NO NUMBER	RENEW R/RR BUMPER SUPPORT	1.0	4.50
NO NUMBER	R + R L/SEAT CPL 3RD SEAT ROW	3.0	13.50
NO NUMBER	R + R R/SEAT CPL 3RD SEAT ROW	3.0	13.50
2696	REMOVE AND REFIT PARKING HELP SYSTEM	5.0*	22.50
3481	REPAIR L/R SIDE PANEL	11 5.0*	22.50
3482	REPAIR R/R SIDE PANEL	5.0*	22.50
3572	REPAIR R/R DRIP RAIL	10.0*	45.00
3900	REPAIR BOOTFLOOR CPL	10.0*	45.00
3905	REPAIR CTR REAR CROSSMEMBER	20.0*	90.00

LABOUR COST

Total Work Units

112.0

PROGRESSIVE AUTOMOTIVE PTE LTD

Claim Reference: TP 0618-5117
Assessment Number: PA001554
Version: PROGRESS/1

Full Report - V1
Registration: SJR8220R
Printed: 27/06/2018 11:50

Sub Total	11.2HRS	\$504.00
Paint Labour	12.7HRS	571.50
Total Labour	23.9HRS	\$1,075.50

PAINT WORK		Time Basis 10 WU = 1 HR. Price = \$45.00/HR	
Guide Number	Description	WU	Cost Price (\$)
	- TWO COAT METALLIC		
	- PREPARE OFF VEHICLE		
2711	REAR PANEL NEW PART PAINTING	17.0	
2931	BOOTLID/TAILGATE NEW PART PAINTING	19.0	
2583	REAR BUMPER NEW PART PAINT K1R	12.0	
3481	L/R SIDE PANEL REPAIR PAINTING <50%	14.0	
3482	R/R SIDE PANEL REPAIR PAINTING <50%	14.0	
3572	R/R DRIP RAIL REPAIR PAINTING <50%	8.0	
3900	BOOTFLOOR CPL SURFACE PAINT	9.0	
3905	CTR REAR CROSSMEMBERSURFACE PAINT	4.0	
LABOUR COST - PAINT			
	TIME(PAINT)	97.0	
	Preparation Main Work Plastic	5.0	
	Preparation Main Work Metal	25.0	
	Preparation Work Multi Layer Paint	0.0	
	Total Work Units (10WU/HR)	127.0	
	Total Paintwork Labour	12.7HRS	\$571.50
MATERIAL COST - PAINT			
	Cost Price		
	New Part Painting		\$74.43
	New Part Painting - Plastic K1R		\$55.10
	Material-Constant Main Work Metal		\$28.60
	Surface-/Blend Paint		\$27.39
	Repair Painting		\$46.51
	Material-Const Main Work Plastic		\$9.00
	Total Excluding Pearlescent Uplift		\$241.03
	Pearlescent Uplift @ 0.0%		\$0.00
	Total Paint Material Cost		\$241.03

PARTS

Guide No. Qty		Description	Part Number	Supplier	Price Valid: 01/06/2015	Bet.	Price (\$)
2711	1	REAR PANEL	65800SZY300ZZ		R	0% 20W4	170.00*
2931	1	BOOTLID/TAILGATE	68100SZYT01ZZ		30/100	0%	650.00*
2583	1	REAR BUMPER	71501SZYT00ZZ		20/02	0%	180.00*
2620	1	R/R BUMPER BRACKET	71593SYY003			0%	14.00*
2619	1	L/R BUMPER BRACKET	71598SYY003			0%	14.00*
3162	1	LWR REAR SCREEN SEAL	73226SYY000		ru	0%	60.00*
2944	1	BOOT/TAILGATE SEAL	74440SZYT01		ru	0%	55.00*
2933	1	BOOT/TAILGATE LOCK	74801TF0902		ru	0%	60.00*
2973	1	REAR LOCK STRIKER	74813SEY003		ru	0%	15.00*
3015	1	BADGE HONDA	75701SYY003		ru	0%	20.00*
3016	1	REAR BADGE	75722SZYT00		ru	0%	32.00*
4904	1	REAR PANEL TRIM	84640SZYT01ZA			0%	40.00*
1000	1	REAR BUMPER SENSOR	Renew	refer to SN	0%	200	220.00*
2650	1	RR BUMPER CLAMP KIT	USE SINGLE PARTS		ru	0%	10.00*
f: OEM Parts			Sub Total				\$1,540.00
g: Original			Sundry Parts	(Fixed)			\$0.00