

REF: CS/ASM18011905/ Ked302

Spec of Instructions

Surveyor

ASSIGNMENT (Office)

From (Person)

Yvonne Frey

or

ASM (AXA)

Date/Time

29/06/2018

Estimated Cost

Bill for

① / .E WS/TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No.

SJY 1577X

Insured:

at Workshop no:

Ah Lim Motor

Tel:

6483 1244

of

10 Amk Ind. Park 2A # 01-209

Policy No.

Claim No:

88 M00M70

Sum Insured

Excess:

\$1,400-00

Make of Veli

D.O.A

26/06/2018

(Client's Record)

02/07/2018

② / REV / REP. / REV 24 HRS

H.O.D. Endorsement:

Date/Time

157pm @ 29/6/18

Person Contacted:

Zila

Vehicle

③ IN/OUT

Date/Time

Action/Instruction (✓) Estimate

SJY 1577X - NBA / INC180116S3/Y

DOA 26/06/2018

5/7/18

Revert this smart claim

(08/10/13) W01

ASS. REC. BY:

REF: ASM (AXA)

ASSIGNMENT

From: Date: 02/07/2018

Estimated Cost:

☒ ON / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SJY 1577X

at Workshop m/s Ah Lim Motor

of 10 AMK Ind. park 2A #01-209

Insured:

Policy No:

Claims No:

Sum Insured: Excess: \$1,100.00

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value: \$38k

IDAC Accident Rpt: Consistent? : Yes or No

GIA / PR. Seen: Consistent? : Yes or No

Est. Repairs: days Res.: Yes or No

Lump Sum: % 3 Val.: Yes or No

☒ CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: Person Contacted:

Veh No: SJY 1577X Yr Regn: 08, 10

Type: ☒ M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: M. B180 c.c. 1699

Colour: M. Grey A/C: Insured / Std / NI / NA

Sp. Reading: 920319 T/Radio: Insured / Std / NI / NA

Eng/No:

C/No: WDD 2452322 J 575648

Gen. Cond: ☒ Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD / Rim or

Tyre Size: F: Nexen 215/45R17

R: Mic

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

R/Bal. 8 mm

L/Bal. 8 mm

D.O.A. 26/6/18

Rear

R/Bal. 6 mm

L/Bal. 6 mm

D.O.I. 21/7/18

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

N/S & U/C

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

22/1 / 7 File pass to Corrine

Confirmed final Stg \$9,101.38 with Mui Heng. (Ref 5412.16, 372)

Date/Time, File Pass to?

☐ : Preli. Report

Days Of Repair: 7

Resurvey No. of Trip: 3

Survey Fee:

290

1)

☐ : Final Report

Transportation:

Date/Time, File Return to?

\$ + RS. SI

2)

Add Fee: ☐ : Site Insp (\$)

Photos

☐ : Interview (\$)

Others

☐ : Tech. Invs (\$)☐ : Weekend (\$)

TOTAL

290

Report Format : 00

Lump Sum / I.B.I. (\$ 9,101.38)



Service Request Details

Claim

S8M00M7O

Reference

None 

Loss Date

June 26, 2018

Request Date

June 29, 2018

Due Date

July 6, 2018

Vendor Name

LKK AUTO CONSULTANTS PTE LTD (OD)

Type of Loss

Own Damage

Services

Accelerated survey and authorize

Actions

Next Step

Agree to perform service

Decline Work

Accept Work

Vehicle Information

Incident Vehicle Registration #

SJY1577X

Make

MERCEDES

Model

B180

Service Address

10 Ang Mo Kio Ind. Park 2A, , , 568047

Primary Contact/Insured

HOO KOK PENG

BLK 461, SEGAR RD, #13-203, 670461, Singapore

97494939

ANDYHOO81@SINGNET.COM.SG

Claim Handler

ANG Yvonne

6568804461

yvonne.ang@axa.com.sg

Additional Instructions

EXCESS 1400

[Messages](#)[Invoices](#)[History](#)[Documents](#)[Assessment](#)[Metrics](#)[Notes](#)[New Message](#)



SUPPLEMENTARY

Type

🔍 Question

Message

Please proceed if consistent

Reply



Auto
Consultants
Pte Ltd

51 UBI AVE 1, #01-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 62564315

Immediate Advice

Date: 16/1/2019

To : AXA Insurance Pte Ltd

Survey details

Date of loss	26-Jun-18
Date of appointment	29-Jun-18
Date of survey	2-Jul-18
Location of survey	AH LIM MOTOR PTE LTD

Vehicle Details:

Claim Type:	Own Damage
Vehicle number	SJY 1577X
Make and Model	MERCEDEZ BENZ B180
Date of registration	5/8/2018
Excess	1,400.00
Market Value	\$38,000
Parf Rebate	\$26,441
Nett Loss	\$11,559

Repair details

Initial Estimate	\$14,514	inclusive supp \$726.80
------------------	----------	-------------------------

Proposed/Revised repair cost:

Parts	\$7,940	inclusive supp \$726.80
Check item	\$1,162	
Labour		
Total	\$9,102	
Lump Sum(if applicable)	\$0	

Number of days of repair	6
--------------------------	---

Remarks:

Damage consistent
Repair cost economical



Auto
Consultants
Pte Ltd

51 UBI AVE 1, #01-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 62564315

Immediate Advice

To : AXA Insurance Pte Ltd

Date: 03.07.2018

Survey Details:

Date of loss	26.06.2018
Date of appointment	29.06.2018
Date of survey	02.07.2018
Location of survey	AH LIM MOTOR PTE LTD

Vehicle Details:

Claim Type:	Own Damage
Vehicle number	SJY 1577X
Make and Model	MERCEDEZ BENZ B180
Date of registration	05-Aug-10
Excess	1,400
Market Value	\$38,000.00
Part Rebate	\$26,441.00
Nett Loss	\$11,559.00

Repair details:

Initial Estimate	\$13,786.74
------------------	-------------

Proposed/Revised repair cost:

Parts	\$2,813.50
Check items (estimate)	\$8,057.74
Labour	\$1,172.48
Total	\$12,043.72
Lump Sum(if applicable)	\$

Number of days for repair	7
---------------------------	---



Auto
Consultants
Pte Ltd

51 UBI AVE 1, #01-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 62564313

Remarks:

Vehicle sustained damages at n/s front portion. The undercarriage affected due collision. Damages consistent. Repair cost economical. We have authorise repair.

Mandate:

Liability(TP)	%	
Proposed repair cost	\$	
Loss of use	\$	no. of days
Loss of rental	\$	no. of days
Loss of income	\$	no. of days
LTA search fees	\$	
Others	\$	
Proposed Total	#VALUE!	

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	26/06/2018 15:30
Date Of Accident	26/06/2018 09:50
Exact Location Of Accident	MARYMOUNT ROAD
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SJY1577X
Insured/Policyholder	
Name Of Registered Owner	HOO KOK PENG (HE GUOPING)
NRIC No	S8111643A
Email Address	ANDYHOO81@SINGNET.COM.SG
Mobile Phone No	(LOCAL) +65-97494939
Alternative Phone No	OTHERS-97494939

Vehicle Particulars

Manufacturer	MERCEDES-BENZ
Model	B180-1.7 (A)

Exact Purpose for which vehicle was being used at time of accident	PRIVATE USE
--	-------------

Are you claiming under your own insurance policy for repair to your vehicle?	YES
--	-----

If No, Please state action to be taken

Vehicle Category	PRIVATE CAR
------------------	-------------

Insurance Company

Name of Insurance Company	AXA INSURANCE PTE LTD
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	GA139648
Cover Note Number	05/02/2018 - 04/02/2019

Driver

Name of Driver	HOO KOK PENG (HE GUOPING)
NRIC No	S8111643A
Date Of Birth	11/04/1981
Occupation	INDOOR
Date Of Driving Pass	30/09/2009
Driving Experience	8 YEARS AND 8 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-97494939
Fax Number	
Contact Number	OTHERS-97494939
Email Address	ANDYHOO81@SINGNET.COM.SG

Address	BLK 461 SEGAR ROAD #13-203
Postcode	670461
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OWNER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	CHAIN COLLISION
Weather Conditions	RAINING
Road Surface	WET

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles involved in the accident	
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	2
Passenger 1	NAME: : GAVIN LIM KIAN SOON GENDER: : MALE

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

REFER TO THE SKETCH PLAN BY DRIVER

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	YES
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SJJ1798D
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	PRIVATE CAR
Name of Driver	NG YEIW POH
NRIC/Passport Number	S7600292D
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

DETAILS OF OTHER VEHICLE PROPERTY 2

Vehicle Registration Number	SJG3763G
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	PRIVATE CAR
Name of Driver	SHIEH HSIAO HSUAN
NRIC/Passport Number	S7676347Z
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.



Policyholder's Signature
Date & Time: 26/6 1340

Driver's Signature
(If driver is not the policyholder)
Date & Time:


Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

Sketch Plan Pg. 2

Date of accident: 26/06/18 Time: 10:12 Location: MARYMOUNT RD
 My Vehicle A: SJ4 1577X Vehicle B: SJ3 1798D Vehicle C: SJG 3763G
 SKETCH PLAN

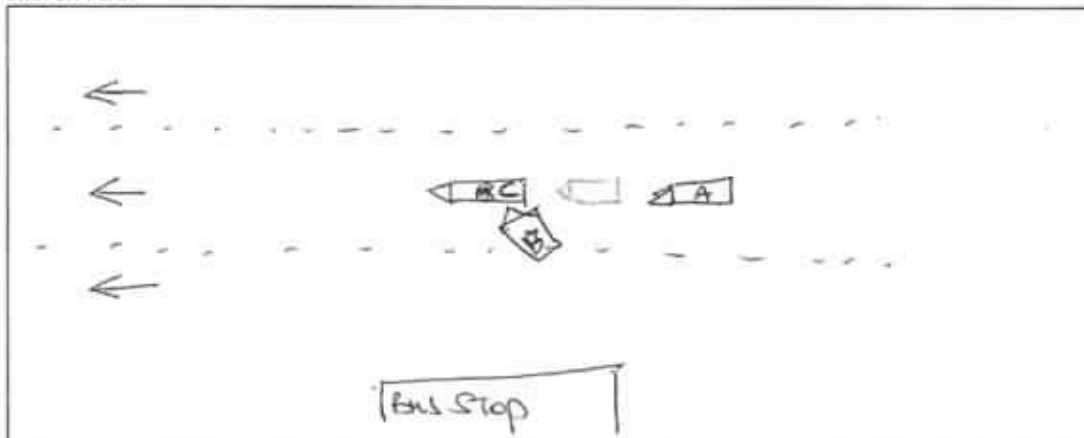

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

ON THIS DATE 26/06/18 AT ABOUT 10:12HRS. I WAS DRIVING MY VEHICLE SJ4 1577X AT ALONG MARYMOUNT RD. WHILE I WAS DRIVING AS IT WAS RAINY DAY, VEHICLE IN FRONT BRAKE, SO I ALSO BRAKE. BUT HOWEVER MY VEHICLE SCIDDED TO THE LEFT AND HIT VEHICLES SJ3 1798D ON THE RIGHT PASSENGER SEAT. THE VEHICLE'S SJ3 1798D RAN ONTO VEHICLES SJG 3763G. I TOOK SEVERAL PHOTO AT THE SCENE AND WE EXCHANGE PARTICULAR. AFTER ACCIDENT, MY VEHICLE CAN'T DRIVE AND ARRANGE TOW TO WORKSHOP. THERE IS NO INJURY ON ALL PARTY INCLUDING MY PASSENGER (AVIN LIM KIAN SOON S9608313).

☒ Claim OD/TP at Ah Lim Motor ☐ Claim OD/TP at other workshop ☐ Reporting Only

Remarks: Please forward a copy of my efile accident report to:

My workshop:

Email address: ANDY HOO @ (A) SINGNET.COM.SG

& myself:

Email address:

Note: Please take note that your insurer have 14 days timeframe for you to submit own damage claim under you own policy. Kindly check with your own insurer for more information.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature
 Date & Time:

Driver's Signature
 (if driver is not the policyholder)
 Date & Time:

Reporting Centre Personnel's Signature
 Name:
 NRIC/FIN No.:



APPROVED & SIGNED



redefining / insurance

HOO KOK PENG
BLK 461
SEGAR RD
#13-203
SINGAPORE 670461

AXA Insurance Pte Ltd
1800 880 4886 (Within Singapore)
(65) 6880 4886 (International)
(65) 6880 4740
customer.care@axa.com.sg
www.axa.com.sg

Renewal

date
22/01/2018

your servicing distributor
HOBBS INSURANCE AGENCY / 05163

your servicing distributor contact
6440 7787

Policy Schedule**Your SmartDrive Comprehensive Essential****Your policy snapshot**

Policyholder name	HOO KOK PENG	Policy number	VA1 / 0A139648
Cover	Comprehensive	FIN / NRIC	S8111643A
Period of Insurance	from 05/02/2018 to 04/02/2019 (both dates inclusive)		

Premium breakdown

Gross Premium after 0% NCD	SGD 1,571.67
7% GST	SGD 110.03
Final Premium	SGD 1,681.90

Your benefits highlights

(refer to Policy Wording for full terms and conditions)

SmartDrive Comprehensive Essential Benefits

- 24/7 Towing & Transportation in Singapore or Overseas
- Windscreen Replacement with Excess OR Repair your windscreen at your preferred location and get \$50 cash reward with no excess
- Guaranteed Repairs for twelve (12) Months
- Loss or Damage
- Legal Liability

Vehicle details

Make & Model of Vehicle	MERCEDES B180	Year of manufacture	2010
Vehicle registration number	SVY1577X	Type of Use	Private use
Body type	MPV	Engine capacity (c.c.)	1699
Seating capacity (excl driver)	4	Engine number	36694030757884
Off-Peak car	No	Chassis number	WDD2452322J575648

Insured's Estimated Market Value	Market Value at the time of Loss (including accessories and spare parts)
Limitation to use	As per Certificate of Insurance
Finance Loan Company	HERITAGE AUTO ENTERPRISE PTE LTD

Excess applicable (refer to Policy Wording for other applicable Excesses)

Basic Own Damage Excess	SGD 1,400.00
Windscreen Excess	SGD 100.00

Drivers details

AXA Insurance Pte Ltd (199903512M)
8 Shenton Way, #24-01, AXA Tower,
Singapore 068811
Customer Centre, #B1-01

Sketch Plan Pg. 4



Car B
SJS1798D
NG YEOW PAM
S78003929

Car C
SJS37636
SHIH HSIAO HSUAN
S78763432


9704 4939

W211 Rm.

NO Rm.

EMER

NEW

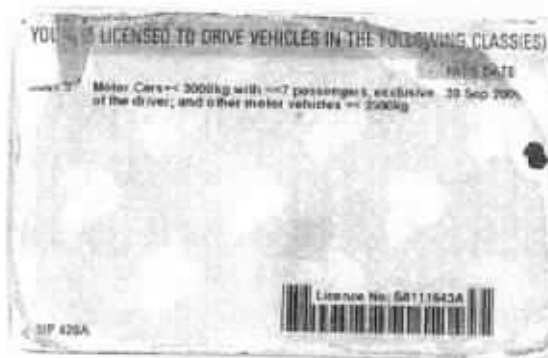

Sketch Plan Pg. 5



redefining / insurance

Date: 26/06/18

To: Owner of Vehicle Number: STL1577X

The following has been advised to you via your workshop, Ah Lim Motor Company through their staff Zila / Eileen / Mui Hong.

Please tick the applicable box if you had been advice on the content as seen below:

- ☒ You had been advised by the workshop that in the case that you wish to claim against your own policy, there is a Fourteen (14) days clause whereby the claim must be made within the stipulated timeframe from the day of occurrence.
- ☐ You had been advised by the workshop on the liability and merits of the case accordingly.
- ☒ You had been advised by the workshop on the claims procedure for the type of claim that you will be making due to this accident.
- ☐ There will be delay to your vehicle repair due to the unavailability of spare parts locally and there is no other option except to indent it from overseas.
- ☐ There will be no cancellation/withdrawal of the Own Damage claim once the order of the spare parts have been placed. If you wish to cancel/withdraw the claim, you shall bear all costs, expenses &/or related charges incurred directly &/or indirectly to the procurement of the spare parts.
- ☒ The estimated waiting time for the spare parts to arrive is TBA. The estimated arrival time does not include the repair period.
- ☐ You will be driving the vehicle out despite being advised by the workshop mechanic/personnel that the vehicle may not be road worthy.
- ☒ For vehicles below Three (3) years old, your Insurance Company will use only genuine original parts to repair your vehicle.
- For vehicles above Three (3) years old, your Insurance Company will be carrying out repairs using **any combination** of genuine original parts and/or original equipment manufacturer (OEM) parts.
- ☒ You had been advised by the workshop of the Twelve (12) months warranty for Own Damage repairs on workmanship related to the accident.
- ☐ For vehicles that are under warranty with a local distributor, you have been advised by the workshop to check with your local distributor on any effect to your warranty prior to making this Own Damage claim.
- ☒ Others claim own damage

Signed and acknowledge by:

[Signature]
Name and signature of policyholder/authorised driver

[Signature]
Name and signature of Workshop personnel including company stamp



> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type: Singapore NRIC
Owner ID: 1643A

Vehicle Details

Vehicle No.: SJY1577X
Vehicle to be Exported: No
Intended De-registration Date: 26 Jun 2018
Vehicle Make: MERCEDES BENZ
Vehicle Model: B180
Primary Colour: Grey
Manufacturing Year: 2010
Engine No.: 26694030757884
Chassis No.: WDD2452322J575648
Maximum Power Output: 85.0 kW (113 bhp)
Open Market Value: \$29,005.00
Original Registration Date: 05 Aug 2010
First Registration Date: 05 Aug 2010
Transfer Count: 1
Actual ARF Paid: \$29,005.00

Intended PARF Rebate Details

PARF Eligibility: Yes
PARF Eligibility Expiry Date: 04 Aug 2020
PARF Rebate Amount: \$17,403.00

Intended COE Rebate Details

COE Expiry Date: 04 Aug 2020
COE Category: B - Car (1601cc & above)
COE Period(Years): 10
QP Paid: \$42,889.00
COE Rebate Amount: \$9,038.00
Total Rebate Amount: \$26,441.00

The information contained herein is correct as at 26 Jun 2018

OK

Ah Lim Motor Company
10 Ang Mo Kio Industrial
Park 2A
#01-09 AMK Autopoint
Singapore 568047

SURVEYOR COPY

Claim Reference:
Assessment Number: AH000842
Version: AHLIM001/1

Full Report - V1
Registration: SJY1577X
Printed: 28/06/2018 11:27

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	Ahlim ahlim	Date of Incident:	
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	AXA Insurance S'pore Pte Ltd	Repairs Authorised:	TBA

Claim Reference:	Estimated Repair Time:
Policy Number:	Quote Due Date:
Other Reference:	Actual Repair Days:
Third Party:	Parts Ordered Date:
Insured Amount:	Hire Car Start:
Under Warranty:	Hire Car End:
Warranty Expired:	Vehicle Collected:

Vehicle Details

Vehicle

Manufacturer:	MERCEDES
Model:	B Class
Sub Model:	B 180 CDI
Model Sheet Number:	322 32
Registration:	SJY1577X
Registration Month:	August
Registration Year:	2010
VIN Number:	WDD2452322J575648
Manufacture Year:	2010
Odometer:	Not Known
Colour:	
Engine Number:	26694030757884
Fuel Level:	%

Model Specs

FOG LAMPS	CHROME PACKAGE
TWO COAT METALLIC	PAINTING OFF VEHICLE

Authorised
Resurvey B4 repair
Ex B1400
7 days

Vehicle Condition

Vehicle Status

Pre-Accident Condition:	Severity of Impact:
Steering:	Vehicle Status on
	Inspection:
Brakes Pedal Travel:	Date of Inspection:
Place of Inspection:	27/06/2018
Pre-Accident Damage:	

Tyres Condition:

Tread Depth LHF:

Tread Depth LHR:

Damage Areas:

Tread Depth RHF:
Tread Depth RHB:
Tread Depth RHR:
Direction of Impact:

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- These photos are subject to confirmation
- This survey is on a "Without Prejudice" basis
- No further action(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Claim Reference:
Assessment Number: AH000842
Version: AHLIM001/1

Full Report - V1
Registration: SJY1577X
Printed: 28/06/2018 11:27



Addresses

Cost Summary

Total Labour	\$1,462.50
Total Paint/Material	\$192.00
Total Parts	\$12,012.24
Total of Additional Costs	\$120.00
Excess:	TBA
Grand Total Exc GST:	\$13,786.74
7 % GST:	\$965.07
Grand Total Inc GST:	\$14,751.81

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$45.00/HR
Price/Dent = \$45.00/HR

Repair /

Guide Number	Repair Details	WU	Cost Price (\$)
40-6500 01	ALIGN VEHICLE DOES NOT INCLUDE: ADJUSTMENTS	9.0	40.50
88-1102 03	R + R COMPLETE FRONT BUMPER INCLUDES: R + R L/F AND R/F PARTITION AND FOG LAMPS	9.0	40.50
88-1105 03	DIS + ASS FRONT BUMPER (REMOVED) INCLUDES: R + R FOG LAMPS, RENEW PARTS AFTER CHECK	7.0	31.50
60-1574 01	R + R MERCEDES STAR	1.0	4.50
82-4810 03)	RENEW BOTH HEADLAMPS (BUMPER REMOVED)	3.0	13.50
88-3814 02	R + R L/F WING (BUMPER REMOVED) INCLUDES: R + R A-PILLAR TRIM	7.0	31.50
88-3818 03)	RENEW L/F WING (REMOVED)	2.0	9.00
88-4702 02)	RENEW L/F PARTITION SECTION (REMOVED)	1.0	4.50
60-1302 02	R + R ATT/PARTS OF THE ENG COMPARTMENT FOR RENEWAL OF THE FRONT CROSSMEMBER INCLUDES: R + R HORN AND BRACKET	2.0	9.00
62-1263 01	R + R FRONT CROSSMEMBER CPL (STOSSFAENGER AUSGEBAUT)	11.0	49.50
94-5455 01	R + R CENTRE ACOUSTIC ENCAPSULATION	3.0	13.50
20-6461 01	R + R FAN UNIT	7.0	31.50
09-1030 01	R + R AIR FILTER CPL	5.0	22.50
33-1835 03)	R + R FRONT AXLE CARRIER	44.0	198.00
33-1840 01	RENEW FRONT AXLE CARRIER (REMOVED) INCLUDES : R + R ALL ATTACHED PARTS AND	7.0	31.50

Ah Lim Motor Company

Claim Reference:
Assessment Number: AH000842
Version: AHLIM001/1

Full Report - V1
Registration: SJY1577X
Printed: 28/06/2018 11:27

	RENEW ACCORDING TO CONDITION		
40-2710 01	FIT L/F WHEEL	3.0	13.50
40-2710 01	FIT R/F WHEEL	3.0	13.50
40-2125 ZAX	BALANCE WHEEL ASS WORK	2.0	9.00
33-3500 01)	R + R LEFT STEERING KNUCKLE	19.0	85.50
32-1955 01)	R + R L/F SUSPENSION STRUT (WHEEL REM)	7.0	31.50
33-6500 02)	R + R L/F AXLE SHAFT	8.0	36.00
32-1908 01)	RENEW L/F SPRING STRUT (REMOVED)	3.0	13.50
32-1920 01)	RENEW L/- AND R/SPRING STRUT (ADD/WORK)	2.0	9.00
32-2050 02)	R + R FRONT STABILIZER	13.0	58.50
0471	REPAIR BONNET	20.0* X	90.00
1481	REPAIR LEFT FRONT DOOR	20.0* X	90.00

LABOUR COST

Total Work Units	218.0	
Panel / Mechanical Labour	20.9HRS	\$940.50
Visual Alignment Labour	0.9HRS	\$40.50
Sub Total	21.8HRS	\$981.00
Paint Labour	10.7HRS	481.50
Total Labour	32.5HRS	\$1,462.50

PAINT WORK

Time Basis 10 WU = 1 HR. Price = \$45.00/HR

Guide Number	Description	WU	Cost Price (\$)
	- TWO COAT METALLIC		
	- PAINTING OFF VEHICLE		
283	FRONT BUMPER REPAIR PAINT PLASTIC	17.0	
471	BONNET REPAIR PAINTING <50%	24.0	
741	L/F WING REPAIR PAINTING >50%	15.0	
1481	LEFT FRONT DOOR REPAIR PAINTING >50%	26.0	
742	R/F WING SURFACE PAINT	5.0	

LABOUR COST - PAINT

TIME(PAINT)	87.0	
Preparation Main Work Plastic	12.0	
Preparation Comp. Work Metal	8.0	
Preparation Work Multi Layer Paint	0.0	
Total Work Units (10WU/HR)	107.0	
Total Paintwork Labour	10.7HRS	\$481.50

MATERIAL COST - PAINT

Surface-/Blend Paint	\$7.72
Repair Painting	\$98.27
Repair Painting Plastic	\$57.11
Material-Const Main Work Plastic	\$16.20
Material-Const Comp. Work Metal	\$12.70
Total Excluding Pearlescent Uplift	\$192.00
Pearlescent Uplift @ 0.0%	\$0.00
Total Paint Material Cost	\$192.00

PARTS

Guide No.	Qty	Description	Part Number	Supplier	Bet.	Price (\$)
283	1	FRONT BUMPER	169 885 2525		0%	580.00*
303	1	L/F BUMPER GRILLE	169 885 1122		0%	57.00*
313	1	L/F BUMPER TRIM	169 885 1374		0%	80.00*
314	1	R/F BUMPER TRIM	169 885 1474		0%	80.00*

Price Valid: 01/06/2015

Ah Lim Motor Company

Claim Reference:

Assessment Number: AH000842

Version: AHLIM001/1

Full Report - V1

Registration: SJY1577X

Printed: 28/06/2018 11:27

319	1	FRT/CTR IMPACT DAMP	169 885 0137	0%	Sm	76.00*	7
351✓	1	FRT BUMPER CLAMP KIT	USE SINGLE PARTS	0%	Sm	60.00*	1
405	1	RADIATOR COVER	169 880 0783	0%	Sm	370.00*	X
561✓	1	LEFT HEADLAMP ASSY	169 820 2561	0%	Sm	570.00*	1
562	1	RIGHT HEADLAMP ASSY	169 820 2661	0%	Sm	570.00*	X
637	1	L/F FOG LAMP	251 820 0756	0%	Sm	170.00*	X
741✓	1	L/F WING	169 880 0718	0%	Sm	320.00*	1
789	1	L/WING CLAMP KIT	USE SINGLE PARTS	0%	nn	40.00*	X
833	1	L/F W-HOUSE FRT CVR	169 698 2530	0%	Sm	65.00*	7
835	1	L/F W-HOUSE RR COVER	169 698 2730	0%	Sm	80.00*	7
1001	1	FRT LWR CROSSMEMBER	169 620 1734	0%	Sm	475.00*	7
7011	1	FRONT AXLE SUPPORT	169 620 0787	0%	Sm	1,350.00*	7
7035	1	L/DRIVE SHAFT CPL	169 360 5100	0%	Sm	1,200.00*	7
7047✓	1	L/F TRACK CONT ARM	169 330 0907	0%	Di	410.00*	2
7077✓	1	L/F STRUT	169 320 1730	0%	Sm	350.00*	2
7081	1	L/F STEERING KNUCKLE	169 330 0720	0%	Sm	740.00*	1
7099	1	L/F STRUT BEARING	169 320 0073 28	0%	nn	175.00*	1
7133	1	L/F NUT	169 335 0072	0%	nn	4.18U	7
7201✓	1	L/F WHEEL	169 400 0402	0%	Sm	61.52U	1
7202	1	R/F WHEEL	169 400 0402	0%	Sm	61.52U	7
7261	1	FRONT STABILISER	169 323 0965	0%	Sm	175.00*	7
7263✓	1	L/F STABILISER ARM	169 320 0989	0%	Di	50.00*	2
7264	1	R/F STABILISER ARM	169 320 0989	0%	Di	50.00*	2
7300✓	1	POWER STEERING	169 460 3300	0%	Di	2,700.00*	2
f: OEM Parts			Sub Total	\$10,920.22			
g: Original			Total Parts	\$12,012.24			
h: Secondhand							
p: Parallel							
x: Exchange							

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description		Betterment	Price	Folio
TYRE LHF	SPECIALIST	0% 140	\$0.00	Folio
TYRE RHF	SPECIALIST	0% 140	\$0.00	Folio
CHK WIRING	SPECIALIST	0%	\$40.00	2d
WHEEL ALIGNMENT	SPECIALIST		\$80.00	6d
Total Extras			\$120.00	

Final Calculation

Total Parts	\$12,012.24
Labour	
Total Panel/Mechanical	\$940.50
Total Paintwork	\$481.50
Total Visual Alignment work	\$40.50
Total Labour	\$1,462.50
Additional Costs	
Corr Prot Materials External	\$0.00
Corr Prot Materials Internal	\$0.00
Cost of Specialist	\$120.00
Total of Additional Costs	\$120.00
Total Paint/Material Costs	\$192.00
Grand Total Excludes GST	\$13,786.74
GST @ 7 %	\$965.07
Grand Total Includes GST	\$14,751.81

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Assessment Notes

51 Ubi Avenue 1, #01-25
Paya Ubi Industrial Park
Singapore
408933

Claim Reference:
Assessment Number: AH000842
Version: LKKAUTOC/2
Date Calculated: 03/07/2018 08:31

Full Report - V1
Registration: SJY1577X
Printed: 03/07/2018 16:29

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	LKK AUTO	Date of Incident:	
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	AXA Insurance S'pore Pte Ltd	Repairs Authorised:	TBA

Claim Reference:	Estimated Repair Time:
Policy Number:	Quote Due Date:
Other Reference:	Actual Repair Days:
Third Party:	Parts Ordered Date:
Insured Amount:	Hire Car Start:
Under Warranty:	Hire Car End:
Warranty Expired:	Vehicle Collected:

Vehicle Details

Vehicle

Manufacturer:	MERCEDES
Model:	B Class
Sub Model:	B 180 CDI
Model Sheet Number:	322 32
Registration:	SJY1577X
Registration Month:	August
Registration Year:	2010
VIN Number:	WDD2452322J575648
Manufacture Year:	2010
Odometer:	Not Known
Colour:	
Engine Number:	26694030757884
Fuel Level:	%

Model Specs

FOG LAMPS	CHROME PACKAGE
TWO COAT METALLIC	PAINTING OFF VEHICLE

Vehicle Condition

Vehicle Status

Pre-Accident Condition:	Severity of Impact:	
Steering:	Vehicle Status on Inspection:	
Brakes Pedal Travel:	Date of Inspection:	27/06/2018
Place of Inspection:		
Pre-Accident Damage:		
Tyres Condition:		
Tread Depth LHF:	Tread Depth RHF:	
Tread Depth LHR:	Tread Depth RHR:	
Damage Areas:	Direction of Impact:	

Claim Reference:

Full Report - V1



Assessment Number: AH000842

Registration: SJY1577X

Version: LKKAUTOC/2

Printed: 03/07/2018 16:29

Date Calculated: 03/07/2018 08:31

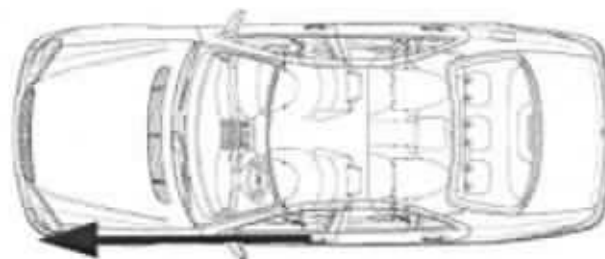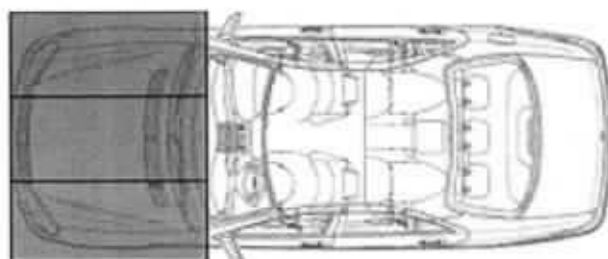**Addresses****Cost Summary**

Total Labour	\$1,066.50
Total Paint/Material	\$105.98
Total Parts	\$10,791.24
Total of Additional Costs	\$80.00
Excess:	TBA
Grand Total Exc GST:	\$12,043.72
7 % GST:	\$843.06
Grand Total Inc GST:	\$12,886.78

Repair Information**LABOUR**

Time Basis 10 WU = 1 HR. Price/CL 1 = \$45.00/HR
Price/Dent = \$45.00/HR

Repair / Guide Number	Repair Details	WU	Cost Price (\$)
40-6500 01	ALIGN VEHICLE	9.0	40.50
	DOES NOT INCLUDE: ADJUSTMENTS		
88-1102 03	R + R COMPLETE FRONT BUMPER	9.0	40.50
	INCLUDES: R + R L/F AND R/F PARTITION AND FOG LAMPS		
88-1105 03	DIS + ASS FRONT BUMPER (REMOVED)	7.0	31.50
	INCLUDES: R + R FOG LAMPS, RENEW PARTS AFTER CHECK		
60-1574 01	R + R MERCEDES STAR	1.0	4.50
82-4790 03)	RENEW L/F LAMP UNIT (BUMPER DETACHED)	5.0	22.50
88-3814 02	R + R L/F WING (BUMPER REMOVED)	7.0	31.50
	INCLUDES: R + R A-PILLAR TRIM		
88-3818 03)	RENEW L/F WING (REMOVED)	2.0	9.00
88-4702 02)	RENEW L/F PARTITION SECTION (REMOVED)	1.0	4.50
60-1302 02	R + R ATT/PARTS OF THE ENG COMPARTMENT FOR RENEWAL OF THE FRONT CROSSMEMBER	2.0	9.00
	INCLUDES: R + R HORN AND BRACKET		
62-1263 01	R + R FRONT CROSSMEMBER CPL (STOSSFAENGER AUSGEBAUT)	11.0	49.50
94-5455 01	R + R CENTRE ACOUSTIC ENCAPSULATION	3.0	13.50
20-6461 01	R + R FAN UNIT	7.0	31.50
09-1030 01	R + R AIR FILTER CPL	5.0	22.50
33-1835 03)	R + R FRONT AXLE CARRIER	44.0	198.00
33-1840 01	RENEW FRONT AXLE CARRIER (REMOVED)	7.0	31.50

Claim Reference:

Full Report - V1

Assessment Number: AH000842

Registration: SJY1577X

Version: LKKAUTOC/2

Printed: 03/07/2018 16:29

Date Calculated: 03/07/2018 08:31

INCLUDES : R + R ALL ATTACHED PARTS AND RENEW ACCORDING TO CONDITION			
40-2710 01	FIT L/F WHEEL	3.0	13.50
40-2710 01	FIT R/F WHEEL	3.0	13.50
40-2125 ZAX	BALANCE WHEEL ASS WORK	2.0	9.00
33-3500 01)	R + R LEFT STEERING KNUCKLE	19.0	85.50
32-1955 01)	R + R L/F SUSPENSION STRUT (WHEEL REM)	7.0	31.50
33-6500 02)	R + R L/F AXLE SHAFT	8.0	36.00
32-1908 01)	RENEW L/F SPRING STRUT (REMOVED)	3.0	13.50
32-1920 01)	RENEW L/- AND R/SPRING STRUT (ADD/WORK)	2.0	9.00
32-2050 02)	R + R FRONT STABILIZER	13.0	58.50
LABOUR COST			
Total Work Units		180.0	
Panel / Mechanical Labour		17.1HRS	\$769.50
Visual Alignment Labour		0.9HRS	\$40.50
Corrosion Protection External Labour		0.0HRS	0.00
Corrosion Protection Internal Labour		0.0HRS	0.00
Sub Total		18.0HRS	\$810.00
Paint Labour		5.7HRS	\$256.50
Total Labour		23.7HRS	\$1,066.50

PAINT WORK		Time Basis 10 WU = 1 HR. Price = \$45.00/HR	
Guide Number	Description	WU	Cost Price (\$)
	- TWO COAT METALLIC		
	- PAINTING OFF VEHICLE		
283	FRONT BUMPER REPAIR PAINT PLASTIC	17.0	
741	L/F WING REPAIR PAINTING >50%	15.0	
742	R/F WING SURFACE PAINT	5.0	
LABOUR COST - PAINT			
TIME(PAINT)		37.0	
Preparation Main Work Plastic		12.0	
Preparation Comp. Work Metal		8.0	
Preparation Work Multi Layer Paint		0.0	
Total Work Units (10WU/HR)		57.0	
Total Paintwork Labour		5.7HRS	\$256.50
MATERIAL COST - PAINT			
Surface-/Blend Paint			\$7.72
Repair Painting			\$12.25
Repair Painting Plastic			\$57.11
Material-Const Main Work Plastic			\$16.20
Material-Const Comp. Work Metal			\$12.70
Total Excluding Pearlescent Uplift			\$105.98
Pearlescent Uplift @ 0.0%			\$0.00
Total Paint Material Cost			\$105.98

PARTS

				Price Valid: 01/06/2015	
Guide No.	Qty	Description	Part Number	Supplier	Bet. Price (\$)
283	1	FRONT BUMPER	169 885 2525		0% 580.00*
303	1	L/F BUMPER GRILLE	169 885 1122		0% 57.00*
313	1	L/F BUMPER TRIM	169 885 1374		0% 80.00*
314	1	R/F BUMPER TRIM	169 885 1474		0% 80.00*

Claim Reference:

Full Report - V1

Assessment Number: AH000842

Registration: SJY1577X

Version: LKKAUTOC/2

Printed: 03/07/2018 16:29

Date Calculated: 03/07/2018 08:31

319	1	FRT/CTR IMPACT DAMP	169 885 0137	0%	76.00*
351	1	FRT BUMPER CLAMP KIT	USE SINGLE PARTS	0%	60.00*
561	1	LEFT HEADLAMP ASSY	169 820 2561	0%	570.00*
741	1	L/F WING	169 880 0718	0%	320.00*
789	1	L/WING CLAMP KIT	USE SINGLE PARTS	0%	40.00*
833	1	L/F W-HOUSE FRT CVR	169 698 2530	0%	65.00*
835	1	L/F W-HOUSE RR COVER	169 698 2730	0%	80.00*
1001	1	FRT LWR CROSSMEMBER	169 620 1734	0%	475.00*
7011	1	FRONT AXLE SUPPORT	169 620 0787	0%	1,350.00*
7035	1	L/DRIVE SHAFT CPL	169 360 5100	0%	1,200.00*
7047	1	L/F TRACK CONT ARM	169 330 0907	0%	410.00*
7077	1	L/F STRUT	169 320 1730	0%	350.00*
7081	1	L/F STEERING KNUCKLE	169 330 0720	0%	740.00*
7099	1	L/F STRUT BEARING	169 320 0073 28	0%	175.00*
7133	1	L/F NUT	169 335 0072	0%	4.18U
7201	1	L/F WHEEL	169 400 0402	0%	61.52U
7202	1	R/F WHEEL	169 400 0402	0%	61.52U
7261	1	FRONT STABILISER	169 323 0965	0%	175.00*
7263	1	L/F STABILISER ARM	169 320 0989	0%	50.00*
7264	1	R/F STABILISER ARM	169 320 0989	0%	50.00*
7300	1	POWER STEERING	169 460 3300	0%	2,700.00*
f: OEM Parts		Sub Total			\$9,810.22
g: Original		Mark Up From Cost		(10 %)	\$981.02
h: Secondhand		Total Parts			\$10,791.24
p: Parallel					
x: Exchange					

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description	Betterment	Price
TYRE LHF SPECIALIST	0%	\$0.00
TYRE RHF SPECIALIST		\$0.00
CHK WIRING SPECIALIST	0%	\$20.00
WHEEL ALIGNMENT SPECIALIST		\$60.00
Total Extras		\$80.00

Final Calculation

Total Parts	\$10,791.24
Labour	
Total Panel/Mechanical	\$769.50
Total Paintwork	\$256.50
Total Visual Alignment work	\$40.50
Total Labour	\$1,066.50
Additional Costs	
Corr Prot Materials External	\$0.00
Corr Prot Materials Internal	\$0.00
Cost of Specialist	\$80.00
Total of Additional Costs	\$80.00
Total Paint/Material Costs	\$105.98
Grand Total Excludes GST	\$12,043.72
GST @ 7 %	\$843.06
Grand Total Includes GST	\$12,886.78

51 Ubi Avenue 1, #01-25 Paya Ubi Industrial Park Singapore

Full Report - V1

Claim Reference:

Assessment Number: AH000842

Version: LKKAUTOC/2

Date Calculated: 03/07/2018 08:31

Registration: SJY1577X

Printed: 03/07/2018 16:29

Assessment Notes



AH LIM MOTOR COMPANY

No. 10 Ang Mo Kio Ind. Park 2A #01-09 AMK Autopoint Singapore 568047
 TEL: 6483 1244 (4 lines) FAX: 6483 6170 Email: ahlimnc@singnet.com.sg
 GST:M9-0009639-E RCB NO:06470300B

M/S : AXA INSURANCE PTE LTD
 8 SHENTON WAY
 #27-01 AXA TOWER
 SINGAPORE 068811

TEL: 63387288

FAX: 63382522

ATTN: Motor Claim Department

Your Ref No: S8M00M70

Claim Type: Own Damage

Accident Date: 26/06/2018

Claim No: MC0913224

Ref No: MF0911265

Date: 31 Aug 2018

Policy No: GA139648

Veh Reg No: SJY1577X

Make/Model: MERCEDES BEN B180

Repair Cost to Vehicle No (For Finalization):SJY1577X

Description	U/Price	Quantity	Cost	Amount
			<u>S\$</u>	<u>S\$</u>
SPARE PARTS				
1 HEADLAMP LH		1 PC	570.00	
2 FRONT BUMPER		1 PC	580.00	
3 FRONT BUMPER CLIPS		15 PC	60.00	
4 FRONT FENDER RH		1 PC	320.00	
5 FRONT KNUCKLE ARM LH (WITH BEARING & HUB)		1 PC	740.00	
6 FRONT LOWER ARM LH		1 PC	410.00	
7 FRONT STABILISER LINKAGE LH		1 PC	50.00	
8 FRONT STEERING RACK (WITH RACK END & TIE ROD)		1 PC	2,700.00	
9 FRONT SHOCK ABSORBER LH		1 PC	350.00	
10 SPORT RIM LHF		1 PC	450.00	
11 SHOCK ABSORBER STOPPER X 2		2 PC	50.00	
12 SUPPORT PANEL		1 PC	530.00	
13 SIDE SKIRT CLIPS		2 PC	8.00	
			6,818.00	
	Add 10%		681.80	7,499.80
Special Nett				
14 TYRE LHF RHF (70% OF 200)		2 PC	280.00	
15 RADIATOR COOLANT		1 PC	30.00	
				310.00
LABOUR				
16 TO DISCONNECT AND CHECK ELECTRICAL WIRING, WIRE SOCKETS AND ETC. TO REMOVE AND REINSTALL DAMAGED ELECTRICAL UNITS, TEST AND RECTIFY FOR PROPER FUNCTIONING.		1 PC	20.00	
17 TO CHECK AND RE-ADJUST WHEEL ALIGNMENT.		1 PC	60.00	
18 TO DISMANTLE ALL DAMAGED PARTS.TO CUT & WELD. TO KNOCK & REPAIR FRONT BONNET,FRONT DOOR LH INNER PANELS AND AFFECTED AREAS. TO REFIT LISTED PARTS BACK SAME.		1 PC	711.00	
19 TO SPRAY FRONT BONNET,FRONT BUMPER,FRONT FENDER LH,FRONT DOOR LH.		1 PC	450.58	
20 TO REMOVE AND REPLACE A/C CONDENSER AND PIPES, RADIATOR AND HOSES, VACUUM A/C SYSTEM AS WELL AS REFILL A/C GAS.		1 PC	50.00	
				1,291.58



AH LIM MOTOR COMPANY

No. 10 Ang Mo Kio Ind. Park 2A #01-09 AMK Autopoint Singapore 568047
TEL: 6483 1244 (4 lines) FAX: 6483 6170 Email: ahlimmc@singnet.com.sg
GST:M9-0009639-E RCB NO:06470300B

M/S : AXA INSURANCE PTE LTD
8 SHENTON WAY
#27-01 AXA TOWER
SINGAPORE 068811

TEL: 63387288

FAX: 63382522

ATTN: Motor Claim Department

Your Ref No: S8M00M70

Claim Type: Own Damage

Accident Date: 26/06/2018

Claim No: MC0913224

Ref No: MF0911265

Date: 31 Aug 2018

Policy No: GA139648

Veh Reg No: SJY1577X

Make/Model: MERCEDES BEN B180

Repair Cost to Vehicle No (For Finalization):SJY1577X

Amount Before Excess	S\$ 9,101.38
Less Excess	S\$ 1,400.00
Amount Before GST	S\$ 7,701.38
Add GST @ 7%	\$39.10
Total Amount payable	S\$ 8,240.48

TOTAL: SINGAPORE DOLLAR EIGHT THOUSAND TWO HUNDRED FORTY AND CENTS FORTY EIGHT ONLY

The above vehicle was surveyed by KENNETH KONG -LKK on 02/07/2017

For AH LIM MOTOR COMPANY

AUTHORISED SIGNATURE



AH LIM MOTOR COMPANY

No. 10 Ang Mo Kio Ind. Park 2A #01-09 AMK Autopoint Singapore 568047
TEL: 6483 1244 (4 lines) FAX: 6483 6170 Email: ahlimmc@singnet.com.sg
GST:M9-0009639-E RCB NO:06470300B

M/S : AXA INSURANCE PTE LTD

8 SHENTON WAY

#27-01 AXA TOWER

SINGAPORE 068811

TEL: 63387288

FAX: 63382522

ATTN: Motor Claim Department

Your Ref No: S8M00M70

Claim Type: Own Damage

Accident Date: 26/06/2018

Estimate No: MC0913224

Date: 12 Jul 2018

Policy No: GA139648

Veh Reg No: SJY1577X

Make/Model: MERCEDES BEN B180

Estimate Repair Cost to Vehicle No :SJY1577X

Description	U/Price	Quantity	Cost S\$	Amount S\$
-------------	---------	----------	-------------	---------------

Supplementary Parts to Repair

SPARE PARTS

- 1 SHOCK ABSORBER STOPPER X 2
- 2 SUPPORT PANEL
- 3 SIDE SKIRT CLIPS

2 PC	<i>u</i>	50.00	<i>u</i>
1 PC	<i>CM</i>	530.00	<i>u</i>
2 PC	<i>u</i>	8.00	<i>u</i>

588.00

Add 10%

58.80

646.80

Amount Before Excess

S\$ 646.80

GST Amount

S\$ 45.28

Total Amount payable

S\$ 692.08

The above vehicle was surveyed by KENNETH KONG -LKK on 02/07/2017

For AH LIM MOTOR COMPANY

AUTHORISED SIGNATURE





AH LIM MOTOR COMPANY

No. 10 Ang Mo Kio Ind. Park 2A #01-09 AMK Autopoint Singapore 568047
TEL: 6483 1244 (4 lines) FAX: 6483 6170 Email: ahlimco@singnet.com.sg
GST:M9-0009639-E RCB NO:06470300B

M/S : AXA INSURANCE PTE LTD
8 SHENTON WAY
#27-01 AXA TOWER
SINGAPORE 068811

TEL: 63387288

FAX: 63382522

ATTN: Motor Claim Department

Your Ref No: S8M00M70

Claim Type: Own Damage

Accident Date: 26/06/2018

Estimate No: MC0913224

Date: 10 Oct 2018

Policy No: GA139648

Veh Reg No: SJY1577X

Make/Model: MERCEDES BEN B180

Estimate Repair Cost to Vehicle No :SJY1577X

Description	U/Price	Quantity	Cost S\$	Amount S\$
Supplementary Parts to Repair				
Special Nett				
1 RADIATOR COOLANT		1 PC	30.00 ✓	30.00
LABOUR				
2 TO REMOVE AND REPLACE A/C CONDENSER AND PIPES, RADIATOR AND HOSES, VACUUM A/C SYSTEM AS WELL AS REFILL A/C GAS.		1 PC	50.00 ✓	50.00
Amount Before Excess				S\$ 80.00
GST Amount				S\$ 5.60
Total Amount payable				S\$ 85.60

The above vehicle was surveyed by KENNETH KONG -LKK on 02/07/2017

For AH LIM MOTOR COMPANY

AH LIM MOTOR COMPANY
No. 10 Ang Mo Kio Ind. Park 2A
#01-09 AMK Autopoint Singapore 568047
AUTHORISED SIGNATURE

Ah Lim Motor Company
10 Ang Mo Kio Industrial
Park 2A
#01-09 AMK Autopoint
Singapore 568047

SURVEYOR COPY

Claim Reference:
Assessment Number: AH000842
Version: AHLIM001/1

Full Report - V1
Registration: SJY1577X
Printed: 28/06/2018 11:27

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	Ahlim ahlim	Date of Incident:	
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	AXA Insurance S'pore Pte Ltd	Repairs Authorised:	TBA

Claim Reference:	Estimated Repair Time:
Policy Number:	Quote Due Date:
Other Reference:	Actual Repair Days:
Third Party:	Parts Ordered Date:
Insured Amount:	Hire Car Start:
Under Warranty:	Hire Car End:
Warranty Expired:	Vehicle Collected:

Vehicle Details

Vehicle	Model Specs
Manufacturer: MERCEDES	FOG LAMPS
Model: B Class	TWO COAT METALLIC
Sub Model: B 180 CDI	CHROME PACKAGE
Model Sheet Number: 322 32	PAINTING OFF VEHICLE
Registration: SJY1577X	
Registration Month: August	
Registration Year: 2010	
VIN Number: WDD2452322J575648	
Manufacture Year: 2010	
Odometer: Not Known	
Colour:	
Engine Number: 26694030757884	
Fuel Level: %	

car at workshop

Authorised

Repair B & paint

Ex B & 400

Little longer 10.15 pm 7 days

Vehicle Condition



Vehicle Status

Pre-Accident Condition:	Severity of Impact:
Steering:	Vehicle Status on Inspection:
Brakes Pedal Travel:	Date of Inspection: 27/06/2018
Place of Inspection:	
Pre-Accident Damage:	
Tyres Condition:	
Tread Depth LHF:	Tread Depth RHF:
Tread Depth LHR:	Tread Depth RHR:
Damage Areas:	Direction of Impact:

Ah Lim Motor Company

Claim Reference:
Assessment Number: AH000842
Version: AHLIM001/1

Full Report - V1
Registration: SJY1577X
Printed: 28/06/2018 11:27

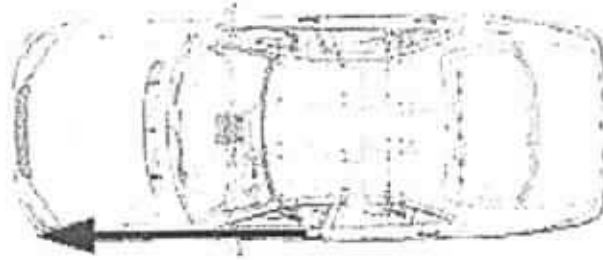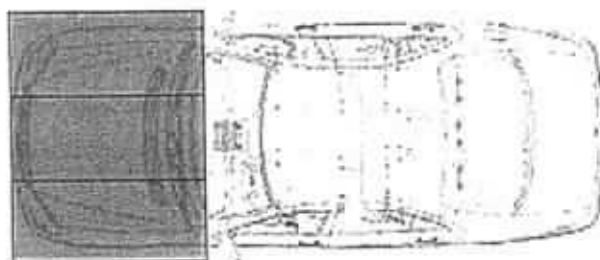

Addresses

Cost Summary

Total Labour	\$1,462.50
Total Paint/Material	\$192.00
Total Parts	\$12,012.24
Total of Additional Costs	\$120.00
Excess:	TBA
Grand Total Exc GST:	\$13,786.74
7 % GST:	\$965.07
Grand Total Inc GST:	\$14,751.81

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$45.00/HR
Price/Dent = \$45.00/HR

Repair / Guide Number	Repair Details	WU	Cost Price (\$)
40-6500 01	ALIGN VEHICLE DOES NOT INCLUDE: ADJUSTMENTS	9.0	40.50
88-1102 03	R + R COMPLETE FRONT BUMPER INCLUDES: R + R L/F AND R/F PARTITION AND FOG LAMPS	9.0	40.50
88-1105 03	DIS + ASS FRONT BUMPER (REMOVED) INCLUDES: R + R FOG LAMPS, RENEW PARTS AFTER CHECK	7.0	31.50
60-1574 01	R + R MERCEDES STAR	1.0	4.50
82-4810 03)	RENEW BOTH HEADLAMPS (BUMPER REMOVED)	3.0	13.50
88-3814 02	R + R L/F WING (BUMPER REMOVED) INCLUDES: R + R A-PILLAR TRIM	7.0	31.50
88-3818 03)	RENEW L/F WING (REMOVED)	2.0	9.00
88-4702 02)	RENEW L/F PARTITION SECTION (REMOVED)	1.0	4.50
60-1302 02	R + R ATT/PARTS OF THE ENG COMPARTMENT FOR RENEWAL OF THE FRONT CROSSMEMBER INCLUDES: R + R HORN AND BRACKET	2.0	9.00
62-1263 01	R + R FRONT CROSSMEMBER CPL (STOSSFAENGER AUSGEBAUT)	11.0	49.50
94-5455 01	R + R CENTRE ACOUSTIC ENCAPSULATION	3.0	13.50
20-6461 01	R + R FAN UNIT	7.0	31.50
09-1030 01	R + R AIR FILTER CPL	5.0	22.50
33-1835 03)	R + R FRONT AXLE CARRIER	44.0	198.00
33-1840 01	RENEW FRONT AXLE CARRIER (REMOVED) INCLUDES : R + R ALL ATTACHED PARTS AND	7.0	31.50

Ah Lim Motor Company

Claim Reference:

Assessment Number: AH000842

Version: AHLIM001/1

Full Report - V1

Registration: SJY1577X

Printed: 28/06/2018 11:27

	RENEW ACCORDING TO CONDITION		
40-2710 01	FIT L/F WHEEL	3.0	13.50
40-2710 01	FIT R/F WHEEL	3.0	13.50
40-2125 ZAX	BALANCE WHEEL ASS WORK	2.0	9.00
33-3500 01)	R + R LEFT STEERING KNUCKLE	19.0	85.50
32-1955 01)	R + R L/F SUSPENSION STRUT (WHEEL REM)	7.0	31.50
33-6500 02)	R + R L/F AXLE SHAFT	8.0	36.00
32-1908 01)	RENEW L/F SPRING STRUT (REMOVED)	3.0	13.50
32-1920 01)	RENEW L/- AND R/SPRING STRUT (ADD/WORK)	2.0	9.00
32-2050 02)	R + R FRONT STABILIZER	13.0	58.50
0471	REPAIR BONNET	20.0* X	90.00
1481	REPAIR LEFT FRONT DOOR	20.0* X	90.00

LABOUR COST

Total Work Units	218.0	
Panel / Mechanical Labour	20.9HRS	\$940.50
Visual Alignment Labour	0.9HRS	\$40.50
Sub Total	21.8HRS	\$981.00
Paint Labour	10.7HRS	481.50
Total Labour	32.5HRS	\$1,462.50

PAINT WORK Time Basis 10 WU = 1 HR. Price = \$45.00/HR

Guide Number	Description	WU	Cost Price (\$)
	- TWO COAT METALLIC		
	- PAINTING OFF VEHICLE		
283	FRONT BUMPER REPAIR PAINT PLASTIC	17.0	
471	BONNET REPAIR PAINTING <50%	24.0	
741	L/F WING REPAIR PAINTING >50%	15.0	
1481	LEFT FRONT DOOR REPAIR PAINTING >50%	26.0	
742	R/F WING SURFACE PAINT	5.0	

LABOUR COST - PAINT

TIME(PAINT)	87.0	
Preparation Main Work Plastic	12.0	
Preparation Comp. Work Metal	8.0	
Preparation Work Multi Layer Paint	0.0	
Total Work Units (10WU/HR)	107.0	
Total Paintwork Labour	10.7HRS	\$481.50

MATERIAL COST - PAINT

Surface-/Blend Paint	\$7.72
Repair Painting	\$98.27
Repair Painting Plastic	\$57.11
Material-Const Main Work Plastic	\$16.20
Material-Const Comp. Work Metal	\$12.70
Total Excluding Pearlescent Uplift	\$192.00
Pearlescent Uplift @ 0.0%	\$0.00
Total Paint Material Cost	\$192.00

PARTS

Price Valid: 01/06/2015

Guide No.	Qty	Description	Part Number	Supplier	Bet.	Price (\$)
283	1	FRONT BUMPER	169 885 2525		0%	580.00*
303	1	L/F BUMPER GRILLE	169-885-1122		0%	57.00*
313	1	L/F BUMPER TRIM	169-885-1374		0%	80.00*
314	1	R/F BUMPER TRIM	169-885-1474		0%	80.00*

Ah Lim Motor Company

Claim Reference:

Assessment Number: AH000842

Version: AHLIM001/1

Full Report - V1

Registration: SJY1577X

Printed: 28/06/2018 11:27

319	1	FRT/CTR-IMPACT-DAMP	169-885-0137	0%		76.00*	?
351	1h	FRT BUMPER CLAMP KIT	USE SINGLE PARTS	0%	re	60.00*	✓
405	1	RADIATOR COVER	169-880-0783	0%	re	370.00*	X
561	1	LEFT HEADLAMP ASSY	169 820 2561	0%	Ch	570.00*	✓
562	1	RIGHT HEADLAMP ASSY	169-820-2661	0%	re	570.00*	X
637	1	L/F-FOG LAMP	251-820 0756	0%	re	170.00*	X
741	1	L/F WING	169 880 0718	0%	re	320.00*	✓
789	1h	L/WING CLAMP KIT	USE SINGLE PARTS	0%	re	40.00*	✓
833	1	L/F W-HOUSE-FRT-GVR	169 698 2530	0%		65.00*	?
835	1	L/F W-HOUSE-RR-COVER	169-698-2730	0%		80.00*	?
1001	1	FRT LWR-CROSSMEMBER	169-620-1734	0%		475.00*	?
7011	1	FRONT AXLE SUPPORT	169 620 0787	0%		1,350.00*	?
7035	1	L/DRIVE SHAFT CPL	169-360-5100	0%		1,200.00*	?
7047	1	L/F TRACK CONT ARM→	169 330 0907	0%	Photo	410.00*	?
7077	1	L/F STRUT →	169 320 1730	0%	Photo	350.00*	?
7081	1	L/F STEERING KNUCKLE→	169 330 0720	0%	re	740.00*	✓
7099	1	L/F STRUT BEARING	169-320-0073-28	0%	re	175.00*	✓
7133	1	L/F-NUT	169-335-0072	0%		4.18U	?
7201	1	L/F WHEEL <i>SPORT RIM</i>	169 400 0402	0%	Photo	61.52U	?
7202	1	R/F-WHEEL	169-400-0402	0%		61.52U	?
7261	1	FRONT STABILISER	169-323-0965	0%		175.00*	?
7263	1	L/F STABILISER ARM	169 320 0989	0%	re	50.00*	?
7264	1	R/F-STABILISER-ARM	169-320-0989	0%		50.00*	?
7300	1	POWER STEERING →	169 460 3300	0%	Photo	2,700.00*	?
f: OEM Parts				Sub Total		\$10,920.22	
g: Original				Total Parts		\$12,012.24	
h: Secondhand							
p: Parallel							
x: Exchange							

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description	Specialist	Betterment	Cur	Price	Folio
E-S. TYRE LHF	SPECIALIST	0%	re	\$0.00	Folio
TYRE RHF	SPECIALIST			\$0.00	Folio
CHK WIRING	SPECIALIST	0%		\$40.00	2d
any WHEEL ALIGNMENT	SPECIALIST			\$80.00	6d
Total Extras				\$120.00	

Final Calculation

Total Parts	\$12,012.24
Labour	
Total Panel/Mechanical	\$940.50
Total Paintwork	\$481.50
Total Visual Alignment work	\$40.50
Total Labour	\$1,462.50
Additional Costs	
Corr Prot Materials External	\$0.00
Corr Prot Materials Internal	\$0.00
Cost of Specialist	\$120.00
Total of Additional Costs	\$120.00
Total Paint/Material Costs	\$192.00
Grand Total Excludes GST	\$13,786.74
GST @ 7 %	\$965.07
Grand Total Includes GST	\$14,751.81

Assessment Notes

SURPASS AUTO PARTS SUPPLIES PTE LTD

10 KAKI BUKIT ROAD 1 #01-33 KB INDUSTRIAL BUILDING SINGAPORE 416175
 Tel: 67476016 Fax: 67449644 Email: surpasslim@gmail.com
 Co & Gst Reg No: 199904808E

AH LIM MOTOR COMPANY (A)
 10 ANG MO KIO IND PARK 2A
 #01-09 AMK AUTOPOINT
 SINGAPORE 568047

TAX INVOICE

Inv No. : 18070031
 Date : 04/07/2018
 Page : 1 of 2

S/N	Item No.	Description	Qty	U/ Price	Amount
1	A1693300707MY	LOWER ARM	1	410.00✓	410.00
2	A1693201530BT	22-215796 A1693201730 [B' FRT S/A	1	350.00✓	350.00
3	A1693300720	KNUCKLE	1	740.00✓	740.00
4	A1693201389	TORSION BAR LINKAGE	1	50.00✓	50.00
5	A169460330080	1694602200 STEERING BOX	1	2,700.00✓	2,700.00
6	A16988593259999	FRT BUMPER	1	580.00✓	580.00
7	A1698800918	FENDER	1	320.00✓	320.00
8	A1698202561B	HEADLAMP LH	1	570.00✓	570.00
9	A1694012602	B6647454664 WHEEL	1	450.00✓	450.00
10	A1696201634	HEADLAMP SUPPORT (B)	1	530.00✓	530.00
11	A0009973169	JOINT	1	5.50 ✓	5.50
12	A1249900492	39067 RIVET	15	4.00✓	60.00
13	A0019978686	PLUG	2	4.00 ✓	8.00
		SJY1577X			

09/07/2018 11:38:40

SURPASS AUTO PARTS SUPPLIES PTE LTD

10 KAKI BUKIT ROAD 1 #01-33 KB INDUSTRIAL BUILDING SINGAPORE 416175
 Tel: 67476016 Fax: 67449644 Email: surpasslim@gmail.com
 Co & Gst Reg No: 199904808E

AH LIM MOTOR COMPANY (A)
 10 ANG MO KIO IND PARK 2A
 #01-09 AMK AUTOPOINT
 SINGAPORE 568047

TAX INVOICE

Inv No. : 18070031
 Date : 04/07/2018
 Page : 2 of 2

S/N	Item No.	Description	Qty	U/ Price	Amount
-----	----------	-------------	-----	----------	--------

Page 1

Customer's Signature

Sub Total 6,773.50
 GST 7% 474.15
 Total 7,247.65

AUTO MART SUPPLY PTE LTD
BLK 10 ANG MO KIO INDUSTRIAL PARK 2A #05-17 AMK AUTOPOINT SINGAPORE 568647 E-mail: automartsupply@gmail.com
TEL 6481-5290 FAX 6481-3904
Business Reg & GST NO: 10-9902339-H

DELIVERY ORDER

AH LIM MOTOR COMPANY

Delivery Order: BI51022

BLK 10, ANG MO KIO INDUSTRIAL PARK 2A

Delivery Date : 4 JUL 2018
16:49

#01-09 AMK AUTOPOINT
SINGAPORE 568047

SJY1577X
Page : 1 of 1 Page.

PRODUCT CODE	DESCRIPTIONS	QUANTITY	UNIT PRICE	AMOUNT
BUSH,FF S/ABS	FRONT SHOCK ABSORBER STOPPER B180	2 PC	25.00	50.00

Subject To 7% Goods & Services Tax (50.00)

Issued By : BOON HUA

Checked By

Customer's Signature

14r
Ah Lim Motor Company
10 Ang Mo Kio Industrial
Park 2A
#01-09 AMK Autopoint
Singapore 568047

Claim Reference:
Assessment Number: AH000842
Version: AHLIM001/4
Date Calculated: 04/09/2018 04:00

Full Report - V1
Registration: SJY1577X
Printed: 11/10/2018 15:58

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	Ahlim ahlim	Date of Incident:	
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	AXA Insurance S'pore Pte Ltd	Repairs Authorised:	TBA
Claim Reference:		Estimated Repair Time:	
Policy Number:		Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	MERCEDES
Model:	B Class
Sub Model:	B 180 CDI
Model Sheet Number:	322 32
Registration:	SJY1577X
Registration Month:	August
Registration Year:	2010
VIN Number:	WDD2452322J575648
Manufacture Year:	2010
Odometer:	Not Known
Colour:	
Engine Number:	26694030757884
Fuel Level:	%

Model Specs

FOG LAMPS	CHROME PACKAGE
TWO COAT METALLIC	PAINTING OFF VEHICLE

Vehicle Condition



Vehicle Status

Pre-Accident Condition:	Severity of Impact:	
Steering:	Vehicle Status on Inspection:	
Brakes Pedal Travel:	Date of Inspection:	27/06/2018
Place of Inspection:		
Pre-Accident Damage:		
Tyres Condition:		
Tread Depth LHF:	Tread Depth RHF:	
Tread Depth LHR:	Tread Depth RHR:	
Damage Areas:	Direction of Impact:	

Ah Lim Motor Company

Claim Reference:
Assessment Number: AH000842
Version: AHLIM001/4
Date Calculated: 04/09/2018 04:00

Full Report - V1
Registration: SJY1577X
Printed: 11/10/2018 15:58

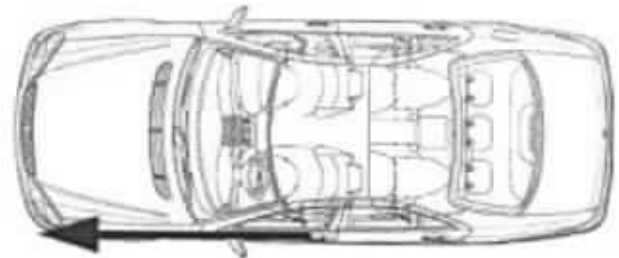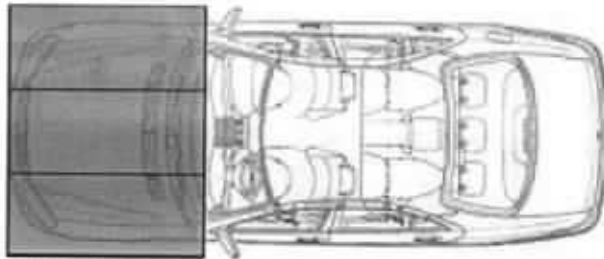

Addresses

Cost Summary

Total Labour	\$1,017.00
Total Paint/Material	\$144.58
Total Parts	\$7,499.80
Total of Additional Costs	\$440.00
Excess:	TBA
Grand Total Exc GST:	\$9,101.38
7 % GST:	\$637.10
Grand Total Inc GST:	\$9,738.48

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$45.00/HR
Price/Dent = \$45.00/HR

Repair / Guide Number	Repair Details	WU	Cost Price (\$)
88-1102 03	R + R COMPLETE FRONT BUMPER INCLUDES: R + R L/F AND R/F PARTITION AND FOG LAMPS	9.0	40.50
88-1105 03	DIS + ASS FRONT BUMPER (REMOVED) INCLUDES: R + R FOG LAMPS, RENEW PARTS AFTER CHECK	7.0	31.50
60-1574 01	R + R MERCEDES STAR	1.0	4.50
60-2296 01	R + R BOTH HEADLAMP UNITS (BUMPER REMOVED)	4.0	18.00
88-3814 02	R + R L/F WING (BUMPER REMOVED) INCLUDES: R + R A-PILLAR TRIM	7.0	31.50
88-3818 03)	RENEW L/F WING (REMOVED)	2.0	9.00
60-1301 02	R + R ATTACHED PARTS OF THE ENGINE COMPARTMENT FOR RENEWAL OF THE TRUSSING INCLUDES: R + R AIR INTAKE PIPE AND BONNET CABLE, DETACH + REFIT PARTIAL PARTITION DOES NOT INCLUDE: R + R BUMPER, HEADLAMPS AND BONNET LOCK	7.0	31.50
62-1320 01	RENEW FRONT TRUSSING CPL BETWEEN WHEELHOUSES	13.0	58.50
40-1580 01	R + R LEFT AND RIGHT FRONT WHEEL	3.0	13.50
40-2710 01	FIT L/F WHEEL	3.0	13.50
40-2125 ZAX	BALANCE WHEEL ASS WORK	2.0	9.00
33-3500 01)	R + R LEFT STEERING KNUCKLE	19.0	85.50

Ah Lim Motor Company

Claim Reference:

Assessment Number: AH000842

Version: AHLIM001/4

Date Calculated: 04/09/2018 04:00

Full Report - V1

Registration: SJY1577X

Printed: 11/10/2018 15:58

32-1955 01)	R + R L/F SUSPENSION STRUT (WHEEL REM)	7.0	31.50
33-1432 01)	R + R L/LWR CONTROL ARM (WHEEL REMOVED)	8.0	36.00
32-1908 01)	RENEW L/F SPRING STRUT (REMOVED)	3.0	13.50
32-1920 01)	RENEW L/- AND R/SPRING STRUT (ADD/WORK)	2.0	9.00
32-3328 01)	R + R L/F STABILIZER ARM	2.0	9.00
46-3611 04	RENEW POWER STEERING	54.0	243.00
NN	ABSORBER STOPPERX2 R&R / NEW PARTS	5.0*	22.50

LABOUR COST

Total Work Units	158.0	
Corrosion Protection External Labour	0.0HRS	0.00
Corrosion Protection Internal Labour	0.0HRS	0.00
Sub Total	15.8HRS	\$711.00
Paint Labour	6.8HRS	\$306.00
Total Labour	22.6HRS	\$1,017.00

PAINT WORK	Time Basis 10 WU = 1 HR. Price = \$45.00/HR
Guide Number Description	WU Cost Price (\$)

	- TWO COAT METALLIC	
	- PAINTING OFF VEHICLE	
283	FRONT BUMPER REPAIR PAINT PLASTIC	17.0
741	L/F WING REPAIR PAINTING >50%	15.0
471	BONNET SURFACE PAINT	11.0
742	R/F WING SURFACE PAINT	5.0

LABOUR COST - PAINT

TIME(PAINT)	48.0	
Preparation Main Work Plastic	12.0	
Preparation Comp. Work Metal	8.0	
Preparation Work Multi Layer Paint	0.0	
Total Work Units (10WU/HR)	68.0	
Total Paintwork Labour	6.8HRS	\$306.00

MATERIAL COST - PAINT

Surface-/Blend Paint	\$46.32
Repair Painting	\$12.25
Repair Painting Plastic	\$57.11
Material-Const Main Work Plastic	\$16.20
Material-Const Comp. Work Metal	\$12.70
Total Excluding Pearlescent Uplift	\$144.58
Pearlescent Uplift @ 0.0%	\$0.00
Total Paint Material Cost	\$144.58

PARTS

Guide No.	Qty	Description	Part Number	Supplier	Bet.	Price (\$)
283	1	FRONT BUMPER	169 885 2525		0%	580.00*
351	1	FRT BUMPER CLAMP KIT	USE SINGLE PARTS		0%	60.00*
561	1	LEFT HEADLAMP ASSY	169 820 2561		0%	570.00*
741	1	L/F WING	169 880 0718		0%	320.00*
1017	1	BONNET LANDING PANEL	169 620 1634		0%	530.00*
7047	1	L/F TRACK CONT ARM	169 330 0907		0%	410.00*
7077	1	L/F STRUT	169 320 1730		0%	350.00*
7081	1	L/F STEERING KNUCKLE	169 330 0720		0%	740.00*
7133	1	L/F NUT	169 335 0072		0%	0.00F

Price Valid: 01/06/2015

Ah Lim Motor Company

Claim Reference:
 Assessment Number: AH000842
 Version: AHLIM001/4
 Date Calculated: 04/09/2018 04:00

Full Report - V1
 Registration: SJY1577X
 Printed: 11/10/2018 15:58

7201	1	L/F WHEEL	169 400 0402	0%	450.00*
7263	1	L/F STABILISER ARM	169 320 0989	0%	50.00*
7300	1	POWER STEERING	169 460 3300	0%	2,700.00*
1000	1	ABSORBER STOPPERX2	Renew	0%	50.00*
1000	1	SIDE SKIRT CLIPX2	Renew	0%	8.00*

f: OEM Parts

g: Original

h: Secondhand

p: Parallel

x: Exchange

Saving

Sub Total

Mark Up From Cost (10 %)

Total Parts

\$4.18

\$6,818.00

\$681.80

\$7,499.80

THIS ASSESSMENT CONTAINS UNPRICED PARTS
 NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description	Betterment	Price
TYRE LHF -70% OF SPECIALIST 200	0%	\$140.00
TYRE RHF -70% OF SPECIALIST 200		\$140.00
CHK WIRING SPECIALIST	0%	\$20.00
WHEEL ALIGNMENT SPECIALIST		\$60.00
COOLANT SPECIALIST	0%	\$30.00
A/C GAS SPECIALIST		\$50.00
Total Extras		\$440.00

Final Calculation

Total Parts \$7,499.80

Labour

Total Panel/Mechanical

\$711.00

Total Paintwork

\$306.00

Total Labour

\$1,017.00

Additional Costs

Corr Prot Materials External

\$0.00

Corr Prot Materials Internal

\$0.00

Cost of Specialist

\$440.00

Total of Additional Costs

\$440.00

Total Paint/Material Costs

\$144.58

Grand Total Excludes GST

\$9,101.38

GST @ 7 %

\$637.10

Grand Total Includes GST

\$9,738.48

Assessment Notes

51 Ubi Avenue 1, #01-25
Paya Ubi Industrial Park
Singapore
408933

Claim Reference:
Assessment Number: AH000842
Version: AHLIM001/4
Date Calculated: 18/12/2018 08:10

Full Report - V1
Registration: SJY1577X
Printed: 21/01/2019 10:42

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	LKK AUTO	Date of Incident:	
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	AXA Insurance S'pore Pte Ltd	Repairs Authorised:	TBA

Claim Reference:	Estimated Repair Time:
Policy Number:	Quote Due Date:
Other Reference:	Actual Repair Days:
Third Party:	Parts Ordered Date:
Insured Amount:	Hire Car Start:
Under Warranty:	Hire Car End:
Warranty Expired:	Vehicle Collected:

Vehicle Details

Vehicle

Manufacturer:	MERCEDES
Model:	B Class
Sub Model:	B 180 CDI
Model Sheet Number:	322 32
Registration:	SJY1577X
Registration Month:	August
Registration Year:	2010
VIN Number:	WDD2452322J575648
Manufacture Year:	2012
Odometer:	Not Known
Colour:	
Engine Number:	26694030757884
Fuel Level:	%

Model Specs

FOG LAMPS	CHROME PACKAGE
TWO COAT METALLIC	PAINTING OFF VEHICLE

Vehicle Condition

Vehicle Status

Pre-Accident Condition:	Severity of Impact:	
Steering:	Vehicle Status on Inspection:	
Brakes Pedal Travel:	Date of Inspection:	27/06/2018
Place of Inspection:		
Pre-Accident Damage:		
Tyres Condition:	Tread Depth RHF:	
Tread Depth LHF:	Tread Depth RHR:	
Tread Depth LHR:	Direction of Impact:	
Damage Areas:		

Claim Reference:

Full Report - V1



Assessment Number: AH000842

Registration: SJY1577X

Version: AHLIM001/4

Printed: 21/01/2019 10:42

Date Calculated: 18/12/2018 08:10

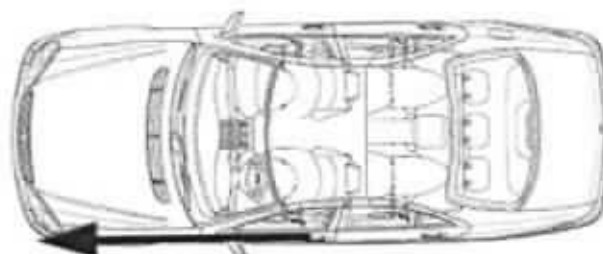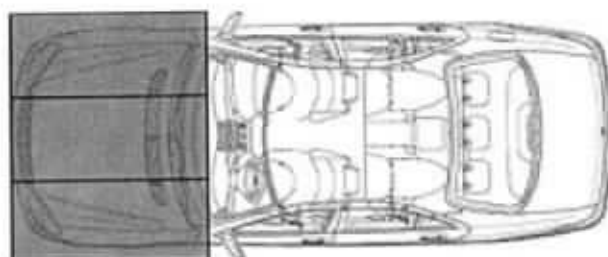**Addresses****Cost Summary**

Total Labour	\$1,017.00
Total Paint/Material	\$144.58
Total Parts	\$7,499.80
Total of Additional Costs	\$440.00
Excess:	TBA
Grand Total Exc GST:	\$9,101.38
7 % GST:	\$637.10
Grand Total Inc GST:	\$9,738.48

Repair Information**LABOUR**

Time Basis 10 WU = 1 HR. Price/CL 1 = \$45.00/HR
Price/Dent = \$45.00/HR

Repair / Guide Number	Repair Details	WU	Cost Price (\$)
88-1102 03	R + R COMPLETE FRONT BUMPER INCLUDES: R + R L/F AND R/F PARTITION AND FOG LAMPS	9.0	40.50
88-1105 03	DIS + ASS FRONT BUMPER (REMOVED) INCLUDES: R + R FOG LAMPS, RENEW PARTS AFTER CHECK	7.0	31.50
60-1574 01	R + R MERCEDES STAR	1.0	4.50
60-2296 01	R + R BOTH HEADLAMP UNITS (BUMPER REMOVED)	4.0	18.00
88-3814 02	R + R L/F WING (BUMPER REMOVED) INCLUDES: R + R A-PILLAR TRIM	7.0	31.50
88-3818 03)	RENEW L/F WING (REMOVED)	2.0	9.00
60-1301 02	R + R ATTACHED PARTS OF THE ENGINE COMPARTMENT FOR RENEWAL OF THE TRUSSING INCLUDES: R + R AIR INTAKE PIPE AND BONNET CABLE, DETACH + REFIT PARTIAL PARTITION DOES NOT INCLUDE: R + R BUMPER, HEADLAMPS AND BONNET LOCK	7.0	31.50
62-1320 01	RENEW FRONT TRUSSING CPL BETWEEN WHEELHOUSES	13.0	58.50
40-1580 01	R + R LEFT AND RIGHT FRONT WHEEL	3.0	13.50
40-2710 01	FIT L/F WHEEL	3.0	13.50
40-2125 ZAX	BALANCE WHEEL ASS WORK	2.0	9.00
33-3500 01)	R + R LEFT STEERING KNUCKLE	19.0	85.50

NOTE: TO BE COMPLETED BY SURVEYOR

TEAM A

AIG THIRD PARTY EXPRESS SETTLEMENT FOR ACCIDENTS ON OR AFTER 1ST JUNE 2008 (PAYMENT BREAKDOWN)

Vehicle No:	SFU7350L (Insd veh)	Model:	TOYOTA
	SKA4634J (TP veh)		
Date of Accident:	02/01/2012		

Global Sum Settlement	:	<input type="checkbox"/> Yes	<input checked="" type="checkbox"/> No
Repair Estimate	:	\$	4,067.18
Final Repair Cost	:	\$	2,354.00
Loss of Use	:	\$	320.00
Rental (if any)	:	\$	0.00
LTA / GIA Search Fee	:	\$	0.00
Others:	:	\$	0.00
	:	\$	
Final Settlement Sum	:	\$	2,674.00

4.00 days at \$80.00 per day

days

Is Third Party Workshop GIA Registered? ☐ YES ☒ NO (Kindly indicate below)

A) For Non GIA Registered Workshop: Agreed Liability 100 (%)

B) For GIA Registered Workshop: BOLA Applicable: Yes/ No BOLA Scenario No: _____

BOLA Liability: _____ (%) Assessed Liability (*): _____ (%)

* Assessed Liability to be filled only for chain collisions and for cases where BOLA does not apply.

Remarks _____

Payment Instruction: Payee's Breakdown			
1)	Bluwel Automotive Service Pte Ltd	:	\$ 2,674.00
2)		:	\$

JOANNE LEE KHANG MIN

27 Feb
2012

LKK Auto Consultants Pte Ltd

Date

Please attach all the supporting documents to the form.
(Final Repair Bill; Rental Invoice; Release Voucher; Authorisation to Act; Survey Report; Medical Report/ Bill (if any))

Claim Reference:

Full Report - V1

Assessment Number: AH000842

Registration: SJY1577X

Version: AHLIM001/4

Printed: 21/01/2019 10:42

Date Calculated: 18/12/2018 08:10

32-1955 01)	R + R L/F SUSPENSION STRUT (WHEEL REM)	7.0	31.50
33-1432 01)	R + R L/LWR CONTROL ARM (WHEEL REMOVED)	8.0	36.00
32-1908 01)	RENEW L/F SPRING STRUT (REMOVED)	3.0	13.50
32-1920 01)	RENEW L/- AND R/SPRING STRUT (ADD/WORK)	2.0	9.00
32-3328 01)	R + R L/F STABILIZER ARM	2.0	9.00
46-3611 04	RENEW POWER STEERING	54.0	243.00
NN	ABSORBER STOPPERX2 R&R / NEW PARTS	5.0*	22.50

LABOUR COST

Total Work Units	158.0	
Corrosion Protection External Labour	0.0HRS	0.00
Corrosion Protection Internal Labour	0.0HRS	0.00
Sub Total	15.8HRS	\$711.00
Paint Labour	6.8HRS	\$306.00
Total Labour	22.6HRS	\$1,017.00

PAINT WORKTime Basis 10 WU = 1 HR. Price = \$45.00/HR
WU Cost Price (\$)

Guide Number	Description	WU	Cost Price (\$)
	- TWO COAT METALLIC		
	- PAINTING OFF VEHICLE		
283	FRONT BUMPER REPAIR PAINT PLASTIC	17.0	
741	L/F WING REPAIR PAINTING >50%	15.0	
471	BONNET SURFACE PAINT	11.0	
742	R/F WING SURFACE PAINT	5.0	

LABOUR COST - PAINT

TIME(PAINT)	48.0	
Preparation Main Work Plastic	12.0	
Preparation Comp. Work Metal	8.0	
Preparation Work Multi Layer Paint	0.0	
Total Work Units (10WU/HR)	68.0	
Total Paintwork Labour	6.8HRS	\$306.00

MATERIAL COST - PAINT

Surface-/Blend Paint	\$46.32
Repair Painting	\$12.25
Repair Painting Plastic	\$57.11
Material-Const Main Work Plastic	\$16.20
Material-Const Comp. Work Metal	\$12.70
Total Excluding Pearlescent Uplift	\$144.58
Pearlescent Uplift @ 0.0%	\$0.00
Total Paint Material Cost	\$144.58

PARTS

Price Valid: 01/06/2015

Guide No.	Qty	Description	Part Number	Supplier	Bet.	Price (\$)
1000	1	ABSORBER STOPPERX2	Renew		0%	50.00*
1017	1	BONNET LANDING PANEL	169 620 1634		0%	530.00*
283	1	FRONT BUMPER	169 885 2525		0%	580.00*
351	1	FRT BUMPER CLAMP KIT	USE SINGLE PARTS		0%	60.00*
7133	1	L/F NUT	169 335 0072		0%	0.00F
7263	1	L/F STABILISER ARM	169 320 0989		0%	50.00*
7081	1	L/F STEERING KNUCKLE	169 330 0720		0%	740.00*
7077	1	L/F STRUT	169 320 1730		0%	350.00*
7047	1	L/F TRACK CONT ARM	169 330 0907		0%	410.00*

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)
 51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
 Singapore 408933
 Tel: 6256-3561 Fax: 6844-8805 Email: account@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CC6/AIG12000147/UA2B1Q2
 Date: 27/02/2012

REFERENCE

Handling Insurer:	Chartis Singapore Insurance Pte Ltd	Policy No:	100526069
Claimant Vehicle No :	SKA4634J	Insured Vehicle No :	SFU7350L
Date of Loss:	02/01/2012	Nature of Claim:	TP
		Claim No:	N/A

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SKA4634J	Engine No:	K20A35800155
Make & Model:	HONDA INTEGRA, 2.0 (A)	Chassis No:	JHMDC54506S200194
Reg. Date:	12/11/2005 (Man. Year: 2005)	Odometer:	77067 km
Colour:	Red		
Engine Capacity:	1998 cc		
Market Value:	N/A		
Sum Insured (S\$):	Market Value		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	225/45Z R17	Rear Tyre Size:	225/45Z R17
Front Left Side:	Champro 6 mm	Rear Left Side:	Champro 6 mm
Front Right Side:	Champro 6 mm	Rear Right Side:	Champro 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS

	Repairer's	Adjuster's	Difference	Diff %
Parts	2,511.10	1,888.76	622.34	24.78
Miscellaneous Items	0.00	0.00	0.00	
Labour	1,290.00	960.00	330.00	25.58
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	3,801.10	2,848.76	952.34	25.05
Approved Total (Overridden) (S\$)		2,200.00		
(S\$)	3,801.10	2,200.00	1,601.10	42.12
+ GST 7.00/7.00% (S\$)	266.08	154.00	112.08	42.12
Nett Amount (S\$)	4,067.18	2,354.00	1,713.18	42.12
+ Loss of Use (4.0 x S\$80.00/day) (S\$)		320.00		
Nett Liability (S\$)		2,674.00		

INSPECTION

Date of Assignment:	04/01/2012	
Date Inspected:	04/01/2012 Inspected At:	Bluwel Automotive Service Pte Ltd (KAKI BUKIT) 1 KAKI BUKIT AVE 6 (UNIT B) #01-28 Singapore 417883
Est Repair Period:	4	

Adjuster: MARCUS CHUA

Manager: JASMINE KHINE PHOO WAI

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

Claim Reference:

Full Report - V1

Assessment Number: AH000842

Registration: SJY1577X

Version: AHLIM001/4

Printed: 21/01/2019 10:42

Date Calculated: 18/12/2018 08:10

7201	1	L/F WHEEL	169 400 0402	0%	450.00*
741	1	L/F WING	169 880 0718	0%	320.00*
561	1	LEFT HEADLAMP ASSY	169 820 2561	0%	570.00*
7300	1	POWER STEERING	169 460 3300	0%	2,700.00*
1000	1	SIDE SKIRT CLIPSX2	Renew	0%	8.00*
f: OEM Parts		Saving			\$4.18
g: Original		Sub Total			\$6,818.00
h: Secondhand		Mark Up From Cost (10 %)			\$681.80
p: Parallel		Total Parts			\$7,499.80
x: Exchange					

THIS ASSESSMENT CONTAINS UNPRICED PARTS
NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description		Betterment	Price
TYRE LHF -70% OF 200	SPECIALIST	0%	\$140.00
TYRE RHF -70% OF 200	SPECIALIST		\$140.00
CHK WIRING	SPECIALIST	0%	\$20.00
WHEEL ALIGNMENT	SPECIALIST		\$60.00
COOLANT	SPECIALIST	0%	\$30.00
A/C GAS	SPECIALIST		\$50.00
		Total Extras	\$440.00

Final Calculation

Total Parts		\$7,499.80
Labour		
Total Panel/Mechanical	\$711.00	
Total Paintwork	\$306.00	
Total Labour		\$1,017.00
Additional Costs		
Corr Prot Materials External	\$0.00	
Corr Prot Materials Internal	\$0.00	
Cost of Specialist	\$440.00	
Total of Additional Costs		\$440.00
Total Paint/Material Costs		\$144.58
Grand Total Excludes GST		\$9,101.38
GST @ 7 %		\$637.10
Grand Total Includes GST		\$9,738.48

Assessment Notes



Auto
Consultants
Pte Ltd

51 UBI AVE 1, #01-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 62564315

Our Ref: CC6/AIG1200147/Ua2b1

16/02/2012

KOH YEOW KWANG
5A LOR 37 GEYLANG
#05-03
SINGAPORE 387914

Dear Sir/Madam,

ACCIDENT INVOLVING SFU 7350L AND SKA 4634J ON 02/01/2012

We refer to the above accident where we are acting for Chartis Singapore Insurance Pte Ltd to resolve the claim against you and/or your authorized driver under the Auto Insurance policy taken up with them.

Kindly note that we have reviewed this matter and would like to advise that you and/or your authorized driver may not be absolved from blame for this accident.

Should you however wish to further discuss on the matter prior to our negotiations and settlement, please contact us within 10 days from the date of this letter.

Accordingly your No Claim Discount (NCD – if applicable) may not be preserved.

Please call us if you have further queries.

Yours faithfully,

Kalvin Ang
Case Handler
DID: 6749 6465
FAX: 6741 4108
Email: kalvinang@lkkauto.com

c.c. *Chartis Singapore Insurance Pte Ltd*
(Motor Claims Dept)