

ASS. REC. BY:

REF:

TM1 / CC3 / TMZ 8012745 / Ksb02

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.


Sum Insured:

Excess:

(Client's Record)

Make of Vsh:

(Policy Condition)

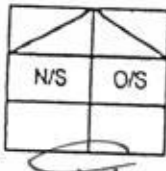Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value:

IDAC Accident Report:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

days

Res.: Yes or No

Lum Sum:

20 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SHC 55436

Yr Regn:

08.14

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Traller or

Make:

Renault Latitude

c.c

1995

Colour:

M. White 1R

A/C:

Insured / Std / NI / NA

Sp. Reading

601088

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

VF1ABL15AUC 27 8896

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modl: Nil / S/Rlm / STD A/Rlm or

Tyre Size:

F:

215/60R16

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or

Giti

Front

R/Bal.

S

mm

Rear

R/Bal.

S

mm

L/Bal.

S

mm

L/Bal.

S

mm

D.O.A.

6/7/18

D.O.I.

12/7/18

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

13/7

File pass to Catherine

L1Pm @ 11,850

SHC 55436 - CS/LIP 09072404 / Ksb02

SLJ 129T - X

(\$45,670.14 Red - 79%)

Date/Time, File Pass to?

13/07/18



: Prell. Report

1)

Type



: Final Report

Date/Time, File Return to?

Days Of Repair:

10

Resurvey No. of Trlp:

1

Survey Fee:

Transportation:

250

S + RS, SI

10

Fixtars

Others

260

TOTAL

Add Fee:



: Site Insp (\$



: Interview (\$



Tech Invs (\$



Weekend (\$

Report Format :

Lump Sum / I.B.I. (\$

11,850.00 4/51

[> Back to OneMotoring](#)**Enquire PARF/COE Rebate for Registered Vehicle****Vehicle Owner Particulars**

Owner ID Type:

Company

Owner ID:

3878K

Vehicle Details

Vehicle No.:

SHC5543G

Vehicle to be Exported:

Yes

Intended De-registration Date:

06 Jul 2018

Vehicle Make:

RENAULT

Vehicle Model:

LATITUDE 2.0L DCI AUTO D/AB 4DR

Primary Colour:

Red

Manufacturing Year:

2014

Engine No.:

M9R8839C001856

Chassis No.:

VF1ABL15AUC278896

Maximum Power Output:

127.0 kW (170 bhp)

Open Market Value:

\$19,998.00

Original Registration Date:

15 Aug 2014

First Registration Date:

15 Aug 2014

Transfer Count:

0

Actual ARF Paid:

\$12,498.00

Intended PARF Rebate Details

PARF Eligibility:

Yes

PARF Eligibility Expiry Date:

14 Aug 2022

PARF Rebate Amount:

\$9,373.00

Intended COE Rebate Details

COE Expiry Date:

14 Aug 2022

COE Category:

A - Car up to 1600cc & 97kW (130bhp)

COE Period(Years):

8

PQP Paid:

\$50,088.00

COE Rebate Amount:

\$25,700.00

Total Rebate Amount:**\$35,073.00****Message**

Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.

The information contained herein is correct as at 06 Jul 2018

OK

Shirley Hiew (LKK Auto)

From: Shirley Hiew (LKK Auto) <ShirleyHiew@lkkauto.com>
Sent: Friday, 13 July 2018 12:16 PM
To: 'Motor Claims'
Cc: 'SUR'
Subject: DIRECT SURVEY INSPECTION ON WORKSHOP - TRANS-CAB AUTO SERVICES PTE LTD DOA: 06/7/2018, SHC 5543G (TP VEHICLE), SJL 129T(OI VEHICLE)
Attachments: TP GIA REPORT.pdf; ESTIMATE.pdf

Dear Sir/Madam,

Please be informed that we had inspected the vehicle **SHC 5543G** M/s: TRANS-CAB AUTO SERVICES PTE LTD, NO.2 ANG MO KIO ST 63, SINGAPORE 569111.

Enclosed herewith a copy of TP's GIA report and estimated cost of repair.

Meanwhile, kindly create claim in merimen for our necessary action.

Thank you.

Best Regards,

Shirley Hiew | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: Sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	06/07/2018 16:16
Date Of Accident	06/07/2018 14:00
Exact Location Of Accident	UBI ROAD 1
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SHC5543G
Insured/Policyholder	
Name Of Registered Owner	TRANS-CAB SERVICES PTE LTD
Co Reg No	200303878K
Email Address	CLAIMS@TRANSCAB.COM.SG
Mobile Phone No	
Alternative Phone No	OFFICE-62876666

Vehicle Particulars

Manufacturer	RENAULT
Model	LATITUDE-2.0 L (A)
Exact Purpose for which vehicle was being used at time of accident	HIRE AND REWARD
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	TAXI

Insurance Company

Name of Insurance Company	AXA INSURANCE PTE LTD
Type Of Coverage	THIRD PARTY
Fleet Policy	YES
Policy Number	VPX/P1680520
Cover Note Number	

Driver

Name of Driver	GOH CHEE SIONG
NRIC No	S7904411C
Date Of Birth	22/02/1979
Occupation	OUTDOOR
Date Of Driving Pass	01/12/2003
Driving Experience	14 YEARS AND 7 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-97476934
Fax Number	
Contact Number	
Email Address	NOEMAIL

Address	BLK 234B SUMANG LANE #15-291
Postcode	822234
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OTHER - RELIEF
Vehicle Registration Number of Driver's Own Vehicle	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	COLLISION - HEAD TO REAR
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles involved in the accident	2
Was any body injured in the Accident?	YES
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	2
Passenger 1	NAME: : UNKNOWN GENDER: : FEMALE

Details of Police Action

Was the accident reported to the police?	YES
If Yes, Please state which Police Station	
Police Station Name	HOGANG N.P.C
Police Station Address	ROAD: 60 HOUGANG AVE 9 SINGAPORE 538775 , POSTCODE: 538775 , COUNTRY: SINGAPORE
Police Station Contact	TEL NO: - FAX NO:
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

PLEASE SEE ATTACHED POLICE REPORT

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SLJ129T
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	PRIVATE CAR
Name of Driver	
NRIC/Passport Number	
Contact Number	
Address	

Postcode

Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)

DETAILS OF INJURED PERSON 1

Name GOH CHEE SIONG

Approximate Age

Injuries Sustain

Injured person in which vehicle? SHC5543G

Were seat belts worn? YES

Was this injured conveyed to hospital by ambulance? NO

Address

Postcode

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this form and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of :
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.(collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents(including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.


Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

De Shuen
Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

Sketch Plan #2 Pg. 1

SKETCH PLAN

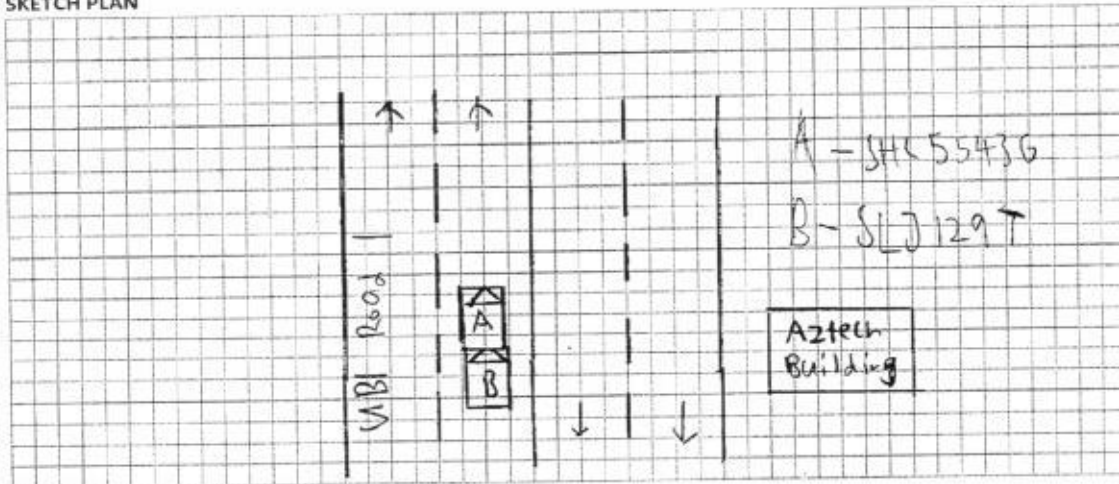

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

Please see attached police report

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

De Shuan
Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

POLICE REPORT Pg. 1



**SINGAPORE
POLICE FORCE**



T/20180706/2127

1 of 3

Police Station Of Origin:
Hougang N.P.C
60 Hougang Avenue 9 SINGAPORE 538775
Tel No: 1800-4890999

Report No. T/20180706/2127

REPORT OF A TRAFFIC ACCIDENT

Date/Time Report Made: 06/07/2018 20:13		Vide Report No.:		Station Diary No.: 90	
Informant's Particulars					
Name of Informant: GOH CHEE SIONG			Address: APT BLK 234B SUMANG LANE #15-291 SINGAPORE 822234		
ID Type / ID No.: NRIC NO / S7904411C			Contact No.: Home/Office:		Mobile: 97476934
Nationality: SINGAPORE CITIZEN			Email:		
Sex: Male	Age: 39	Date of Birth: 22/02/1979	Type of Informant: Driver		
Race: Chinese			Language:		Institution / School Name:
Occupation: Taxi driver			Driving Licence Information: Class: 2B,3		Date of Expiry:

General Information of the Accident

Type of Accident:	Injury Others	Drink Drive: No	Date/Time of Accident: 06/07/2018 14:00	Type of Location: X-Junction
Location: Along Road 1 UBI ROAD 1 Ubi Road 1 @ Aztech Building				
Weather: Clear		Road Surface: Dry	Road Speed Limit:	
Traffic Flow:		Traffic Control:	Traffic Volume: Heavy	
Type of Collision: Between Moving Vehicles - Head To Rear				Anyone conveyed by ambulance: No

Details of Vehicle Involved

Vehicle No	Type	Make	Model	Color	Condition	No of Passenger
SHC5543G	Car				Seriously Damaged	1
SLJ129T	Car				Seriously Damaged	0

Details of Person Involved

Any Pedestrian Involved: No	Use of Pedestrian Crossing: NA
No. of Pedestrians Injured: NIL	

POLICE REPORT Pg. 1



**SINGAPORE
POLICE FORCE**



T/20180706/2127

2 of 3

Police Station Of Origin:
Hougang N.P.C
60 Hougang Avenue 9 SINGAPORE 538775
Tel No: 1800-4890999

Report No. T/20180706/2127

CONTINUATION OF REPORT

Driver			
Name	GOH CHEE SIONG	ID No.	S7904411C
Related Vehicle	SHC5543G (Car)	Contact No.	97476934
Hospital/Clinic	POW FAMILY CLINIC & SURGERY	Class of Driving Licence & Expiry Date	Class: 2B,3 Date of Expiry: NIL
Date Treatment	06/07/2018	Date Discharge	06/07/2018
No. of Days granted Medical Leave	05	Degree of Injury	Slight
Driver			
Name	LIM LAI HENG	ID No.	S7809431A
Related Vehicle	SLJ129T (Car)	Contact No.	82993501
Hospital/Clinic	NIL	Class of Driving Licence & Expiry Date	Class: NIL Date of Expiry: NIL
Date Treatment	NIL	Date Discharge	NIL
No. of Days granted Medical Leave	NIL	Degree of Injury	NIL

Brief Details.

On 6/7/2018 at about 1400hrs, I was driving along Ubi Road 1 in my taxi SHC5543G as I was about to turn into Aztech Building the vehicle SLJ129T bang onto the rear of my taxi. I got off my taxi and we exchange particulars with the driver. There was one passenger on my car at that point of time and the lady informed me that she did not suffer any injuries, she refused to give me her particulars and informed me that she is fine. No police were at scene. Due to the collision the back part of my taxi was severally damaged, the bumper drop off and the car boot was unable to be open and dented in. The front part of the other parties vehicle was also severally damaged, the bumper drop off and dented in.

There is a CCTV installed in my taxi. Only my taxi company Trans Cab can retrieve the footages.

After the collision, I felt headache and pain on my neck and my upper and lower back and was unable to turn my neck fully hence I went to the clinic - Pow Family Clinic & Surgery, MC/48904 to see the doctor and was issued a 5 days medical certificate.
I am making this police report for injuries claim.

POLICE REPORT Pg. 1



**SINGAPORE
POLICE FORCE**



T/20180706/2127

3 of 3

Police Station Of Origin:
Hougang N.P.C
60 Hougang Avenue 9 SINGAPORE 538775
Tel No: 1800-4890999

Report No. T/20180706/2127

CONTINUATION OF REPORT

Sketch Plan

Informant is not able to provide sketch plan

IMPORTANT: Please attach a copy of your vehicle's Insurance Certificate to this report. If you don't have the certificate with you now, please fax a copy to 65474885 stating the report number as reference.

Signature Of Officer Recording The Report:

F /
Sgt 2 LEE JIA YI

Signature Of Interpreter:
Not applicable

Officer In Charge Of Case:
TP / AEIT /
SI DZUL HAIRIE BIN RAMLI
Contact No.: 65476220

Signature Of Informant:

Date/Time:
06/07/2018 20:13

Classification Of Case:

SN 085

Authentication Stamp
NP168



Signature:

Singapore Police Force

POLICE REPORT Pg. 1

Trans-cab Auto Services Pte Ltd

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHC 5543G**AAD1807-054***Not Authored
C/Lm 8/11, 850/*

Vehicle No.:

Chassis No.:

Vehicle Make:

Vehicle Model:

Date of Accident :

Third Party Insurer :

SHC 5543G

VF1ABL15AUC278896

RENAULT

LATITUDE

6.7.2018

*RCO***PART****LIST**

1	1 BUMPER COVER REAR	\$	<i>B</i> 1,108.46	✓
2	1 BUMPER LOWER REAR	\$	<i>his</i> 768.84	✓
3	1 BUMPER BRACKET CTR REAR	\$	<i>CMS</i> 113.47	✓
4	1 BUMEP R BRACKET SIDE RH REAR	\$	<i>Sm</i> 135.97	X
5	1 BUMEP R RETAINER RH REAR	\$	<i>Sm</i> 44.99	X
6	1 BUMPER REFLECTOR RH	\$	<i>Sm</i> 43.61	X
7	1 BUMEP R BRACKET SIDE LH REAR	\$	<i>Sm</i> 135.97	X
8	1 BUMEP R RETAINER LH REAR	\$	<i>his</i> 44.99	—
9	1 BUMPER REFLECTOR LH	\$	<i>CMS</i> 43.61	✓
10	1 BUMPER BEAM REAR	\$	<i>B</i> 777.52	✓
11	1 BUMPER BEAM BRACKET LH REAR	\$	<i>B</i> 225.95	—
12	1 BUMPER BEAM BRACKET RH REAR	\$	<i>his</i> 225.95	—
13	1 BOOT REAR	\$	<i>B</i> 2,872.68	✓
14	1 BOOT FINISHER	\$	<i>Sm</i> 470.06	X
15	1 BOOT WHEATERSTRIP	\$	<i>his/CN</i> 323.05	✓
16	1 BOOT REFLECTOR LAMP LH	\$	<i>CMS</i> 493.35	✓
17	1 BOOT REFLECTOR LAMP RH	\$	<i>Sm</i> 493.35	X
18	1 BOOT BADGE 'RENAULT'	\$	<i>Sm</i> 225.36	—
19	1 BOOT BADGE	\$	<i>Sm</i> 225.36	—
20	1 BOOT STRUT LH	\$	<i>Sm</i> 276.08	} X
21	1 BOOT STRUT RH	\$	<i>Sm</i> 276.08	
22	1 BOOT HINGE LH	\$	<i>R</i> 367.84	
23	1 BOOT HINGE RH	\$	<i>R</i> 367.84	
24	1 BOOT INNER TRIM	\$	<i>Sm</i> 586.45	
25	1 BOOT SWITCH	\$	<i>Sm</i> 168.13	
26	1 BOOT LOCK	\$	<i>R</i> 202.67	
27	1 BOOT LOCK CATCH	\$	<i>R</i> 74.40	
28	2 LICENCE PLATE LAMP	\$	<i>Sm</i> 50.52	
29	2 BOOT RUBBER PLUG	\$	<i>Sm</i> 221.81	

Trans-cab Auto Services Pte Ltd**AAD1807-054**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHC 5543G

- | | |
|----|---|
| 30 | 1 DOOR PANEL REAR LH |
| 31 | 1 FENDER PANEL INNER TRIM REAR LH |
| 32 | 1 FENDER PANEL REAR LH |
| 33 | 1 WHEELARCH REAR LH |
| 34 | 1 FENDER PANEL INNER TRIM REAR RH |
| 35 | 1 FENDER PANEL REAR RH |
| 36 | 1 WHEELARCH REAR RH |
| 37 | 1 TAILLAMP RH |
| 38 | 1 TAILLAMP PANEL RH |
| 39 | 1 TAILLAMP LH |
| 40 | 1 TAILLAMP PANEL LH |
| 41 | 1 OUTER PANEL REAR (End Panel) |
| 42 | 1 OUTER PANEL REAR (End Panel)TRIM |
| 43 | 1 SPARE WHEEL PANEL (Luggage Floor Panel) |
| 44 | 1 SPARE WHEEL PANEL TRIM |
| 45 | 1 EXHAUST REAR |
| 46 | 1 EXHAUST CAP REAR |
| 47 | 1 FUEL FLAP L70Y |
| 48 | 1 CHASSIS PANEL REAR LH |
| 49 | 1 WHEEL HOUSING PANEL REAR LH |

\$	<i>n</i>	2,844.66	}	<i>X</i>
\$	<i>sn</i>	671.45		
\$	<i>n</i>	3,299.13		
\$	<i>sn</i>	543.47		
\$	<i>sn</i>	671.45		
\$	<i>n</i>	3,299.13		
\$	<i>sn</i>	543.47		
\$	<i>sn</i>	552.55		
\$	<i>n</i>	986.70	}	
\$	<i>ngm</i>	552.55		
\$	<i>n</i>	986.70		<i>X</i>
\$	<i>n</i>	1,471.77		<i>✓</i>
\$	<i>cm</i>	404.56		<i>✓</i>
\$	<i>Br/An</i>	2,189.88		<i>✓</i>
\$	<i>sn</i>	612.21		<i>X</i>
\$	<i>n</i>	7,489.05		<i>X</i>
\$	<i>n</i>	230.49		<i>X</i>
\$	<i>sn</i>	343.57		<i>X</i>
\$	<i>n</i>	3,766.43		<i>X</i>
\$	<i>n</i>	4,682.09		<i>X</i>
TOTAL		\$ 47,505.69		<i>67</i>
10%		\$ 4,750.57		
		\$ 42,755.12		

Special Nett

- | | |
|----|-------------------------------------|
| 1 | 1SET PARKING AID |
| 2 | 1SET REAR BUMPER CLIP |
| 3 | 1SET BUMPER BRACKET CTR CLIP |
| 4 | 1SET BUMPER BRACKET SIDE CLIP RH RR |
| 5 | 1SET BUMPER RETAINER RH CLIP RR |
| 6 | 1SET BUMPER BRACKET SIDE CLIP LH RR |
| 7 | 1SET BUMPER RETAINER CLIP LH RR |
| 8 | 1SET BUMPER LOWER REAR RIVET |
| 9 | 1SET BUMPER LOWER REAR CLIP |
| 10 | 1 EXHAUST MOUNTING REAR |
| 11 | 1SET BOOT FINISHER CLIP |
| 12 | 1 BOOT STICKER "Trans-cab" |

\$	<i>short</i>	700.00	<i>✓</i>
\$	<i>nn</i>	66.00	<i>✓</i>
\$	<i>nn</i>	33.00	<i>✓</i>
\$	<i>nn</i>	10.00	<i>X</i>
\$	<i>nn</i>	20.00	<i>X</i>
\$	<i>nn</i>	10.00	<i>X</i>
\$	<i>nn</i>	20.00	<i>X</i>
\$	<i>nn</i>	22.00	<i>X</i>
\$	<i>nn</i>	66.00	<i>✓</i>
\$	<i>sn</i>	17.82	<i>X</i>
\$	<i>nn</i>	24.20	<i>X</i>
\$	<i>nn</i>	30.00	<i>✓</i>

Trans-cab Auto Services Pte Ltd**AAD1807-054**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHC 5543G

13	1 BOOT STICKER "6555-3333"	\$	30.00	✓
14	1 BOOT INNER TRIM CLIP	\$	45.00	✓
15	1SET FENDER WHEELARCH REAR RH CLIP	\$	35.00	X
16	1SET FENDER WHEELARCH REAR LH CLIP	\$	35.00	X
17	1 FENDER INNER TRIM CLIP LH	\$	28.00	X
18	1 FENDER INNER TRIM CLIP LH	\$	28.00	X
19	1 TAILLAMP CLIP RH	\$	5.00	X
20	1 TAILLAMP CLIP LH	\$	5.00	✓
21	2 REAR WINDSCREEN SELANT	\$	80.00	X
22	1 WINDSCREEN MOULDING	\$	100.00	X
23	1 REAR WINDSCREEN INNER SPONGE SEAL	\$	100.00	X
24	1 SPARE TYRE RIM (ROUE 7J 16H 2547)	\$	385.00	X
25	1 SPARE TYRE	\$	330.00	X

TOTAL \$ 2,225.02**TOTAL PARTS \$ 44,980.14****LABOUR**

Putty And Spray Painting Of The Affected Portion.	\$	6,000.00	1100
Panel Beating, Knocking And Straightening The Necessary Portion, Remove And Renewal Of Parts, Adjust And Realign The Same	\$	4,200.00	1400
To Rust-Proofing Of The Affected Areas.	\$	170.00	90
To reinstall rear bumper parking sensor.	\$	170.00	60
To transfer of bootlid fittings, attachments and perform water seepage test.	\$	170.00	60
To repair and realign rear exhaust pipe.	\$	170.00	} 80
To drop rear exhaust box, renew the same, to repair and realign centre exhaust pipe.	\$	170.00	

Trans-cab Auto Services Pte Ltd

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHC 5543G**AAD1807-054**

To transfer of rear end panel fittings, attachment and perform water seepage test.

\$ 170.00

To transfer of rear luggage floor panel fittings, attachment and perform water seepage test.

\$ 170.00

} 1001

To supply and re-do rear luggage floor panel insulation padding.

\$ 380.00

801

To transfer of rear fender fittings, attachment and perform water seepage test.

\$ 380.00

X

To transfer of rear windscreen fittings and conduct water seepage test.

\$ 170.00

X

To check steering geometry and computer wheel alignment

\$ 220.00

X

To transfer of rear door fittings, attachment and perform water seepage test.

\$ 380.00

X

TOTAL \$ 12,540.00**Over All Total \$ 57,520.14**

57900.12

(LUMP SUM)**Repair Days****20 DAYS**

10 days

By _____ notify
the _____

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from insurance Company

Acknowledged by Repairer
Signature: _____
Date: _____

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from insurance Company

Acknowledged by Repairer
Signature: _____
Date: _____

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CC3/TMI18012745/KSBN2

Date: 16/07/2018

REFERENCE

Handling Insurer:	Tokio Marine Insurance Singapore Ltd	Policy No:	MU012412
Claimant Vehicle No :	SHC5543G	Insured Vehicle No :	SLJ129T
Date of Loss:	06/07/2018	Nature of Claim:	TP
		Claim No:	M1803364

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SHC5543G	Engine No:	M9R8839C001856
Make & Model:	RENAULT LATITUDE, 2.0 L (A)	Chassis No:	VF1ABL15AUC278896
Reg. Date:	15/08/2014 (Man. Year: 2014)	Odometer:	601088 km
Colour:	Metallic White/Red		
Engine Capacity:	1995 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	215/60R16	Rear Tyre Size:	215/60R16
Front Left Side:	Giti 8 mm	Rear Left Side:	Giti 8 mm
Front Right Side:	Giti 8 mm	Rear Right Side:	Giti 8 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	44,980.12	11,835.61	33,144.51	73.69
Miscellaneous Items	0.00	0.00	0.00	
Labour	12,920.00	2,970.00	9,950.00	77.01
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	57,900.12	14,805.61	43,094.51	74.43
Approved Total (Overridden) (S\$)		11,850.00		
(S\$)	57,900.12	11,850.00	46,050.12	79.53
+ GST 7.00/7.00% (S\$)	4,053.01	829.50	3,223.51	79.53
Nett Amount (S\$)	61,953.13	12,679.50	49,273.63	79.53

INSPECTION

Date of Assignment:	13/07/2018	
Date Inspected:	12/07/2018	Inspected At:

Trans-cab Auto Services Pte Ltd
No 2 Ang Mo Kio Street 63
Singapore 569111

Estimated Period of Repair: 10.0 days

Adjuster: KENNETH KONG

Manager: Hiew May Fung

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source: MRM-SG	Version: 1.0 (Last Synchronised: 16 Jul 2018)
Parts: 143	RENAULT LATITUDE 2.0 L (A) (Catalogue:Merimen Singapore 1.0)
Labour: Repairer's	(Price-denominated Standard List)
Print Code: (Unsubmitted, no print-code for SHC5543G)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No. Particulars	Condition	Repairer's	Amount
1	1	*BUMPER COVER REAR	Bent	1,108.46 FL	*1,108.46 FL
2	1	*BUMPER LOWER REAR	Missing	768.84 FL	*768.84 FL
3	1	*BUMPER BRACKET CTR REAR	Cracked	113.47 FL	*113.47 FL
4	1	*BUMPER BRACKET SIDE RH REAR	Serviceable	135.97 FL	*- FL
5	1	*BUMPER RETAINER RH REAR	Serviceable	44.99 FL	*- FL
6	1	*BUMPER REFLECTOR RH	Serviceable	43.61 FL	*- FL
7	1	*BUMPER BRACKET SIDE LH REAR	Serviceable	135.97 FL	*- FL
8	1	*BUMPER RETAINER LH REAR	Distorted	44.99 FL	*44.99 FL
9	1	*BUMPER REFLECTOR LH	Cracked	43.61 FL	*43.61 FL
10	1	*BUMPER BEAM REAR	Bent	777.52 FL	*777.52 FL
11	1	*BUMPER BEAM BRACKET LH REAR	Bent	225.95 FL	*225.95 FL
12	1	*BUMPER BEAM BRACKET RH REAR	Distorted	225.95 FL	*225.95 FL
13	1	*BOOT REAR	Bent	2,872.68 FL	*2,872.68 FL
14	1	*BOOT FINISHER	Serviceable	470.06 FL	*- FL
15	1	*BOOT WEATHERSTRIP	Distorted/Cut	323.05 FL	*323.05 FL
16	1	*BOOT REFLECTOR LAMP LH	Cracked	493.35 FL	*493.35 FL
17	1	*BOOT REFLECTOR LAMP RH	Serviceable	493.35 FL	*- FL
18	1	*BOOT BADGE RENAULT	Necessary	225.36 FL	*225.36 FL
19	1	*BOOT BADGE	Necessary	225.36 FL	*225.36 FL
20	1	*BOOT STRUT LH	Serviceable	276.08 FL	*- FL
21	1	*BOOT STRUT RH	Serviceable	276.08 FL	*- FL
22	1	*BOOT HINGE LH	Repair	367.84 FL	*- FL
23	1	*BOOT HINGE RH	Repair	367.84 FL	*- FL
24	1	*BOOT INNER TRIM	Serviceable	586.45 FL	*- FL
25	1	*BOOT SWITCH	Serviceable	168.13 FL	*- FL
26	1	*BOOT LOCK	Repair	202.67 FL	*- FL
27	1	*BOOT LOCK CATCH	Repair	74.40 FL	*- FL
28	2	*LICENCE PLATE LAMP	Serviceable	50.52 FL	*- FL
29	2	*BOOT RUBBER PLUG	Serviceable	221.81 FL	*- FL
30	1	*DOOR PANEL REAR LH	Repair	2,844.66 FL	*- FL
31	1	*FENDER PANEL INNER TRIM REAR LH	Serviceable	671.45 FL	*- FL
32	1	*FENDER PANEL REAR LH	Repair	3,299.13 FL	*- FL
33	1	*WHEELARCH REAR LH	Serviceable	543.47 FL	*- FL
34	1	*FENDER PANEL INNER TRIM REAR RH	Serviceable	671.45 FL	*- FL
35	1	*FENDER PANEL REAR RH	Repair	3,299.13 FL	*- FL
36	1	*WHEELARCH REAR RH	Serviceable	543.47 FL	*- FL
37	1	*TAILLAMP RH	Serviceable	552.55 FL	*- FL
38	1	*TAILLAMP PANEL RH	Repair	986.70 FL	*- FL
39	1	*TAILLAMP LH	Mtg Cracked	552.55 FL	*552.55 FL
40	1	*TAILLAMP PANEL LH	Repair	986.70 FL	*- FL
41	1	*OUTER PANEL REAR (END PANEL)	Bent	1,471.77 FL	*1,471.77 FL
42	1	*OUTER PANEL REAR (END PANEL) TRIM	Cracked	404.56 FL	*404.56 FL
43	1	*SPARE WHEEL PANEL (LUGGAGE FLOOR PANEL)	Bent/Buckled	2,189.88 FL	*2,189.88 FL
44	1	*SPARE WHEEL PANEL TRIM	Serviceable	612.21 FL	*- FL

Report was unsubmitted during this print-out.

No.	Qty	Part No. Particulars	Condition	Repairer's	Amount
45	1	*EXHAUST REAR	Repair	7,489.05 FL	*-FL
46	1	*EXHAUST CAP REAR	Repair	230.49 FL	*-FL
47	1	*FUEL FLAP L70Y	Serviceable	343.57 FL	*-FL
48	1	*CHASSIS PANEL REAR LH	Repair	3,766.43 FL	*-FL
49	1	*WHEEL HOUSING PANEL REAR LH	Repair	4,682.09 FL	*-FL
50	1	*SET PARKING AID	Shorted	700.00 FS	*700.00 FS
51	1	*SET REAR BUMPER CLIP	Necessary	66.00 FS	*66.00 FS
52	1	*SET BUMPER BRACKET CTR CLIP	Necessary	33.00 FS	*33.00 FS
53	1	*SET BUMPER BRACKET SIDE CLIP RH RR	Not Necessary	10.00 FS	*-FS
54	1	*SET BUMPER RETAINER RH CLIP RR	Not Necessary	20.00 FS	*-FS
55	1	*SET BUMPER BRACKET SIDE CLIP LH RR	Not Necessary	10.00 FS	*-FS
56	1	*SET BUMPER RETAINER CLIP LH RR	Not Necessary	20.00 FS	*-FS
57	1	*SET BUMPER LOWER REAR RIVET	Not Necessary	22.00 FS	*-FS
58	1	*SET BUMPER LOWER REAR CLIP	Necessary	66.00 FS	*66.00 FS
59	1	*EXHAUST MOUNTING REAR	Serviceable	17.82 FS	*-FS
60	1	*SET BOOT FINISHER CLIP	Not Necessary	24.20 FS	*-FS
61	1	*BOOT STICKER TRANS-CAB	Necessary	30.00 FS	*30.00 FS
62	1	*BOOT STICKER 6555-3333	Necessary	30.00 FS	*30.00 FS
63	1	*BOOT INNER TRIM CLIP	Necessary	45.00 FS	*45.00 FS
64	1	*SET FENDER WHEELARCH REAR RH CLIP	Not Necessary	35.00 FS	*-FS
65	1	*SET FENDER WHEELARCH REAR LH CLIP	Not Necessary	35.00 FS	*-FS
66	1	*FENDER INNER TRIM CLIP LH	Not Necessary	28.00 FS	*-FS
67	1	*FENDER INNER TRIM CLIP LH	Not Necessary	28.00 FS	*-FS
68	1	*TAILLAMP CLIP RH	Not Necessary	5.00 FS	*-FS
69	1	*TAILLAMP CLIP LH	Necessary	5.00 FS	*5.00 FS
70	2	*REAR WINDSCREEN SEALANT	Not Necessary	80.00 FS	*-FS
71	1	*WINDSCREEN MOULDING	Not Necessary	100.00 FS	*-FS
72	1	*REAR WINDSCREEN INNER SPONGE SEAL	Not Necessary	100.00 FS	*-FS
73	1	*SPARE TRYE RIM (ROUE 7J 16H 2547)	Serviceable	385.00 FS	*-FS
74	1	*SPARE TYRE	Serviceable	330.00 FS	*-FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$)	49,730.69	13,042.35
- List Item Discount on L Items 10.00/10.00% (\$\$)	4,750.57	1,206.74
Total Parts (\$\$)	44,980.12	11,835.61

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION	New	6,000.00	1,100.00
2	PANEL BEATING,KNOCKING AND STRAIGHTENING THE NECESSARY PORTION,REMOVE AND RENEWAL OF PARTS,ADJUST AND REALIGN THE SAME	New	4,200.00	1,400.00
3	TO RUST-PROOFING OF THE AFFECTED AREAS	New	170.00	90.00
4	TO REINSTALL REAR BUMPER PARKING SENSOR	New	170.00	60.00
5	TO TRANSFER OF BOOTLID FITTINGS,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST	New	170.00	60.00
6	TO REPAIR AND REALIGN REAR EXHAUST PIPE }	New	170.00	80.00
7	TO DROP REAR EXHAUST BOX,RENEW THE SAME,TO REPAIR AND REALIGN CENTRE EXHAUST PIPE }	New	170.00	-
8	TO TRANSFER OF REAR END PANEL FITTINGS,ATTACHMENT AND PERFORM WATER SEEPAGE TEST }	New	170.00	100.00
9	TO TRANSFER OF REAR LUGGAGE FLOOR PANEL FITTINGS,ATTACHMENT AND PERFORM WATER SEEPAGE TEST }	New	170.00	-
10	TO SUPPLY AND RE-DO REAR LUGGAGE FLOOR PANEL INSULATION PADDING	New	380.00	80.00
11	TO TRANSFER OF REAR FENDER FITTINGS,ATTACHMENT AND PERFORM WATER SEEPAGE TEST	New	380.00	-
12	TO TRANSFER OF REAR WINDSCREEN FITTINGS AND CONDUCT WATER SEEPAGE TEST	New	170.00	-
13	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT	New	220.00	-
14	TO TRANSFER OF REAR DOOR FITTINGS,ATTACHMENT AND PERFORM WATER SEEPAGE TEST	New	380.00	-
Gross Labour Cost (S\$)			12,920.00	2,970.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >