

ASS. REC. BY:

REF:

A/G/

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

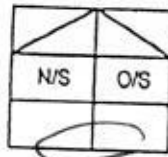

Bal. or Market Value:

IDAC Accident Report:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

06

days

Res.:

Yes or No

Lum Sum:

20

%

3 Val.:

Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

S14D 9357X

Yr Regn:

01, 12

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Traller or

Make:

Chevrolet Epica

c.c

1991

Colour:

White / Red

A/C:

Insured / Std / NI / NA

Sp. Reading

643703

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

KLILA69RTJB 072788

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: M / S/Rim / STD A/Rim or

Tyre Size:

F:

195/65R15

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or

Giti

Front

R/Bal.

9

mm

Rear

R/Bal.

8

mm

L/Bal.

9

mm

L/Bal.

8

mm

D.O.A.

16/7/18

D.O.I.

18/7/18

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

19/7

File pass to Catherine

L/S - \$6050 (Red 31917.19 / 842)

Date/Time, File Pass to?

☐

: Prell. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trlp:

Survey Fee:

Transportation:

S - RS - SI

Fixes

Others

TOTAL

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech Invs (\$

☐

: Weekend (\$

Report Format :

Lump Sum / I.B.I: (\$



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
AIG ASIA PACIFIC INSURANCE PTE LTD		Ref : CC3/AIG18013128/Kub3	
78 SHENTON WAY #08-16 CHARTIS BUILDING SINGAPORE 079120		Date : 19-07-2018	
		Code : AIG	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	SJJ 1005J	Veh. Inspected	SHD 9357X
Policy No.		Coverage (\$)	0.00
Claim No.		Excess (\$)	0.00
Assign From		Assign Date	19/07/2018
2. Vehicle Particulars & Condition			
Make & Model		c.c	0
Engine No.	HIDDEN	Year of Reg.	
Chassis No.		Colour	
Odometer	-	Steering	
Brakes		Modification	
General			
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm
4. Description of Damages			
5. General Information			
Accident Date	16/07/2018	Inspection Date	18/07/2018
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			

Trans-cab Auto Services Pte Ltd

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHD 9357X**AAD1807-156***Not Notified
1/1/2018 \$6050*

Vehicle No.:

Chassis No.:

Vehicle Make:

Vehicle Model:

Date of Accident :

Third Party Insurer :

SHD 9357X

KL1LA69RJB072798

CHEVROLET

EPICA 2.0

16.7.2018

AIG

PART		LIST	
1	1	Front Bumper	\$ <i>CM</i> 1,202.00 ✓
2	1	Front Bumper Reinforcement	\$ <i>N</i> 295.25 ✗
3	1	Front Bumper Lower Absorber	\$ <i>N</i> 180.00 ✗
4	1	Front Bumper Lower Grille	\$ <i>N</i> 78.00 ✓
5	1	Front Bumper Retainer RH	\$ <i>N</i> 102.00 ✗
6	1	Front Bumper Retainer LH	\$ <i>N</i> 102.00 ✗
7	1	Front Bumper Lower Stiffener	\$ <i>N</i> 134.37 ✗
8	1	Front Headlamp RH	\$ <i>N</i> 816.00 ✗
9	1	Front Headlamp LH	\$ <i>N</i> 816.00 ✗
10	1	Front Support Panel Assy (Panel A-Frt)	\$ <i>N</i> 1,222.32 ✗
11	1	Bonnet (Panel A-Hood)	\$ <i>N</i> 1,250.00 ✗
12	1	Centre 'CHEVROLET' Logo Badge	\$ <i>N</i> 144.30 ✗
13	1	Bonnet Moulding	\$ <i>N</i> 257.00 ✗
14	1	Radiator Grille (Grille A-Rad)	\$ <i>CM</i> 367.00 ✓
15	1	Radiator Assembly (Radiator A)	\$ <i>N</i> 618.00 ✗
16	1	Aircon Condenser (Condenser A)	\$ <i>N</i> 600.00 ✗
17	1	Air Intercooler	\$ <i>N</i> 652.00 ✗
18	1	Fan Blade (Small)	\$ <i>N</i> 536.00 ✗
19	1	Fan Blade (Big)	\$ <i>N</i> 634.00 ✗
20	1	Front Fender LH	\$ <i>N</i> 837.60 ✗
21	1	Front Fender RH	\$ <i>N</i> 837.60 ✗
22	1	Rear Bumper	\$ <i>B</i> 1,202.00 ✓
23	1	Rear Bumper Beam	\$ <i>B</i> 239.94 ✓
24	1	Rear Bumper Centre Absorber	\$ <i>CM</i> 260.00 ✓
25	1	Rear Bumper Side Retainer RH	\$ <i>CM</i> 68.76 ✓
26	1	Rear Bumper Side Retainer LH	\$ <i>CM</i> 68.76 ✓
27	1	Rear Bumper side support RH	\$ <i>N</i> 25.00 ✓

Trans-cab Auto Services Pte Ltd**AAD1807-156**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHD 9357X

28	1	Rear Bumper side support LH	\$	Sh 25.00 X
29	1	Rear Bumper Reflectors RH	\$	Bto 119.74 —
30	1	Rear Bumper Reflectors LH	\$	cm 119.74 —
31	1	Rear Bumper Tow Hook Cover	\$	h11 93.00 —
32	1	Rear Luggage Floor Panel	\$	R 973.00 X
33	1	Rear Luggage Floor Panel Insulator	\$	Sh 63.50 X
34	1	Rear Luggage Floor Panel Trim Board	\$	Sh 378.00 X
35	1	Rear End Panel Inner	\$	B 336.84 —
36	1	Rear End Panel Outer	\$	R 623.76 —
37	1	Rear End Panel Inner Trim	\$	D11 263.84 —
38	1	Bootlid	\$	R 973.00 X
39	1	Bootlid inner trim board	\$	Sh 400.00 X
40	1	Bootlid Weatherstrip	\$	Sh 344.28 X
41	1	Bootlid Lock - Top	\$	R 466.56 X
42	1	Bootlid lock - bottom	\$	R 39.40 X
43	1	Bootlid 'CHEVROLET' Badge	\$	Sh 120.62 —
44	1	Bootlid Logo	\$	Sh 138.84 —
45	1	Bootlid 'EPICA LT' Badge	\$	Sh 119.84 —
46	1	Bootlid inner handle	\$	Sh 45.55
47	1	Bootlid Reflector Centre	\$	Sh 217.97
48	1	Bootlid Reflector RH	\$	Sh 128.40
49	1	Bootlid Reflector LH	\$	Sh 128.40
50	1	Bootlid Hinge RH	\$	R 120.00
51	1	Bootlid Hinge LH	\$	R 120.00
52	1	Rear Tail Lamp RH	\$	Sh 479.30
53	1	Rear Tail Lamp Panel RH	\$	R 359.00
54	1	Rear Tail Lamp LH	\$	Sh 479.30
55	1	Rear Tail Lamp Panel LH	\$	R 359.00
56	1	Rear Exhaust Box (Muffler A-EXH,RR)	\$	R 1,110.00
57	1	Rear Fender RH	\$	R 1,145.00
58	1	Rear Fender Inner Cowling RH	\$	Sh 298.00
59	1	Rear Fender Inner Trim RH	\$	Sh 418.44
60	1	Rear Fender LH	\$	R 1,145.00
61	1	Rear Fender Inner Cowling LH	\$	Sh 298.00
62	1	Rear Fender Inner Trim LH	\$	Sh 418.44

Trans-cab Auto Services Pte Ltd

AAD1807-156

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHD 9357X

TOTAL	\$	26,414.66
10%	\$	2,641.47
	\$	23,773.19

5442.68

Special Nett

1	1Set	Front Bumper Fastener Clip	\$	24.00 ✓
2	1Set	Front Licence Plate With Holder	\$	192.00 25m
3	1Set	Bonnet Insulator Clip	\$	40.00 X
4	1Set	Radiator Grille Clip	\$	18.00 ✓
5	1Set	Bootlid inner trim board Clip	\$	40.00 X
6	1Set	Radiator Grille Top Cover Clip	\$	10.00 X
7	1Set	Front Fender Liner Clip	\$	40.00 X
8	1Set	Rear Bumper Parking Sensor	\$	300.00 ✓
9	1Set	Rear Bumper Fastener Clip	\$	30.00 ✓
10	2Set	Rear Fender inner cowl clip	\$	30.00 X
11	1Set	Rear Fender Inner Trim Clip RH	\$	30.00 X
12	1Set	Rear Fender Inner Trim Clip LH	\$	30.00 X
13	1Set	Rear Bumper End Dust Cover Clip	\$	30.00 X
14	1	Rear Boot Sticker 'Trans-cab'	\$	30.00 ✓
15	1	Rear Boot Sticker '6555-3333'	\$	30.00 ✓
16	1	Rear Exhaust Mounting	\$	10.00 X
17	1	Rear Bumper End Sealant	\$	80.00 X
18	2	Rear Windscreen Sealant	\$	80.00 X
19	1	Rear Windscreen Inner Sponge Seal	\$	100.00 X

TOTAL	\$	1,144.00
--------------	-----------	-----------------

TOTAL PARTS	\$	24,917.19
--------------------	-----------	------------------

Panel Beating, Knocking And Straightening The
Necessary Portion, Remove And Renewal Of
Parts, Adjust And Realign The Same

\$	6,000.00
----	----------

To Check Electrical Lighting Concerned.

\$	170.00
----	--------

1000

40

Trans-cab Auto Services Pte Ltd

AAD1807-156

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHD 9357X

To Rust-Proofing Of The Affected Areas.	\$	170.00 <i>bol</i>
Putty And Spray Painting Of The Affected Portion.	\$	4,800.00 <i>1000</i>
To drop rear exhaust box, renew the same, to repair and realign centre exhaust pipe.	\$	170.00 <i>bol</i>
To reinstall rear bumper parking sensor.	\$	170.00 <i>bol</i>
To transfer of end panel fittings and conduct water seepage test.	\$	170.00 <i>X</i>
Towing fees	\$	<i>na</i> 120.00 <i>X</i>
To transfer of boot fittings and conduct water seepage test.	\$	<i>na</i> 170.00 <i>X</i>
To transfer of Fender fittings, attachments and perform water seepage test.	\$	<i>na</i> 170.00 <i>X</i>
To check steering geometry and computer wheel alignment	\$	<i>na</i> 220.00 <i>X</i>
To transfer of tire, rim and on wheel balancing.	\$	<i>na</i> 170.00 <i>X</i>
To Remove And Refit Rear W/Screen Glass To Facilitate Bodywork Repair.	\$	<i>na</i> 170.00 <i>X</i>
To check ABS brake efficiency, final checking and testing.	\$	<i>na</i> 380.00 <i>X</i>

KK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Repair Days

Acknowledged by Repairer
Signature:
Date:

\$	13,050.00
TOTAL	\$ 37,967.19

20-DAYS
6 days

7/17/2018

PARF/COE Rebate Enquiry

[> Back to OneMotoring](#)**Enquire PARF/COE Rebate for Registered Vehicle****Vehicle Owner Particulars**

Owner ID Type:	Company
Owner ID:	3878K

Vehicle Details

Vehicle No.:	SHD9357X
Vehicle to be Exported:	Yes
Intended De-registration Date:	17 Jul 2018
Vehicle Make:	CHEVROLET
Vehicle Model:	EPICA 2.0DSL AT ABS D/AB 2WD 4DR TURBO
Primary Colour:	Red
Manufacturing Year:	2011
Engine No.:	Z20S1447769K
Chassis No.:	KL1LA69RJB072798
Maximum Power Output:	110.0 kW (147 bhp)
Open Market Value:	\$13,834.00
Original Registration Date:	19 Jan 2012
First Registration Date:	19 Jan 2012
Transfer Count:	0
Actual ARF Paid:	\$13,834.00

Intended PARF Rebate Details

PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	18 Jan 2020
PARF Rebate Amount:	\$8,992.00

Intended COE Rebate Details

COE Expiry Date:	18 Jan 2020
COE Category:	A - Car (1600cc & below)
COE Period(Years):	8
QP Paid:	\$40,232.00
COE Rebate Amount:	\$7,557.00
Total Rebate Amount:	\$16,549.00

Message

Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.

The information contained herein is correct as at 17 Jul 2018

OK

...CLAIM SUBFOLDER...(Pending for Survey Report)

Express

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	20 Jul 2018 Edit Reg		18 Jul 2018 00:00 Edit Adj Rpt	S\$6,050.00 Edit Estimates	S\$6,050.00 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS [Created by adjuster]									
Insured: SHIN-HAN LIMO SERVICE , Co. Reg. No.: NA									
Main Claimant: TRANS-CAB SERVICES PTE LTD , Co. Reg. No.: 200303878K									
Vehicle Reg. No.: SHD9357X		Date of Loss: 16/07/2018 17:00 - :59 [77 Months and 27 Days From LTA Reg Date (Man Yr)]							
Claim Type: TP / 8148185475SG		Policy/Cover Note No.: (Third Party Only)							
Vehicle Reg. No. (Insured): SJJ1005J		Policy No. (Claimant): VPX/P1680520							
		Excess:							
Repairer: Trans-cab Auto Services Pte Ltd (Ang Mo Kio) 2, Ang Mo Kio Street 63, 569111 Ang Mo Kio - Tel: 62876666									
Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. (Express) - Tel: 65-6419-3000 ... [Handled by Lee, Ming-Yao] MingYao.Lee@aig.com									
Claimant's Insurer: AXA Insurance Pte Ltd (HQ) - Tel: 6338 7288									
Adjuster: LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by KENNETH KONG] ... [Final Rpt due 30/07/2018]									
ASSOCIATED MAIL RECEIVED View All Compose Case Mail									
There are no mail for this case.									
ALL ASSOCIATED TASKS View All Search Tasks Create New Task Complete									
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

***SHD9357X (8148185475SG)
[SJJ1005J]**

TP

**TRANS-CAB SERVICES PTE LTD
Jul 16 2018 5:00PM
[SHIN-HAN LIMO SERVICE]
Trans-cab Auto Services Pte Ltd**

Upload Documents			Upload Photos			Compose New Letter			Upload Video			Upload Audio			View			View in Browser		
Video															1 per page		☒			
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)												Thumbnail		Print				
1	29/07/19 10:50	Video - Accident (TP)														Load WMV				
Letters/Correspondences															1 per page		☒			
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)												Thumbnail		Print				
1	(Draft)	Third Party Express Settlement - Payment Breakdown														Edit				
Photos/Images															3 per page		☒			
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)												Thumbnail		Print				
1	26/09/19 14:13	General View														Load JPG				
2	26/09/19 14:13	General View														Load JPG				
3	26/09/19 14:13	General View														Load JPG				
4	26/09/19 14:13	General View														Load JPG				
5	26/09/19 14:13	General View														Load JPG				
6	26/09/19 14:13	General View														Load JPG				
7	26/09/19 14:13	General View														Load JPG				
8	26/09/19 14:13	General View														Load JPG				
9	26/09/19 14:13	General View														Load JPG				
10	26/09/19 14:13	General View														Load JPG				
11	26/09/19 14:13	General View														Load JPG				
12	26/09/19 14:13	General View														Load JPG				
13	26/09/19 14:13	General View														Load JPG				
14	26/09/19 14:13	General View														Load JPG				
15	26/09/19 14:13	General View														Load JPG				
16	26/09/19 14:13	General View														Load JPG				
17	26/09/19 14:13	General View														Load JPG				
18	26/09/19 14:13	General View														Load JPG				
19	26/09/19 14:13	General View														Load JPG				
20	26/09/19 14:13	General View														Load JPG				
21	26/09/19 14:13	General View														Load JPG				
22	26/09/19 14:13	General View														Load JPG				
23	26/09/19 14:13	General View														Load JPG				
24	26/09/19 14:13	General View														Load JPG				
25	26/09/19 14:13	General View														Load JPG				
26	26/09/19 14:13	Odometer Reading														Load JPG				
27	26/09/19 14:13	Chassis Number														Load JPG				
Documentation															1 per page		☒			
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)												Thumbnail		Print				
1	19/07/18 17:47	TP ESTIMATE- MARKED														Load PDF				
2	19/07/18 17:47	TP GIA REPORT														Load PDF				
3	18/10/19 15:51	AUTHORISATION TO ACT														Load PDF				
4	18/10/19 15:51	LETTER TO OI														Load PDF				
5	18/10/19 15:51	LOD														Load PDF				

Video			1 per page ▼	✓
No	Finalized On		Thumbnail	Print
LKK Auto Consultants Pte Ltd (HQ)				
6	18/10/19 15:51	LTA SEARCH	 Load PDF	
7	18/10/19 15:51	RELEASE VOUCHER	 Load PDF	
8	18/10/19 15:51	RENTAL MILEAGE	 Load PDF	
9	18/10/19 15:51	RENTAL RECEIPT	 Load PDF	
10	18/10/19 15:51	WORKSHOP INVOICE	 Load PDF	
AIG Asia Pacific Insurance Pte. Ltd. (SG)				
No	Finalized On		Thumbnail	Print
1	20/07/18 09:36	OI GIA REPORT	 Load PDF	

Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			

Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)

Show Remarks To: ☐ Handling Insurer

Note: Remarks are private unless you show it to other parties.

NOTE: TO BE COMPLETED BY SURVEYOR

TEAM _____

THIRD PARTY EXPRESS SETTLEMENT (PAYMENT BREAKDOWN)

Vehicle No:	SJJ1005J (Insd veh)	Model:	CHEVROLET EPICA 2.0 (A)
	SHD9357X (TP veh)		
Date of Accident:	16/07/2018		

Global Sum Settlement	:	☒ [X]	Yes	☐ []	No
Repair Estimate	:	\$			40,624.89
Final Repair Cost	:	\$			7,400.00
Loss of Use	:	\$			8.00 days at \$50.00 per day
Rental (if any)	:	\$			8 days
LTA / GIA Search Fee	:	\$			
Others:	:	\$			
	:	\$			
Final Settlement Sum (GOBAL SUM)	:	\$			7,400.00
Is Third Party Workshop GIA Registered? ☐ [] YES ☒ [X] NO (Kindly indicate below)					
A) For <u>Non GIA Registered Workshop</u> :			Agreed Liability _____ 100 _____ (%)		
B) For <u>GIA Registered Workshop</u> :			BOLA Applicable: Yes/ No BOLA Scenario No: _____		
BOLA Liability: _____ (%)			Assessed Liability (*): _____ 100 _____ (%)		
* Assessed Liability to be filled only for chain collisions and for cases where BOLA does not apply.					
Remarks _____					

Payment Instruction: Payee's Breakdown			
1)	Trans-Cab Auto Services Pte Ltd	:	\$ 7,400.00
2)		:	
3)		:	
4)		:	
5)		:	

NUR SHAQILAH BTE ABDOL WAHAB

18 Oct
2019

LKK Auto Consultants Pte Ltd

Date

Please attach all the supporting documents to the form.
(Final Repair Bill; Rental Invoice; Release Voucher; Authorisation to Act; Survey Report; Medical Report/
Bill (if any))

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CC3/AIG18013128/KDB3S2
Date: 18/10/2019

REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd.

Policy No:

Claimant Vehicle No : SHD9357X

Insured Vehicle No : SJJ1005J

Date of Loss: 16/07/2018

Nature of Claim: TP **Claim No:** 8148185475SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SHD9357X**

Make & Model: CHEVROLET EPICA, 2.0 (A)

Reg. Date: 19/01/2012 (Man. Year: 2012)

Colour: White/Red

Engine Capacity: 1991 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price**

Engine No: Z20S1447769K

Chassis No: KL1LA69RJBB072798

Odometer: 643703 km

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Good Steering (Serviceable): Yes Footbrake (Serviceable): Yes
 Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 195/65 R15 Rear Tyre Size: 195/65 R15
 Front Left Side: Giti 9 mm Rear Left Side: Giti 8 mm
 Front Right Side: Giti 9 mm Rear Right Side: Giti 8 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS

	Repairer's	Adjuster's	Difference	Diff %
Parts	24,917.19	5,359.91	19,557.28	78.49
Miscellaneous Items	0.00	0.00	0.00	
Labour	13,050.00	2,220.00	10,830.00	82.99
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	37,967.19	7,579.91	30,387.28	80.04
Approved Total (Overridden) (S\$)		6,050.00		
(S\$)	37,967.19	6,050.00	31,917.19	84.07
+ GST 7.00/7.00% (S\$)	2,657.70	423.50	2,234.20	84.07
Nett Amount (S\$)	40,624.89	6,473.50	34,151.39	84.07
+ Loss of Use (8.0 x S\$50.00/day) (S\$)		400.00		
+ Car Rental (8.0 x S\$75.25/day) (S\$)		602.00		
+ Doc/Search Fee (S\$)		7.49		
Nett Liability (S\$)		7,482.99		
Global Sum Settlement (S\$)		7,400.00		

INSPECTION

Date of Assignment: 18/07/2018

Date Inspected: 18/07/2018 Inspected At:

Estimated Period of Repair: 6.0 days

Trans-cab Auto Services Pte Ltd (Ang Mo Kio)
 2, Ang Mo Kio Street 63
 Singapore 569111

Adjuster: KENNETH KONG

Manager: CHAN JIA LE

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Cracked	1,202.00 FL	*1,202.00 FL
2	1		*FRONT BUMPER REINFORCEMENT	Not Necessary	295.25 FL	*- FL
3	1		*FRONT BUMPER LOWER ABSORBER	Not Necessary	180.00 FL	*- FL
4	1		*FRONT BUMPER LOWER GRILLE	Dented	78.00 FL	*78.00 FL
5	1		*FRONT BUMPER RETAINER RH	Serviceable	102.00 FL	*- FL
6	1		*FRONT BUMPER RETAINER LH	Serviceable	102.00 FL	*- FL
7	1		*FRONT BUMPER LOWER STIFFENER	Repair	134.37 FL	*- FL
8	1		*FRONT HEADLAMP RH	Serviceable	816.00 FL	*- FL
9	1		*FRONT HEADLAMP LH	Serviceable	816.00 FL	*- FL
10	1		*FRONT SUPPORT PANEL ASSY (PANEL A-FRT)	Repair	1,222.32 FL	*- FL
11	1		*BONNET (PANEL A-HOOD)	Repair	1,250.00 FL	*- FL
12	1		*CENTRE CHEVROLET LOGO BADGE	Not Necessary	144.30 FL	*- FL
13	1		*BONNET MOOULding	Serviceable	257.00 FL	*- FL
14	1		*RADIATOR GRILLE (GRILLE A-RAD)	Cracked	367.00 FL	*367.00 FL
15	1		*RADIATOR ASSEMBLY (RADIATOR A)	Serviceable	618.00 FL	*- FL
16	1		*AIRCON CONDENSER (CONDENSER A)	Serviceable	600.00 FL	*- FL
17	1		*AIR INTERCOOLER	Serviceable	652.00 FL	*- FL
18	1		*FAN BLADE (SMALL)	Serviceable	536.00 FL	*- FL
19	1		*FAN BLADE (BIG)	Serviceable	634.00 FL	*- FL
20	1		*FRONT FENDER LH	Repair	837.60 FL	*- FL
21	1		*FRONT FENDER RH	Repair	837.60 FL	*- FL
22	1		*REAR BUMPER	Bent	1,202.00 FL	*1,202.00 FL
23	1		*REAR BUMPER BEAM	Bent	239.94 FL	*239.94 FL
24	1		*REAR BUMPER CENTRE ABSORBER	Cracked	260.00 FL	*260.00 FL
25	1		*REAR BUMPER SIDE RETAINER RH	Cracked	68.76 FL	*68.76 FL
26	1		*REAR BUMPER SIDE RETAINER LH	Cracked	68.76 FL	*68.76 FL
27	1		*REAR BUMPER SIDE SUPPORT RH	Distorted	25.00 FL	*25.00 FL
28	1		*REAR BUMPER SIDE SUPPORT LH	Serviceable	25.00 FL	*- FL
29	1		*REAR BUMPER REFLECTORS RH	Broken	119.74 FL	*119.74 FL
30	1		*REAR BUMPER REFLECTORS LH	Cracked	119.74 FL	*119.74 FL
31	1		*REAR BUMPER TOW HOOK COVER	Missing	93.00 FL	*93.00 FL
32	1		*REAR LUGGAGE FLOOR PANEL	Repair	973.00 FL	*- FL
33	1		*REAR LUGGAGE FLOOR PANEL INSULATOR	Serviceable	63.50 FL	*- FL
34	1		*REAR LUGGAGE FLOOR PANEL TRIM BOARD	Serviceable	378.00 FL	*- FL
35	1		*REAR END PANEL INNER	Bent	336.84 FL	*336.84 FL
36	1		*REAR END PANEL OUTER	Bent	623.76 FL	*623.76 FL
37	1		*REAR END PANEL INNER TRIM	Distorted	263.84 FL	*263.84 FL
38	1		*BOOTLID	Repair	973.00 FL	*- FL
39	1		*BOOTLID INNER TRIM BOARD	Serviceable	400.00 FL	*- FL
40	1		*BOOTLID WEATHERSTRIP	Serviceable	344.28 FL	*- FL
41	1		*BOOTLID LOCK - TOP	Repair	466.56 FL	*- FL
42	1		*BOOTLID LOCK - BOTTOM	Repair	39.40 FL	*- FL
43	1		*BOOTLID CHEVROLET BADGE	Necessary	120.62 FL	*120.62 FL
44	1		*BOOTLID LOGO	Necessary	138.84 FL	*138.84 FL
45	1		*BOOTLID EPICA LT BADGE	Necessary	119.84 FL	*119.84 FL
46	1		*BOOTLID INNER HANDLE	Serviceable	45.55 FL	*- FL
47	1		*BOOTLID REFLECTOR CENTRE	Serviceable	217.97 FL	*- FL
48	1		*BOOTLID REFLECTOR RH	Serviceable	128.40 FL	*- FL
49	1		*BOOTLID REFLECTOR LH	Serviceable	128.40 FL	*- FL
50	1		*BOOTLID HINGE RH	Repair	120.00 FL	*- FL
51	1		*BOOTLID HINGE LH	Repair	120.00 FL	*- FL
52	1		*REAR TAIL LAMP RH	Serviceable	479.30 FL	*- FL
53	1		*REAR TAIL LAMP PANEL RH	Repair	359.00 FL	*- FL
54	1		*REAR TAIL LAMP LH	Serviceable	479.30 FL	*- FL
55	1		*REAR TAIL LAMP PANEL LH	Repair	359.00 FL	*- FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
56	1		*REAR EXHAUST BOX (MUFFLER A-EXH,RR)	Repair	1,110.00 FL	*- FL
57	1		*REAR FENDER RH	Repair	1,145.00 FL	*- FL
58	1		*REAR FENDER INNER COWLING RH	Serviceable	298.00 FL	*- FL
59	1		*REAR FENDER INNER TRIM RH	Serviceable	418.44 FL	*- FL
60	1		*REAR FENDER LH	Repair	1,145.00 FL	*- FL
61	1		*REAR FENDER INNER COWLING LH	Serviceable	298.00 FL	*- FL
62	1		*REAR FENDER INNER TRIM LH	Serviceable	418.44 FL	*- FL
63	1		*SET FRONT BUMPER FASTENER CLIP	Necessary	24.00 FS	*24.00 FS
64	1		*SET FRONT LICENCE PLATE WITH HOLDER	Bent	192.00 FS	*25.00 FS
65	1		*SET BONNET INSULATOR CLIP	Not Necessary	40.00 FS	*- FS
66	1		*SET RADIATOR GRILLE CLIP	Necessary	18.00 FS	*18.00 FS
67	1		*SET BOOTLID INNER TRIM BOARD CLIP	Not Necessary	40.00 FS	*- FS
68	1		*SET RADIATOR GRILLE TOP COVER CLIP	Not Necessary	10.00 FS	*- FS
69	1		*SET FRONT FENDER LINER CLIP	Not Necessary	40.00 FS	*- FS
70	1		*SET REAR BUMPER PARKING SENSOR	Cracked	300.00 FS	*300.00 FS
71	1		*SET REAR BUMPER FASTENER CLIP	Necessary	30.00 FS	*30.00 FS
72	2		*SET REAR FENDER INNER COWLING CLIP	Not Necessary	30.00 FS	*- FS
73	1		*SET REAR FENDER INNER TRIM CLIP RH	Not Necessary	30.00 FS	*- FS
74	1		*SET REAR FENDER INNER TRIM CLIP LH	Not Necessary	30.00 FS	*- FS
75	1		*SET REAR BUMPER END DUST COVER CLIP	Not Necessary	30.00 FS	*- FS
76	1		*REAR BOOT STICKER TRANS-CAB	Necessary	30.00 FS	*30.00 FS
77	1		*REAR BOOT STICKER 6555-3333	Necessary	30.00 FS	*30.00 FS
78	1		*REAR EXHAUST MOUNTING	Not Necessary	10.00 FS	*- FS
79	1		*REAR BUMPER END SEALANT	Not Necessary	80.00 FS	*- FS
80	2		*REAR WINDSCREEN SEALANT	Not Necessary	80.00 FS	*- FS
81	1		*REAR WINDSCREEN INNER SPONGE SEAL	Not Necessary	100.00 FS	*- FS

F=Franchise part, S=SpcNett, L=ListItemDisc.

Sub Total (\$\$)	27,558.66	5,904.68
- List Item Discount on L Items 10.00/10.00% (\$\$)	2,641.47	544.77
Total Parts (\$\$)	24,917.19	5,359.91

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	PANEL BEATING, KNOCKING AND STRAIGHTENING THE NECESSARY PORTION. REMOVE AND RENEWAL OF PARTS, ADJUST AND REALIGN THE SAME.	New	6,000.00	1,000.00
2	TO CHECK ELECTRICAL LIGHTING CONCERNED.	New	170.00	40.00
3	TO RUST-PROOFING OF THE AFFECTED AREAS.	New	170.00	60.00
4	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION.	New	4,800.00	1,000.00
5	TO DROP REAR EXHAUST BOX, RENEW THE SAME, TO REPAIR AND REALIGN CENTRE EXHAUST PIPE.	New	170.00	60.00
6	TO REINSTALL REAR BUMPER PARKING SENSOR.	New	170.00	60.00
7	TO TRANSFER OF END PANEL FITTINGS AND CONDUCT WATER SEEPAGE TEST.	New	170.00	0.00
8	TOWING FEES.	New	120.00	0.00
9	TO TRANSFER OF BOOT FITTINGS AND CONDUCT WATER SEEPAGE TEST.	New	170.00	0.00
10	TO TRANSFER OF FENDER FITTINGS, ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	New	170.00	0.00
11	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.	New	220.00	0.00
12	TO TRANSFER OF TIRE, RIM AND ON WHEEL BALANCING.	New	170.00	0.00
13	TO REMOVE AND REFIT REAR W/SCREEN GLASS TO FACILITATE BODYWORK REPAIR.	New	170.00	0.00
14	TO CHECK ABS BRAKE EFFICIENCY, FINAL CHECKING AND TESTING.	New	380.00	0.00
Gross Labour Cost (\$\$)			13,050.00	2,220.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >