



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2101541

INV Date 11/03/2021

Reference CC4/LPC18013411/Krs3q2

Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SLF 2707H
Insured Veh. SKL 737P
Claim No. 18/18/18/VP05/020745
Policy No. Z18VP05018777
Accident Date 05/07/2018
Inspection Date 25/07/2018

Description	Total
Third Party Express Settlement	450.00
Subtotal	450.00
GST (7%)	31.50
Grand Total	481.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSE SINGAPORE 199555			Ref: CC4/LPC18013411/Krs3q2	
			Date: 11/03/2021	
			Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SKL 737P	Veh. Inspected	SLF 2707H	
Policy No.	Z18VP05018777	Coverage (\$)	0.00	
Claim No.	18/18/18/VP05/020745	Excess (\$)	0.00	
Assign From	GERALD	Assign Date	23/07/2018	
2. Vehicle Particulars & Condition				
Make & Model	HONDA VEZEL (A)	c.c	1496	
Engine No.	HIDDEN	Year of Reg.	2006	
Chassis No.	RU11204739	Colour	METALLIC BROWN	
Odometer	113191 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	215/60 R16	ACHILLES	8 mm	
L/H Front Tyre	215/60 R16	ACHILLES	8 mm	
R/H Rear Tyre	215/60 R16	DUNLOP	3 mm	
L/H Rear Tyre	215/60 R16	DUNLOP	3 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE N/S FRONT PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	05/07/2018	Inspection Date	25/07/2018	
Survey held at	COMFORTDELGRO ENGINEERING PTE LTD 205 BRADDELL ROAD Blk C, 3rd Floor SINGAPORE 579701.			
5a. Remarks				
A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			3 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 1

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLF 2707H

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT BUMPER	TO REPAIR SEE LABOUR	801.80	-
1	FRONT BUMPER SIDE RETAINER LH	DISTORTED	18.90	12.00
1	FRONT BUMPER CLIPS	NOT NECESSARY	30.00	-
1	FRONT BUMPER LOWER SPOILER	DISTORTED / DENTED	395.50	165.00
1	FRONT BUMPER LOWER SPOILER CLIPS	NECESSARY	30.00	2.50
1	FRONT BUMPER FOG LAMP COVER LH	SERVICEABLE	38.80	-
1	FRONT BUMPER FOG LAMP LH	SERVICEABLE	318.00	-
1	HEADLAMP LH	SERVICEABLE	1,715.10	-
1	HEADLAMP LOWER BRACKET LH	SERVICEABLE	38.90	-
1	LH FRONT FENDER WHEEL ARCH GARNISH	CUT	171.10	57.00
1	LH FRONT FENDER WHEEL ARCH GARNISH CLIPS	NOT NECESSARY	55.00	-
	LESS 20% DISCOUNT		-722.62	-47.30
			2,890.48	189.20
	<u>LABOUR</u>			
	LABOUR TO REPAIR ,PANEL BEAT AND REPLACE DAMAGED PARTS.INCLUSIVE OF THE REPAIR OF FORNT BUMPER.}		720.00	250.00
	TO PUTTY AND SPRAY PAINT FRONT BUMPER ,LH FRONT FENDER ,FRONT BUMPER LOWER SPOILER AND ALL AFFECTED AREA. }		750.00	-
	TO CHECK WIRING FUNCTIONS.	NOT NECESSARY	50.00	-
			1,520.00	250.00
	GRAND TOTAL		4,410.48	439.20
	RECOMMENDED COST OF REPAIRS			439.20

Report Ref No. CC4/LPC18013411/Krs3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLF 2707H

INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

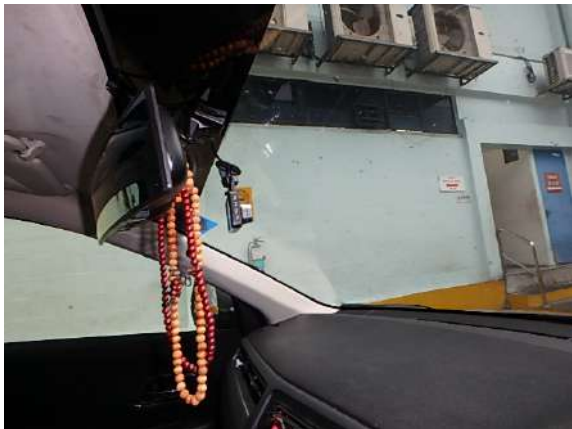



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

