

K.KIM HIN AUTO PTE LTD
160 Sin Ming Drive
#02-20 Sin Ming AutoCity
Singapore 575722

Claim Reference:
Assessment Number: KKHA0013
Version: K.KIMHIN/1
Date Calculated: 25/07/2018 10:41

Full Report - V1
Registration: SLE6877D
Printed: 25/07/2018 17:42

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	SANDRA KHONG	Date of Incident:	23/07/2018
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	AXA Insurance S'pore Pte Ltd	Repairs Authorised:	TBA
Claim Reference:		Estimated Repair Time:	
Policy Number:		Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	MITSUBISHI
Model:	Lancer
Sub Model:	EX
Model Sheet Number:	G39 57
Registration:	SLE6877D
Registration Month:	July
Registration Year:	2016
VIN Number:	JMYSRCY1AGU005619
Manufacture Year:	2016
Odometer:	Not Known
Colour:	
Engine Number:	4A92CJ4834
Fuel Level:	%

Model Specs

FROM 09/2016	AIR CONDITIONING
XENON HEADLAMPS	FOG LAMPS
DAYTIME RUNNING LIGHT	HEADLAMP WASHERS
RADIATOR GRILLE SPORT	FRONT MUDFLAPS
HEAD AIRBAG	1.6 LTR 85/86/91KW
6-SPEED GEARBOX	TYRE PRESSURE SENSOR
HEIGHT CONTROL	STABILITY PROGRAM
PASSENGER AIRBAG	ANTI LOCK BRAKES
DRIVER AIRBAG	KNEE AIRBAG
SIDE AIRBAGS	4-DOOR SALOON
FRONT SKIRT	PREPARE OFF VEHICLE
THREE COAT PEARL	

Vehicle Condition

Vehicle Status

Pre-Accident Condition:	Severity of Impact:
Steering:	Vehicle Status on
	Inspection:
Brakes Pedal Travel:	Date of Inspection:
Place of Inspection:	24/07/2018
Pre-Accident Damage:	

Tyres Condition:

Tread Depth LHF:
Tread Depth LHR:

Damage Areas:

Tread Depth RHF:
Tread Depth RHR:
Direction of Impact:

LKK Auto Consultants henceforth the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No financial modification(s) is allowed
- All repair item(s) must be approved by the Repairer and the Insured Company

Approved by Repairer: _____
Date: _____

Not Authorized
1.3.1
Repair by paint
4 days

Claim Reference:

Assessment Number: KKHA0013



Version: K.KIMHIN/1

Date Calculated: 25/07/2018 10:41

Full Report - V1

Registration: SLE6877D

Printed: 25/07/2018 17:42

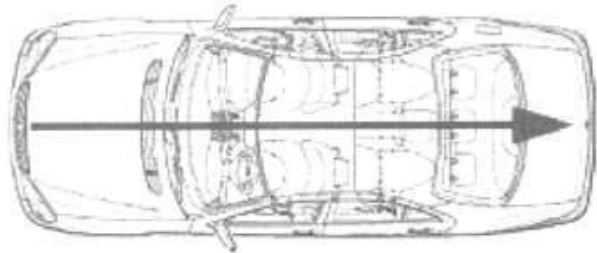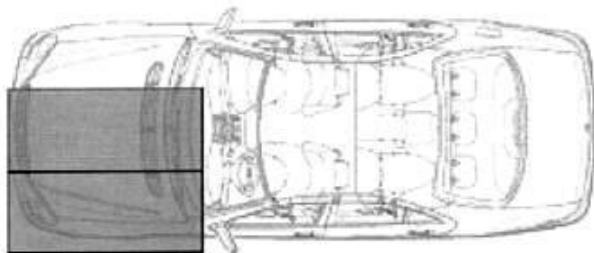

Addresses

Repairer

Name : K.KIM HIN AUTO PTE LTD

Address :

160 SIN MING DRIVE

#02-20

SIN MING AUTOCITY

Post Code : 575722

Email Address : service@kkimhin.com.sg

Cost Summary

Total Labour	\$1,417.50
Total Paint/Material	\$341.97
Total Parts	\$3,616.18
Total of Additional Costs	\$230.00
Excess:	TBA
Grand Total Exc GST:	\$5,605.65
7 % GST:	\$392.40
Grand Total Inc GST:	\$5,998.05

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$45.00/HR
Price/Dent = \$0.00/HR

Repair /

Guide Number Repair Details

		WU	Cost Price (\$)
GROUP42B	PREPARATION TIME PER JOB	2.0	9.00
514121 10)	R + R ATTACHED PARTS OF THE BUMPER (BUMPER WITH FRONT FOG LAMPS)	14.0	63.00
NO NUMBER	R + R FRONT BUMPER REINFORCEMENT (BUMPER REMOVED)	3.0	13.50
425111 10)	RENEW BONNET (REMOVED)	2.0	9.00
	INCLUDES: R + R ATTACHED PARTS, ALIGN BONNET		
425141 10	R + R BONNET LOCK	3.0	13.50
NO NUMBER	R + R BONNET STAY	1.0	4.50
425113 10)	R + R LEFT BONNET HINGE (BONNET REMOVED)	1.0	4.50
425113 10)	R + R RIGHT BONNET HINGE (BONNET REMOVED)	1.0	4.50
422025 10)	R + R R/WING SPLASH SHIELD	4.0	18.00
NO NUMBER	ADJUST HEADLAMPS	2.0	9.00
421020 YC	RENEW L/FRONT PANEL	73.0	328.50
	INCLUDES: R + R BUMPER, SPLASH SHIELD, WING, BONNET, HEADLAMP, RADIATOR AND		

K.KIM HIN AUTO PTE LTD

Claim Reference:

Assessment Number: KKHA0013

Version: K.KIMHIN/1

Date Calculated: 25/07/2018 10:41

Full Report - V1

Registration: SLE6877D

Printed: 25/07/2018 17:42

421020 ZAX	ALL PARTS IN THE REPAIR SECTION	6.0	27.00
9852	RENEW L/WHEELHOUSE CONNECTION PANEL	30.0* 7	135.00
	READ OUT FAULT MEM AFTER REP		
LABOUR COST			
	Total Work Units	142.0	
	Corrosion Protection External Labour	0.0HRS	0.00
	Corrosion Protection Internal Labour	0.0HRS	0.00
	Sub Total	14.2HRS	\$639.00
	Paint Labour	17.3HRS	\$778.50
	Total Labour	31.5HRS	\$1,417.50

PAINT WORK		Time Basis 10 WU = 1 HR. Price = \$45.00/HR	
Guide Number	Description	WU	Cost Price (\$)
	- PREPARE OFF VEHICLE		
	- THREE COAT PEARL		
340	FRT BUMPER REINF SURFACE PAINT	4.0	
341	FRT BUMPER SUPPORT SURFACE PAINT	4.0	
471	BONNET NEW PART PAINTING	24.0	
741	L/F WING NEW PART PAINTING	10.0	
1019	L/F PANEL SURFACE PAINT	4.0	
1175	L/F W-HOUSE CONN PNLSURFACE PAINT	4.0	
283	FRONT BUMPER COVER NEW PART PAINT K1R	13.0	
284	FRONT BUMPER COVER SURFACE PAINT	9.0	
	ADD/WORK FOR 3-COAT PAINTING		
345	CTR BUMPER BRACKET SURFACE PAINT	4.0	
472	BONNET SURFACE PAINT	10.0	
	ADD/WORK FOR 3-COAT PAINTING		
742	R/F WING SURFACE PAINT	6.0	
743	L/F WING SURFACE PAINT	5.0	
	ADD/WORK FOR 3-COAT PAINTING		
744	R/F WING SURFACE PAINT	5.0	
	ADD/WORK FOR 3-COAT PAINTING		
1010	FRT LWR CROSSMEMBER SURFACE PAINT	5.0	
1017	FRT UPP LOCK CARRIERSURFACE PAINT	4.0	
1020	R/F PANEL SURFACE PAINT	4.0	
1187	L/F OUT S-MEMBER PNLSURFACE PAINT	4.0	
1188	R/F OUT S-MEMBER PNLSURFACE PAINT	4.0	
1481	LEFT FRONT DOOR SURFACE PAINT	8.0	
1497	LEFT FRONT DOOR SURFACE PAINT	7.0	
	ADD/WORK FOR 3-COAT PAINTING		
LABOUR COST - PAINT			
	TIME(PAINT)	138.0	
	Preparation Main Work Plastic	5.0	
	Preparation Main Work Metal	25.0	
	Preparation Work Multi Layer Paint	5.0	
	Total Work Units (10WU/HR)	173.0	
	Total Paintwork Labour	17.3HRS	\$778.50
MATERIAL COST - PAINT			
	New Part Painting		\$98.04
	New Part Painting - Plastic K1R		\$64.94
	Material-Constant Main Work Metal		\$28.60

K.KIM HIN AUTO PTE LTD

Claim Reference:

Assessment Number: KKHA0013

Version: K.KIMHIN/1

Date Calculated: 25/07/2018 10:41

Full Report - V1

Registration: SLE6877D

Printed: 25/07/2018 17:42

Surface-/Blend Paint	\$132.09
Material-Const Main Work Plastic	\$9.00
Total Excluding Pearlescent Uplift	\$341.97
Pearlescent Uplift @ 0.0%	\$0.00
Total Paint Material Cost	\$341.97

PARTS

Price Valid: 01/06/2015

Guide No.	Qty	Description	Part Number	Supplier	Bet.	Price (\$)
283	1	FRONT BUMPER COVER	6400C075		0%	430.00*
295	1	L/DAYTIME HEADLAMP	8312A045		0%	330.00*
313	1	LWR RADIATOR GRILLE	6402A399		0%	55.00*
340	1	FRT BUMPER REINF	6400A832		0%	60.00*
341	1	FRT BUMPER SUPPORT	6400C639		0%	300.00*
350	6	FRT BUMPER CLAMP KIT	MS100224		0%	10.00*
351	1	L/LOWER AIR GRILLE	8321A089		0%	30.00*
354	1	CTR PROTECT MOULDING	6400C043		0%	130.00*
355	1	L/F BUMPER BRACKET	6400F549		0%	13.00*
356	1	R/F BUMPER BRACKET	6400F550		0%	13.00*
410	1	GRILLE	7450A780		0%	150.00*
471	1	BONNET	5900A209		0%	370.00*
475	1	LEFT BONNET HINGE	5905A089		0%	40.00*
476	1	RIGHT BONNET HINGE	5905A090		0%	40.00*
493	1	BONNET LOCK	5908A009		0%	40.00*
495	1	BONNET SUPPORT	5906A005		0%	20.00*
528	1	REAR BONNET SEAL	5902A078		0%	20.00*
561	1	L/F HEADLAMP CPL	8301C345		0%	400.00*
637	1	L/F FOG LAMP CPL	8321A668		0%	170.00*
741	1	L/F WING	5220G043		0%	270.00*
789	18	L/F WING CLAMP KIT	MS100222		0%	8.00*
841	1	L/WHEELHOUSE SHELL	5370B837		0%	75.00*
1019	1	L/F PANEL	5256A599		0%	55.00*
1175	1	L/F W-HOUSE CONN PNL	5220C499		0%	13.00*
1000	1	FRT BUMPER RIVET	\$1.50 @ 15PCS		0%	22.50*
1000	1	LH FRT BUMPER BRK	Renew		0%	12.00*
1000	1	RH FRT BUMPER BRK	Renew		0%	12.00*
1000	1	FRT LWR GRILLE CLIP	\$2.00 @ 8PCS		0%	16.00*
1000	1	BONNET INSULATO CLIP	Renew		0%	15.00*
1000	1	L/F WING T 1/4 GARNI	Renew		0%	25.00*
f: OEM Parts			Sub Total			\$3,144.50
g: Original			Mark Up From Cost	(15 %)		\$471.68
h: Secondhand			Sundry Parts	(Fixed)		\$0.00
p: Parallel			Total Parts			\$3,616.18
x: Exchange						

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description	Betterment	Price
AUDATEX FEE SPECIALIST	0%	\$42.00
ANTIFREEZE 4 LTR SPECIALIST		\$48.00
TOP UP AIRCON GAS SPECIALIST	0%	\$100.00
FRT NUMBER PLATE SPECIALIST		\$40.00
Total Extras		\$230.00

Final Calculation

Claim Reference:

Assessment Number: KKHA0013

Version: K.KIMHIN/1

Date Calculated: 25/07/2018 10:41

Full Report - V1

Registration: SLE6877D

Printed: 25/07/2018 17:42

Total Parts		\$3,616.18
Labour		
Total Panel/Mechanical	\$639.00	
Total Paintwork	\$778.50	
Total Labour		\$1,417.50
Additional Costs		
Corr Prot Materials External	\$0.00	
Corr Prot Materials Internal	\$0.00	
Cost of Specialist	\$230.00	
Total of Additional Costs		\$230.00
Total Paint/Material Costs		\$341.97
Grand Total Excludes GST		\$5,605.65
GST @ 7 %		\$392.40
Grand Total Includes GST		\$5,998.05

Assessment Notes

Supplementary
Repair Left Foot Door 10 30 WU ✓