



SMRT Vehicle Repair Estimate

Group : Buses / Taxis / Private Car

Reg. No. : SJL8606T

Ref. No. _____

Make / Model : HYUNDAI ELANTRA

Reg. Date : 21.06.2016

Chassis No : KMHD841CMHU192771

Mileage _____

Name of Driver : ABNER KOH MINGFENG

Rental/Replacement Vehicle : Yes/No

Date/Time of Accident 26.07.2018

Surveyor is Required ? **YES** / NO

If Yes, VICOM / LKK / AIS / Other MSIG : _____

Vehicle is Towed Back **YES** / NO Date / Time : _____


Accident reporting date 26.07.2018

Type of Accident : Skid / Head-Rear / Head-On / Side Swipe / Others

Special Instruction to ARC, if any :

TP CLAIM AIG

The damages on the vehicle are as indicated in the following diagram :

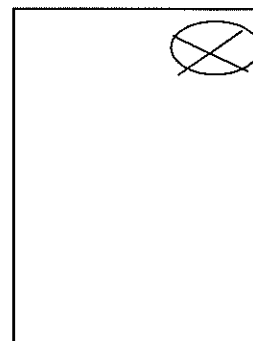

Signed : _____ Date : _____

Accident Repair Job Card : _____ Date Prepared : _____

Summary of Repair Estimates Repair Completed : _____

Quotation from ARC

Adjusted by Surveyor, if applicable

Total Labour Charge : \$ 1,600.00

\$ -

Total Spray Painting Charge \$ 1,600.00

\$ -

Total Material Charge : \$ 7,397.04

\$ -

Other Charges : \$ 1,380.00

\$ -

TOTAL : \$ 11,977.04

\$ -

Lump Sum Repair, if any : _____

No. of Repair Days : [8] days () days

Signature : Prepared by: _____

Adjusted by: _____

QN No. _____ Invoice No. _____

Signed : _____ Date : _____

Part 1 - Labour Works

Job Scope	Quotation from ARC	
To renew damaged parts, replace and realign end panel, and aligned all parts	\$ 1,600.00	
Total Labour Cost	\$ 1,600.00	\$ -

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	
To respray affected areas	\$ 1,600.00	
Spray Painting	\$ 1,600.00	

Part 3 - Other Costs - Accident and Accident Repair Related Expenses

Job Scope	Quotation from ARC	
Towing	\$ 80.00	
Windscreen sealant	\$ 100.00	
To tuffcoat affect areas	\$ 150.00	
To renew front/ windscreen glass		
To renew engine mountings and gear box mounting		
To remove /refit aircon condensor, pipings, vacuum and recharge aircon gas		
To remove/refit replace dashboard		
To remove and refit interior upholstery	\$ 120.00	
To remove and replace steering column		
To remover /refit wiring check	\$ 80.00	
To remove/refit rear windscreen for rear fender replacement	\$ 150.00	
To remove/replace exhaust silencer box and straighten centre pipe	\$ 300.00	
To remove/replace reverse sensors and distance settling	\$ 150.00	
To remove and transfer rear boot mechanism	\$ 150.00	
To re-programing all necessary system	\$ 100.00	
Total Other Costs	\$ 1,380.00	

Part 4 - Spare Parts / Material Usage

To be completed by Service Advisor, ARC						
Item	Parts Description	Qty	Cost Price (\$)	PARTS DISCOUNT	Final Price (\$)	Repair (R) Replace (/)
1	REAR BOOT	1	\$ 1,187.80	20%	\$ 950.24	
2	REAR BOOT INNER TRIM	1	\$ 245.30	20%	\$ 196.24	
3	REAR BOOT REFLECTOR	2	\$ 786.40	20%	\$ 629.12	
4	REAR BOOT WEATHERSTRIP	1	\$ 203.40	20%	\$ 162.72	
5	REAR BOOT LOCK	1	\$ 189.30	20%	\$ 151.44	
6	TAILAMPS	2	\$ 1,050.60	20%	\$ 840.48	
7	TAILAMP PANEL LH	1	\$ 48.00	20%	\$ 38.40	
8	REAR END PANEL	1	\$ 582.90	20%	\$ 466.32	
9	END PANEL TOP GARNISH	1	\$ 135.80	20%	\$ 108.64	
10	REAR BUMPER	1	\$ 558.70	20%	\$ 446.96	
11	REAR BUMPER REINFORCEMENT	1	\$ 306.80	20%	\$ 245.44	
12	REAR BUMPER REINFORCEMENT BRACKETS	2	\$ 188.60	20%	\$ 150.88	
13	REAR BUMPER RETAINERS	2	\$ 96.20	20%	\$ 76.96	
14	REAR FENDER INNER COWLING	2	\$ 188.60	20%	\$ 150.88	
15	REAR BUMPER LOWER COVER	1	\$ 272.60	20%	\$ 218.08	
16	REAR BUMPER RELECTORS	2	\$ 96.80	20%	\$ 77.44	
17	REAR FENDER	2	\$ 1,320.80	20%	\$ 1,056.64	
18	REAR FENDER AIR DUCT	2	\$ 66.40	20%	\$ 53.12	
19	REAR SILENCER BOX	1	\$ 499.60	20%	\$ 399.68	
20	REAR EXHAUST INSULATOR SHIELD	1	\$ 106.30	20%	\$ 85.04	
21	REAR EXHAUST MOUNTING	1	\$ 33.60	20%	\$ 26.88	
22	REAR EXHAUST TIP	1	\$ 106.20	20%	\$ 84.96	
23	REAR EXHAUST HANGER	1	\$ 38.10	20%	\$ 30.48	

Special Nett Items	Parts Description	Qty				
	FRONT NUMPER PLATE WITH CASING	1 SET	\$ 50.00		\$ 50.00	
	REAR BUMPER CLIPS	1 SET	\$ 30.00		\$ 30.00	
	REAR FENDER COWLING CLIPS	2 SETS	\$ 60.00		\$ 60.00	
	REAR FENDER INNER TRIM CLIPS	1 SET	\$ 30.00		\$ 30.00	
	REAR BUMPER LOWER COVER CLIPS	1 SET	\$ 30.00		\$ 30.00	
	REAR END PANEL TOP GARNISH CLIPS	1 SET	\$ 30.00		\$ 30.00	
	REAR BOOT STOPPER	2	\$ 60.00		\$ 60.00	
	END PANEL TOP GARNISH CLIPS	1 SET	\$ 30.00		\$ 30.00	
	REAR BOOT INNER TRIM CLIPS	1 SET	\$ 30.00		\$ 30.00	
	REVERSE SENSORS	1 SET	\$ 250.00		\$ 250.00	
	REAR BOOT HYUNDAI LOGO	1	\$ 55.00		\$ 55.00	
	REAR BOOT "ELANTRA" EMBLEM	1	\$ 55.00		\$ 55.00	
	REAR BOOT "GLS" EMBLEM	1	\$ 40.00		\$ 40.00	

TOTAL MATERIALS

\$ 9,058.80 - \$ 7,397.04

Surveyor Remark: