

ASS. REC. BY:

REF:

CS/GAI/8014288/R190302

Instruction:

Surveyor:

Relsul

ASSIGNMENT (Office)

From (Person):

Nguyen Kelyna

of

GAI

Date/Time:

6/8/18 @ 3:12pm

Estimated Cost:

Bill to:

☒ OD / TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

SLM 9996G

Insured:

at Workshop m/s

Lee Hung & CO

Tel:

6 458 8 460

of

21k9 Sir Ming Rd # Ind. Sec-C #01-36

Policy No:

Claim No:

MOMVP000003627-00-000

Sum Insured:

Excess:

\$500-00

Make of Veh:

D.O.A.

30/07/2018

(Clerk)

Authorise if consistent

☒ CA

/ REV / REP. / REV 24 HRS

H.O.D. Endorsement:

Date/Time:

3:40pm @ 6/8/18

Person Contacted:

William

Vehicle:

☒ IN / OUT

Date/Time

Action/Instruction (✓) Estimate

SLM 9996G-X

07/8/18 @ 2:58pm revised to Kelyna by email.

22/07/19 @ 3:21pm confirmed with William final fig @ 12568.20, 9 days.
(Red @ 550, 4%)

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OB / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SLM9996Gat Workshop m/s LEE HONH & COof BLK G. SIN M/M RO #01-36Insured: GAI

Policy No. _____

Claims No. _____

Sum Insured: _____ Excess: 500

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.Bal. or Market Value: 82K

IDAC Accident Rpt: Consistent? : Yes or No

GIA / PR Seen: Consistent? : Yes or No

Est. Repairs: 9 days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: SLM9996G Yr Regn: 2013 / 86PType: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: MERCEDES BENZ C180 C.C. 1595Colour: WHITE A/C: Insured / Std / NI / NASp. Reading: 88893 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: WDD 2040312A831551

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt orBrake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 225/45 2R17

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or CONTINENTAL

Front _____ Rear _____

R/Bal. 6 mm R/Bal. 6 mmL/Bal. 6 mm L/Bal. 6 mmD.O.A. 30/07/18 D.O.I. 06/08/18Survey held at LEE HONHDes. of Damages: Fr / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

RECEIVED 25 FEB 2019

22/2/2019

Date/Time, File Pass to?

☐ : Preli. Report1) 25/2/2019☐ : Final Report

Date/Time, File Return to?

2) _____

Days Of Repair: 9Resurvey No. of Trip: 1Survey Fee: 350

Transportation: _____

Add Fee: ☐ : Site Insp (\$)☐ : Interview (\$)☐ : Tech. Invs (\$)☐ : Weekend (\$)

) S + RS SI

) Photos

) Others

TOTAL

350

Report Format : ODLump Sum / I.B.I. (\$) 12568.20

Nivitha (LKK Auto)

From: Ngian, Kelvyna <Kelvyna.Ngian@sg.gaig.com>
Sent: Monday, 6 August 2018 3:12 PM
To: "SUR"; Nivitha (LKK Auto); 'Admin A'
Subject: FW: Request For Own Damaged Claim Survey - SLM9996G
Attachments: GIA_SAS2447890.pdf

Hi team

OD survey, excess \$500. Authorise if consistent

Thanks
Kelvyna

From: Lee Hong <leehong36@rocketmail.com>
Sent: Thursday, August 02, 2018 12:30 PM
To: General Claims <GeneralClaims@sg.gaig.com>; Ngian, Kelvyna <Kelvyna.Ngian@sg.gaig.com>
Subject: [External] Fw: Request For Own Damaged Claim Survey - SLM9996G

Your Ref.: MOMVP000003627-00-000
Our Ref.: SLM9996G

Great American Insurance Company
Motor Claim Department

Dear Sir/Madam,

**Accident Involving SLM9996G and SJP5599D on the 30 July 2018
Along Woodlands Ave 4 Slip Rd to Admiralty Rd West**

We refer to the above matter.


Kindly arrange a survey for our mutual clients' vehicle, SLM9996G soonest.

Thank you and best regards,

William Saw

Lee Hong & Co. Motor Service

Lee Hong & Co. Motor Service | Blk 9 Sin Ming Road Sin Ming Industrial Estate Sector C #01-36 Singapore 575644.
DID : 6458-8460 T : +65 6552-5192 I F : +65 6455-5379 I E : leehong36@rocketmail.com

 **Be earthsmart.** Please consider the environment before printing this e-mail.

This email and any attachments are confidential and may also be privileged. If you are not the intended recipient, please delete all copies and notify the sender immediately.

The content of this e-mail message and any attachments are confidential and may be legally privileged, intended solely for the addressee. If you are not the intended recipient, be advised that any use, dissemination, distribution, or copying of this e-mail is strictly prohibited. If you receive this message in error, please notify the sender immediately by reply email and destroy the message and its attachments.

**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

GREAT AMERICAN INSURANCE COMPANY

Ref : CS/GAI18014288/R1qd3

3 TEMASEK AVENUE
#16-01 CENTENNIAL TOWER
SINGAPORE 039190

Date : 06-08-2018



Code : GAI

1. Policy Particulars :- OWN DAMAGE

Insured Veh.		Veh. Inspected	SLM 9996G
Policy No.		Coverage (\$)	0.00
Claim No.	MOMVP000003627-00-000	Excess (\$)	500.00
Assign From	NGIAN KELVYNA	Assign Date	06/08/2018

2. Vehicle Particulars & Condition

Make & Model		c.c	0
Engine No.	HIDDEN	Year of Reg.	
Chassis No.		Colour	
Odometer	-	Steering	
Brakes		Modification	
General			

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm

4. Description of Damages

--	--

5. General Information

Accident Date	30/07/2018	Inspection Date	06/08/2018
Survey held at	LEE HONG & COMPANY MOTOR SERVICES BLK 9, SIN MING ROAD, #01-36 SINGAPORE 575644.		

5a. Remarks

A) THE MARKET VALUE IS S\$----- (EST. AVERAGE)
B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE AUTHORISED REPAIRS.

Shiau Chan (LKKAUTO)

From: Shiau Chan (LKKAUTO)
Sent: Tuesday, 7 August 2018 2:58 PM
To: 'Ngian, Kelvyna'; assignments
Cc: SUR
Subject: RE: Fw: Request For Own Damaged Claim Survey - SLM9996G
Attachments: CSGAI18014288R1qd3.pdf; SLM9996 EST.pdf

Dear Kelvyna,

Enclosed herewith preliminary advice of SLM 9996G.

Best Regards,

Shiau Chan (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: siewsc@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Admin-D (LKKAUTO)
Sent: Monday, 6 August 2018 3:37 PM
To: 'Ngian, Kelvyna' <Kelvyna.Ngian@sg.gaig.com>; assignments <assignments@lkkauto.com>
Cc: SUR <sur@lkkauto.com>
Subject: RE: Fw: Request For Own Damaged Claim Survey - SLM9996G

Dear Sir/ Mdm,

Thank you for the assignment.

BEST REGARDS,

G.Nivitha | Admin

LKK Auto Consultants Pte Ltd

Phone: 6841-1972 | email: assignments@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Ngian, Kelvyna [<mailto:Kelvyna.Ngian@sg.gaig.com>]
Sent: Monday, 6 August 2018 3:12 PM
To: "SUR" <sur@lkkauto.com>; Nivitha (LKK Auto) <admin-d@lkkauto.com>; 'Admin A' <admin-a@lkkauto.com>
Subject: FW: Fw: Request For Own Damaged Claim Survey - SLM9996G

Hi team

OD survey, excess \$500. Authorise if consistent

Thanks
Kelvyna

From: Lee Hong <leehong36@rocketmail.com>
Sent: Thursday, August 02, 2018 12:30 PM
To: General Claims <GeneralClaims@sg.gaig.com>; Ngian, Kelvyna <Kelvyna.Ngian@sg.gaig.com>
Subject: [External] Fw: Request For Own Damaged Claim Survey - SLM9996G



Auto
Consultants
Pte Ltd

51 UBI AVE 1, #01-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 62564315

Claim No. : MOMVP000003627-00-000

Date: 07th August 2018

Our Ref: CS/GAI18014288/R1qd3

The Motor Claims Department
Great American Insurance Company

Attn: Kelvyna

Dear Sirs/Mdm


PRELIMINARY ADVICE OF VEHICLE NO. SLM 9996G

We thank you for the instruction on 06/08/2018.

Please be informed that we had conducted the inspection of the abovementioned vehicle on 06/08/2018 at the premises of M/s LEE HONG & CO and have the following to report:-

Workshop Estimate Amount	: S\$ <u>2,985.00 (SN + LABOUR)</u>
Revised Estimate Amount	: S\$ <u>2,435.00</u>
"Check" Items Amount	: S\$ <u>-</u>
Market Value	: S\$ <u>82,000.00</u>
Salvage Value	: S\$ <u>63,650.00</u>
Nett Value	: S\$ <u>18,350.00</u>

Description of Damage:
The vehicle sustained damages at the front portion.

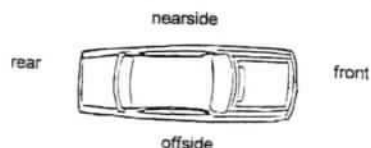

Comments/ Present Status:
Damages consistent.
Pending for parts prices
Recommend repair days: 9 days
We have authorise repair.

Yours faithfully

Rasul
Automotive Assessor

[> Back to OneMotoring](#)

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	4695H
Vehicle Details	
Vehicle No.:	SLM9996G
Vehicle to be Exported:	No
Intended De-registration Date:	07 Aug 2018
Vehicle Make:	MERCEDES BENZ
Vehicle Model:	C 180 BLUEEFFICIENCY
Primary Colour:	White
Manufacturing Year:	2013
Engine No.:	27491030037277
Chassis No.:	WDD2040312A831551
Maximum Power Output:	115.0 kW (154 bhp)
Open Market Value:	\$32,661.00
Original Registration Date:	25 Sep 2013 ✓
First Registration Date:	25 Sep 2013
Transfer Count:	1
Actual ARF Paid:	\$32,726.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	24 Sep 2023
PARF Rebate Amount:	\$24,544.00
Intended COE Rebate Details	
COE Expiry Date:	24 Sep 2023 ✓
COE Category:	A - Car (1600cc & below)
COE Period(Years):	10
QP Paid:	\$76,223.00
COE Rebate Amount:	\$39,106.00
Total Rebate Amount:	\$63,650.00

The information contained herein is correct as at 07 Aug 2018

OK

82,000
63,650

18,350

18k

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT	
Date Of Report	31/07/2018 12:05
Date Of Accident	30/07/2018 15:55
Exact Location Of Accident	WOODLANDS AVE 4 SLIP ROAD TO ADMIRALTY ROAD WEST
Country/State of Loss	SINGAPORE
DETAILS OF OWN VEHICLE	
Vehicle Registration Number	SLM9996G
Insured/Policyholder	
Name Of Registered Owner	TNG WEE LEONG
NRIC No	S8704695H
Email Address	WILLIAM@ORICOMMS.COM
Mobile Phone No	(LOCAL) +65-86114096
Alternative Phone No	OFFICE-86114096
Vehicle Particulars	
Manufacturer	MERCEDES-BENZ
Model	C180 BLUE EFFICIENCY-1.6 (A)
Exact Purpose for which vehicle was being used at time of accident	PTE USE
Are you claiming under your own insurance policy for repair to your vehicle?	YES
If No, Please state action to be taken	
Vehicle Category	PRIVATE CAR
Insurance Company	
Name of Insurance Company	GREAT AMERICAN INSURANCE COMPANY
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	MOMVP000003627-00-000
Cover Note Number	
Driver	
Name of Driver	TNG WEE LEONG
NRIC No	S8704695H
Date Of Birth	31/01/1987
Occupation	INDOOR
Date Of Driving Pass	23/12/2006
Driving Experience	11 YEARS AND 7 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-86114096
Fax Number	
Contact Number	OFFICE-86114096
Email Address	WILLIAM@ORICOMMS.COM

Address	280 WOODLANDS INDUSTRIAL PARK E5 #02-37 HARVEST@WOODLANDS
Postcode	757322
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OWNER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	COLLISION - HEAD TO REAR
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles involved in the accident	2
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

As per Sketch Plan Attached

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	YES
Remarks/ Reasons:	VIDEO NOT AVAILABLE YET
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SJP5599D
Vehicle Make/Model/Colour	MERCEDES BENZ
Details Of Properties	GLE 400
Vehicle Category	PRIVATE CAR
Name of Driver	KEN CHONG
NRIC/Passport Number	
Contact Number	93689696
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	REAR
No. Of Passenger (Including Driver)	1

Sketch Plan

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.



Policyholder's Signature
Date & Time:




Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

Sketch Plan #2

SKETCH PLAN

Admiralty Road West

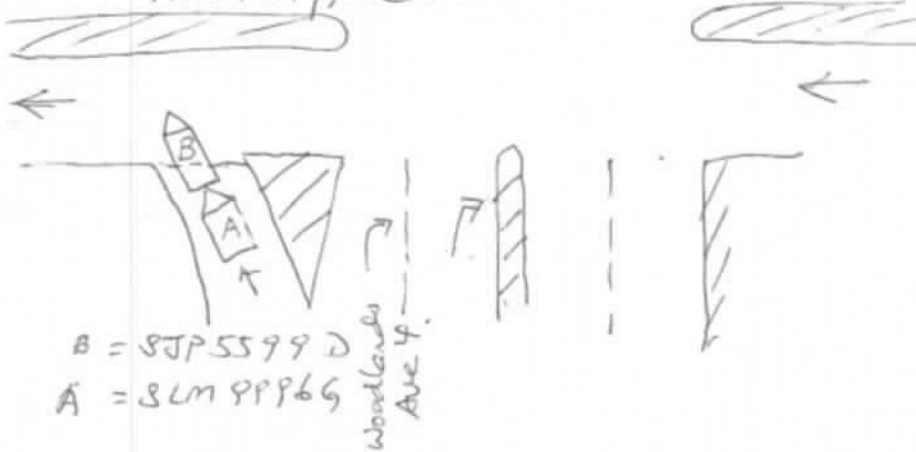

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

On 30/7/18 I was travelling along Woodlands Ave 4 towards Admiralty Rd west. The front vehicle after passing half way out of the slip road then junc on the bike. I also quickly put junc but still could not make it in time to avoid the accident.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

LEE HONG & CO MOTOR SERVICE

Blk 9 Sin Ming Road
 #01-36 Sin Ming Industrial Estate
 Singapore 575644.

T. (65) 6458 8460
 F. (65) 6455 5379
 E. leehong36@rocketmail.com

Date	31-Jul-2018	ESTIMATE	
Insurance Particulars			
Name	GREAT AMERICAN INSURANCE COMPANY		
Address	3 Temasek Avenue		
	#16-01 Centennial Tower		
	Singapore 039190		
Owner Particulars			
Name	Tng Wee Leong		
# No.	S8704695H		
Address	63 Jalan Chempaka Kuning		
	Singapore 489101		
Driver Particulars			
Name	As Above		
# Nos.		Mobile No.	
Address			
Vehicle Particulars			
Number	SLM9996G		
Model	MERCEDES BENZ C 180 BLUEEFFICIENCY		
Engine	27491030037277		
Chassis	WDD2040312A831551		
Year	25-Sep-13		
Accident Details			
Date	30/7/2018		
Time	15.55 hrs		
Place	Woodlands Ave 4 Slip Road To Admiralty Road West		
Parts & Labour			
Cost Price		\$	-
	Plus 15%	\$	-
		\$	-
Special Nett			
Labour Charges			
Total		\$	-

ESTIMATE COST OF REPAIRS TO SLM9996G

QTY	DESCRIPTIONS	UNITS	AMOUNTS
			Cost Prices
1 pce	Bonnet <i>pm</i>	1	
1 pce	Bonnet centre hook <i>PA</i>		
2 pcs	Bonnet side catches <i>PA</i>		
1 pce	Bonnet damping spring <i>MIS</i>		
2 pcs	Bonnet dampers <i>X SRC</i>		
1 pce	Bonnet front rubber beading <i>neu</i>		
1 pce	Bonnet insulating pad <i>DE</i>		
1 pce	Bonnet badge <i>neu</i>		
2 pcs	Bonnet bottom locks <i>PA</i>		
1 pce	Bonnet surround rubber <i>neu</i>		
1 pce	Radiator grille <i>CRA</i>		
1 pce	Radiator grille emblem <i>MIS</i>		
1 set	Radiator grille mouldings <i>CRA</i>		
1 pce	Front bumper fascia <i>DE</i>		
2 pcs	Front bumper side retainers <i>neu</i>		
2 pcs	Front bumper side grilles <i>X SRC</i>		
2 pcs	Front bumper side grille mouldings <i>X SRC</i>		
1 pcs	Front bumper centre grille <i>? ? cut</i>		
1 pce	Front bumper inner sponge <i>cut</i>		
1 pce	Front bumper reinforcement <i>PA</i>		
2 pcs	Front bumper brackets <i>neu</i>		
1 pce	Front number plate base plate <i>CRA</i>		
1 pce	O/s front fender <i>PA</i>		
2 pcs	Headlamp assy <i>CRA</i>		
2 pcs	Headlamp top panels <i>PA</i>		
1 pce	Front centre panel <i>PA</i>		
1 pce	Centre panel top garnish cover <i>CRA</i>		
2 pcs	Centre panel side air guide plastic <i>CRA</i>		
1 pce	Aircon condenser <i>PA</i>		
1 pce	Aircon condenser intake pipe <i>? PA</i>		
1 pce	Aircon condenser discharge pipe <i>? PA</i>		
1 pce	Radiator assy <i>? cut</i>		
1 pce	Radiator fan assy <i>? cut</i>		
1 pce	Radiator fan cowling <i>? CRA</i>		
1 pce	Radiator top hose <i>TW1</i>		
1 pce	Radiator bottom hose <i>? TW1</i>		
1 pce	Aircleaner intake funnel <i>DE</i>		
1 pce	Aircleaner intake hose <i>cut</i>		
1 pce	Aircleaner by-pass hose <i>cut X SRC</i>		
1 pce	"ABS" unit <i>? X SRC</i>		
1 pce	N/s roof moulding <i>cut</i>		
			\$ -
		Plus 10%	\$ -
			\$ -

	S/Nett		
1 pce	Front number plate	\$	45.00
	Labour		
	To remove lamps, necessary wirings and Electrical fittings to enable necessary repairs, check, replace damaged lamps, refit same. Test electrical-circuit and refocus headlights.	\$	40.00
	To remove 'ABS' assy. sensor and detonator, Replace damaged parts and reset system	\$	100.00
	To remove necessary Aircon parts and fittings to enable necessary repairs, check, replace damaged parts, refit same, vacuum and recharge gas. (A134 Gas)	\$	120.00
	To check and re-align body structure on chassis alignment systems.	\$	300.00
	To check wheel alignment – computerize.	\$	60.00
	To remove damaged parts, jack and cut out damaged body panels, jack out, straighten up damaged body panels and repair body parts and fittings, whichever possible and necessary, replace and weld necessary damaged parts, refit and realign whichever parts necessary.	\$	1,200.00
	To spray painting replacement parts and repaint damaged sections with welded portions in and outside, including putty.	\$	1,000.00
	To perform a computerise systems checking after removing of necessary wirings and Electrical fittings to enable necessary diagnosing and re-setting to specifications	\$	120.00
		\$	2,985.00

35 ms

60

80

200

1000

900

60

LKK Auto Consultants hence notify

the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Rasul
Hp 90010068

9 days

P/P

EXCESS: 500

Repair by paint Authorized
21/08/18 @ 1630

8/8/2018

Shiau Chan (LKKAuto)

From: Lee Hong <leehong36@rocketmail.com>
Sent: Friday, 22 February 2019 3:21 PM
To: Shiau Chan (LKKAuto)
Subject: Re: SLM9996G Mercedes Benz

Dear Shiau Chan,

Ok. Confirmed.


Thank you

William Saw

Lee Hong & Co. Motor Service

Lee Hong & Co. Motor Service | Blk 9 Sin Ming Road Sin Ming Industrial Estate Sector C, #01-36 Singapore 575644.

DID : 6458-8460 T : +65 6552-5192 I F : +65 6455-5379 I E : leehong36@rocketmail.com

 **Be earthsmart.** Please consider the environment before printing this e-mail.

This email and any attachments are confidential and may also be privileged. If you are not the intended recipient, please delete all copies and notify the sender immediately.

On Friday, 22 February 2019, 2:43:11 pm GMT+8, Shiau Chan (LKKAuto) <siewsc@lkkauto.com> wrote:

Dear William,

WITHOUT PREJUDICE

Offer final fig \$12,568.20 before excess \$500.00 & GST and 9 repair days.

Kindly confirm.

Best Regards,

Shiau Chan (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: siewsc@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

ESTIMATE COST OF REPAIRS TO SLM9996G

QTY	DESCRIPTIONS	UNITS	AMOUNTS
			Cost Prices
1 pce	Bonnet <2048801418MB> 2		\$ 980.00
1 pce	Bonnet centre hook <2048800064MB> 29		\$ 45.00
2 pcs	Bonnet side catches <2128800060MB> 4	\$ 22.00	\$ 44.00
1 pce	Bonnet damping spring <2048800227MB> 3	\$ 12.00	\$ 24.00
2 pcs	Bonnet dampers		\$ -
1 pce	Bonnet front rubber beading <2048800297MB> 34		\$ 15.00
1 pce	Bonnet insulating pad <2046820626MB> 11		\$ 140.00
1 pce	Bonnet badge <2048170616MB> 3		\$ 43.00
2 pcs	Bonnet bottom locks <2048800260MB> 5	\$ 39.00	\$ 78.00
1 pce	Bonnet surround rubber <2046280198MB> 35		\$ 15.00
1 pce	Radiator grille <2048800023MB> 31	}	
1 pce	Radiator grille emblem	}	\$ 420.00
1 set	Radiator grille mouldings	}	
1 pce	Front bumper fascia <20488027499999> 12		\$ 880.00
2 pcs	Front bumper side retainers <2048851016/1116MB>	\$ 25.00	\$ 27.28 50.00
2 pcs	Front bumper side grilles		\$ -
2 pcs	Front bumper side grille mouldings		\$ -
1 pcs	Front bumper centre grille <2048850853MB> 41		\$ 95.00
1 pce	Front bumper inner sponge <2048853837MB>	40	\$ 65.00
1 pce	Front bumper reinforcement <2076201600MB>	17	\$ 175.00
2 pcs	Front bumper brackets-aluminium<0995/1195MB>	\$ 150.00	\$ 21.22 300.00
1 pce	Front number plate base plate<2048173278MB>	2	\$ 63.00
1 pce	O/s front fender <2048801418MB> 1		\$ 460.00
2 pcs	Headlamp assy<2048209759/9859MN> 23,24	\$ 280.00	\$ 560.00
2 pcs	Headlamp top panels <2046201191/1291MB>	\$ 140.00	\$ 18.19 280.00
1 pce	Front centre panel <2046200272MB>	20	\$ 80.00
1 pce	Centre panel top garnish cover <2045001455MB>	10	\$ 30.00
2 pcs	Centre panel side air guide plastic<2045050530MB>	7	\$ 35.00
1 pce	Aircon condenser <2045000654>		\$ 700.00
1 pce	Aircon condenser intake pipe<2048304916MB>	42	\$ 190.00
1 pce	Aircon condenser discharge pipe<2128308115MB>	43	\$ 75.00
1 pce	Radiator assy <0995006203MB>	33	\$ 715.00
1 pce	Radiator fan assy <2049066802MB>	93	\$ 560.00
1 pce	Radiator fan cowling		
1 pce	Radiator top hose <2045018782MB>	14	\$ 48.00
1 pce	Radiator bottom hose <2045019482MB>	15	\$ 81.00
1 pce	Aircleaner intake funnel <2740900429MB>	39	\$ 200.00
1 pce	Aircleaner intake hose <2740900082MB>	38	\$ 130.00
1 pce	Aircleaner by-pass hose		\$ -
1 pce	"ABS" unit		\$ -
1 pce	N/s roof moulding <20469075829040>	32	\$ 190.00
1 pce	Inter cooler <2045000200MB>	36	\$ 630.00
1 pce	Inter cooler pastic garnish <2045053430MB>	16	\$ 95.00
			\$ 8,491.00
		Plus 10%	\$ 849.10
			\$ 9,340.10

pnc =
 BT =
 BT =
 BT =
 MS =
 X SUC
 MS =
 DE =
 DE =
 BT =
 MS =
 CRA - X
 MS =
 CRA - X
 DE =
 MS =
 X SUC
 X SUC
 ? CUT -
 CUT =
 BT =
 MS =
 CRA =
 BT =
 CRA =
 BT =
 CRA =
 BT =
 BT =
 ? BT -
 ? BT -
 ? BT -
 ? CUT -
 ? CRA -
 TWI =
 ? CUT -
 DE =
 CUT -
 CUT - X SUC
 ? X SUC
 CUT =
 BT -
 CRA -

	S/Nett		
1 pce	Front number plate	\$	45.00
	Labour		
	To remove lamps, necessary wirings and Electrical fittings to enable necessary repairs, check, replace damaged lamps, refit same. Test electrical-circuit and refocus headlights.	\$	40.00
	To remove 'ABS' assy. sensor and detonator, Replace damaged parts and reset system	\$	100.00
	To remove necessary Aircon parts and fittings to enable necessary repairs, check, replace damaged parts, refit same, vacuum and recharge gas. (A134 Gas)	\$	120.00
	To check and re-align body structure on chassis alignment sysyems.	\$	300.00
	To check wheel alignment – computerize.	\$	60.00
	To remove damaged parts, jack and cut out damaged body panels, jack out, straighten up damaged body panels and repair body parts and fittings, whichever possible and necessary, replace and weld necessary damaged parts, refit and realign whichever parts necessary.	\$	1,200.00
	To spray painting replacement parts and repaint damaged sections with welded portions in and outside, including putty.	\$	1,000.00
	To perform a computerise systems checking after removing of necessary wirings and Electrical fittings to enable necessary diagnosing and re-setting to specifications	\$	120.00
		\$	12,325.10

35 M.S. ✓

60

80

200 ✓

1000

900

60

LEE HONG & CO MOTOR SERVICE

Blk 9 Sin Ming Road
 #01-36 Sin Ming Industrial Estate
 Singapore 575644.

T. (65) 6458 8460
 F. (65) 6455 5379
 E. leehong36@rocketmail.com

Date	13-Aug-2018	SUPPLEMENTARY
------	-------------	---------------

	Insurance Particulars
Name	GREAT AMERICAN INSURANCE COMPANY
Address	3 Temasek Avenue #16-01 Centennial Tower Singapore 039190

	Vehicle Particulars
Number	SLM9996G
Model	MERCEDES BENZ C 180 BLUEEFFICIENCY
Engine	27491030037277
Chassis	WDD2040312A831551
Year	25-Sep-13

	Accident Details
Date	30/7/2018
Time	15.55 hrs
Place	Woodlands Ave 4 Slip Road To Admiralty Road West

	Parts & Labour		
	Cost Price		\$ 721.00
		Plus 10%	\$ 72.10
			\$ 793.10
	Special Nett		\$ -
	Labour Charges		\$ -
	Total		\$ 793.10

SUPPLEMENTARY ESTIMATE COST OF REPAIRS TO SLM9996G

QTY	DESCRIPTIONS	UNITS	AMOUNTS
			Cost Price
2 pcs	Front bumper basic carriers <4165/4265MB>	\$ 45.00	\$ 90.00
2 pcs	Front bumper centre stiffening <2048850736MB>		\$ 16.00
1 pce	Front bumper top plastic support <4665MB>		\$ 60.00
1 pce	N/s bonnet bottom lock sensor switch <4458MB>		\$ 28.00
1 pce	Bonnet support <2048800164MB>		\$ 47.00
2 pcs	Radiator clips <0009912595MB>	\$ 10.00	\$ 20.00
1 pce	Radiator air baffle		\$ -
1 pce	N/s front fender <2048801318MB>		\$ 460.00
			\$ 721.00
		Plus 10%	\$ 72.10
			\$ 793.10

13110.20

LEE HONG & CO MOTOR SERVICE

Blk 9 Sin Ming Road
 #01-36 Sin Ming Industrial Estate
 Singapore 575644.

T. (65) 6458 8460
 F. (65) 6455 5379
 E. leehong36@rocketmail.com

Date	31-Jul-2018		ESTIMATE	
Insurance Particulars				
Name	GREAT AMERICAN INSURANCE COMPANY			
Address	3 Temasek Avenue			
	#16-01 Centennial Tower			
	Singapore 039190			
Owner Particulars				
Name	Tng Wee Leong			
# No.	S8704695H			
Address	63 Jalan Chempaka Kuning			
	Singapore 489101			
Driver Particulars				
Name	As Above			
# Nos.		Mobile No.		
Address				
Vehicle Particulars				
Number	SLM9996G			
Model	MERCEDES BENZ C 180 BLUEEFFICIENCY			
Engine	27491030037277			
Chassis	WDD2040312A831551			
Year	25-Sep-13			
Accident Details				
Date	30/7/2018			
Time	15.55 hrs			
Place	Woodlands Ave 4 Slip Road To Admiralty Road West			
Parts & Labour				
Cost Price			\$	-
		Plus 15%	\$	-
			\$	-
Special Nett				
Labour Charges				
Total			\$	-

Quo Qiy.
LH
08/8/18

ESTIMATE COST OF REPAIRS TO SLM9996G

QTY	DESCRIPTIONS	UNITS	AMOUNTS
			Cost Prices
1 pce	Bonnet <i>PA</i>	1	
1 pce	Bonnet centre hook <i>PA</i>		
2 pcs	Bonnet side catches <i>PA</i>		
1 pce	Bonnet damping spring <i>MIS</i>		
2 pcs	Bonnet dampers <i>X</i>		
1 pce	Bonnet front rubber beading <i>neu</i>		
1 pce	Bonnet insulating pad <i>DE</i>		
1 pce	Bonnet badge <i>neu</i>		
2 pcs	Bonnet bottom locks <i>PA</i>		
1 pce	Bonnet surround rubber <i>neu</i>		
1 pce	Radiator grille <i>CRA</i>		
1 pce	Radiator grille emblem <i>MIS</i>		
1 set	Radiator grille mouldings <i>CRA</i>		
1 pce	Front bumper fascia <i>DE</i>		
2 pcs	Front bumper side retainers <i>neu</i>		
2 pcs	Front bumper side grilles <i>X</i>		
2 pcs	Front bumper side grille mouldings <i>X</i>		
1 pcs	Front bumper centre grille <i>PA</i> / <i>Cest</i>		
1 pce	Front bumper inner sponge <i>Cut</i>		
1 pce	Front bumper reinforcement <i>PA</i>		
2 pcs	Front bumper brackets <i>neu</i>		
1 pce	Front number plate base plate <i>CRA</i>		
1 pce	O/s front fender <i>PA</i>		
2 pcs	Headlamp assy <i>CRA</i>		
2 pcs	Headlamp top panels <i>PA</i>		
1 pce	Front centre panel <i>PA</i>		
1 pce	Centre panel top garnish cover <i>CRA</i>		
2 pcs	Centre panel side air guide plastic <i>CRA</i>		
1 pce	Aircon condenser <i>PA</i>		
1 pce	Aircon condenser intake pipe <i>PA</i> / <i>BT</i>		
1 pce	Aircon condenser discharge pipe <i>PA</i> / <i>BT</i>		
1 pce	Radiator assy <i>PA</i> / <i>BT</i>		
1 pce	Radiator fan assy <i>PA</i> / <i>Cest</i>		
1 pce	Radiator fan cowling <i>PA</i> / <i>CRA</i>		
1 pce	Radiator top hose <i>THI</i>		
1 pce	Radiator bottom hose <i>X</i> / <i>Cest</i>		
1 pce	Aircleaner intake funnel <i>DE</i>		
1 pce	Aircleaner intake hose <i>Cut</i>		
1 pce	Aircleaner by-pass hose <i>Cut</i>		
1 pce	"ABS" unit <i>PA</i>		
1 pce	N/s roof moulding <i>Cut</i>		
1 pce	Turbo Cooler <i>BR</i>		
1 pce	Turbo Cooler plastic garnish <i>CRA</i>		
			\$ -
		Plus 10%	\$ -
			\$ -

	S/Nett		
1 pce	Front number plate	\$	45.00 35 ms
	Labour		
	To remove lamps, necessary wirings and Electrical fittings to enable necessary repairs, check, replace damaged lamps, refit same. Test electrical-circuit and refocus headlights.	\$	40.00
	To remove 'ABS' assy. sensor and detonator, Replace damaged parts and reset system	\$	100.00 60
	To remove necessary Aircon parts and fittings to enable necessary repairs, check, replace damaged parts, refit same, vacuum and recharge gas. (A134 Gas)	\$	120.00 80
	To check and re-align body structure on chassis alignment systems.	\$	300.00 200
	To check wheel alignment – computerize.	\$	60.00
	To remove damaged parts, jack and cut out damaged body panels, jack out, straighten up damaged body panels and repair body parts and fittings, whichever possible and necessary, replace and weld necessary damaged parts, refit and realign whichever parts necessary.	\$	1,200.00 1000
	To spray painting replacement parts and repaint damaged sections with welded portions in and outside, including putty.	\$	1,000.00 900
	To perform a computerise systems checking after removing of necessary wirings and Electrical fittings to enable necessary diagnosing and re-setting to specifications	\$	120.00 60
		\$	2,985.00

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Rasul
Hp 90010068

9 days

P/P

EXCESS: 500

Resurvey by panel

Authorised
06/08/18 @ 1630

LEE HONG & CO MOTOR SERVICE

Blk 9 Sin Ming Road
 #01-36 Sin Ming Industrial Estate
 Singapore 575644.

T. (65) 6458 8460
 F. (65) 6455 5379
 E. leehong36@rocketmail.com

Date	31-Jul-2018	ESTIMATE	
Insurance Particulars			
Name	GREAT AMERICAN INSURANCE COMPANY		
Address	3 Temasek Avenue		
	#16-01 Centennial Tower		
	Singapore 039190		
Owner Particulars			
Name	Tng Wee Leong		
# No.	S8704695H		
Address	63 Jalan Chempaka Kuning		
	Singapore 489101		
Driver Particulars			
Name	As Above		
# Nos.		Mobile No.	
Address			
Vehicle Particulars			
Number	SLM9996G		
Model	MERCEDES BENZ C 180 BLUEEFFICIENCY		
Engine	27491030037277		
Chassis	WDD2040312A831551		
Year	25-Sep-13		
Accident Details			
Date	30/7/2018		
Time	15.55 hrs		
Place	Woodlands Ave 4 Slip Road To Admiralty Road West		
Parts & Labour			
Cost Price			\$ 8,491.00
		Plus 10%	\$ 849.10
			\$ 9,340.10
Special Nett			\$ 45.00
Labour Charges			\$ 2,940.00
Total			\$ 12,325.10



PAS AUTO PTE LTD

BLK 32 SIN MING DRIVE #01-325 S(575706)
TEL NO : 64523938 (6 LINES) FAX NO : 64527936
A/C DEPT : 64590882
Business Reg & GST NO : 201512120M



D189498

TAX INVOICE

LEE HONG & CO.MOTOR SERVICE

BLK9 SIN MING RD

#01-36 SIN MING IND EST

S'PORE 575644

REMARK : VEH NO.SLM9996G

DELIVER TO :

INV NO : I189498

DATE : 13/08/2018

A/C NO : 305007

TERM : 30

PAGE : 1 OF 2

ISSUE : APS

Printed on 28/08/2018 17:09:35

ITEM	PART NO	DESCRIPTION	LOCATION	QTY	UNIT	PRICE	TOTAL AMT.
1	204 880 0023MB 90	GRILL SPORT 9040	DC	1	PCS	420.00	420.00
2	204 817 3278MB	FRT NOS PLATE GARNISH	3W	1	PC	63.00	63.00
3	204 880 0227MB	BONNET SPRING	SS2C00	2	PCS	12.00	24.00
4	212 880 0060MB	BONNET LOCK TOP LH&RH	SS2C16	2	PCS	22.00	44.00
5	204 880 0260MB	BONNET LOCK BOTTOM LH&RH	SS2C16	2	PC	39.00	78.00
6	204 885 4665MB	FRT BUMPER BAISC CARRIER	LC	1	PCS	60.00	60.00
7	204 505 0530MB	RAD AIR BAFFLE	3W3J05	1	PCS	35.00	35.00
8	000 991 2595MB	RAD CLIP	SS2A25	2	PCS	10.00	20.00
9	204 906 6802MB	RAD FAY ASSY	2W1D04	1	PCS	560.00	560.00
10	204 500 1455MB	RAD TOP COVERING	3W3A02	1	PCS	30.00	30.00
11	204 682 0626MB	BONNET SPONGE	3W3G04	1	PCS	140.00	140.00
12	204 880 2749 9999	FRT BUMPER 9999	LC	1	PCS	880.00	880.00
13	204 880 0164MB	RETAINING HOOK	SS2C15	1	PCS	47.00	47.00
14	204 501 8782MB	COOLANT HOSE	SS2G20	1	PCS	48.00	48.00
15	204 501 9482MB	COOLANT HOSE	SS2G20	1	PC	81.00	81.00
16	204 505 3430MB	AIR DUCT	3W3A10	1	PCS	95.00	95.00
17	207 620 1600MB	FRT BUMPER MEMBER	3W2F02	1	PCS	175.00	175.00
18	204 620 1191MB	HEAD LAMP PANEL LH	3W3A14	1	PCS	140.00	140.00
19	204 620 1291MB	HEAD LAMP PANEL RH	3W3A14	1	PCS	140.00	140.00
20	204 620 0272MB	STIFFENING	3W3A05	1	PC	80.00	80.00
21	204 620 0995MB	FRT BUMPER MEMBER RH	3W3A08	1	PC	150.00	150.00
22	204 620 1195MB	FRT BUMPER MEMBER LH	3W3A08	1	PC	150.00	150.00
23	204 820 9759MN	HEADLAMP LH	2W2A08	1	PCS	280.00	280.00
24	204 820 9859MN	HEADLAMP RH	2W2A08	1	PCS	280.00	280.00
25	204 885 4165MB	FRT BUMPER BAISC CARRIER LH	3W3J06	1	PCS	45.00	45.00
26	204 885 4265MB	FRT BUMPER BAISC CARRIER RH	3W3J06	1	PCS	45.00	45.00
27	204 885 1016MB	FRT BUMPER STIFFENING LH	SS2C11	1	PC	25.00	25.00

Goods sold are not returnable except Repairs/Service at authorized workshop.



PAS AUTO PTE LTD

BLK 32 SIN MING DRIVE #01-325 S(575706)
TEL NO : 64523938 (6 LINES) FAX NO : 64527936
A/C DEPT : 64590882
Business Reg & GST NO : 201512120M



D189498

TAX INVOICE

LEE HONG & CO.MOTOR SERVICE

BLK9 SIN MING RD

#01-36 SIN MING IND EST

S'PORE 575644

REMARK : VEH NO.SLM9996G

DELIVER TO :

INV NO : 1189498

DATE : 13/08/2018

A/C NO : 305007

TERM : 30

PAGE : 2 OF 2

ISSUE : APS

Printed on 28/08/2018 17:09:35

ITEM	PART NO	DESCRIPTION	LOCATION	QTY	UNIT	PRICE	TOTAL AMT.
28	204 885 1116MB	FRT BUMPER STIFFENING RH	SS2C11	1	PC	25.00	25.00
29	204 880 0064MB	BONNET SAFETY LOCK ✓	SS2C15	1	PCS	45.00	45.00
30	204 885 0736MB	SUPPORT	SS3B13	1	PCS	16.00	16.00
31	204 870 4458MB	SWITCH	SS2C28	1	PCS	28.00	28.00
32	204 690 7582 9040	ROOF MOULDING LH 9040	3W3H08	1	PCS	190.00	190.00
33	099 500 6203MB	RADIATOR	3W2A20	1	PCS	715.00	715.00
34	204 628 0198MB	SEAL,BONNET	SS2H27	1	PC	15.00	15.00
35	204 880 0297MB	ENGINE HOOD SEAL	LC	1	PC	15.00	15.00
36	204 500 0200MB	INTERCOOLER	2W2B11	1	PCS	630.00	630.00
37	204 880 1318MB	FRT FENDER LH	3W2J10	1	PCS	460.00	460.00
38	274 090 0082MB	AIR INTAKE HOSE	SS1B33	1	PCS	130.00	130.00
39	274 090 0429MB	AIR INTAKE PIPE	2W1B01	1	PC	200.00	200.00
40	204 885 3837MB	FRT BUMPER SPONG	3W3F03	1	PC	65.00	65.00
41	204 885 0853MB	FRT BUMPER LOWER GRILL CTR	LC	1	PC	95.00	95.00
42	204 830 4916MB	A/C PIPE	LC	1	PC	190.00	190.00
43	212 830 8115MB	A/C PIPE	LC	1	PC	75.00	75.00

RECEIVED BY

PICKED BY:

SUB-TOTAL : S\$ 7,029.00

ADD 7% GST : S\$ 492.03

TOTAL : S\$ 7,521.03

Goods sold are not returnable except Repairs/Service at authorized workshop.



PAS AUTO PTE LTD

BLK 32 SIN MING DRIVE #01-325 S(575706)
TEL NO : 64523938 (6 LINES) FAX NO : 64527936
A/C DEPT : 64590882
Business Reg & GST NO : 201512120M



D190030

TAX INVOICE

LEE HONG & CO.MOTOR SERVICE

BLK9 SIN MING RD

#01-36 SIN MING IND EST

S'PORE 575644

REMARK : VEH NO.SLM9996G

DELIVER TO :

INV NO : I190030

DATE : 14/08/2018

A/C NO : 305007

TERM : 30

PAGE : 1 OF 1

ISSUE : APS

Printed on 28/08/2018 17:04:18

ITEM	PART NO	DESCRIPTION	LOCATION	QTY	UNIT	PRICE	TOTAL AMT.
1	204 880 1418MB	FRT FENDER RH	3W2J10	1	PCS	460.00	460.00
2	204 880 0957MB	BONNET	3W1C16	1	PCS	980.00	980.00
3	204 817 0616MB	BONNET STAR	SS2D05	1	PCS	43.00	43.00

RECEIVED BY

PICKED BY:

SUB-TOTAL : S\$ 1,483.00

ADD 7% GST : S\$ 103.81

TOTAL : S\$ 1,586.81

Goods sold are not returnable except Repairs/Service at authorized workshop.

78 ST PTE LTD

16:09:43

BLK 3021 UBI AVE 2, #01-193 SINGAPORE 408897


TEL: 6745 7787 FAX: 67451178

EMAIL: a78st@singnet.com.sg

CO. GST REG. NO : 201332725D CO. REG. NO: 201332725D

** TAX **
CASH
BILL

CASH

ATTN. :
TEL. :
FAX :
A/C NO. : 3000/CASNO. : 50015188
AGENT. : 
DATE : 14/08/2018
TERM : C.O.D
PAGE : 1

ITEM NO.	DESCRIPTION	QTY	U.PRICE TAX	AMOUNT
1 204.500.0654	BEHR COND MB C180 W204 W/DR	1.000 PCS*	700.000	700.00

SINGAPORE DOLLAR : SEVEN HUNDRED FORTY NINE ONLY

TOTAL QUANTITY	1.000	TOTAL	700.00
		DISCOUNT	0.00
		NET	700.00
	7%	TAX	49.00
		GROSS	SS 749.00

AUTHORISED SIGNATURE(S)


RECEIVED BY

**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
GREAT AMERICAN INSURANCE COMPANY		Ref : CS/GAI18014288/R1qd3e2		
3 TEMASEK AVENUE #16-01 CENTENNIAL TOWER SINGAPORE 039190		Date : 25-02-2019		
		Code : GAI		
1. Policy Particulars :- OWN DAMAGE				
Insured Veh.	Veh. Inspected		SLM 9996G	
Policy No.	MOMVP000003627-00-000	Coverage (\$)	0.00	
Claim No.		Excess (\$)	500.00	
Assign From	NGIAN KELVYNA	Assign Date	06/08/2018	
2. Vehicle Particulars & Condition				
Make & Model	MERCEDES BENZ C 180	c.c	1595	
Engine No.	HIDDEN	Year of Reg.	2013	
Chassis No.	WDD2040312A831551	Colour	WHITE	
Odometer	88893	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	FAIR			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	225/45Z R17	CONTINENTAL	6 mm	
L/H Front Tyre	225/45Z R17	CONTINENTAL	6 mm	
R/H Rear Tyre	225/45Z R17	CONTINENTAL	6 mm	
L/H Rear Tyre	225/45Z R17	CONTINENTAL	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	30/07/2018	Inspection Date	06/08/2018	
Survey held at	LEE HONG & COMPANY MOTOR SERVICES BLK 9, SIN MING ROAD, #01-36 SINGAPORE 575644.			
5a. Remarks				
A)THE MARKET VALUE IS S\$82,000.00(EST. AVERAGE) B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		9 Working Days		

**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLM 9996G

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	BONNET <2048801418MB> (WCP)	BUCKLED	980.00	980.00
1	BONNET CENTRE HOOD <2048800064MB> (WCP)	BENT	45.00	45.00
2	BONNET SIDE CATCHES <212800060MB> @\$22.00 (WCP)	BENT	44.00	44.00
2	BONNET DAMPLING SPRING <2048800227MB> @\$12.00 (WCP)	MISSING	24.00	24.00
2	BONNET DAMPERS (NPA)	SERVICEABLE	-	-
1	BONNET FRONT RUBBER BEADING <2048800297MB> (WCP)	NECESSARY	15.00	15.00
1	BONNET INSULATING PAD <2046820626MB> (WCP)	DEFORMED	140.00	140.00
1	BONNET BADGE <2048170616MB> (WCP)	NECESSARY	43.00	43.00
2	BONNET BOTTOM LOCKS <2048800260MB> @\$39.00 (WCP)	BENT	78.00	78.00
1	BONNET SURROUND RUBBER <2046280198MB> (WCP)	NECESSARY	15.00	15.00
1	RADIATOR GRILLE <2048800023MB> (WCP) }	CRACKED	-	-
1	RADIATOR GRILLE EMBLEM (WCP) }	MISSING	420.00	420.00
1	SET RADIATOR GRILLE MOULDINGS (WCP) }	CRACKED	-	-
1	FRONT BUMPER FASCIA <20488027499999> (WCP)	DEFORMED	880.00	880.00
2	FRONT BUMPER SIDE RETAINERS <2048851016/1116MB> @\$25.00 (WCP)	NECESSARY	50.00	50.00
2	FRONT BUMPER SIDE GRILLES (NPA)	SERVICEABLE	-	-
2	FRONT BUMPER SIDE GRILLE MOULDINGS (NPA)	SERVICEABLE	-	-
1	FRONT BUMPER CENTRE GRILLE <2048850853MB> (WCP)	CUT	95.00	95.00
1	FRONT BUMPER INNER SPONGE <2048853837MB> (WCP)	CUT	65.00	65.00
1	FRONT BUMPER REINFORCEMENT <2076201600MB> (WCP)	BENT	175.00	175.00
2	FRONT BUMPER BRACKETS-ALUMINIUM <0995/1195MB> @\$150.00 (WCP)	NECESSARY	300.00	300.00
1	FRONT NUMBER PLATE BASE PLATE <2048173278MB> (WCP)	CRACKED	63.00	63.00
1	O/S FRONT FENDER <2048801418MB> (WCP)	BENT	460.00	460.00
2	HEADLAMP ASSY <2048209759/9859MN> @\$280.00 (WCP)	CRACKED	560.00	560.00

Report Ref No. CS/GAI18014288/R1qd3e2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	HEADLAMP TOP PANELS <2046201191/1291MB> @\$140.00 (WCP)	BENT	280.00	280.00
1	FRONT CENTRE PANEL <2046200272MB> (WCP)	BENT	80.00	80.00
1	CENTRE PANEL TOP GARNISH COVER <2045001455MB> (WCP)	CRACKED	30.00	30.00
2	CENTRE PANEL SIDE AIR GUIDE PLASTIC <2045050530MB> (WCP)	CRACKED	35.00	35.00
1	AIRCON CONDENSER <2045000654> (WCP)	BENT	700.00	700.00
1	AIRCON CONDENSER INTAKE PIPE <2048304916MB> (WCP)	BENT	190.00	190.00
1	AIRCON CONDENSER DISCHARGE PIPE <2128308115MB> (WCP)	BENT	75.00	75.00
1	RADIATOR ASSY <0995006203MB> (WCP)	BENT	715.00	715.00
1	RADIATOR FAN ASSY <2049066802MB> (WCP) }	CUT	560.00	560.00
1	RADIATOR FAN COWLING (WCP) }	CRACKED	-	-
1	RADIATOR TOP HOSE <2045018782MB> (WCP)	TWISTED	48.00	48.00
1	RADIATOR BOTTOM HOSE <2045019482MB> (WCP)	CUT	81.00	81.00
1	AIRCLEANER INTAKE FUNNEL <2740900429MB> (WCP)	DEFORMED	200.00	200.00
1	AIRCLEANER INTAKE HOSE <2740900082MB> (WCP)	CUT	130.00	130.00
1	AIRCLEANER BY-PASS HOSE (NPA)	SERVICEABLE	-	-
1	"ABS" UNIT (NPA)	SERVICEABLE	-	-
1	N/S ROOF MOULDING <20469075829040> (WCP)	CUT	190.00	190.00
1	INTER COOLER <2045000200MB> (WCP)	BROKEN	630.00	630.00
1	INTER COOLER PASTIC GARNISH <2045053430MB> (WCP)	CRACKED	95.00	95.00
2	FRONT BUMPER BASIC CARRIERS <4165/4265MB> @\$45.00 (WCP) (ADDITIONAL)	CRACKED	90.00	90.00
2	FRONT BUMPER CENTRE STIFFENING <2048850736MB> (WCP) (ADDITIONAL)	CRACKED	16.00	16.00
1	FRONT BUMPER TOP PLASTIC SUPPORT <4665MB> (WCP) (ADDITIONAL)	CRACKED	60.00	60.00
1	N/S BONNET BOTTOM LOCK SENSOR SWITCH <4458MB> (WCP) (ADDITIONAL)	DAMAGED	28.00	28.00
1	BONNET SUPPORT <2048800164MB> (WCP) (ADDITIONAL)	BENT	47.00	47.00
2	RADIATOR CLIPS <0009912595MB> @\$10.00 (WCP) (ADDITIONAL)	NECESSARY	20.00	20.00

Report Ref No. CS/GAI18014288/R1qd3e2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	RADIATOR AIR BAFFLE (ADDITIONAL) (NPA)	TORN	-	-
1	N/S FRONT FENDER <2048801318MB> (WCP) (ADDITIONAL)	BUCKLED	460.00	460.00
	COST PLUS 10%		921.20	921.20
			10,133.20	10,133.20
	<u>SPECIAL NETT ITEMS</u>			
1	FRONT NUMBER PLATE (SN)	MISSING	45.00	35.00
			45.00	35.00
	<u>LABOUR</u>			
	TO REMOVE LAMPS, NECESSARY WIRINGS AND ELECTRICAL FITTINGS TO ENABLE NECESSARY REPAIRS, CHECK, REPLACE DAMAGED LAMPS, REFIT SAME. TEST ELECTRICAL-CIRCUIT AND REFOCUS HEADLIGHTS.		40.00	40.00
	TO REMOVE 'ABS' ASSY. SENSOR AND DETONATOR, REPLACE DAMAGED PARTS AND RESET SYSTEM.		100.00	60.00
	TO REMOVE NECESSARY AIRCON PARTS AND FITTINGS TO ENABLE NECESSARY REPAIRS, CHECK, REPLACE DAMAGED PARTS, REFIT SAME, VACUUM AND RECHARGE GAS. (A134 GAS)		120.00	80.00
	TO CHECK AND RE-ALIGN BODY STRUCTURE ON CHASSIS ALIGNMENT SYSTEMS.		300.00	200.00
	TO CHECK WHEEL ALIGNMENT - COMPUTERIZE.		60.00	60.00
	TO REMOVE DAMAGED PARTS, JACK AND CUT OUT DAMAGED BODY PANELS, JACK OUT, STRAIGHTEN UP DAMAGED BODY PANELS AND REPAIR BODY PARTS AND FITTINGS, WHICHEVER POSSIBLE AND NECESSARY, REPLACE AND WELD NECESSARY DAMAGED PARTS, REFIT AND REALIGN WHICHEVER PARTS NECESSARY.		1,200.00	1,000.00
	TO SPRAY PAINTING REPLACEMENT PARTS AND REPAINT DAMAGED SECTIONS WITH WELDED PORTIONS IN AND OUTSIDE, INCLUDING PUTTY.		1,000.00	900.00
	TO PERFORM A COMPUTERISE SYSTEMS CHECKING AFTER REMOVING OF NECESSARY WIRINGS AND ELECTRICAL FITTINGS TO ENABLE NECESSARY DIAGNOSTING AND RE-SETTING TO SPECIFICATIONS.		120.00	60.00
			2,940.00	2,400.00
	GRAND TOTAL		13,118.20	12,568.20

Report Ref No. CS/GAI18014288/R1qd3e2



RECOMMENDED COST OF REPAIRS			12,568.20
LESS EXCESS			-500.00
NETT LIABILITY			12,068.20

Report Ref No. CS/GAI18014288/R1qd3e2

MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.