23/03/2002	REF:	CS/CTU8	014821 / Asbn:	Special la	netruction:
SURVEYOR  From (Person):	Hwang Shipng Ti	ASSIGNM	CI1	Date	Time: 14087018 447pm
Retinated Cost	Vdi	WIM PUTO SKW VINVIMV	1200	Insured:	STP 879D 81118
of	55 DMHC8N17335517	Ubi Rd 100	Claim No: _ Excess: _		8003907(02 .o.A. 13082018
Make of Veh: (Client's Record) CA / REV / Date/Time:	REP. / REV 24 HRS 150SIUS 1009am		ted: Tony		H.O.D. Endorsement:
Date/Time	Action/Instruction ( SKM 43/5S - CC)		3293/Agball		DIA-300416
09/11/18	C\$ 11,945.0	plp \$ 20	22/)	13 days	- with Adries

## ASSIGNMENT

From: Date:	Veh No: SKM43/SS. Yr Regn: 2014 / Feb.
Estimated Cost:	Type M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
OD / TP / WS / TP RES / OD RES / EVA / INV / MV	Truck / Trailer or
To Inspect Vehicle No:	Make: Audi A3 Sedan c.c 1395
at Workshop m/s	Colour Silver- A/G: Insured / Std / NI / NA
of	Sp.Reading 82966. T/Radio: Insured / Std / NI / NA
Insured:	Eng/No:
Policy No.	C/No: WAUZZZ&VXE1021633.
Claims No.	Gen. Cond: Fair / Poor / Burnt
Sum Insured: Excess:	Steering: Inorde / Jammed / Leaked / Burnt or
(Client's Record)	Brake:   forder / Jammed / Leaked / Burnt or
Make of Veh:	Modi: Nil / (Rim / STD A/Rim or
	Tyre Size: F: 205/55R16.
(Policy Condition)	R: 205/55R6
Remark: The veh had commenced its N/	S O/S BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU P / SUMI /
repair at the time of inspection.	TOYO / YOKO or
Bal. or Market Value:	<u>Front</u> <u>Rear</u>
IDAC Accident Rport: Consistent? : Yes or No	
GIA / PR Seen: Consistent? : Yes or No	
Est Repairs: (3 1/2 days Res.: Yes or No	
Lum Sum: / % 3 Val.; Yes or No	
CA / REV / REP. / 24 HRS	Des. of Damages Fr (Rea) / O/S / N/S / U/C / Rooftop or
	le: IN / OUT The U/C / Chassis frame / Body Structure affected due to collision.
Date: Person Contacted:  Date / Time   Action / Instruction	the old / chassis fiding / body didding another
TP Ching.	
WA : 21 15.	
PV:51K.	WED 4 2 NOV 2018
Net: 20K. RECE	IVED 1 2 NOV 2018
Date/Time, File Pass to? Preli Report	Days Of Repair: /3
12/11/18 Final Report	Resurvey No. of Trip:   Survey Fee:
Date/Time, File Return to?	Transportation:
2)	Add Fee: Site Insp (\$ ) s+Rs, Si
-d	Interview (\$ ) Photos
Report Format :	: Tech. Invs (\$ ) Others
Lump Sum / LB.1: (\$ 20.000/- 1/2)	Weekend (\$ - ) 2x0
80,000/- 111	1010.

### ...CLAIM SUBFOLDER...(New Assignment)

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Sub	mitted	Ins Authled	Status		
Main	14 Aug 2018		14 Aug 2018 16:47 Assign					New As	signmer Case	nt
м	lain	Re	ference		Claim Details		Document	s	] [	Show All
CLAIM SUE	FOLDER DE	TAILS				[Create	d by insurer]			NATIONAL PROPERTY.
Insured:	BK XPRES	S, Co. Reg. No.:	53343509M	3-10-05		1-				
Main Claimant:	SIEW HO	NG KAI, ID: S8	239810D							
Vehicle Reg. No.:	SKM431	5S			Date of Loss:	13/08/20	18 08:00 - :59			
Claim Type:	TP / SNN	118D03907C02			Policy/Cover Note No.:	DMHCSN	1733351700 (Com	prehensive	e)	
Vehicle Reg. No. (Insured):	SJP879D				Policy No. (Claimant):	D18MTPV01012677				
2902000000000		CARLONICO SUPERIO CONCESSOR			Excess:	S\$0.00				
Repairer:	Premium	Automobiles Pte	Ltd (UBI) 55 U	Jbi Road 1,	408699 Ubi - Tel	67689828	3/9827/9911			
Handling Insurer:	China Tai	ping Insurance (	Singapore) Pte	e. Ltd. (HQ)	- Tel: 6389 611	1 [Hand	lled by <b>Hwang Sh</b>	iang Yi -	5389654	1]
Claimant's Insurer:	Sompo In	surance Singapo	re Pte. Ltd. (H	Q) - Tel: 64	61 6555					
Adjuster:		Consultants Pte	Ltd (HQ) - Tel:	6256-3561	[Final Rpt	due 24/0	8/2018]			
Driver/Custo dian (Insured):		NG FENG (CHENG	ZHANGFENG) (3	5 / Male),	NRIC: S830448	1J, Tel: +	-6597226988			
Adj Asg. Remarks:	EST \$30,04	49.00, ASSIGN AD	RIAN LING AS S	DE.						
ASSOCIATI	ED MAIL RE	CEIVED					· V	iew All	Compose	Case Mai
There are no	mail for this	case.					_			
ALL ASSO	CIATED TAS	KS⊟				View All	Search Tasks	Create Ne	w Task I	Complet
Due Date	Priority	Type Task	Group Subj	ject Han	dler Assign	ned By	Completed On		ited On	Done
No results.			10000		1533.753					1163175

### Shirley Hiew (LKK Auto)

From:

Shirley Hiew (LKK Auto) <ShirleyHiew@lkkauto.com>

Sent:

Monday, 12 November 2018 9:13 AM

To:

'Boo seng yak'

Cc:

'Adrian Ling'; 'cs-a@lkkauto.com'; 'admin-a@lkkauto.com'; 'Carrine Leong';

'jiayee.yap@premiumauto.com.sg'; 'Chang Chee Sing'

Subject:

RE: FINAL REVISION - SKM4315S - TP CHINA - SURVEYED 15 AUG 18

Dear Mr Boo,

Confirmed final fig of \$20,000.00 @ 13 days of repairs before GST.

Final invoice and all supporting documents sent over to China Taiping Insurance (Singapore) Pte. Ltd.

Thank you.

Best Regards,

Shirley Hiew | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: Sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Boo seng yak [mailto:boojohnny@gmail.com]

Sent: Thursday, 27 September 2018 6:17 PM

To: Adrian Ling <adrianling@lkkauto.com>; shirleyHiew@lkkauto.com; cs-a@lkkauto.com; admin-a@lkkauto.com;

Carrine Leong <carrine.leong@premiumauto.com.sg>; jiayee.yap@premiumauto.com.sg; Chang Chee Sing

<claims@premiumauto.com.sg>

Subject: FINAL REVISION - SKM4315S - TP CHINA - SURVEYED 15 AUG 18

Hi Adrian and all,

Revised estimate is attached.

Please confirm repair cost of \$20K @ 13 days exclude 1 PH and 2 Sundays.

Your early approval is appreciated.

Best regards - jb

### Shirley Hiew (LKK Auto)

From:

Shirley Hiew (LKK Auto) <ShirleyHiew@lkkauto.com>

Sent:

Thursday, 27 September 2018 3:39 PM

To:

'Claims Dept'

Cc:

'Nora Khai'; 'Boo seng yak'; 'SUR'

Subject:

SKM 4315S (TP) SJP 879D (OI)

Hi All,

As agreed by Jonny Boo, please repair the vehicle not exceeding the repair cost \$ 20,000.00 on part by part basis.

Thank you.

Best Regards,

Shirley Hiew | Case Handler

### LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: <u>Sur@lkkauto.com</u> | fax: 6256-4315 Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933) **New Cars** 

**Used Cars** 

Sell My Car

Directory

Products

Insurance

Articles

Forum

Resources





(2) Fancy Yellow hamonds 4.70ct.tw Diamonds 4,70ct.tw Diamond 3,08ct. V81-V82 (GIA Certificates) Internally Flawless - Color: F SEIZED ASSETS - OVER 900 ITEMS



ERY & WATCH Sunday, 19th August

Preview: 11am - Auction: 1pm - 5pm Sheraton Towers Hotel 39 Scotts Road - Singapore






Post an Advertisement Sell it yourself! Advertise it at just \$58 until it's SOLD!





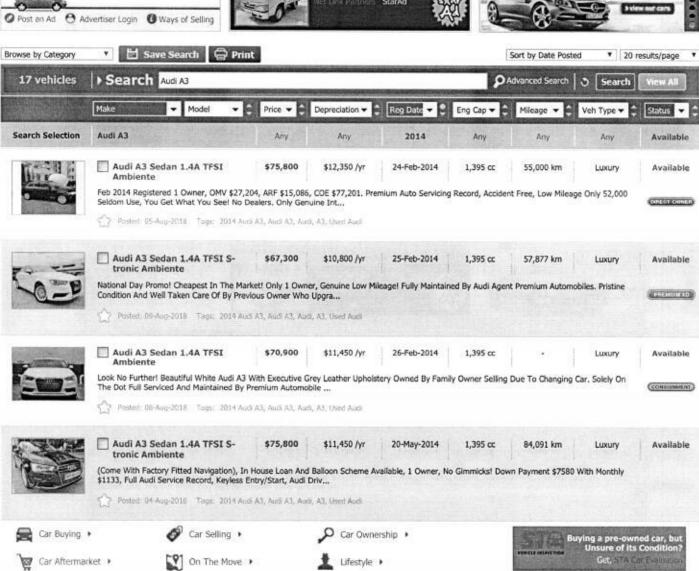

Audi A3 Sedan 1.4A TFSI Ambiente

\$73,800

\$11,350 /yr

29-May-2014

Well Maintained Interior And Exterior. Buy With An Added Peace Of Mind From Vantage Preowned, A Member Of The Sime Darby Group. Complete With A Comprehensive 72 Points Check. Trade Ins Are Welcome. Ca...

Posted: 07-Aug-2018 Tags: 2014 Audi A3, Audi A3, Audi, A3, Used Audi

Audi A3 Sedan 1.4A TFSI Stronic Ambiente

\$71,800

\$10,610 /yr

30-May-2014

1,395 cc

1,395 cc

82,854 km

79,800 km

Luxury

Available

PREMIUM AD

Available

Best Deal! Bidded Car Number. Very Low Mileage Done 82854km. Tip Top Condition, Test Drive/See To Justify. 1 Owner. New Paintwork. Road Tax Till Nov 18, 100% Accident Free, Price Negotiable, Call Now!

Lake View Credit Pte Ltd

Posted: 11-Aug-2016 Tags: 2014 Audi A3, Audi A3, Audi, A3, Used Audi



Audi A3 Sedan 1,4A TFSI Stronic Ambiente

\$74,800

\$11,560 /yr

09-Jun-2014

1,395 €

46,000 km

Luxury

Available

Posted: 13-Aug-2018 Tirgs: 2014 Audi A3, Audi A3, Audi A3, Osed Audi

### > Back to OneMotoring

### Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars		
Owner ID Type:	Singapore NRIC	
Owner ID:	9810D	
Vehicle Details	SKM4315S	S. Hills
Vehicle No.:	Yes	
Vehicle to be Exported:		
Intended De-registration Date:	15 Aug 2018	
Vehicle Make:	AUDI	
Vehicle Model:	A3 SEDAN 1.4 TFSI (AMBIENTE)	
Primary Colour:	Silver	
Manufacturing Year:	2014	
Engine No.:	CX5064621	
Chassis No.:	WAUZZZ8VXE1021633	
Maximum Power Output:	90.0 kW (120 bhp)	
Open Market Value:	\$27,215.00	
Original Registration Date:	27 Feb 2014	
First Registration Date:	27 Feb 2014	
Transfer Count:	1	
Actual ARF Paid:	\$15,101.00	
Intended PARF Rebate Details		18.5
PARF Eligibility:	Yes	
PARF Eligibility Expiry Date:	26 Feb 2024	
PARF Rebate Amount:	\$11,325.00	
Intended COE Reparte Details	(A) 100 多音 (1) 10 10 10 10 10 10 10 10 10 10 10 10 10	trit
COE Expiry Date:	26 Feb 2024	
COE Category:	E - Open Category	
COE Period(Years):	10	
QP Paid:	\$77,003.00	
COE Rebate Amount:	\$39,586.00	
Total Rebate Amount:	\$50,911.00	

The information contained herein is correct as at 15 Aug 2018

#### SINGAPORE ACCIDENT STATEMENT

#### IMPORTANT NOTICE

- Please report correctly the details of the accident to speed up the claims process.
- 2. This Form must be completed by the Policyholder and/or the Authorised Driver.
- 3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or witholding of material facts may allow insurance companies to repudiate policy ability.
- 4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.

5. Any false reporting may be referred to the Police for investigation.

- This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
- 7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCI	DEN	F CTA		EM
ALL	DEN	DIA	-17	

Date Of Report 13/08/2018 15:08

Date Of Accident 13/08/2018 08:00

Exact Location Of Accident KJE TOWARD CCK

Country/State of Loss SINGAPORE

#### DETAILS OF OWN VEHICLE

Vehicle Registration Number SKM4315S

Insured/Policyholder

Name Of Registered Owner SIEW HONG KAI

NRIC No S8239810D

Email Address ROY\_SIEW@YAHOO.COM.SG

Mobile Phone No (LOCAL) +65-91474229

Alternative Phone No OFFICE-91474229

Vehicle Particulars

Manufacturer AUDI

Model A3 SEDAN 1.4 TFSI (AMBIENTE)

Exact Purpose for which vehicle was being used at

time of accident

PRIVATE USE

Are you claiming under your own insurance policy

for repair to your vehicle?

NO

If No. Please state action to be taken

THIRD PARTY

Vehicle Category

PRIVATE CAR

Insurance Company

Name of Insurance Company

SOMPO INSURANCE SINGAPORE PTE. LTD.

Type Of Coverage COMPREHENSIVE

Fleet Policy NC

Policy Number D18MTPV01012677

Cover Note Number

Driver

Name of Driver SIEW HONG KAI

 NRIC No
 \$8239810D

 Date Of Birth
 22/11/1982

 Occupation
 INDOOR

Date Of Driving Pass 16/03/2007

Driving Experience 11 YEARS AND 4 MONTHS

Gender MALE

Mobile Number (LOCAL) +65-91474229

Fax Number

Contact Number OFFICE-91474229

EMail Address ROY\_SIEW@YAHOO.COM.SG

Address

ESPARINA RESIDENCES, 113 COMPASSVALE BOW. (S)544814 #16-06

Postcode

Was driver an employee of the Insured's Company NO

OWNER If No. Relationship of the Driver with the Insured

Vehicle Registration Number of Driver's Own

Vehicle

Insurance Company of Driver's Own Vehicle

General Information of the Accident

CHAIN COLLISION Type Of Accident

CLEAR Weather Conditions

DRY Road Surface

Other Information

Was any foreign vehicle involved in this accident? NO

Number of vehicles involved in the accident

NO Was any body injured in the Accident?

Was any injured conveyed to hospital by

ambulance?

NO

YES

Was any other material or property damaged?

I have been approached by unknown person(s)

soliciting/offering accident claims assistance.

NO

Number of Passengers (Including Driver)

**Details of Police Action** 

Was the accident reported to the police?

NO

If Yes, Please state which Police Station

Was notice of intended Prosecution given?

NO

If Yes, against whom?

#### Circumstances of Accident

My vehicle was stopped along the said location, on the second lane of four lane road. While waiting for traffic ahead to move, I felt an impact from my rear. Vehicle b had collided onto my vehicle, due to the impact my vehicle surged forward and came into contact onto vehicle c. Five vehicle was involved in total, there was no injuries.

Attachment(s)

Are accident photos available for attachment?

YES

Was there any video captured by Car Camera?

NO

Was there any audio recorded?

NO

#### DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number

SJP879D

Vehicle Make/Model/Colour

TOYOTA/ WISH 1.8 AUTO/SILVER

**Details Of Properties** 

Vehicle Category

PRIVATE CAR

Name of Driver

**BRYAN KIAN** 

NRIC/Passport Number

Contact Number

97226988

Address

Postcode

Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)

#### **DETAILS OF OTHER VEHICLE PROPERTY 2**

Vehicle Make/Model/Colour

HONDA/ FIT 1.3G A/BLK

Details Of Properties

Vehicle Category

PRIVATE CAR

Name of Driver

RACHAEL TAN

NRIC/Passport Number

Contact Number

94379028

Address

Postcode

Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)

#### **DETAILS OF OTHER VEHICLE PROPERTY 3**

Vehicle Registration Number

SJE7482B

Vehicle Make/Model/Colour

TOYOTA/ ESTIMA 2.4X A

**Details Of Properties** 

Vehicle Category Name of Driver PRIVATE CAR

COCO ZHANG

NRIC/Passport Number

Contact Number

83334555

Address

Postcode

Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)

### **DETAILS OF OTHER VEHICLE PROPERTY 4**

Vehicle Registration Number

SLM2408J

Vehicle Make/Model/Colour

HONDA/ HRV 1.5 DX CVT

Details Of Properties

Vehicle Category

PRIVATE CAR

Name of Driver

JERLYN LOW

NRIC/Passport Number

Contact Number

90628353

Address

Postcode

Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)

CONTRACTOR OF THE PARTY OF THE

#### SKETCH PLAN

#### IMPORTANT NOTICE

- Please report correctly the details of the accident to speed up the claims pro-
- 2. This Form must be completed by the Policyholder and/or the Authroised Driver.
- 3 information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
- The issue and acceptance of this form by insurance companies is not an admission of policy liability on the part of insurance companies.
- Any false reporting may be referred to the Police for Investigation.

  The report will be forwarded by the insurers of the GIA Records Management Centre established by the Geographic during. of Singapore (GIA) for archiving and that copies of this report will for a fee be made available application by interested parties.
- By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report. being made available aforesaid
- 8. Consent under the Personal Data Protection Act (PDPA)
- I understand, acknowledge, agree and consent that
- (a) My insurer, my workshop and the General Insurance Association of Singapore ("QRA") mayrare permitted to collect, use, disclose and/or process my personal data personal information set out in this (form) and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicles) involved in this accident (all insurers) who have insured vehicles) involved in this accident shall be collectively referred to as the "Insurers"), the insurers lawyers law firms, the Monetary Authority of Singapore and any helevant government agency/authority (such as the police), for the purpose(s) of
- (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims
- (ii) investigating the accident and/or my claims.
- (iii) Carrying out and/or dealing with my instructions or responding to any enquiries by me.
  (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail

- packages); and/or

  (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.

  (collect/selly the "Purposes")

  (b) all insurers) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use disclose and/or process my Personal Information for one or more of the above Purposes; and


  (d) my Personal Information may can be disclosed by any of the Insurers and/or GAA to their third party service providers or agents (including their lawyers/law firms), which may be alted outside of Singapore, for one or more of the above Purposes.

VERIFIED BY AJAX MARS REPORTING OFFICER MOHAMAD HELMY BIN ALEHAM

Policyholder's Signature / Date & Time Driver's Signature (if driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre


#### Sketch Plan

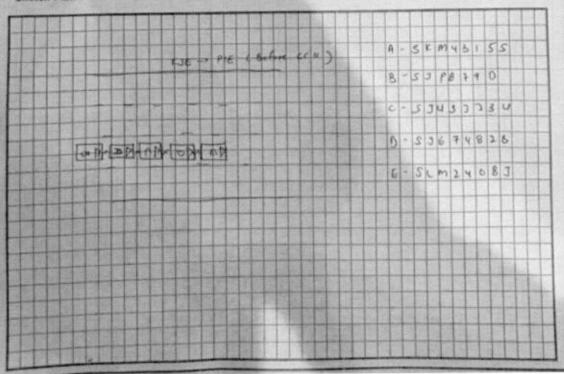


### Sketch Plan #2 Pg. 1

CCIDENT STATEMENT (2000 characters)		
While waiting for traffic ahead to move, I	felt an impact from my rear. Vehicle b had act my vehicle surged forward and came into involved in total, there was no injuries.	
Taxi Voucher No.:		
DECLARATION		
I/We declare that the above particulars & information provide	ded above are true in every aspect	
VERIFIED BY AJAX MARS REPORTING OFFICER - MOHAMAD HELMY BIN ALEHAM		
	X	
MARS Officer		
	Registered Owner or Driver's Signature	
Job Complete Date/Time	Date/Time:	7
		1

**Driving License** 

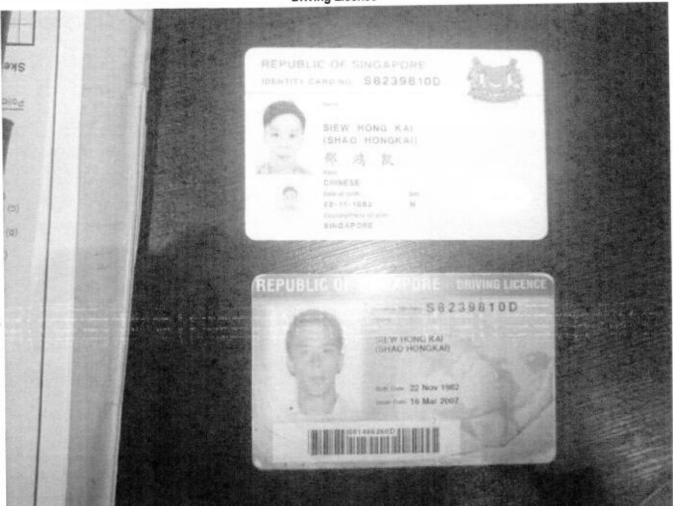

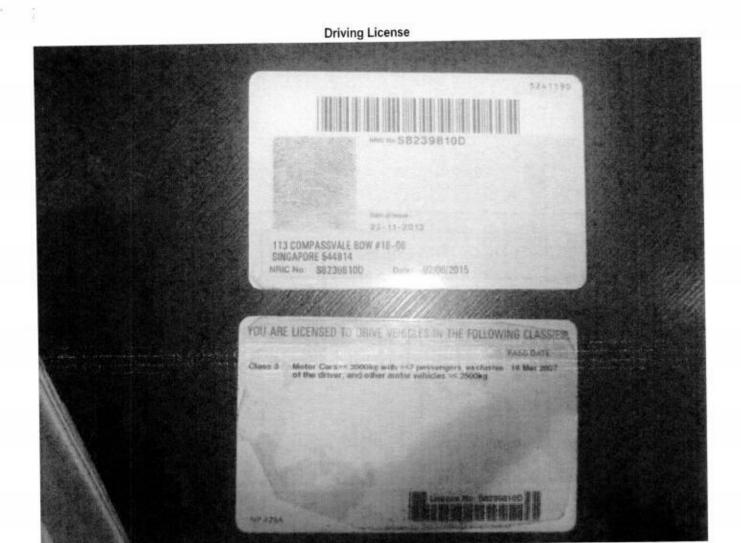

### REPUBLIC OF SINGAPORE IDENTITY CARD NO. \$8239810D



SIEW HONG KAI (SHAO HONGKAI)

鸿 凯

Roce

CHINESE

Date of birth 22-11-1982 Country/Place of birth

SINGAPORE

Sex M

S82398100





5241190



NRIC No. S8239810D

Date of issue 22-11-2013

113 COMPASSVALE BOW #16-08

SINGAPORE 544814

NRIC No: \$8239810D

Date: 02/06/2015

YOU ARE LICENSED TO DRIVE VEHICLES IN THE FOLLOWING CLASSIES

PASS DATE

Class 3 Motor Cars=< 3000kg with =<7 passengers, exclusive 16 Mar 2007 of the driver; and other motor vehicles =< 2500kg

Licence No: S8239810D

NP 428A

55 Ubi Road 1, Singapore 408699 Tel: 6366 2323 Fax: 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

#### Telefax

Estimate : Accident Repairs
Workshop : Ubi Road 1

Contact No : 6366 2323 Fax No : 6841 1183

Reference : PA/TP/0922/2018/PH

Date : 13-Aug-18

Vehicle not in workshop. Kindly arrange for survey.

Your insured vehicle no: SJP 879 D

China Taiping Insurance (SG) Pte Ltd

105 Cecil Street #19-00 The Octagon Singapore 069534

Attn: Ms Angie - Motor Claims Dept/Windscreen

Tel: 6389 6541 - Fax: 6224 7175

Owner's Name : Mr Siew Hong Khai

Address Esparina Residence, 113 Compassvalve Bow.

#16-06

Telephone : (HP) 91474229
Type of Claim : Third Party Claim

Policy No. : D18MTPV01012677

Vehicle No : SKM 4315 S

Model Code : Audi A3 Sedan 1.4 TFSI

Model / Year : Feb-14 Engine No : CXS 064621

Chassis No : WAUZZZ8VXE1021633

Mileage :

Date In : Liability :

Excess Cost : -

Estimated By : Johnny Boo / Allan Wu

Accident Date : 13-Jul-18

Place of Accident : KJE towards CCK

55 Ubi Road 1, Singapore 408699 Tel: 6366 2323 Fax: 6841 1183

Telefax

## Estimated Labour Charges for Accident Vehicle SKM 4315 S.

S/N	Nature of Jobs		Estimated Charges	Surveyor's lecommendation
1	To remove and transfer front wire harness for headlights, horns, outside temperature sensor and headlight washer assy.	S/N	\$ 360.00	/
2	To dismantle and renew front bumper, both side headlight. Re-organise front crash management components. Reinstall all parts removed.		\$ 1,800,06	600
3	To respray front bumper and bonnet		\$ 1,400.00	1200.
	SUB-TOTAL LABOUR CHARGES	:	\$ 3,560.00	

55 Ubi Road 1, Singapore 408699 Tel: 6366 2323 Fax: 6841 1183

Telefax

## Estimated Labour Charges for Accident Vehicle SKM 4315 S (Rear).

S/N	Nature of Jobs		Estimated Charges	Surveyor's Recommendation
1	To remove and transfer rear parking aid.Check function.	S/N	\$ 280.00	
2	To remove and transfer rear lid's convenience system lock system and wire harness for tail lights.	S/N	\$ 480.00 -	
3	To dislodge and reinstall rear wire harness for lights, battery manager, fuse and relay trays, electrical and audio equipment.	S/N	\$ 1,400.00	
4	To dismantle and renew rear bumper and lid.Cut out and reweld end panelling.Re-organise rear crash management components.Reinstall all parts removed.		\$ 3,600.00	3000
5	To respray rear bumper, rear lid and end panelling & rear lid hinges. To carry out stone chip treatment and joint sealant works.		\$ 2,600.00	1800.
6	To carry out diagnostic check	S/N	\$ 384.00	/
7	Towing vehicle from accident scene	S/N	\$ 280.00	ייִי (
	TOTAL LABOUR CHARGES	:	\$ 12,584.00	

55 Ubi Road 1, Singapore 408699 Tel: 6366 2323 Fax: 6841 1183

Telefax

## Material List for Accident Vehicle Regn No. SKM 4315 S (FRONT).

S/N	Parts Description		S	Damage Parts & Prices /NETT REMARKS
3/11	·			
1	BUMPER COVER Delad		\$	1,739.00
2	FIXING PARTS FOR BUMPER AT ~		\$	161.00⊀
3	COVER TRIM - LH/RH >50 1	2	\$	280.00 X
4	CLOSING ELEMENT - LOWER CENTRE		\$	140.00 ×
5	PULL STRAP Zute in Sample	4	\$	175.00+ 174.80
6	GUIDE SECTION - LH/RH	2	\$	66.00 ×
7	AIR GUIDE GRILLE - LH/RH MISSING	2	\$	190.00 - 189.60
8	RADIATOR GRILLE Couleed		\$	573.00 - 572.56
9	SIDE REINFORCEMENT HE NEW		\$	633.00 <sup>7</sup> X
10	FOAM FILLER PIECE		\$	117.00 <sup>?</sup> ×
11	COVER THE NEC		\$	48.00 ?X
12	CAUTION' STICKER 44-	,	\$	12.00 - 11.60
13	HEADLIGHT FOR GAS DISCHARGE LAMP - LH/RH	2	\$	3,528.00 🔏
14	LIFT CYLINDER FOR HEADLIGHT - LH/RH 3/4	2	\$	348.00 · X
	SUB-TOTAL SPARE PARTS	1	\$	8,010.00

All charges are not inclusive of GST.

Legend: Remarks (OK) = Approved, Remarks (X) = Not approved Spare parts are Special Nett.

55 Ubi Road 1, Singapore 408699 Tel: 6366 2323 Fax: 6841 1183

Telefax

## Material List for Accident Vehicle Regn No. SKM 4315 S (REAR).

			,	Damage Parts & Prices NETT REMARKS
S/N	Parts Description			S/NETT REMARKS
1	BUMPER COVER Distarted		\$	1,619.00
2	FIXING PARTS FOR BUMPER	200	\$	166.00
а 3	GUIDE SECTION - LH/RH	2	\$	28.00 7 / 13.40
4	LOCKING MECHANISM 3-0	2	\$	50.00 / 49.30
5	REAR LIGHT REFLECTOR - LH/RH /~~~	2	\$	52.00°
6	SPOILER &		\$	206.00 - 205-50
7	SIDE REINFORCEMENT Best		\$	501.00 -500.50
8	BRACKET - LH/RH	2	\$	22.00 - 21.00
9	GUIDE SECTION - LH/RH ~~~	2	\$	114.00
10	SENSOR PRIME - INNER/OUTER 7-d	2	\$	421.00
11	WIRING SET FOR BUMPER 7 Not New		\$	458.00 ? X
12	REAR LID Deuted		\$	2,310.00
13	ATTACHMENT PARTS FOR REAR LID		\$	253.00 - 273.00
٤ 14	LID HINGE - LH/RH Men Bert	2	\$	448.00 *
15	WEATHERSTRIP Let		\$	176.00 175-50
16	LOCK STRIKER Danged,		\$	44.00 4 43.20
17	LID LOCK 36l New		\$	170.00 7 X
18	PUSH BUTTON FOR LID LOCK ACTUATOR	n	\$	159.00 +
19	COVER MOTHER		\$	12.00 2 🗡
20	STOP BUFFER, ADJUSTABLE ~~~	2	\$	30.00 ₹.
1000000	SUB-TOTAL SPARE PARTS	•	\$	7,239.00

All charges are not inclusive of GST.

Legend: Remarks (OK) = Approved, Remarks (X) = Not approved Spare parts are Special Nett.

55 Ubi Road 1, Singapore 408699 Tel: 6366 2323 Fax: 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

#### Supplementary Estimate

GST Reg No. 19-9902271-W

China Taiping Insurance (SG) Pte Ltd

105 Cecil Street #19-00 The Octagon Singapore 069534 Attn: Motor Claims Dept

Tel: 6389 6541 - Fax: 6224 7175

Estimate No.

Date

Service Advisor

Pages Regn No Model No PA/TP/0922/2018/PH

20-Aug-18 CHANG

1 of 1 SKM 4315 S

Audi A3 SEDAN 1.4 TFSI

						S. D. W.
Quantity	Description		U	nit Price	Amo	unt
Labours						
1	To repair rear spare wheel housing.		\$	600.00	\$	300.00
2	To respray spare wheel housing.		\$	800.00	\$	600.00
Parts			S	1,400.00	\$	900.00
1 2	BONNET CATCH HOOK - LOWER PARENTE STATES	2	\$	55.00 14.00	sundries sundries	7
	GRAND TOTAL	:	\$	1,469.00	\$	900.00

For Premium Automobiles Pte Ltd

Authorised Signature

55 Ubi Road 1, Singapore 408699 Tel: 6366 2323 Fax: 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

#### Telefax

Estimate

Accident Repairs

Workshop Contact No : Ubi Road 1 : 6366 2323

Fax No

6841 1183

Reference

PA/TP/0922/2018/PH

Date

13-Aug-18

Vehicle not in workshop. Kindly arrange for survey.

Your insured vehicle no:

SJP 879 D

China Taiping Insurance (SG) Pte Ltd

105 Cecil Street #19-00 The Octagon Singapore 069534 Hi Adrian
We took 13 working days
exclude 2 Sundays and 1 PH
with checked items replaced.
ib 27 Sep 18

Attn: Ms Angie - Motor Claims Dept/Windscreen

Tel: 6389 6541 - Fax: 6224 7175

Owner's Name

Mr Siew Hong Khai

Address

Esparina Residence, 113 Compassvalve Bow.

#16-06

Singapore 544814 (HP) 91474229

Telephone Type of Claim

Third Party Claim D18MTPV01012677

Policy No. Vehicle No

SKM 4315 S

Model Code

Audi A3 Sedan 1.4 TFSI

Model / Year

: Feb-14

Engine No

CXS 064621

Chassis No

WAUZZZ8VXE1021633

Chassis No Mileage

3

Date In

\*\*\* ==

Liability

. .

**Excess Cost** 

.

Estimated By

Johnny Boo / Allan Wu

**Accident Date** 

13-Jul-18

Place of Accident

KJE towards CCK

55 Ubi Road 1, Singapore 408699 Tel: 6366 2323 Fax: 6841 1183

Telefax

## Estimated Labour Charges for Accident Vehicle SKM 4315 S.

S/N	Nature of Jobs	Estimated Charges	Surveyor's Recommendation		
1	To remove and transfer front wire harness for headlights, horns, outside temperature sensor and headlight washer assy.	S/N	\$ 360.00	\$	360.00
2	To dismantle and renew front bumper, both side headlight. Re-organise front crash management components. Reinstall all parts removed.		\$ 1,800.00	\$	600.00
3	To respray front bumper and bonnet		\$ 1,400.00	\$	1,200.00
	SUB-TOTAL LABOUR CHARGES	:	\$ 3,560.00	\$	2,160.00

55 Ubi Road 1, Singapore 408699 Tel: 6366 2323 Fax: 6841 1183

Telefax

## Estimated Labour Charges for Accident Vehicle SKM 4315 S (Rear).

S/N	Nature of Jobs		Estimated Charges	urveyor's mmendation
Ont	Labour front c/f			\$ 2,160.00
1	To remove and transfer rear parking aid.Check function.	S/N	\$ 280.00	\$ 280.00
2	To remove and transfer rear lid's convenience system lock system and wire harness for tail lights.	S/N	\$ 480.00	\$ 480.00
3	To dislodge and reinstall rear wire harness for lights, battery manager, fuse and relay trays, electrical and audio equipment.	S/N	\$ 1,400.00	\$ 1,400.00
4	To dismantle and renew rear bumper and lid.Cut out and reweld end panelling.Re-organise rear crash management components.Reinstall all parts removed.		\$ 3,600.00	\$ 3,000.00
5	To respray rear bumper, rear lid and end panelling & rear lid hinges. To carry out stone chip treatment and joint sealant works.		\$ 2,600.00	\$ 1,800.00
6	To carry out diagnostic check	S/N	\$ 384.00	\$ 384.00
6a	Added labour charges - see atatched		\$ 1,400.00	\$ 900.00
7	Towing vehicle from accident scene	S/N	\$ 280.00	\$ 280.00
	TOTAL LABOUR CHARGES		\$ 13,984.00	\$ 10,684.00

55 Ubi Road 1, Singapore 408699 Tel: 6366 2323 Fax: 6841 1183

Telefax

## Material List for Accident Vehicle Regn No. SKM 4315 S (FRONT).

				Damage Parts & Prices			
S/N	Parts Description		S	NETT R	EMAF	RKS	
			-21		(I) AC		
1	BUMPER COVER		\$	1,739.00		1,739.00	
2	FIXING PARTS FOR BUMPER		\$	161.00			
3	COVER TRIM - LH/RH	2	\$	280.00			
4	CLOSING ELEMENT - LOWER CENTRE		\$	140.00			
5	PULL STRAP	4	\$	175.00	\$	174.80	
6	GUIDE SECTION - LH/RH	2	\$	66.00			
7	AIR GUIDE GRILLE - LH/RH	2	\$	190.00	\$	189.60	
8	RADIATOR GRILLE		\$	573.00	\$	572.50	
9	SIDE REINFORCEMENT		\$	633.00			
10	FOAM FILLER PIECE		\$	117.00	ř.		
11	COVER		\$	48.00	1		
12	CAUTION' STICKER		\$	12.00	\$	11.60	
13	HEADLIGHT FOR GAS DISCHARGE LAMP - LH/RH	2	\$	3,528.00	)		
14	LIFT CYLINDER FOR HEADLIGHT - LH/RH	2	\$	348.00	)		
	SUB-TOTAL SPARE PARTS	:	\$	8,010.00	\$	2,687.50	

All charges are not inclusive of GST.

Legend: Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

55 Ubi Road 1, Singapore 408699 Tel: 6366 2323 Fax: 6841 1183

Telefax

## Material List for Accident Vehicle Regn No. SKM 4315 S (REAR).

			Damage Parts & Prices S/NETT REMARKS			
S/N	Parts Description		_ 5	MEII	\$	2,687.50
	materials frt c/f		2	4 040 00		now no on the notice of
1	BUMPER COVER		\$	1,619.00	\$	1,619.00
2	FIXING PARTS FOR BUMPER		\$	166.00		2012/02/20
3	GUIDE SECTION - LH/RH	2	\$	28.00	\$	13.40
4	LOCKING MECHANISM	2	\$	50.00	\$	49.80
5	REAR LIGHT REFLECTOR - LH/RH	2	\$	52.00		
6	SPOILER		\$	206.00	\$	205.50
7	SIDE REINFORCEMENT		\$	501.00	\$	500.50
8	BRACKET - LH/RH	2	\$	22.00	\$	21.00
9	GUIDE SECTION - LH/RH	2	\$	114.00		
10	SENSOR PRIME - INNER/OUTER	2	\$	421.00	\$	421.00
11	WIRING SET FOR BUMPER		\$	458.00		
12	REAR LID		\$	2,310.00	\$	2,310.00
13	ATTACHMENT PARTS FOR REAR LID		\$	253.00	\$	273.00
14	LID HINGE - LH/RH	2	\$	448.00	\$	448.00
15	WEATHERSTRIP		\$	176.00	\$	175.50
16	LOCK STRIKER		\$	44.00	\$	43.20
17	LID LOCK		\$	170.00		
18	PUSH BUTTON FOR LID LOCK ACTUATOR		\$	159.00		
19	COVER		\$	12.00		
20	STOP BUFFER, ADJUSTABLE	2	\$	30.00		
20	SUB-TOTAL SPARE PARTS	1	\$	7,239.00	\$	8,767.40

All charges are not inclusive of GST.

Legend: Remarks (OK) = Approved, Remarks (X) = Not approved Spare parts are Special Nett.

55 Ubi Road 1, Singapore 408699 Tel: 6366 2323 Fax: 6841 1183

#### Telefax

## Material List for Accident Vehicle Regn No. SKM 4315 S (REAR).

			Dam	age Pa	arts & P	rices
S/N	Parts Description		S/NETT	R	EMARK	S
Ont		c/f			\$	8,767.40
21	PACKING ADHESIVE		\$	15.00	\$	14.50
22	AUDI CHROME EMBLEM		\$	108.00	\$	107.50
23	A3' EMBLEM		\$	83.00	\$	82.70
24	1.4T' EMBLEM		\$	83.00	\$	82.70
25	TRIM FOR REAR CROSS PANEL SOUL(BLACK)		\$	135.00	\$	134.50
26	REAR CROSS PANEL		\$	317.00	\$	317.00
27	REINFORCEMENT FOR REAR CROSS PANEL		\$	645.00	\$	644.50
28	TIRE COMPARTMENT TRIM		\$	476.00	\$	475.50
29	ARCYLIC SEALANT	S/N	\$	180.00	\$	180.00
30	CAVITY WAX	S/N	\$	140.00	\$	140.00
31	STONE CHIP	S/N	\$	180.00	\$	180.00
32	CAR PLATE - FRONT	S/N	\$	25.00	\$	25.00
33	CAR PLATE- REAR	S/N	\$	25.00		
35	SUNDRIES		\$	300.00	\$	127.60
	Materials frt/rr		\$ 17,	961.00	\$	11,278.90
	Labour charges frt/rr		\$ 13,	984.00	\$	10,684.00
	GRAND TOTAL	1	\$ 31,	945.00	\$	21,962.90
	GIAND TOTAL					

All charges are not inclusive of GST.

Legend :

Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

55 Ubi Road 1, Singapore 408699 Tel: 6366 2323 Fax: 6841 1183

#### Telefax

Name

Surveyed Date

**Authorised Date** 

**Excess Cost** Liability

Remarks

Please Note

: This estimate is based on visual inspection of the affected vehicle.

Should we require further labour charges and spare parts in the

progress of repair, we shall inform you accordingly.

For inspection of vehicle, please refer to Ms Norah Khai at

Tel:6768 9828 for appointment.

Yours faithfully,

Premium Automobiles Pte Ltd

Johnny Boo

Body Repair Manager

Allan Wu

Claims Consultant

#### LKK Auto Consultants Pte Ltd (Co.Reg. No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

### VEHICLE DAMAGE INSPECTION REPORT

CS/CTI18014821/ASBN2 Our File No:

16/11/2018 Date:

REFERENCE

Handling Insurer:

China Taiping Insurance (Singapore) Pte. Ltd.

Policy No:

DMHCSN1733351700

Claimant

SKM4315S

No:

Steering (Serviceable):

Yes Engine Modification:

Insured Vehicle SJP879D

Vehicle No: Date of Loss:

13/08/2018

Nature of Claim:

TP

Claim No:

SNM18D03907C02

**DESCRIPTION & IDENTIFICATION OF VEHICLE** 

Reg No:

SKM4315S

Make & Model:

AUDI A3, 1.4 SEDAN TFSI (AMBIENTE) (A)

Engine No: Chassis No: CXS064621

Reg. Date: Colour:

27/02/2014 (Man. Year: 2014) Silver

Odometer:

WAUZZZ8VXE1021633 82966 km

**Engine Capacity:** 

Market Value/New Car N/A

1395 cc

Price:

Sum Insured (S\$):

General Condition:

Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

Yes Footbrake (Serviceable):

No Pre-accident Condition:

Yes

Handbrake (Serviceable):

CONDITION OF TYRES

205/55R16 Pirelli 6 mm Rear Tyre Size: Rear Left Side:

205/55R16 Pirelli 6 mm

Front Left Side: Front Right Side:

Front Tyre Size:

Pirelli 6 mm

Rear Right Side:

Pirelli 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	17,981.00	11,278.90	6,702.10	37.27
Miscellaneous Items	0.00	0.00	0.00	
Labour	13,984.00	10,684.00	3,300.00	23.60
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00 0.00 0.00			
Calculated Gross Total (S\$)	31,965.00	21,962.90	10,002.10	31.29
Approved Total (Overridden) (S\$)		20,000.00		
(\$\$)	31,965.00	20,000.00	11,965.00	37.43
+ GST 7.00/7.00% (S\$)	2,237.55	1,400.00	837.55	37.43
Nett Amount (S\$)	34,202.55	21,400.00	12,802.55	37.43

INSPECTION

Date of Assignment:

14/08/2018

Date Inspected:

15/08/2018 Inspected At:

Premium Automobiles Pte Ltd (UBI)

55 Ubi Road 1 Singapore 408699

Estimated Period of Repair:

13.0 days

Adjuster: ADRIAN LING

Manager: Hiew May Fung

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our

knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

### REPAIR DETAILS

Reference

Part Source: MRM-SG

Version: 1.0 (Last Synchronised: 16 Nov 2018)

Parts:

144

AUDI A3 1.4 SEDAN TFSI (AMBIENTE) (A) (Catalogue:Merimen Singapore 1.0)

Labour:

Repairer's

(Price-denominated Standard List)

Validity:

Print Code: (Unsubmitted, no print-code for SKM4315S) These estimates are valid only if they contain the print code (above) on all estimate pages, running page

numbers with the END OF ESTIMATES marker on the last estimate page

Further Info: Items/values not in reference catalogue are prefixed with an asterisk \*.

	1 1 2	*BUMPER COVER	Deformed		
2 3 4 5	1 2		Dolollilou	1,739.00 FS	*1,739.00 FS
4 5	2	*FIXING PARTS FOR BUMPER	Not Necessary	161.00 FS	*-FS
4 5		*COVER TRIM-LH/RH	Not Necessary	280.00 FS	*- FS
5	7	*CLOSING ELEMENT-LOWER CENTRE	Not Necessary	140.00 FS	*-FS
	4	*PULL STRAP	Damaged	175.00 FS	*174.80 FS
0	2	*GUIDE SECTION-LH/RH	Not Necessary	66.00 FS	*-FS
7	2	*AIR GUIDE GRILLE-LH/RH	Missing	190.00 FS	*189.60 FS
8	1	*RADIATOR GRILLE	Cracked	573.00 FS	*572.50 FS *- FS
9	1	*SIDE REINFORCEMENT	Not Necessary	633.00 FS	Distrik
10	1	*FOAM FILLER PIECE	Not Necessary	117.00 FS	*-FS *-FS
11	1	*COVER	Not Necessary		
12	1	*CAUTION STICKER	Necessary	12.00 FS	*11.60 FS *- FS
13	2	*HEADLIGHT FOR GAS DISCHARGE LAMP-LH/RH	Not Necessary		*-FS
14	2	*LIFT CYLINDER FOR HEADLIGHT-LH/RH	Not Necessary		
15	1	*BUMPER COVER	Distorted		*1,619.00 FS *- FS
16	1	*FIXING PARTS FOR BUMPER	Not Necessary	28.00 FS	
17	1	*GUIDE SECTION-LH/RH	N/s Damaged	50.00 FS	
18	2	*LOCKING MECHANISM	Damaged		
19	2	*REAR LIGHT REFLECTOR-LH/RH	Not Necessary	206.00 FS	V. Brownian English III
20	1	*SPOILER	Cut		
21	1	*SIDE REINFORCEMENT	Bent	501.00 FS 22.00 FS	
22	2	*BRACKET-LH/RH	Necessary		
23	2	*GUIDE SECTION-LH/RH	Not Necessary	421.00 FS	
24	2	*SENSOR PRIME-INNER/OUTER	Damaged		
25	1	*WIRING SET FOR BUMPER	Not Necessary Dented		*2,310.00 FS
26	1	*REAR LID	Necessary	273.00 FS	
27	1	*ATTACHMENT PARTS FOR REAR LID	Bent	448.00 FS	\$ 17.4000 DESIGNATION
28	2	*LID HINGE-LH/RH	Cut	176.00 FS	
29	1	*WEATHERSTRIP	Damaged	44.00 FS	
30	1	*LOCK STRIKER	Not Necessary		
31	1	*LID LOCK	Not Necessary		
32	1	*PUSH BUTTON FOR LID LOCK ACTUATOR	Not Necessary		
33	1	*COVER	Not Necessary		
34	2	*STOP BUFFER,ADJUSTABLE	Necessary	15.00 FS	
35	1	*PACKING ADHESIVE *AUDI CHROME EMBLEM	Necessary	108.00 FS	
36	1		Necessary	83.00 FS	
37	1	*A3 EMBLEM	Necessary	83.00 FS	3)
38	1	*1.4T EMBLEM  *TRIM FOR REAR CROSS PANEL SOUL (BLACK)	Cracked	135.00 FS	
39	1	*REAR CROSS PANEL	Dented	317.00 FS	항 - [60] 영화 [1] 현황 [1] [1] [1]
40	1	*REINFORCEMENT FOR REAR CROSS PANEL	Dented	645.00 FS	
41	1	*TRIM COMPARTMENT TRIM	Deformed	476.00 FS	집
42	1		Necessary	180.00 FS	
43	1	*ARCYLIC SEALANT *CAVITY WAX	Necessary	140.00 FS	

No.	Qty	Part No. Particulars	Condition	Repairer's	Amount
45	4	*STONE CHIP	Necessary	180.00 FS	*180.00FS
45	1	*CAR PLATE-FRONT	Bent	25.00 FS	*25.00 FS
46	1	*CAR PLATE-PRONT	Not Necessary	25.00 FS	
47 48	1	*SUNDRIES	Necessary	300.00 FS	*127.60 FS
10000	anchise	part, S=SpcNett.			SWarranez S
			Total Parts (S\$)	17,981.00	11,278.90

Report was unsubmitted during this print-out.

# Recommended Miscellaneous Items There are no new miscellaneous items selected.

	a recommendation and the second
Recommended	ahour
RECOMMENDED	Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labo	our Items			020-00
1	TO REPAIR REAR SPARE WHEEL HOUSING	New	600.00	300.00
2	TO RESPRAY SPARE WHEEL HOUSING	New	800.00	600.00
3	TO REMOVE AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS, OUTSIDE TEMPERATURE SENSOR AND HEADLIGHT WASHER ASSY	New	360.00	360.00
4	TO DISMANTLE AND RENEW FRONT BUMPER,BOTH SIDE HEADLIGHT.RE-ORGANISE FRONT CRASH MANAGEMENT COMPONENTS.REINSTALL ALL PARTS REMOVED	New	1,800.00	600.00
5	TO RESPRAY FRONT BUMPER AND BONNET	New	1,400.00	1,200.00
6	TO REMOVE AND TRANSFER REAR PARKING AID.CHECK FUNCTION	New	280.00	280.00
7	TO REMOVE AND TRANSFER REAR LIDS CONVENIENCE SYSTEM LOCK SYSTEM AND WIRE HARNESS FOR TAIL LIGHTS	New	480.00	480.00
8	TO DISLODGE AND REINSTALL REAR WIRE HARNESS FOR LIGHTS, BATTERY MANAGER, FUSE AND RELAY TRAYS, ELECTRICAL AND AUDIO EQUIPMENT	New	1,400.00	1,400.00
9	TO DISMANTLE AND RENEW REAR BUMPER AND LID.CUT OUT AND REWELD END PANELLING.RE-ORGANISE REAR CRASH MANAGEMENT COMPONENTS.REINSTALL ALL PARTS REMOVED	New	3,600.00	3,000.00
10	TO RESPRAY REAR BUMPER, REAR LID AND END PANELLING & REAR LID HINGES. TO CARRY OUT STONE CHIP TREATMENT AND JOINT SEALANT WORKS	New	2,600.00	1,800.00
11	TO CARRY OUT DIAGNOSTIC CHECK	New	384.00	384.00
12	TOWING VEHICLE FROM ACCIDENT SCENE	New	280.00	280.00
	Gross Labou	r Cost (S\$)	13,984.00	10,684.00
	Report was unsubmitted during	ng this print-out.		

< END OF ESTIMATES >