

ASS. REC. BY:

REF:

TP / CS/TP18015070/Kvbn2

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MY

To inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

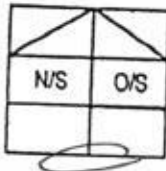

Bal. or Market Value:

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

02 days

Res.: Yes or No

Lum Sum:

1-B1%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SHD 3982

Yr Regn:

09, 18

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Renault Cantele c.c.

1.9.95

Colour:

m. white / Red

A/C:

Insured / Std / NI / NA

Sp. Reading

334046

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

VF1ABL15AUC 283415

Gen. Cond:

Good / Fair / Poor / Burnt

Steering:

In order / Jammed / Leaked / Burnt or

Brake:

In order / Jammed / Leaked / Burnt or

Mod:

Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

215/60R16

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or

Giti

Front

Rear

R/Bal.

9

mm

R/Bal.

9

mm

L/Bal.

9

mm

L/Bal.

9

mm

D.O.A.

9/8/18

D.O.I.

17/8/18

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

20/8

File pass to Catherine

2334.57

(Red 21,709.98, 90%)

(No Res)

SHD 3982 - CS/TP17018718/Kvbn2

Date: 28/9/2018

20/8/2018

RECEIVED 1 AUG 2018

Date/Time, File Pass to?

☐

: Prel. Report

1)

☐

: Final Report

Date/Time, File Return to?

2) 20/8 - typist

Days Of Repair:

2

Resurvey No. of Trip:

-

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

Tech Invs (\$

☐

Weekend (\$

Survey Fee:

Transportation:

S + RS. SI

Fees

Others

TOTAL

12x15=180

170+180

50

12

80

492

Report Format:

TP

Lump Sum / I.B.I. (\$

2334.57

8/10/2018

PARF/COE Rebate Enquiry

[> Back to OneMotoring](#)**Enquire PARF/COE Rebate for Registered Vehicle****Vehicle Owner Particulars**

Owner ID Type:	Company
Owner ID:	3878K

Vehicle Details

Vehicle No.:	SHD398L
Vehicle to be Exported:	Yes
Intended De-registration Date:	10 Aug 2018
Vehicle Make:	RENAULT
Vehicle Model:	LATITUDE 2.0L DCI AUTO D/AB 4DR
Primary Colour:	Red
Manufacturing Year:	2016
Engine No.:	M9R8839C003380
Chassis No.:	VF1ABL15AUC283415
Maximum Power Output:	127.0 kW (170 bhp)
Open Market Value:	\$19,998.00
Original Registration Date:	30 Sep 2016
First Registration Date:	30 Sep 2016
Transfer Count:	0
Actual ARF Paid:	\$19,998.00

Intended PARF Rebate Details

PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	29 Sep 2024
PARF Rebate Amount:	\$14,998.00

Intended COE Rebate Details

COE Expiry Date:	29 Sep 2024
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	8
PQP Paid:	\$42,672.00
COE Rebate Amount:	\$32,730.00
Total Rebate Amount:	\$47,728.00

Message

Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.

The information contained herein is correct as at 10 Aug 2018

OK

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	10/08/2018 11:00
Date Of Accident	09/08/2018 17:50
Exact Location Of Accident	CHANGI AIRPORT TERMINAL 2 TAXI STAND
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SHD398L
Insured/Policyholder	
Name Of Registered Owner	TRANS-CAB SERVICES PTE LTD
Co Reg No	200303878K
Email Address	CLAIMS@TRANSCAB.COM.SG
Mobile Phone No	
Alternative Phone No	OFFICE-62876666

Vehicle Particulars

Manufacturer	RENAULT
Model	LATITUDE-2.0 L (A)
Exact Purpose for which vehicle was being used at time of accident	HIRE AND REWARD
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	TAXI

Insurance Company

Name of Insurance Company	AXA INSURANCE PTE LTD
Type Of Coverage	THIRD PARTY
Fleet Policy	YES
Policy Number	VPX/P1680520
Cover Note Number	

Driver

Name of Driver	SOH TEOW CHUAN
NRIC No	S1662233H
Date Of Birth	21/03/1964
Occupation	OUTDOOR
Date Of Driving Pass	26/03/1984
Driving Experience	34 YEARS AND 4 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-90155551
Fax Number	
Contact Number	
Email Address	NOEMAIL

Address	BLK 427 SERANGOON CENTRAL #03-312
Postcode	550427
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OTHER - RELIEF
Vehicle Registration Number of Driver's Own Vehicle	-
	-
Insurance Company of Driver's Own Vehicle	-
	-

General Information of the Accident

Type Of Accident	COLLISION - HEAD TO REAR
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles involved in the accident	
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

On 9.8.2018 at about 1750 hours, I was stationary straight along Changi Airport Terminal 2 Taxi Stand to queue up for passenger. Suddenly, I felt an impact. Vehicle B (SHB1082B) had hit onto my taxi rear portion.

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SHB1082B
Vehicle Make/Model/Colour	
Details Of Properties	SMRT TAXI
Vehicle Category	TAXI
Name of Driver	CHOO BOON HOE
NRIC/Passport Number	S0076581C
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

Sketch Plan Pg. 1

SKETCH PLAN


IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.

Policyholder's Signature
Date & Time:


Driver's Signature
(if driver is not the policyholder)
Date & Time:


Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

Sketch Plan #2 Pg. 1

SKETCH PLAN

A	
B	
1	

A= SH10398L
B= SHB1082B

Changi Airport Terminal
2 Taxi Stand

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

please refer to GIA Report

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

Trans-cab Auto Services Pte Ltd

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHD 398L

Vehicle No.:

Chassis No.:

Vehicle Make:

Vehicle Model:

Date of Accident :

Third Party Insurer :

AAD1808-063*Ng Nithan**Runway 84 p.m*
*8 2334.57***SHD 398L**

VF1ABL15AUC283415

RENAULT

LATITUDE

9.8.2018

FCIL / *SMRT***PART****LIST**

1	1 BUMPER COVER REAR	\$	<i>Bul</i> <i>1100</i>	1,108.46	✓
2	1 BUMPER LOWER REAR	\$	<i>nd/h</i>	768.84	✓
3	1 BUMPER BRACKET CTR REAR	\$	<i>Sh</i>	113.47	}
4	1 BUMEP R BRACKET SIDE RH REAR	\$	<i>Sh</i>	135.97	
5	1 BUMEP R RETAINER RH REAR	\$	<i>Sh</i>	44.99	
6	1 BUMPER REFLECTOR RH	\$	<i>Sh</i>	43.61	
7	1 BUMEP R BRACKET SIDE LH REAR	\$	<i>Sh</i>	135.97	
8	1 BUMEP R RETAINER LH REAR	\$	<i>Sh</i>	44.99	
9	1 BUMPER REFLECTOR LH	\$	<i>Sh</i>	43.61	
10	1 BUMPER BEAM REAR	\$	<i>R</i>	777.52	
11	1 BUMPER BEAM BRACKET LH REAR	\$	<i>R</i>	225.95	
12	1 BUMPER BEAM BRACKET RH REAR	\$	<i>R</i>	225.95	
13	1 OUTER PANEL REAR (End Panel)	\$	<i>R</i>	1,471.77	} X
14	1 OUTER PANEL REAR (End Panel)TRIM	\$	<i>Sh</i>	404.56	
15	1 TAILLAMP RH	\$	<i>Sh</i>	552.55	
16	1 TAILLAMP PANEL RH	\$	<i>R</i>	986.70	
17	1 TAILLAMP LH	\$	<i>Sh</i>	552.55	
18	1 TAILLAMP PANEL LH	\$	<i>R</i>	986.70	
19	1 BOOT REAR	\$	<i>R</i>	2,872.68	
20	1 BOOT FINISHER	\$	<i>Sh</i>	470.06	
21	1 BOOT WHEATERSTRIP	\$	<i>Sh</i>	323.05	
22	1 BOOT REFLECTOR LAMP LH	\$	<i>Sh</i>	493.35	
23	1 BOOT REFLECTOR LAMP RH	\$	<i>Sh</i>	493.35	
24	1 BOOT BADGE 'RENAULT'	\$	<i>na</i>	225.36	
25	1 BOOT BADGE	\$	<i>na</i>	225.36	
26	1 BOOT STRUT LH	\$	<i>Sh</i>	276.08	
27	1 BOOT STRUT RH	\$	<i>Sh</i>	276.08	
28	1 BOOT HINGE LH	\$	<i>R</i>	367.84	
29	1 BOOT HINGE RH	\$	<i>R</i>	367.84	

Trans-cab Auto Services Pte Ltd

AAD1808-063

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHD 398L

30	1 BOOT INNER TRIM	\$	586.45	X
31	1 BOOT SWITCH	\$	168.13	X
32	1 BOOT LOCK	\$	202.67	X
33	1 BOOT LOCK CATCH	\$	74.40	X

	\$	16,046.87
10%	\$	7.44
	\$	<u>16,039.43</u>

14442.18

Special Nett

1	1SET PARKING AID	\$	700.00	X
2	1SET REAR BUMPER CLIP	\$	66.00	—
3	1SET BUMPER BRACKET CTR CLIP	\$	33.00	—
4	1SET BUMPER BRACKET SIDE CLIP RH RR	\$	10.00	X
5	1SET BUMPER RETAINER RH CLIP RR	\$	20.00	X
6	1SET BUMPER BRACKET SIDE CLIP LH RR	\$	10.00	X
7	1SET BUMPER RETAINER CLIP LH RR	\$	20.00	X
8	1SET BUMPER LOWER REAR RIVET	\$	22.00	X
9	1SET BUMPER LOWER REAR CLIP	\$	66.00	✓
10	1 EXHAUST MOUNTING REAR	\$	17.82	X
11	2 REAR WINDSCREEN SELANT	\$	80.00	X
12	1 WINDSCREEN MOULDING	\$	100.00	X
13	1 REAR WINDSCREEN INNER SPONGE SEAL	\$	100.00	X

TOTAL \$ 1,244.82**TOTAL PARTS \$ 17,284.25****LABOUR**

Putty And Spray Painting Of The Affected Portion.	\$	3,000.00	2200
Panel Beating, Knocking And Straightening The Necessary Portion, Remove And Renewal Of Parts, Adjust And Realign The Same	\$	2,200.00	2000
To Rust-Proofing Of The Affected Areas.	\$	170.00	X

Trans-cab Auto Services Pte Ltd

AAD1808-063

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHD 398L

To reinstall rear bumper parking sensor.	\$	170.00	601
To transfer of bootlid fittings, attachments and perform water seepage test.	\$	na 170.00	X
To repair and realign rear exhaust pipe.	\$	na 170.00	X
To drop rear exhaust box, renew the same, to repair and realign centre exhaust pipe.	\$	na 170.00	X
To transfer of rear end panel fittings, attachment and perform water seepage test.	\$	na 170.00	X
To transfer of rear end panel fittings, attachment and perform water seepage test.	\$	na 170.00	X
To transfer of rear windscreen fittings and conduct water seepage test.	\$	na 170.00	X
To check steering geometry and computer wheel alignment	\$	na 220.00	X

TOTAL \$ 6,780.00**Over All Total \$ 24,064.25****(PART-BY-PART)****Repair Days****10 DAYS***2 days*

22467



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

TRANS-CAB AUTO SERVICES PTE LTD	Ref : CS/TP18015070/Kvbn2
NO.2 ANG MO KIO STREET 63 SINGAPORE 569111	Date : 28-08-2018
	Code : TP378



1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	Veh. Inspected	SHD 398L
Policy No.	Coverage (\$)	0.00
Claim No.	Excess (\$)	0.00
Assign From	Assign Date	17/08/2018

2. Vehicle Particulars & Condition

Make & Model	RENAULT LATITUDE (A)	c.c	1995
Engine No.	HIDDEN	Year of Reg.	2016
Chassis No.	VF1ABL15AUC283415	Colour	METALLIC WHITE / RED
Odometer	334046	Steering	IN ORDER
Brakes	IN ORDER	Modification	NIL
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	215/60 R16	GITI	9 mm
L/H Front Tyre	215/60 R16	GITI	9 mm
R/H Rear Tyre	215/60 R16	GITI	9 mm
L/H Rear Tyre	215/60 R16	GITI	9 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION.
DAMAGES SEE DETAILS.

5. General Information

Accident Date	09/08/2018	Inspection Date	17/08/2018
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111		

5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	2 Working Days
-------------------------------------	----------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHD 398L

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BUMPER COVER REAR	BUCKLED / DENTED	1,108.46	1,108.46
1	BUMPER LOWER REAR	DENTED / CUT	768.84	768.84
1	BUMPER BRACKET CTR REAR	SERVICEABLE	113.47	-
1	BUMPER BRACKET SIDE RH REAR	SERVICEABLE	135.97	-
1	BUMPER RETAINER RH REAR	SERVICEABLE	44.99	-
1	BUMPER REFLECTOR RH	SERVICEABLE	43.61	-
1	BUMPER BRACKET SIDE LH REAR	SERVICEABLE	135.97	-
1	BUMPER RETAINER LH REAR	SERVICEABLE	44.99	-
1	BUMPER REFLECTOR LH	SERVICEABLE	43.61	-
1	BUMPER BEAM REAR	TO REPAIR SEE LABOUR	777.52	-
1	BUMPER BEAM BRACKET LH REAR	TO REPAIR SEE LABOUR	225.95	-
1	BUMPER BEAM BRACKET RH REAR	TO REPAIR SEE LABOUR	225.95	-
1	OUTER PANEL REAR (END PANEL)	TO REPAIR SEE LABOUR	1,471.77	-
1	OUTER PANEL REAR (END PANEL) TRIM	SERVICEABLE	404.56	-
1	TAILLAMP RH	SERVICEABLE	552.55	-
1	TAILLAMP PANEL RH	TO REPAIR SEE LABOUR	986.70	-
1	TAILLAMP LH	SERVICEABLE	552.55	-
1	TAILLAMP PANEL LH	TO REPAIR SEE LABOUR	986.70	-
1	BOOT REAR	TO REPAIR SEE LABOUR	2,872.68	-
1	BOOT FINISHER	SERVICEABLE	470.06	-
1	BOOT WEATHERSTRIP	SERVICEABLE	323.05	-
1	BOOT REFLECTOR LAMP LH	SERVICEABLE	493.35	-
1	BOOT REFLECTOR LAMP RH	SERVICEABLE	493.35	-
1	BOOT BADGE "RENAULT"	NOT NECESSARY	225.36	-
1	BOOT BADGE	NOT NECESSARY	225.36	-
1	BOOT STRUT LH	SERVICEABLE	276.08	-
1	BOOT STRUT RH	SERVICEABLE	276.08	-
1	BOOT HINGE LH	TO REPAIR SEE LABOUR	367.84	-

Report Ref No. CS/TP18015070/Kvbn2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	BOOT HINGE RH	TO REPAIR SEE LABOUR	367.84	-
1	BOOT INNER TRIM	SERVICEABLE	586.45	-
1	BOOT SWITCH	SERVICEABLE	168.13	-
1	BOOT LOCK	TO REPAIR SEE LABOUR	202.67	-
1	BOOT LOCK CATCH	TO REPAIR SEE LABOUR	74.40	-
	LESS 10% DISCOUNT		-1,604.68	-187.73
			14,442.18	1,689.57
	<u>SPECIAL NETT ITEMS</u>			
1	SET PARKING AID (SN)	SERVICEABLE	700.00	-
1	SET REAR BUMPER CLIP (SN)	NECESSARY	66.00	66.00
1	SET BUMPER BRACKET CTR CLIP (SN)	NECESSARY	33.00	33.00
1	SET BUMPER BRACKET SIDE CLIP RH RR (SN)	NOT NECESSARY	10.00	-
1	SET BUMPER RETAINER RH CLIP RR (SN)	NOT NECESSARY	20.00	-
1	SET BUMPER BRACKET SIDE CLIP LH RR (SN)	NOT NECESSARY	10.00	-
1	SET BUMPER RETAINER CLIP LH RR (SN)	NOT NECESSARY	20.00	-
1	SET BUMPER LOWER REAR RIVET (SN)	NOT NECESSARY	22.00	-
1	SET BUMPER LOWER REAR CLIP (SN)	NECESSARY	66.00	66.00
1	EXHAUST MOUNTING REAR (SN)	SERVICEABLE	17.82	-
2	REAR WINDSCREEN SEALANT (SN)	NOT NECESSARY	80.00	-
1	WINDSCREEN MOULDING (SN)	NOT NECESSARY	100.00	-
1	REAR WINDSCREEN INNER SPONGE SEAL (SN)	NOT NECESSARY	100.00	-
			1,244.82	165.00
	<u>LABOUR</u>			
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION.		3,000.00	220.00
	PANEL BEATING,KNOCKING AND STRAIGHTENING THE NECESSARY PORTION,REMOVE AND RENEWAL OF PARTS,ADJUST AND REALIGN THE SAME.INCLUSIVE OF THE REPAIR OF BUMPER BEAM REAR,BUMPER BEAM BRACKET LH REAR,BUMPER BEAM BRACKET RH REAR,OUTER PANEL REAR (END PANEL),TAILLAMP PANEL RH,TAILLAMP PANEL LH,BOOT REAR,BOOT HINGE LH,BOOT HINGE RH,BOOT LOCK AND BOOT LOCK CATCH.		2,200.00	200.00
	TO RUST-PROOFING OF THE AFFECTED AREAS.	NOT NECESSARY	170.00	-
	TO REINSTALL REAR BUMPER PARKING SENSOR.		170.00	60.00

Report Ref No. CS/TP18015070/Kvbn2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO TRANSFER OF BOOTLID FITTINGS, ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO REPAIR AND REALIGN REAR EXHAUST PIPE.	NOT NECESSARY	170.00	-
	TO DROP REAR EXHAUST BOX, RENEW THE SAME, TO REPAIR AND REALIGN CENTRE EXHAUST PIPE.	NOT NECESSARY	170.00	-
	TO TRANSFER OF REAR END PANEL FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO TRANSFER OF REAR WINDSCREEN FITTINGS AND CONDUCT WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO TRANSFER OF REAR END PANEL FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.	NOT NECESSARY	220.00	-
			6,780.00	480.00
	GRAND TOTAL		22,467.00	2,334.57
RECOMMENDED COST OF REPAIRS				2,334.57

Report Ref No. CS/TP18015070/Kvbn2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report. No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.