

ASSIGNMENT

From: Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

N/S	O/S

Bal. or Market Value:

IDAC Accident Report: Consistent?: Yes or No

GIA / PR Seen: Consistent?: Yes or No

Est. Repairs: days Res.: Yes or No

Lum Sum: % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

L1A 44023

Vehicle: IN / OUT

Date: Person Contacted:

Veh No:

SLC2201R

Yr Regn:

5-116

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

CA/

Make:

Toyota Sienta

c.c

1496

Colour:

white

A/C:

Insured / Std / NI / NA

Sp. Reading

310.12

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

NSP170 7028262

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

205/50R16

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

mm

R/Bal.

mm

L/Bal.

mm

L/Bal.

mm

D.O.A.

18/8/18

D.O.I.

21/8/18

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

Rear

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

L1A N/A

L1A P305 (Red: 10699.70; 56%)

RECEIVED 29 AUG 2013

Date/Time, File Pass to?

☐

: Preli. Report

☐

: Final Report

Date/Time, File Return to?

2)

Add Fee:

☐

: Site Insp (\$

☐

) S + RS, SI

☐

: Interview (\$

☐

) Photos

☐

: Tech. Invs (\$

☐

) Others

☐

: Weekend (\$

☐

) TOTAL

Report Format :

Lump Sum / I.B.I. (\$

TP

83001

Days Of Repair:

7

Resurvey No. of Trip:

1

Survey Fee:

Transportation:

☐

) S + RS, SI

☐

) Photos

☐

) Others

☐

) TOTAL

8x15= 120

170+120

50

50+50

130

80

650

Ref. No : <u>CS/TP/80/5213/UT/bn2</u>	Res. Date: <u>23/8/18</u>	Date Received:
Veh. No : <u>SLC 220/12</u>	SP:	WKSP: <u>15/11</u>
C/No :		
Action/Instruction:		
1. File	2. Submit Photo? YES / NO	
3. Indicate Res. Date On Photo Page?	YES / NO	Message:
If No, due to a) No authorisation b) Days of repair		
others:		
Final Re-inspection or Progress Photos		Inspected By:

ANIA178107543 / National Assessment Centre Services - Ubi
 ENTRY DATE & TIME: 20/08/2018 14:09
 SUBMITTED BY: Rosliana Zinte Abdul Wahab

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the Centre and to copies of the report being made available storesaid.

ACCIDENT STATEMENT

Date Of Report	20/08/2018 14:09
Date Of Accident	18/08/2018 14:45
Exact Location Of Accident	BOON LAY WAY TWDS LAKESIDE MRT AT CORPORATION RD J
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SLC2201R
Insured/Policyholder	
Name Of Registered Owner	NG BOON YONG
NRIC No	S8001443J
Email Address	NOEMAIL
Mobile Phone No	(LOCAL) +65-98395177
Alternative Phone No	OTHERS-98395177
Vehicle Particulars	
Manufacturer	TOYOTA
Model	SIENTA
Exact Purpose for which vehicle was being used at time of accident	LEISURE
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	PRIVATE CAR
Insurance Company	
Name of Insurance Company	CHINA TAIPING INSURANCE (SINGAPORE) PTE. LTD.
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	DMPCSN1728041801
Cover Note Number	
Driver	
Name of Driver	NG BOON YONG
NRIC No	S8001443J
Date Of Birth	12/01/1980
Occupation	INDOOR
Date Of Driving Pass	12/06/2007
Driving Experience	11 YEARS AND 2 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-98395177
Fax Number	
Contact Number	OTHERS-98395177
EMail Address	NOEMAIL

Address BLK 669B JURONG WEST ST 64
#04-76
Postcode 642689
Was driver an employee of the Insured's Company NO
If No, Relationship of the Driver with the Insured OWNER
Vehicle Registration Number of Driver's Own Vehicle -
-
Insurance Company of Driver's Own Vehicle -
-

General Information of the Accident

Type Of Accident COLLISION - HEAD TO REAR
Weather Conditions CLEAR
Road Surface DRY

Other Information

Was any foreign vehicle involved in this accident? NO
Number of vehicles involved in the accident
Was any body injured in the Accident? YES
Was any injured conveyed to hospital by ambulance? NO
Was any other material or property damaged? YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance. NO
Number of Passengers (Including Driver) 5
Passenger 1 NAME: : CHIA TZE MIANG,RACHEL
GENDER: : FEMALE
Passenger 2 NAME: : NG YI SHENG,BENEDIKT
GENDER: : MALE
Passenger 3 NAME: : NG YI HENG,JOSE
GENDER: : MALE
Passenger 4 NAME: : MONDIA JELLY PIDO
GENDER: : FEMALE

Details of Police Action

Was the accident reported to the police? NO
If Yes,Please state which Police Station
Was notice of intended Prosecution given? NO
If Yes,against whom?

Circumstances of Accident

PLS REFER TO THE ATTACHED STATEMENT.

Attachment(s)

Are accident photos available for attachment? YES
Was there any video captured by Car Camera? NO
Was there any audio recorded? NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number SGT1641E
Vehicle Make/Model/Colour HONDA
Details Of Properties
Vehicle Category PRIVATE CAR

Name of Driver KOH LIAK HUAT
NRIC/Passport Number S1797587J
Contact Number 91867661
Address
Postcode
Insurance Company Name
Nature Of Damage
No. Of Passenger (Including Driver)

DETAILS OF INJURED PERSON 1

Name NG BOON YONG
Approximate Age
Injuries Sustain SLIGHT
Injured person in which vehicle? SLC2201R
Were seat belts worn? YES
Was this injured conveyed to hospital by ambulance? NO
Address
Postcode

DETAILS OF INJURED PERSON 2

Name CHIA TZE MIANG, RACHEL
Approximate Age
Injuries Sustain SLIGHT
Injured person in which vehicle? SLC2201R
Were seat belts worn? YES
Was this injured conveyed to hospital by ambulance? NO
Address
Postcode

DETAILS OF INJURED PERSON 3

Name NG YI SHENG, BENEDIKT
Approximate Age
Injuries Sustain SLIGHT
Injured person in which vehicle? SLC2201R
Were seat belts worn? YES
Was this injured conveyed to hospital by ambulance? NO
Address
Postcode

DETAILS OF INJURED PERSON 4

Name NG YI HENG, JOSE
Approximate Age
Injuries Sustain SLIGHT
Injured person in which vehicle? SLC2201R
Were seat belts worn? YES
Was this injured conveyed to hospital by ambulance? NO
Address
Postcode

DETAILS OF INJURED PERSON 5

Name MONDIA JELLY PIDO
Approximate Age

Injuries Sustain

SLIGHT

Injured person in which vehicle?

SLC2201R

Were seat belts worn?

YES

Was this injured conveyed to hospital by ambulance?

NO

Address

Postcode

Accident Sketch Plan

SKETCH PLANIMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorized Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this form and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purposes of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.

Policyholder's Signature
Date & Time:

Driver's Signature
(if driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

SKETCH PLAN

[illegible]

On the stated date time at the second vehicle I
observed it was making some travelling straight on my
initial lane moving to the right hand position as
the light turned red so a sense to a complete
stopped after abt 5 seconds, I left a short impact
on my rear portion of my stationary vehicle
Vehicle # "AT 11411 collected onto my rear portion
of my stationary vehicle
Persons involved of driver -
1) No Name Young (Huang Minche) 2 ICC (F)
2) Chin Tze Man (Khal) S8610956 (F)
3) Mr. Y. Hoon Nametikt TH10558E (M)
4) Ng Y. Hoon Joke TH10775G (M)
5) Mendaia John (aka Nick Namale) G2756772 (F)

> **Back to OneMotoring**

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	1443J
Vehicle Details	
Vehicle No.:	SLC2201R
Vehicle to be Exported:	No
Intended De-registration Date:	23 Aug 2018
Vehicle Make:	TOYOTA
Vehicle Model:	SIENTA 1.5G A
Primary Colour:	White
Manufacturing Year:	2016
Engine No.:	2NR8604769
Chassis No.:	NSP1707028262
Maximum Power Output:	80.0 kW (107 bhp)
Open Market Value:	\$21,058.00
Original Registration Date:	05 May 2016
First Registration Date:	05 May 2016
Transfer Count:	0
Actual ARF Paid:	\$11,482.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	04 May 2026
PARF Rebate Amount:	\$8,611.00
Intended COE Rebate Details	
COE Expiry Date:	04 May 2026
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$46,009.00
COE Rebate Amount:	\$35,412.00
Total Rebate Amount:	\$44,023.00

The information contained herein is correct as at 23 Aug 2018

OK

onefm
913
5000 TIMES, GREATEST HITS

THE COURTS ONE FM 91.3
TOP 913 GREATEST HITS
OF ALL TIME COUNTDOWN

WHAT'S YOUR NO
OF ALL TIME?

Post an Advertisement


Sell it yourself! Advertise it at just
\$58 until it's SOLD!

[Post an Ad](#)
[Advertiser Login](#)
[Ways of Selling](#)

New 5 Years Coe Renewal Toyota Vios 1.5A



\$2000 Downpayment Monthly
From \$488 Onwards. Lowest
3.68%P.A@GV Cars Financing
GV Credit Pte Ltd StarAd

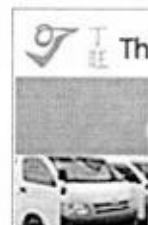

Browse by Category ▼

Sort b

9 vehicles

Toyota Sienta

Advant

Make Model Price Depreciation Reg Date Eng Cap Mil

Search Selection

Toyota Sienta

Any

Any

2016

Any



Toyota Sienta 1.5A X

\$73,800

\$8,920 /yr

20-May-2016

1,496 cc

25

Most Popular Japanese Reliable Mid Sized 7 Seaters With Comfortable Leg Room And Sliding Door For Easy Access. Super Compromising Power, Non Uber/Grab Unit. High Loan Availabl...

Car (S) Pte Ltd

Posted: 21-Aug-2018 Tags: 2016 Toyota Sienta, Toyota Sienta, Toyota, Sienta, Used Toyota



Toyota Sienta 1.5A X

\$71,800

\$9,080 /yr

05-Feb-2016

1,496 cc

36

1 Owner Come With Nice Number Sxx444x. Most Popular Japanese Reliable Mid Sized 7 Seaters With Comfortable Leg R Easy Access. Owner Consignment, Superb Fuel Efficiency. In Hou...

Posted: 18-Aug-2018 Tags: 2016 Toyota Sienta, Toyota Sienta, Toyota, Sienta, Used Toyota



Toyota Sienta 1.5A X

\$73,166

\$9,260 /yr

02-Mar-2016

1,496 cc

25

1 Owner Only And The Most Popular Mid Sized 7 Seaters With Comfortable Leg Room And Auto Sliding Doors For Easy A Without Compromising Power. Best Selling MPV! Keyless Ent...

Creative Auto

Posted: 15-Aug-2018 Tags: 2016 Toyota Sienta, Toyota Sienta, Toyota, Sienta, Used Toyota



Toyota Sienta 1.5A G

\$82,900

\$9,270 /yr

31-Aug-2016


1,496 cc

14

Highest ARF At \$17,000. All Time Favourite 7 Seater Without Stressing You On Petrol And Road Tax. Good For Big Famili Maintained Coupled With Showroom Condition. 100% In Hou...

Posted: 12-Aug-2018 Tags: 2016 Toyota Sienta, Toyota Sienta, Toyota, Sienta, Used Toyota

[Car Buying](#)
[Car Selling](#)
[Car Ownership](#)
[Car Aftermarket](#)
[On The Move](#)
[Lifestyle](#)
[Compare](#)

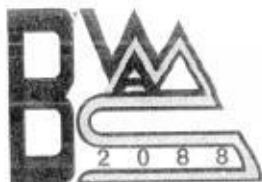

BLUWEL AUTOMOTIVE SERVICE PTE LTD

Workshop: 1 Kaki Bukit Ave 6 (Unit B) #01-28
 (Unit C) #01-28-53/55 Singapore 417883
 Hp: 9755 2088 Tel: 6745 2088 Fax: 6841 2088
 Website: www.bluwel.com.sg Email: bluwel2088@yahoo.com.sg
 Co. Reg. No.: 200704951N
 GST Reg. No.: 200704951N

SLC2201R

	Rear windscreen moulding	rec	\$6.50	/
	Tailgate	sol/gw	1255.10	/
	Tailgate rear logo	rec	60.80	/
	Tailgate outer handle	cm	266.10	/
2pc	Tailgate reflectors @325.10	M/Scun	650.20	1pc
	Tailgate inner lock	tw/jm	345.10	/
	Tailgate lock striker	n1	66.80	X
	Tailgate weatherstrip	tw/n	285.50	/
	Tailgate inner trim	n1	399.10	X
2pc	Tailgate dampers @288.10	n1	576.20	X
	Rear bumper	Dis	\$28.10	/
	Rear bumper outer protector	Dis	245.10	/
2pc	Rear bumper side outer protectors @165	twi	330.00	/
2pc	Rear bumper side retainers @49.50	sol	99.00	/
2pc	Rear bumper reflectors @85.10	cm	170.20	/
1set	Rear bumper clips	rec	50.00	/
	Rear bumper tow cover	twi	69.50	/
	Rear bumper centre sponge	tw/n	68.00	/
	Rear end panel	sol/gw	685.10	/
	Rear end panel top garnish	twi	266.60	/
	Rear floor panel	n	1045.10	X
	Rear floor panel top board	n1	488.20	X
	Rear floor panel top tray	twi	409.10	/
2pc	Rear fenders @979.10	n	1958.20	X
2pc	Rear fender inner trim boards @425.30	de/tw/n	\$906.00	/
2	Rear fender outer sliding garnishes @322.90	cm	645.80	/
	Rear exhaust	n	899.50	X
2pc	Rear exhaust mountings @45.00	n1	90.00	X
2pc	Tailamps @450.10	cm	900.20	/
			14089.70	

25%

8241.5



BLUWEL AUTOMOTIVE SERVICE PTE LTD

Workshop: 1 Kaki Bukit Ave 6 (Unit B) #01-28
 (Unit C) #01-28-53/55 Singapore 417883
 Hp: 9755 2088 Tel: 6745 2088 Fax: 6841 2088
 Website: www.bluwel.com.sg Email: bluwel2088@yahoo.com.sg
 Co. Reg. No.: 200704951N
 GST Reg. No.: 200704951N

SINOT SLC 2201R

1st
set

Rear bumper reverse sensor	short	280.00	200
Rear reverse camera	short	500.00	380
Rear windscreen sealant	ref	50.00	40
Rear end panel sealant	ref	50.00	/
Rear floor panel insulator	ref	180.00	x
To check wiring		80.00	30
To dismantle & replacing reverse sensor		80.00	60
To dismantle & refix rear windscreen		150.00	120
To dismantle & refix rear exhaust		100.00	60
To dismantle & refix seat, cushion upholstery		120.00	100
To dismantle & refix petrol tank	ref	100.00	x
To transfer Tailgate mechanism		100.00	80
To spray rust proofing		120.00	80
labour for panel beating, cut, weld, straighten & replacing parts		1500.00	1200
To putty & spray painting		1500.00	1200
		TOTAL \$ 18999.70	

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

9781.12



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
BLUWEL AUTOMOTIVE SERVICE PTE LTD		Ref : CS/TP18015213/Utbn2		
BLK 1 KAKI BUKIT AVE 6 #01-28/51/53/55(MAIN OFFICE)SINGAPORE 417883		Date : 03-09-2018		
ON BEHALF OF NG BOON YONG		Code : TP149		
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	Veh. Inspected		SLC 2201R	
Policy No.	Coverage (\$)		0.00	
Claim No.	Excess (\$)		0.00	
Assign From	Assign Date		21/08/2018	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA SIENTA (A)	c.c	1496	
Engine No.	HIDDEN	Year of Reg.	2016	
Chassis No.	NSP1707028262	Colour	WHITE	
Odometer	31012	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	205/50 R16	YOKOHAMA	8 mm	
L/H Front Tyre	205/50 R16	YOKOHAMA	8 mm	
R/H Rear Tyre	205/50 R16	YOKOHAMA	8 mm	
L/H Rear Tyre	205/50 R16	YOKOHAMA	8 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	18/08/2018	Inspection Date	21/08/2018	
Survey held at	BLUWEL AUTOMOTIVE SERVICE PTE LTD BLK 1 KAKI BUKIT AVE 6 #01-28/51/53/55(MAIN OFFICE) SINGAPORE 417883			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		7 Working Days		



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.: 1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLC 2201R

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR WINDSCREEN MOULDING	NECESSARY	86.50	86.50
1	TAILGATE	BADLY DENTED	1,255.10	1,255.10
1	TAILGATE REAR LOGO	NECESSARY	60.80	60.80
1	TAILGATE OUTER HANDLE	CRACKED	266.10	266.10
2	TAILGATE REFLECTORS @\$325.10	N/S CUT	650.20	325.10
1	TAILGATE INNER LOCK	TWISTED / JAMMED	345.10	345.10
1	TAILGATE LOCK STRIKER	NOT NECESSARY	66.80	-
1	TAILGATE WEATHERSTRIP	TORN	285.50	285.50
1	TAILGATE INNER TRIM	NOT NECESSARY	399.10	-
2	TAILGATE DAMPERS @\$288.10	NOT NECESSARY	576.20	-
1	REAR BUMPER	DISTORTED	828.10	828.10
1	REAR BUMPER OUTER PROTECTOR	DISTORTED	245.10	245.10
2	REAR BUMPER SIDE OUTER PROTECTORS @\$165.00	TWISTED	330.00	330.00
2	REAR BUMPER SIDE RETAINERS @\$49.50	BENT	99.00	99.00
2	REAR BUMPER REFLECTORS @\$85.10	CRACKED	170.20	170.20
1	SET REAR BUMPER CLIPS	NECESSARY	50.00	50.00
1	REAR BUMPER TOW COVER	TWISTED	69.50	69.50
1	REAR BUMPER CENTRE SPONGE	TORN	68.00	68.00
1	REAR END PANEL	BADLY DENTED	685.10	685.10
1	REAR END PANEL TOP GARNISH	TWISTED	266.60	266.60
1	REAR FLOOR PANEL	TO REPAIR SEE LABOUR	1,045.10	-
1	REAR FLOOR PANEL TOP BOARD	NOT NECESSARY	488.20	-
1	REAR FLOOR PANEL TOP TRAY	TWISTED	409.10	409.10
2	REAR FENDERS @\$979.10	TO REPAIR SEE LABOUR	1,958.20	-
2	REAR FENDER INNER TRIM BOARDS @\$425.30	DEFORMED / TORN	850.60	850.60
2	REAR FENDER OUTER SLIDING GARNISHS @\$322.90	CRACKED	645.80	645.80
1	REAR EXHAUST	TO REPAIR SEE LABOUR	899.50	-
2	REAR EXHAUST MOUNTINGS @\$45.00	NOT NECESSARY	90.00	-
2	TAILLAMPS @\$450.10	CRACKED	900.20	900.20
	LESS 25% DISCOUNT		-	-2,060.38
			14,089.70	6,181.12

Report Ref No. CS/TP18015213/Utbn2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>SPECIAL NETT ITEMS</u>			
1	SET REAR BUMPER REVERSE SENSOR (SN)	SHORTED	280.00	200.00
1	SET REAR REVERSE CAMERA (SN)	SHORTED	500.00	380.00
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	50.00	40.00
1	REAR END PANEL SEALANT (SN)	NECESSARY	50.00	50.00
1	REAR FLOOR PANEL INSULATOR (SN)	NOT NECESSARY	180.00	-
			1,060.00	670.00
	<u>LABOUR</u>			
	TO CHECK WIRING.		80.00	30.00
	TO DISMANTLE & REPLACING REVERSE SENSOR.		80.00	60.00
	TO DISMANTLE & REFIX REAR WINDSCREEN.		150.00	120.00
	TO DISMANTLE & REFIX REAR EXHAUST.		100.00	60.00
	TO DISMANTLE & REFIX SEAT,CUSHION UPHOLSTERY.		120.00	100.00
	TO DISMANTLE & REFIX PETROL TANK.	NOT NECESSARY	100.00	-
	TO TRANSFER TAILGATE MECHANISM.		100.00	80.00
	TO SPRAY RUST PROOFING.		120.00	80.00
	LABOUR FOR PANEL BEATING,CUT,WELD,STRAIGHTEN & REPLACING PARTS.INCLUSIVE OF THE REPAIR OF REAR FLOOR PANEL,REAR FENDERS AND REAR EXHAUST.		1,500.00	1,200.00
	TO PUTTY & SPRAY PAINTING.		1,500.00	1,200.00
			3,850.00	2,930.00
	GRAND TOTAL		18,999.70	9,781.12

RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			8,300.00
---	--	--	-----------------

Report Ref No. CS/TP18015213/Utbn2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.