

SMRT Accident Taxi Repair Estimates

Section A - To be completed by Claims Advisor/Duty Officer at Accident Reporting Centre

Reg. No. : SHC 4321L Ref. No. TAX 9 / 18 / 2022

Make / Model : TOYOTA PRIUS Reg. Date : 20/11/2015

Name of Driver : TAN ANN KAH

Date/Time of Accident : 06/09/2018 20:30

Surveyer is Required ? YES / NO

If Yes, VICOM / LKK / LH Teo / AIS (Please circle one)


Taxi is Towed Back ? YES / NO

Replacement Taxi Issued ? YES / NO

Accident Repair Job Card No. : 24097846

Special Instruction to ARC, if any :

The damages on the Taxi are as indicated in the following diagram :

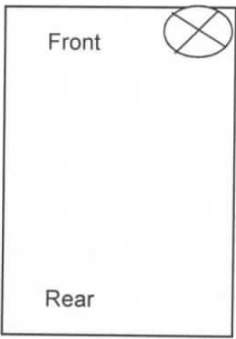

Signed : _____ Date : _____

Section B - To be Completed by Service Advisor, Accident Repair Centre

Chassis No : JTDKN36UX05767153 Mileage : _____

Date Prepared : 08/09/2018 11:55 Repair Completed date/time: _____

Summary of Repair Estimates

	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Charges :	\$ <u>676.00</u>	\$ _____
Total Spray Painting Charges :	\$ <u>1674.00</u>	\$ _____
Total Material Charges :	\$ <u>6364.83</u>	\$ _____
Other Charges :	\$ <u>728.44</u>	\$ _____
TOTAL :	\$ <u>9443.27</u>	\$ <u>0</u> ()
No. of Repair Days :	[<u>5</u>] days	[<u>3</u>] days

Signature :

Prepared by: MING

08/09/2018 11:55

Adjusted by:

Section C - To be Completed by Admin Assistant, Accident Repair Centre, Upon Completion of Repair

QN No. _____ Invoice No. _____ Invoice Date _____

Signed : _____ Date : _____

Part 1 - Labour Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPAIR RH FRONT PORTION	676.00	400
Total Labour	\$ 676.00	\$ -

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPSRAY FRONT BUMPER	378.00	200
TO SPRAY FRONT BUMPER LOWER SUB GRILLE	180.00	X ?
TO RESPRAY FRONT SUPPORT PANEL	180.00	?
TO RESPRAY FRONT FENDER RH	378.00	200
TO RESPRAY RIM	180.00	X nn
TO REPSRAY FRONT HOOD	378.00	X nn
Total Spray Painting & Panel Beating	\$ 1,674.00	\$ -

Part 3 - Other Costs - Accident and Accident Repair Related Expenses

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO CHECK WIRING AND SYSTEM FUNCTION	80.00	20
TO APPLY RUST-PROOFING ON AFFECTED AREA	100.00	40
TO DO WHEEL ALIGNMENT / TYRE BALANCING	120.00	X nn
TO PROVIDE LABOUR & MATERIAL FOR ADVERTISEMENT STICKER(NET)	148.44	/ ntl
TO REMOVE AND REFIT TYRE RIM (SPRAYING PURPOSE)	120.00	X nn
TO WASH AND VACUUM	60.00	X nn
TO REPLACE SUNDRY PARTS	100.00	X nn
Total Other Costs	\$ 728.44	\$ -

Part 4 - Spare Parts / Material Usage

Reservation No : _

Page ()

To be completed by Service Advisor, ARC							Surveyor Adj
Part Number	Parts Description	Qty	List Price (\$)	Discount (%)	Final Price (\$)	Repair (R) Replace (/)	Not given (x) Repair (R) Replace (/)
52119-47930	BUMPER FRT	1	482	25%	361.5	/	/CRA
52115-47040	BUMPER SUPPORT F/RH	1	76.4	25%	57.3	/	?
81511-47050	LENS & BODY, FR TURN RH	1	511.8	10%	460.62	/	/scr
81519-47060	BRACKET, FR TURN UPPER RH	1	24.4	25%	18.3	/	?
81519-47050	BRACKET, FR TURN LOWER RH	1	26	25%	19.5	/	?
81519-47060	BRACKET, FR TURN	1	58.2	25%	43.65	/	?
	NUMBER PLATE	1	15	0%	15	/	/DD
	NUMBER PLATE FRAME	1	12	0%	12	/	/CRA
52114-47140	BRACKET, FR BUMPER	1	110.4	25%	82.8	/	?
53102-47020	BUMPER GRILLE SUB-ASSY, LOWER	1	311.1	25%	233.33	/	X SVC
52611-47080	BUMPER ENERGY ABSORBER FRT	1	78.8	25%	59.1	/	?
52021-47023	BUMPER REINFORCEMENT FRT	1	498.4	25%	373.8	/	?
57013-47030	ARM SUB-ASSY, FR BUMPER RH	1	250.4	25%	187.8	/	?
52618-47050	BUMPER FRT ABSORBER LOWER	1	127.7	25%	95.78	/	?
52127-47903	COVER, FR BUMPER HOLE RH	1	18.5	25%	13.88	/	?
81130-47500	HEAD LAMP RH	1	945.2	10%	850.68	/	/scr
53201-47902	SUPPORT SUB-ASSY	1	1460.4	25%	1095.3	/	?
53801-47050	FENDER FRT/RH	1	723.4	25%	542.55	/	/DD
75374-47051	NAME PLATE (HYBRID)	1	51.9	25%	38.93	/	/NCC
53875-47030	FENDER LINER FRT/RH	1	171.7	25%	128.78	/	/TN
42611--47140(Frt)	WHEEL DISC. FRONT	1	1484.2	25%	1113.15	/	X SVC
53301-47060	HOOD PANEL	1	748.1	25%	561.08	/	X SVC
	NA2 LKX						
	11/9/18 1050						
	P/P						
	BEFORE PAINT PHOTO						
	3 DAYS						

KK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

FR-AS-ARC-02 Rev 6

TOTAL MATERIALS	\$	6,364.83
-----------------	----	----------