

ASS. REC. BY:

REF: CS/CTI/18017080/ Kvd3br

Special Instruction:

Surveyor
Merimen

From (Person):

Kenneth
Cheng Boon Sen

ASSIGNMENT (Office)

of CTI

Date/Time: 19/11/18 @ 3:36pm

Estimated Cost:

Bill to:

① / TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

SKG 9618S

Insured:

at Workshop m/s

Cheng Hoe Motor

Tel:

6481 2001

of

Blk 1019 # 01-374 / 382

Policy No:

DMPCSN1717 471801

Claim No:

SNM18D04519C01

Sum Insured:

Excess:

Make of Veh:

(Client's Record)

D.O.A. 17/09/18

Insp: Cheng Hoe (AME) @ 20/9/18

CA / REV

/ REP: / REV 24 HRS

H.O.D. Endorsement:

Date/Time:

4:27pm @ 19/11/18

Person Contacted:

Sharon

Vehicle

IN/OUT


Date/Time	Action/Instruction (✓) Estimate
	SKG 9618S - X
21/9/18	Revert via merimen
24/9/18	Rec approved \$3315.07 from Alfred via merimen
24/9/18	Informed Dorlyn c/A on PXP not exceeding \$3200 ex \$0 by email

REF: CTJ

ASSIGNMENT

From:
 Date: 20/9/18
 Estimated Cost:
 () P / WS / TP RES / OD RES / EVA / INV / MV
 To inspect Vehicle No: SKG 9618S
 at Workshop no/s: Cheng Hpe Motor
 of: No. 10, AMK Ind. Park 2A #01-04
 Insured:
 Policy No.:
 Claims No.:
 Sum Insured: Excess: -
 (Client's Record)
 Make of Veh:
 (Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

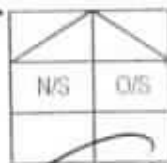

Bal. or Market Value: 42/c
 IDAC Accident Report: Consistent? Yes or No
 GIA / PR Seen: Consistent? Yes or No
 Est. Repairs: 05 days Res.: Yes or No
 Lum Sum: 1.31 % 3 Val: Yes or No
 CA / (REV) / REP. 1-24 HRS

Date: Person Contacted:

Vehicle: IN / OUT

Veh No: SKG 9618S Yt Regt: 10, 12
 Type: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
 Truck / Trailer or
 Make: Hyundai A) Elantra 1591
 Colour: M. Silver A/C: - Insured / Std / NI / NA
 Sp. Reading: 84014 T/Radio: Insured / Std / NI / NA
 Eng/No:
 C/No: KMHDH41CMOU 64848
 Gen. Cond: Good / Fair / Poor / Burnt
 Steering: In order / Jammed / Leaked / Burnt or
 Brake: In order / Jammed / Leaked / Burnt or
 Mod: Nil / S/Rim / STD A/Rim or
 Tyre Size: F: B.S 205/55R16
 R: Yoko
 BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
 TOYO / YOKO or
 Front:
 R/Bal: 8 mm
 L/Bal: 8 mm
 D.O.A: 17/9/18
 Rear:
 R/Bal: 6 mm
 L/Bal: 6 mm
 D.O.L: 20/9/18
 Survey held at:
 Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or
 The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

21/9 1st per to C. H. H. H.

12/11 @ 3370-22 32001 Car frame Tune (Red 625-444, 1619)

RECEIVED 14 NOV 2018

Signature
14/11/2018

Date/Time, File Path to:

☐ : Prel. Report
☐ : Final Report

Days Of Repair: 5

Resurvey No. of Trip: 2

Date/Time, File Return to:

14/11 - typist

Add Fee: ☐ Site Insp (\$)
☐ Interview (\$)
☐ Tech. fees (\$)
☐ Weekend (\$)

Report Format: meri men
 Lump Sum / L.B.I.: (\$ RS \$ 3200f)

Survey Fee:

Transportation:

1. 2. 3. 4. 5. 6. 7. 8. 9. 10.

Photo

Other

TOTAL

220



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

CHINA TAIPING INSURANCE (S) PTE LTD

Ref : CS/CTI18017080/Kvd3

3 ANSON ROAD #16-00
SPRINGLEAF TOWERS SINGAPORE 079909

Date : 19-09-2018



Code : CTI

1. Policy Particulars :- OWN DAMAGE

Insured Veh.		Veh. Inspected	SKG 9618S
Policy No.	DMPCSN1717471801	Coverage (\$)	0.00
Claim No.	SNM18D04519C01	Excess (\$)	0.00
Assign From	MERIMEN (CHONG BOON SEN)	Assign Date	19/09/2018

2. Vehicle Particulars & Condition

Make & Model		c.c	0
Engine No.	HIDDEN	Year of Reg.	
Chassis No.		Colour	
Odometer	-	Steering	
Brakes		Modification	
General			

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm

4. Description of Damages

--	--

5. General Information

Accident Date	17/09/2018	Inspection Date	20/09/2018
Survey held at	10 ANG MO KIO IND PARK 2A #01-04		
Repairer	CHENG HOE MOTOR PL		

5a. Remarks

A) THE MARKET VALUE IS S\$----- (EST. AVERAGE)
B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE AUTHORISED REPAIRS.

...CLAIM SUBFOLDER...(New Assignment)

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Jns Auth'd	Status
Main	19 Sep 2018 Sendback Est	19 Sep 2018 14:12 S\$3,825.44	19 Sep 2018 15:36 Assign				New Assignment Cancel Case

Main

Reference

Claim Details

Documents

Show All

CLAIM SUBFOLDER DETAILS

Insured:	LEE CHOON HUAT, ID: S6920818E		
Vehicle Reg. No.:	SKG9618S	Date of Loss:	17/09/2018 05:00 - :59 (70 Months and 23 Days From LTA Reg Date (Man Yr))
Claim Type:	OD / SNM18D04519C01	Policy/Cover Note No.:	DMPCSN1717471801 (Comprehensive)
		Excess:	S\$0.00
Repairer:	Cheng Hoe Motor Pte Ltd (Yishun) Blk 1019 #01-374/382, Yishun Industrial Park A, 768761 Yishun - Tel: 6755 6142		
Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd. (HQ) - Tel: 6389 6111 ... [Handled by Chong Boon Sen]		
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Final Rpt due 28/09/2018]		
Driver/Custodian:	LIU WEE LOON (37 / Male), NRIC: S8182456H, Tel: +6591092390		
Adj Asg. Remarks:	SURVEY REVERT		

ASSOCIATED MAIL RECEIVED

View All

Compose Case Mail

There are no mail for this case.

ALL ASSOCIATED TASKS

View All

Search Tasks

Create New Task

Complete

Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Veron Chen (LKKAuto)

From: Veron Chen (LKKAuto)
Sent: Monday, 24 September 2018 12:08 PM
To: 'chmamk@singnet.com'
Cc: SUR
Subject: SKG 9618S-DOA: 17/9/2018 (CHINA TAI PING OD)

Dear Dorlyn,

As instructed by our client , please proceed to repair the insured vehicle **SKD 9618S on part by part not exceeding S3200/- (Excess S0/-)**.

If there are any check items or supplementary items please inform our office's Assignment Team at Tel: 6741 8434 to arrange our surveyor for inspection.

All supplementary items and unconfirm items are subjected to further approval from insurance company before completion of the repair.

*Our client reserve their right **not to pay** if there is no valid approval obtained before repair.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

View Received Message

This mail is associated with :

SKG9618S (SNM18D04519C01)

OD

Sep 17 2018 5:00AM

[LEE CHOON HUAT]

Cheng Hoe Motor Pte Ltd

[Reply](#) [Reply All](#) [Mark as Unread](#) [Print Message](#) [Delete Message](#) [Forward](#)

From China Taiping Insurance (Singapore) Pte. Ltd. (HQ) (CHINA_TAIPING), sent on **24/09/2018 11:31 AM**.

To LKK_HQ

Subject Alert - Adj Mandate Approved (S\$3315.07) - SKG9618S - Claim Handler: Chong Boon Sen

Approved:3315.07:Proceed to authorize NO MORE THAN \$3,315.07. (MARGIN FOR REPAIRS \$3,235.00) IF not accepted, proceed to CTL claim.

DOCUMENTS SUMMARY

There are no documents.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To:	China Taiping Insurance (Singapore) Pte. Ltd. 3 Anson Road #16-00 Springleaf Tower Singapore 079909	From:	LKK Auto Consultants Pte Ltd 51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park Singapore 408933
Attn:	Chong Boon Sen	Date:	21 Sep 2018

Preliminary Advice

Vehicle No	: SKG9618S	Accident Date	: 17/09/2018
Make	: HYUNDAI ELANTRA	Policy No.	: DMPCSN1717471801
Assignment Date	: 19/09/2018	Excess	: S\$0.00
Date of Inspection	: 20/09/2018	Est. Duration of Repair	: 5.00
Inspection At	: CHENG HOE MOTOR PTE LTD (YISHUN) BLK 1019 #01-374/382, YISHUN INDUSTRIAL PARK A SINGAPORE 768761		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages rear portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	3,825.44
Revised Amount	:S\$	3,185.07
Check Items (Estimated)	:S\$	130.00
Total	:S\$	3,315.07

Lump Sum Repair :S\$

Total Loss Consideration

New for Old Value	:S\$	
Pre-Accident Value	:S\$	42,000.00
COE / PARF Rebate	:S\$	38,765.00
Salvage Value	:S\$	
Margin for Repair	:S\$	3,235.00

Remarks

☐ The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.

☐ The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.

☒ Other comments :Vehicle repair on part by part basis. Base on our revised is not economical to repair.

[> Back to OneMotoring](#)**Enquire PARF/COE Rebate for Registered Vehicle****Vehicle Owner Particulars**

Owner ID Type: Singapore NRIC
Owner ID: 0818E

Vehicle Details

Vehicle No.: SKG96185
Vehicle to be Exported: No
Intended Deregistration Date: 19 Sep 2018
Vehicle Make: HYUNDAI
Vehicle Model: ELANTRA 1.6 AT ABS D/AB 2WD 4DR
Primary Colour: Silver
Manufacturing Year: 2012
Engine No.: G4FGCU641280
Chassis No.: KMHDH41CMDU648446
Maximum Power Output: 95.6 kW (128 bhp)
Open Market Value: \$13,827.00
Original Registration Date: 25 Oct 2012
First Registration Date: 25 Oct 2012
Transfer Count: 1
Actual ARF Paid: \$13,827.00

Intended PARF Rebate Details

PARF Eligibility: Yes
PARF Eligibility Expiry Date: 24 Oct 2022
PARF Rebate Amount: \$9,678.00

Intended COE Rebate Details

COE Expiry Date: 24 Oct 2022
COE Category: A - Car (1600cc & below)
COE Period(Years): 10
QP Paid: \$71,001.00
COE Rebate Amount: \$29,087.00
Total Rebate Amount: \$38,765.00

The information contained herein is correct as at 19 Sep 2018

OK



DON'T FALL FOR HER ONLINE PURCHASE SCAM

CLICK TO FIND OUT MORE AT www.scamalert.sg

Hyundai elantra

Price Range

Depreciation

2012

Vehicle Type

Submit

Advanced Search

Home > Used Cars > Tim Bock Enterprise > Hyundai Elantra 1.6A

Resources

Car Buying

Car Selling

Car Ownership

Car Aftermarket

On The Move

Lifestyle

Car Leasing

CL LEASING
 OVER 10 YEARS OF CAR FINANCING
 SPECIALISED IN CAR LEASING

 6760 7117 8720 5000 8720 8000

Hyundai Elantra 1.6A

Overview Financial Accessories Similar Research Photos Map

Add to Shortlist

Add to Compare

Add a Note

Report Error

More Actions

Share

Car Details

Price	\$42,800	
Depreciation	\$8,970 /yr View models with similar depreciation	?
Reg Date	12-Nov-2012 (4yrs 1mth 23days COE left)	
Manufactured	2012	?
Mileage	54,658 km (9.3k /yr)	
Transmission	Auto	
Engine Cap	1,591 cc	
Road Tax	\$738 /yr	?
Power	95.6 kW (128 hp) View specs of the Hyundai Elantra (2011-2014)	?
Curb Weight	1,267 kg	?
Features	Powerful And Responsive 1.6 Dual CVT Engine Producing 128hp, Multi Function Steering, ABS, Auto Retractable Side Mirror.	
Accessories	Leather Seat, Knockdown Rear Seats, Reverse Sensors, Sport Rims.	
Description	1 Owner, Very Mint Condition, Low Mileage Of 54658km. Good Fuel Efficient Engine. Huge Interior. Cheapest In The Market Right Now. Come Down To View This Beautiful Pristine Car Before It's Gone!	
COE	\$62,600	?
OMV	\$11,174	?
ARF	\$11,174	?
Dereg Value	\$13,788 as of today (change)	?
No. of Owners	1	?
Type of Veh	Mid-Sized Sedan	
Category	FAAF Car, Low Mileage Car	
Availability	Available	

Add to Shortlist

Add to Compare

Add a Note

Posted on: 10-Sep-2018 | Last updated on: 13-Sep-2018

Tags: Hyundai Elantra, 2012 Hyundai Elantra, Hyundai, Elantra, Used Hyundai

Upfront Payment

> more Financial info

Transfer Fee	\$25	?
Down Payment	\$12,840 (change)	Maximum 70% Loan
1st Instalment	\$686	?
Total Upfront Payment	\$13,551 (excluding insurance)	?

Estimation based on 70% loan at 2.98% interest rate. Check with seller for exact figure.

Items for Hyundai Elantra

> View All

Pedal
\$68LED Bumper Reflector
Light
\$140

SME 72 L



Seller Information

Company	Tim Bock Enterprise = dealer's price list = 13 vms sold 23 vms available
Address	210 Turf Club Road Lot A2 Search cars nearby this location
Location	Car Mall @ The Grandstand
Office No	64595611
Contact Person(s)	Richard 98197977 Raymond 81596282

Useful Services

Ahead of lemons? Request to have
this car evaluated professionally.

Vehicle Evaluation

Find out the market value for your car.
Get a free Car Valuation.

Free Valuation

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT	
Date Of Report	17/09/2018 16:46
Date Of Accident	17/09/2018 05:30
Exact Location Of Accident	NEAR MALAYSIA CUSTOM COMING INTO SINGAPORE
Country/State of Loss	MALAYSIA/JOHOR DARUL TAKZIM
DETAILS OF OWN VEHICLE	
Vehicle Registration Number	SKG9618S
Insured/Policyholder	
Name Of Registered Owner	LEE CHOON HUAT
NRIC No	S6920818E
Email Address	MICHAEL@MDPRETECH.COM
Mobile Phone No	(LOCAL) +65-92773737
Alternative Phone No	OTHERS-92773737
Vehicle Particulars	
Manufacturer	HYUNDAI
Model	ELANTRA-1.6 (A)
Exact Purpose for which vehicle was being used at time of accident	PTE USE
Are you claiming under your own insurance policy for repair to your vehicle?	YES
If No, Please state action to be taken	
Vehicle Category	PRIVATE CAR
Insurance Company	
Name of Insurance Company	CHINA TAIPING INSURANCE (SINGAPORE) PTE. LTD.
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	DMPCSN1717471801
Cover Note Number	25/04/2018 - 24/04/2019
Driver	
Name of Driver	LIU WEE LOON
NRIC No	S8182456H
Date Of Birth	18/04/1981
Occupation	INDOOR
Date Of Driving Pass	12/05/2007
Driving Experience	11 YEARS AND 4 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-91092390
Fax Number	
Contact Number	OTHERS-92773737
Email Address	NOEMAIL

Address BLK 704 HOUGANG AVE 2 #05-215
 Postcode 530704
 Was driver an employee of the Insured's Company YES
 If No, Relationship of the Driver with the Insured
 Vehicle Registration Number of Driver's Own Vehicle -
 -
 -
 Insurance Company of Driver's Own Vehicle -
 -
 -

General Information of the Accident

Type Of Accident COLLISION - HEAD TO REAR
 Weather Conditions CLEAR
 Road Surface DRY

Other Information

Was any foreign vehicle involved in this accident? YES
 Foreign Vehicle Registration Number JSN5364 (MOTORCYCLE)
 Number of vehicles involved in the accident
 Was any body injured in the Accident? YES
 Was any injured conveyed to hospital by ambulance? NO
 Was any other material or property damaged? YES
 I have been approached by unknown person(s) soliciting/offering accident claims assistance. NO
 Number of Passengers (Including Driver) 1

Details of Police Action

Was the accident reported to the police? YES
 If Yes, Please state which Police Station
 Police Station Name ANG MO KIO NORTH NEIGHBOURHOOD POLICE CENTRE
 Police Station Address ROAD: 51 ANG MO KIO AVE 9 , POSTCODE: 569784 , COUNTRY: SINGAPORE
 Police Station Contact TEL NO: 1800-4849999 - FAX NO: 62181399
 Was notice of intended Prosecution given? NO
 If Yes, against whom?

Circumstances of Accident

REFER TO POLICE REPORT

Attachment(s)

Are accident photos available for attachment? YES
 Was there any video captured by Car Camera? NO
 Was there any audio recorded? NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number JSN5364
 Vehicle Make/Model/Colour
 Details Of Properties
 Vehicle Category MOTORCYCLE
 Name of Driver
 NRIC/Passport Number
 Contact Number
 Address
 Postcode
 Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)

DETAILS OF INJURED PERSON 1

Name

RIDER

Approximate Age

Injuries Sustain

Injured person in which vehicle?

JSN5364

Were seat belts worn?

Was this injured conveyed to hospital by ambulance?

Address

Postcode

Sketch Plan

SKETCH PLAN

VEHICLE NO.: SK5 96185
 INSURER: China
 DATE & TIME: 17/09/2018 @ 0530

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

B. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.

Policyholder's Signature
 Date & Time:

Driver's Signature
 (If driver is not the policyholder)
 Date & Time:

Reporting Centre Personnel's Signature
 Name: David (AMK)
 NRIC/FIN No: 17/09/18

Malaysia's
Customs

10m

Motor
Bike

Car/bus

A: SKG 96185
(alone)

B: JSN 5364

Vehicle No: SK6 96185 (China)
Date & Time: 17/09/18 @ 0530 (cleaning)
Refer to police report attach.

Note : Please note that your insurer may have 14days Time Frame for you to submit an Own Damage Claim under your own comprehensive policy. Please check with your policy for more information.

I/We declare the foregoing particulars are true in every respect.

NRIC/FIN No.:

Reporting Only

(

Sketch Plan #3



**SINGAPORE
POLICE FORCE**



F/20180917/2121

1 of 2

POLICE REPORT (NP299)

Report No. F/20180917/2121

Police Station Of Origin
Ang Mo Kio North N.P.C
51 Ang Mo Kio Avenue 9 SINGAPORE
569784
Tel No: 1800-4849999

Date/Time Report Made 17/09/2018 16:00	Vide Report No.	Station Diary No. 72
Name Of Informant LIU WEE LOON	Address APT BLK 704 HOUGANG AVENUE 2 #05-215 SINGAPORE 530704	
ID Type / ID No. NRIC NO / S8182456H	Contact No. Home/Office	Mobile 91092390
Nationality MALAYSIAN	Email Address	
Occupation SALES ENGINEER	Sex Male	Age 37
Institution/School Name	Date of Birth 18/04/1981	Race Chinese
Date/Time Of Incident 17/09/2018 05:30	Language English	
	Location Of Incident NEAR MALAYSIA CUSTOM COMING INTO SINGAPORE MALAYSIA	

Brief details.

On 17/09/2018 at about 5.30am, I was driving my vehicle bearing registration number SKG9618S queuing to enter Singapore at Malaysia customs. Suddenly, I felt an impact from the rear. I then went down to take a look and saw the rider sitting on the floor and the motorcycle had fall to the side. The motorbike registration plate number is JSN5364. There was people helping the motorbike to the side of the road. I observed that there were dent at the rear of my vehicle. I then sent the rider to the Malaysia

Signature Of Officer Recording The Report:

F / Sgt 3 CHUA KAI LING

Signature Of Informant:

Date/Time:
17/09/2018 16:00Signature Of Interpreter:
Not applicable

Officer In-Charge Of Case:
F / Ang Mo Kio North N.P.C /
SI NG GEOK MENG
Contact No.: 64849999

Classification Of Case:

Authentication Stamp



**SINGAPORE
POLICE FORCE**



F/20180917/2121

2 of 2

POLICE REPORT (NP299)

CONTINUATION OF REPORT

Report No. F/20180917/2121

hospital as I see that there was a bruise on his head. I then immediately lodged a police report at Malaysia police station.

I am lodging this report for my own insurance action.

Signature Of Officer Recording The Report:

F / Sgt 3 CHUA KAI LING

Signature Of Informant:

Signature Of Interpreter:
Not applicable

Date/Time:
17/09/2018 16:00

Officer In-Charge Of Case:
F / Ang Mo Kio North N.P.C /
SI NG GEOK MENG
Contact No.: 64849999

Classification Of Case:

Authentication Stamp



POLIS DIRAJA MALAYSIA REPOT POLIS

Balai : TRAFIK JOHOR BAHRU(S) Pegawai Penyiasat : R190078
 Daerah : J/BAHRU SELATAN
 Kontinjen : JOHOR
 No Repot : TRAFIK JOHOR BAHRU(S)/022345/18
 Tarikh : 17/09/2018
 Waktu : 0918 AM
 Bahasa Diterima : B. Malaysia

Butir-butir Penerima Repot

Nama : NOAZZA BINTI ABD WAHID No Personel : R136178 Pangkat : KPL
 Butir-butir Jurubahasa (Jika Ada)
 Nama : — No K/P (Baru) : — No Polis/Tentera : —
 No Paspot : — Bahasa Asal : —
 Alamat : —

Butir-butir Pengadu

Nama : LIU WEE LOON
 No K/P (Baru) : — No Polis/Tentera : — No Paspot : S8182456H
 No Sijil Beranak : —
 Jantina : Lelaki Tarikh Lahir : 18/04/1981 Umur : 37 tahun 4 bulan
 Keturunan : Cina Warganegara : Singapore
 Pekerjaan : -
 Alamat Tempat Tinggal : APT BLK 704 HOUGANG AVENUE 2, #05-215 SINGAPURA, 530704
 Alamat Ibu/Bapa : —
 Alamat Pejabat : —
 No Tel (Rumah) : — No Tel (Pejabat) : — No Tel (HP) : 91092390

Pengadu Menyatakan:-

(ADA 17/09/2018 JAM LEBIH KURANG 0530HRS, SEMASA SAYA MEMANDU MIKAR4 NO SKG9618S DARI JOHOR BAHRU HENDAK KE SINGAPURA, APABILA SAYA SAMPAI DI KM 1.5 L/RAYA EDL, JALAN AGAK SESAK DAN SAYA BERHENTIKAN MIKAR SAYA DAN TIBA - TIBA SEBUAH M/SEKAL NO JSN5364 YANG DATANG DARI BELAKANG TELAH MELANGGAR BAHAGIAN BELAKANG MIKAR SAYA, SAYA TIDAK CEDERA DAN KEROSAKAN MIKAR SAYA BUMPER DAN BONET BELAKANG, PANEL BELAKANG, LAMPU BELAKANG KIRI KANAN, SENSOR DAN LAIN - LAIN KEROSAKAN TIDAK PASTI LAGI.
 INILAH LAPORAN SAYA

Tandatangan Pengadu:

Tandatangan Jurubahasa (Jika ada):

Tandatangan Penerima Repot:

ID Pencetak | Tarikh @ Masa Cetak

PEJ. RUMAH REPORT
 TRAFIK JOHOR BAHRU (S)
 SALINAN YANG BENAR
 (SALINAN UNTUK TUNTUTAN SIVIL)

KETUA TRAFIK DAERAH JOHOR BAHRU (S) JOHOR
 TIDAK BOLEH DIGUNA-KAN UNTUK TUJUAN PERBICARAAN

CHENG HOE MOTOR PTE
LTD
BLK 1019, YISHUN
INDUSTRIAL PARK A
#01-374/382
SINGAPORE 768761

Claim Reference:
Assessment Number: CSKG9618
Version: CHENGHOE/1
Date Calculated: 19/09/2018 03:49

Full Report - V1
Registration: SKG9618S
Printed: 19/09/2018 13:35

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	CHENG HOE MOTOR PTE LTD	Date of Incident:	17/09/2018
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	China Taiping Insurance (S) Pt	Repairs Authorised:	TBA
Claim Reference:		Estimated Repair Time:	7 day(s)
Policy Number:	DMPCSN1717471801	Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	HYUNDAI
Model:	Elantra
Sub Model:	A ELITE
Model Sheet Number:	3032 03
Registration:	SKG9618S
Registration Month:	October
Registration Year:	2012
VIN Number:	KMHDH41CMDU648446
Manufacture Year:	2012
Odometer:	Not Known
Colour:	Silver
Engine Number:	
Fuel Level:	%

Model Specs

FROM 08/2012	AIR CONDITIONING
CENTRAL LOCKING	REAR ELECT WINDOWS
KEYLESS ENTRY	MIRROR W/NDICATOR
ELECT FOLDING MIRROR	FOG LAMPS
GRILLE CHROME/BLACK	IMMOBILISER
ANTI THEFT ALARM	REAR BRAKE DRUM
REAR PARKING SYSTEM	1.6 LTR 97KW
AUTO GEARBOX 6 SPEED	STRG COLUMN ADJUST
TWIN AIRBAGS	ABS
TYRES 205/55 HR 16	WHEELS 6.5J X 16 ALU
EMISSION STD EURO 4	ESP
4-DOOR	D/MLDG BLACK BRIGHT
RIGHT HAND DRIVE	PREPARE OFF VEHICLE
TWO COAT PEARL/MICA	

Vehicle Condition

Vehicle Status

Pre-Accident Condition:
Steering:

Severity of Impact:
Vehicle Status on
Inspection:
Date of Inspection:

fax: 67564315

19/09/2018

Brakes Pedal Travel:
Place of Inspection:
Pre-Accident Damage:

Tyres Condition:
Tread Depth LHF:
Tread Depth LHR:
Damage Areas:

Tread Depth RHF:
Tread Depth RHR:
Direction of Impact:

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice"
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

Audatex System Using Manufacturer Times

Not Authorised
1. B1
Resurvey B4 paint



10
Q
Rec

5 days

CHENG HOE MOTOR PTE LTD

Claim Reference:
Assessment Number: CSKG9618
Version: CHENGHOE/1
Date Calculated: 19/09/2018 03:49

Full Report - V1
Registration: SKG9618S
Printed: 19/09/2018 13:35

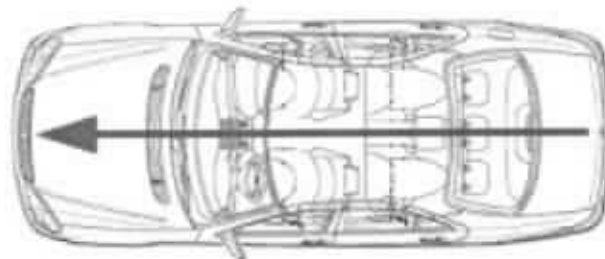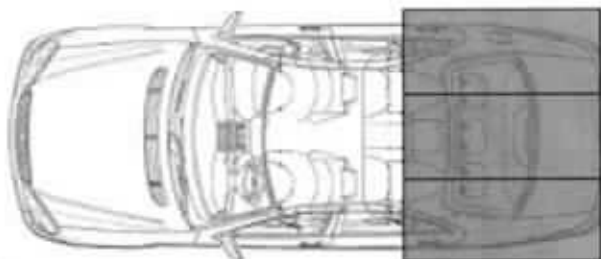

Addresses

Repairer

Name : CHENG HOE MOTOR PTE LTD
Address :
NO 10, AMK IND PK 2A
01-04
Post Code : 568047

Cost Summary

Total Labour	\$1,344.00
Total Paint/Material	\$250.44
Total Parts	\$1,996.00
Total of Additional Costs	\$235.00
Excess:	TBA
Grand Total Exc GST:	\$3,825.44
7 % GST:	\$267.78
Grand Total Inc GST:	\$4,093.22

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$42.00/HR
Price/Dent = \$42.00/HR

Repair /

Guide Number	Repair Details	WU	Cost Price (\$)
86520R00	RENEW COMPLETE REAR BUMPER INCLUDES: R + R OUTER TAIL LAMPS AND NECESSARY TRIMS, RENEW REAR BUMPER AND BUMPER CARRIER, CONVERT ATTACHED PARTS, RENEW IF NECESSARY	8.0	33.60
NO NUMBER	R + R RIGHT REAR BUMPER BRACKET	2.0	8.40
69200R00	RENEW BOOTLID INCLUDES: R + R TRIM ASSEMBLE ATTACHED PARTS IF NECESS RENEW	11.0	46.20
79210R00	R + R BOTH BOOTLID HINGES	10.0	42.00
81214R00	R + R BOOTLID LOCKING PLATE	2.0	8.40
87321R00	R + R BOOT LID RUBBER SEAL	2.0	8.40
NO NUMBER	RENEW END PANEL	45.0	189.00
2695	PANEL WORK REAR END	20 30.0*	126.00
3485	REPAIR L/R OUT QTR PANEL	10 20.0*	84.00
3486	REPAIR R/R OUT QTR PANEL	20 20.0* X	84.00
3901	REPAIR BOOTFLOOR	15 25.0*	105.00
3991	REPAIR RR FLOOR FRAME	25 25.0* X	105.00
LABOUR COST			
Total Work Units		200.0	
Corrosion Protection External Labour		0.0HRS	0.00

CHENG HOE MOTOR PTE LTD

Claim Reference:

Assessment Number: CSKG9618

Version: CHENGHOE/1

Date Calculated: 19/09/2018 03:49

Full Report - V1

Registration: SKG9618S

Printed: 19/09/2018 13:35

Corrosion Protection Internal Labour	0.0HRS	0.00
Sub Total	20.0HRS	\$840.00
Paint Labour	12.0HRS	\$504.00
Total Labour	32.0HRS	\$1,344.00

PAINT WORK		Time Basis 10 WU = 1 HR. Price = \$42.00/HR	
Guide Number	Description	WU	Cost Price (\$)
	- PREPARE OFF VEHICLE		
	- TWO COAT PEARL/MICA		
2711	REAR PANEL NEW PART PAINTING	18.0	
2931	BOOTLID NEW PART PAINTING	16.0	
2583	REAR BUMPER NEW PART PAINT K1R	13.0	
3485	L/R OUT QTR PANEL REPAIR PAINTING <50%	13.0	
3486	R/R OUT QTR PANEL REPAIR PAINTING <50%	13.0	
3901	BOOFLOR SURFACE PAINT	10.0	
3991	RR FLOOR FRAME SURFACE PAINT	7.0	
LABOUR COST - PAINT			
TIME(PAINT)		90.0	
Preparation Main Work Plastic		5.0	
Preparation Main Work Metal		25.0	
Preparation Work Multi Layer Paint		0.0	
Total Work Units (10WU/HR)		120.0	
Total Paintwork Labour		12.0HRS	\$504.00
MATERIAL COST - PAINT			Cost Price
New Part Painting			\$64.14
New Part Painting - Plastic K1R			\$63.96
Material-Constant Main Work Metal			\$28.60
Surface-/Blend Paint			\$48.56
Repair Painting			\$36.18
Material-Const Main Work Plastic			\$9.00
Total Excluding Pearlescent Uplift			\$250.44
Pearlescent Uplift @ 0.0%			\$0.00
Total Paint Material Cost			\$250.44

PARTS

				Price Valid: 01/06/2015	
Guide No.	Qty	Description	Part Number	Supplier	Bet. Price (\$)
2583	1	REAR BUMPER	866103X011		0% <i>Ry</i> 195.00* ✓
2620	1	R/R BUMPER BRACKET	866143X000		0% <i>Ry</i> 17.00* ✓
2640	1	REAR BUMPER SUPPORT	866313X100		0% <i>CMA</i> 130.00* ✓
2711	1	REAR PANEL	691003X000		0% <i>Ry</i> 160.00* ✓
2931	1	BOOTLID	692003X120		0% <i>Ry</i> 410.00* ✓
2944	1	BOOTLID SEAL	873213X000		0% <i>Ry</i> 50.00* ✓
2953	1	L/BOOTLID HINGE	792103X000		0% <i>Ry</i> 45.00* ✓
2954	1	R/BOOTLID HINGE	792203X000		0% <i>Ry</i> 45.00* X
2973	1	REAR STRIKER	812103L000		0% <i>Ry</i> 25.00* ✓
2977	1	BOOTLID LOCK	812303X010		0% <i>Ry</i> 85.00* ✓
3013	1	MANUFACTURER BADGE	863213X000		0% <i>Ry</i> 22.00* ✓
3014	1	BADGE MODEL	863153X100		0% <i>Ry</i> 30.00* ✓
3015	1	BADGE "HYUNDAI"	863203X000		0% <i>Ry</i> 22.00* ✓
3287	1	L/R OUTER LAMP	924103X010		0% <i>CMA</i> 170.00* ✓
3288	1	R/R OUTER LAMP	924203X010		0% <i>CMA</i> 170.00* ✓

CHENG HOE MOTOR PTE LTD

Claim Reference:
Assessment Number: CSKG9618
Version: CHENGHOE/1
Date Calculated: 19/09/2018 03:49

Full Report - V1
Registration: SKG9618S
Printed: 19/09/2018 13:35

3289	1	L/R INNER LAMP	924303X050	0%	CM	130.00*	✓
3290	1	R/R INNER LAMP	924403X050	0%	CM	130.00*	✓
3296	1	R/R REFLECTOR	924063X000	0%	CM	22.00*	✓
4985	1	REAR PANEL TRIM	857703X000RY	0%	Am	38.00*	✓
f: OEM Parts			Sub Total			\$1,896.00	
g: Original			Sundry Parts	(Fixed)		\$100.00	
h: Secondhand			Total Parts			\$1,996.00	
p: Parallel							
x: Exchange							

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description	Betterment	Price	
REAR NO PLATE SPECIALIST	0%	\$35.00	✓
REVERSE SENSORS SPECIALIST		\$200.00	✓
Total Extras		\$235.00	

Final Calculation

Total Parts \$1,996.00

Labour

Total Panel/Mechanical	491.40	\$840.00
Total Paintwork	441	\$504.00

Total Labour

\$1,344.00

Additional Costs

Corr Prot Materials External	\$0.00
Corr Prot Materials Internal	\$0.00
Cost of Specialist	\$235.00

Total of Additional Costs

\$235.00

Total Paint/Material Costs

213.67 \$250.44

Grand Total Excludes GST

\$3,825.44

GST @ 7 %

\$267.78

Grand Total Includes GST

\$4,093.22

Assessment Notes

51 Ubi Avenue 1, #01-25
Paya Ubi Industrial Park
Singapore

408933

Report

Claim Reference: SNM18D04519C01
Assessment Number: CSKG9618
Version: CHINATAI/2
Date Calculated: 21/09/2018 07:12

Full Report - V1
Registration: SKG9618S
Printed: 21/09/2018 14:13

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	LKK AUTO	Date of Incident:	17/09/2018
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	China Taiping Insurance (S) Pt	Repairs Authorised:	TBA
Claim Reference:	SNM18D04519C01	Estimated Repair Time:	7 day(s)
Policy Number:	DMPCSN1717471801	Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	HYUNDAI
Model:	Elantra
Sub Model:	A ELITE
Model Sheet Number:	3032 03
Registration:	SKG9618S
Registration Month:	October
Registration Year:	2012
VIN Number:	KMHDH41CMDU648446
Manufacture Year:	2012
Odometer:	Not Known
Colour:	Silver
Engine Number:	
Fuel Level:	%



Model Specs

FROM 08/2012	AIR CONDITIONING
CENTRAL LOCKING	REAR ELECT WINDOWS
KEYLESS ENTRY	MIRROR W/NDICATOR
ELECT FOLDING MIRROR	FOG LAMPS
GRILLE CHROME/BLACK	IMMOBILISER
ANTI THEFT ALARM	REAR BRAKE DRUM
REAR PARKING SYSTEM	1.6 LTR 97KW
AUTO GEARBOX 6 SPEED	STRG COLUMN ADJUST
TWIN AIRBAGS	ABS
TYRES 205/55 HR 16	WHEELS 6.5J X 16 ALU
EMISSION STD EURO 4	ESP
4-DOOR	D/MLDG BLACK BRIGHT
RIGHT HAND DRIVE	PREPARE OFF VEHICLE
TWO COAT PEARL/MICA	

Vehicle Condition

Vehicle Status

Pre-Accident Condition:	Severity of Impact:
Steering:	Vehicle Status on Inspection:
Brakes Pedal Travel:	Date of Inspection:
Place of Inspection:	19/09/2018
Pre-Accident Damage:	
Tyres Condition:	Tread Depth RHF:
Tread Depth LHF:	Tread Depth RHR:
Tread Depth LHR:	Direction of Impact:
Damage Areas:	

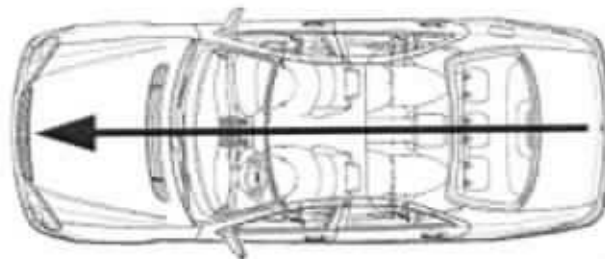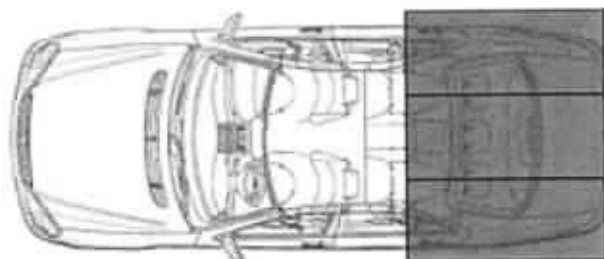

Addresses

Repairer

Name : CHENG HOE MOTOR PTE LTD

Address :

NO 10, AMK IND PK 2A

01-04

Post Code : 568047

Cost Summary

Total Labour	\$932.40
Total Paint/Material	\$213.67
Total Parts	\$1,934.00
Total of Additional Costs	\$235.00
Excess:	- \$0.00
Grand Total Exc GST:	\$3,315.07
7 % GST:	\$232.05
Grand Total Inc GST:	\$3,547.12

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$42.00/HR

Price/Dent = \$42.00/HR

Repair /

Guide Number	Repair Details	WU	Cost Price (\$)
86520R00	RENEW COMPLETE REAR BUMPER INCLUDES: R + R OUTER TAIL LAMPS AND NECESSARY TRIMS, RENEW REAR BUMPER AND BUMPER CARRIER, CONVERT ATTACHED PARTS, RENEW IF NECESSARY	8.0	33.60
69200R00	RENEW BOOTLID INCLUDES: R + R TRIM ASSEMBLE ATTACHED PARTS IF NECESS RENEW	11.0	46.20
79210R00)	R + R L/BOOTLID HINGE	4.0	16.80
81214R00	R + R BOOTLID LOCKING PLATE	2.0	8.40
87321R00	R + R BOOT LID RUBBER SEAL	2.0	8.40
NO NUMBER	RENEW END PANEL	45.0	189.00
2695	PANEL WORK REAR END	20.0*	84.00
3485	REPAIR L/R OUT QTR PANEL	10.0*	42.00
3901	REPAIR BOOTFLOOR	15.0*	63.00

LABOUR COST

Total Work Units	117.0	
Corrosion Protection External Labour	0.0HRS	0.00
Corrosion Protection Internal Labour	0.0HRS	0.00
Sub Total	11.7HRS	\$491.40
Paint Labour	10.5HRS	\$441.00

Total Labour **22.2HRS** **\$932.40**

PAINT WORK		Time Basis 10 WU = 1 HR. Price = \$42.00/HR	
Guide Number	Description	WU	Cost Price (\$)
	- PREPARE OFF VEHICLE		
	- TWO COAT PEARL/MICA		
2711	REAR PANEL NEW PART PAINTING	18.0	
2931	BOOTLID NEW PART PAINTING	16.0	
2583	REAR BUMPER NEW PART PAINT K1R	13.0	
3485	L/R OUT QTR PANEL REPAIR PAINTING <50%	13.0	
3901	BOOTFLOOR SURFACE PAINT	15.0*	
LABOUR COST - PAINT			
TIME(PAINT)		75.0	
Preparation Main Work Plastic		5.0	
Preparation Main Work Metal		25.0	
Preparation Work Multi Layer Paint		0.0	
Total Work Units (10WU/HR)		105.0	
Total Paintwork Labour		10.5HRS	\$441.00
MATERIAL COST - PAINT			Cost Price
New Part Painting			\$64.14
New Part Painting - Plastic K1R			\$63.96
Material-Constant Main Work Metal			\$28.60
Surface-/Blend Paint			\$29.88
Repair Painting			\$18.09
Material-Const Main Work Plastic			\$9.00
Total Excluding Pearlescent Uplift			\$213.67
Pearlescent Uplift @ 0.0%			\$0.00
Total Paint Material Cost			\$213.67

PARTS

				Price Valid: 01/06/2015	
Guide No.	Qty	Description	Part Number	Supplier	Price (\$)
3015	1	BADGE "HYUNDAI"	863203X000		22.00*
3014	1	BADGE MODEL	863153X100		30.00*
2931	1	BOOTLID	692003X120		410.00*
2977	1	BOOTLID LOCK	812303X010		85.00*
2944	1	BOOTLID SEAL	873213X000		50.00*
2953	1	L/BOOTLID HINGE	792103X000		45.00*
3289	1	L/R INNER LAMP	924303X050		130.00*
3287	1	L/R OUTER LAMP	924103X010		170.00*
3013	1	MANUFACTURER BADGE	863213X000		22.00*
3290	1	R/R INNER LAMP	924403X050		130.00*
3288	1	R/R OUTER LAMP	924203X010		170.00*
3296	1	R/R REFLECTOR	924063X000		22.00*
2583	1	REAR BUMPER	866103X011		195.00*
2640	1	REAR BUMPER SUPPORT	866313X100		130.00*
2711	1	REAR PANEL	691003X000		160.00*
4985	1	REAR PANEL TRIM	857703X000RY		38.00*
2973	1	REAR STRIKER	812103L000		25.00*
f: OEM Parts		Sub Total			\$1,834.00
g: Original		Sundry Parts		(Fixed)	\$100.00
h: Secondhand		Total Parts			\$1,934.00

p: Parallel
x: Exchange

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description	Betterment	Price
REAR NO PLATE SPECIALIST	0%	\$35.00
REVERSE SENSORS SPECIALIST		\$200.00
Total Extras		\$235.00

Final Calculation

Total Parts		\$1,934.00
Labour		
Total Panel/Mechanical	\$491.40	
Total Paintwork	\$441.00	
Total Labour		\$932.40
Additional Costs		
Corr Prot Materials External	\$0.00	
Corr Prot Materials Internal	\$0.00	
Cost of Specialist	\$235.00	
Total of Additional Costs		\$235.00
Total Paint/Material Costs		\$213.67
Grand Total Excludes GST		\$3,315.07
GST @ 7 %		\$232.05
Grand Total Includes GST		\$3,547.12

Assessment Notes

51 Ubi Avenue 1, #01-25
Paya Ubi Industrial Park
Singapore
408933

Finalised

Claim Reference: SNM18D04519C01
Assessment Number: CSKG9618
Version: LKKAUTOC/2
Date Calculated: 12/11/2018 03:42

Full Report - V1
Registration: SKG9618S
Printed: 12/11/2018 11:44

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	LKK AUTO	Date of Incident:	17/09/2018
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	China Taiping Insurance (S) Pt	Repairs Authorised:	TBA
Claim Reference:	SNM18D04519C01	Estimated Repair Time:	7 day(s)
Policy Number:	DMPCSN1717471801	Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	HYUNDAI
Model:	Elantra
Sub Model:	A ELITE
Model Sheet Number:	3032 03
Registration:	SKG9618S
Registration Month:	October
Registration Year:	2012
VIN Number:	KMHDH41CMDU648446
Manufacture Year:	2012
Odometer:	Not Known
Colour:	Silver
Engine Number:	
Fuel Level:	%



Model Specs

FROM 08/2012	AIR CONDITIONING
CENTRAL LOCKING	REAR ELECT WINDOWS
KEYLESS ENTRY	MIRROR W/NDICATOR
ELECT FOLDING MIRROR	FOG LAMPS
GRILLE CHROME/BLACK	IMMOBILISER
ANTI THEFT ALARM	REAR BRAKE DRUM
REAR PARKING SYSTEM	1.6 LTR 97KW
AUTO GEARBOX 6 SPEED	STRG COLUMN ADJUST
TWIN AIRBAGS	ABS
TYRES 205/55 HR 16	WHEELS 6.5J X 16 ALU
EMISSION STD EURO 4	ESP
4-DOOR	D/MLDG BLACK BRIGHT
RIGHT HAND DRIVE	PREPARE OFF VEHICLE
TWO COAT PEARL/MICA	

Vehicle Condition

Vehicle Status

Pre-Accident Condition:	Severity of Impact:	
Steering:	Vehicle Status on	
	Inspection:	
Brakes Pedal Travel:	Date of Inspection:	19/09/2018
Place of Inspection:		
Pre-Accident Damage:		
Tyres Condition:		
Tread Depth LHF:	Tread Depth RHF:	
Tread Depth LHR:	Tread Depth RHR:	
Damage Areas:	Direction of Impact:	

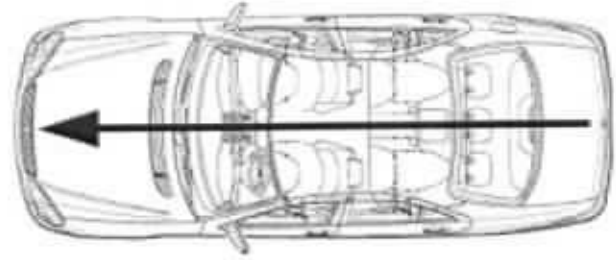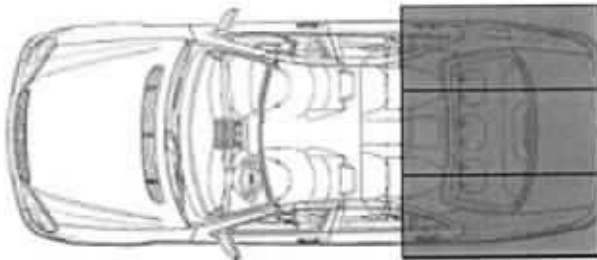

Addresses

Repairer

Name : CHENG HOE MOTOR PTE LTD

Address :

NO 10, AMK IND PK 2A

01-04

Post Code : 568047

Cost Summary

Total Labour	\$932.40
Total Paint/Material	\$213.67
Total Parts	\$1,934.00
Total of Additional Costs	\$235.00
Excess:	- \$0.00
Grand Total Exc GST:	\$3,315.07
7 % GST:	\$232.05
Grand Total Inc GST:	\$3,547.12

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$42.00/HR
Price/Dent = \$42.00/HR

Repair / Guide Number	Repair Details	WU	Cost Price (\$)
86520R00	RENEW COMPLETE REAR BUMPER INCLUDES: R + R OUTER TAIL LAMPS AND NECESSARY TRIMS, RENEW REAR BUMPER AND BUMPER CARRIER, CONVERT ATTACHED PARTS, RENEW IF NECESSARY	8.0	33.60
69200R00	RENEW BOOTLID INCLUDES: R + R TRIM ASSEMBLE ATTACHED PARTS IF NECESS RENEW	11.0	46.20
79210R00)	R + R L/BOOTLID HINGE	4.0	16.80
81214R00	R + R BOOTLID LOCKING PLATE	2.0	8.40
87321R00	R + R BOOT LID RUBBER SEAL	2.0	8.40
NO NUMBER	RENEW END PANEL	45.0	189.00
2695	PANEL WORK REAR END	20.0*	84.00
3485	REPAIR L/R OUT QTR PANEL	10.0*	42.00
3901	REPAIR BOOTFLOOR	15.0*	63.00
LABOUR COST			
Total Work Units		117.0	
Corrosion Protection External Labour		0.0HRS	0.00
Corrosion Protection Internal Labour		0.0HRS	0.00
Sub Total		11.7HRS	\$491.40
Paint Labour		10.5HRS	\$441.00

Total Labour **22.2HRS** **\$932.40**

PAINT WORK		Time Basis 10 WU = 1 HR. Price = \$42.00/HR	
Guide Number	Description	WU	Cost Price (\$)
	- PREPARE OFF VEHICLE		
	- TWO COAT PEARL/MICA		
2711	REAR PANEL NEW PART PAINTING	18.0	
2931	BOOTLID NEW PART PAINTING	16.0	
2583	REAR BUMPER NEW PART PAINT K1R	13.0	
3485	L/R OUT QTR PANEL REPAIR PAINTING <50%	13.0	
3901	BOOTFLOOR SURFACE PAINT	15.0*	
LABOUR COST - PAINT			
TIME(PAINT)		75.0	
Preparation Main Work Plastic		5.0	
Preparation Main Work Metal		25.0	
Preparation Work Multi Layer Paint		0.0	
Total Work Units (10WU/HR)		105.0	
Total Paintwork Labour		10.5HRS	\$441.00
MATERIAL COST - PAINT			Cost Price
New Part Painting			\$64.14
New Part Painting - Plastic K1R			\$63.96
Material-Constant Main Work Metal			\$28.60
Surface-/Blend Paint			\$29.88
Repair Painting			\$18.09
Material-Const Main Work Plastic			\$9.00
Total Excluding Pearlescent Uplift			\$213.67
Pearlescent Uplift @ 0.0%			\$0.00
Total Paint Material Cost			\$213.67

PARTS

Price Valid: 01/06/2015

Guide No.	Qty	Description	Part Number	Supplier	Bet.	Price (\$)
3015	1	BADGE "HYUNDAI"	863203X000		0%	22.00*
3014	1	BADGE MODEL	863153X100		0%	30.00*
2931	1	BOOTLID	692003X120		0%	410.00*
2977	1	BOOTLID LOCK	812303X010		0%	85.00*
2944	1	BOOTLID SEAL	873213X000		0%	50.00*
2953	1	L/BOOTLID HINGE	792103X000		0%	45.00*
3289	1	L/R INNER LAMP	924303X050		0%	130.00*
3287	1	L/R OUTER LAMP	924103X010		0%	170.00*
3013	1	MANUFACTURER BADGE	863213X000		0%	22.00*
3290	1	R/R INNER LAMP	924403X050		0%	130.00*
3288	1	R/R OUTER LAMP	924203X010		0%	170.00*
3296	1	R/R REFLECTOR	924063X000		0%	22.00*
2583	1	REAR BUMPER	866103X011		0%	195.00*
2640	1	REAR BUMPER SUPPORT	866313X100		0%	130.00*
2711	1	REAR PANEL	691003X000		0%	160.00*
4985	1	REAR PANEL TRIM	857703X000RY		0%	38.00*
2973	1	REAR STRIKER	812103L000		0%	25.00*
f: OEM Parts		Sub Total				\$1,834.00
g: Original		Sundry Parts		(Fixed)		\$100.00
h: Secondhand		Total Parts				\$1,934.00

p: Parallel
x: Exchange

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras	Description	Betterment	Price
	REAR NO PLATE SPECIALIST	0%	\$35.00
	REVERSE SENSORS SPECIALIST		\$200.00
	Total Extras		\$235.00

Final Calculation

Total Parts		\$1,934.00
Labour		
Total Panel/Mechanical	\$491.40	
Total Paintwork	\$441.00	
Total Labour		\$932.40
Additional Costs		
Corr Prot Materials External	\$0.00	
Corr Prot Materials Internal	\$0.00	
Cost of Specialist	\$235.00	
Total of Additional Costs		\$235.00
Total Paint/Material Costs		\$213.67
Grand Total Excludes GST		\$3,315.07
GST @ 7 %		\$232.05
Grand Total Includes GST		\$3,547.12

Assessment Notes

Claim Documents

SKG9618S (SNM18D04519C01)

OD





Sep 17 2018 5:00AM

[LEE CHOON HUAT]

Cheng Hoe Motor Pte Ltd

Upload Documents		Upload Photos	Compose New Letter	View View in Browser	
Assessment Reports				1 per page	<input checked="" type="checkbox"/>
No	Finalized On	Cheng Hoe Motor Pte Ltd (Yishun)	Thumbnail	Print	
1	17/09/18 17:20	Accident Statement	Load HTM		
2	18/09/18 14:47	Addendum Sheet	Load JPG	<input checked="" type="checkbox"/>	
3	18/09/18 14:48	Accident Statement Addm. #1	Load HTM		
4	19/09/18 14:12	Repairer Estimates	Load HTM		
		LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print	
1	21/09/18 14:41	Adjuster Immediate Advice	Load HTM		
Photos/Images				3 per page	<input checked="" type="checkbox"/>
No	Finalized On	Cheng Hoe Motor Pte Ltd (Yishun)	Thumbnail	Print	
1	17/09/18 17:20	IC & DL [Linked Accident Report Documents]	Load JPG	<input checked="" type="checkbox"/>	
2	17/09/18 17:20	Accident Photo [Linked Accident Report Documents]	Load JPG	<input checked="" type="checkbox"/>	
3	17/09/18 17:20	Accident Photo [Linked Accident Report Documents]	Load JPG	<input checked="" type="checkbox"/>	
4	17/09/18 17:20	Accident Photo [Linked Accident Report Documents]	Load JPG	<input checked="" type="checkbox"/>	
5	17/09/18 17:20	Accident Photo [Linked Accident Report Documents]	Load JPG	<input checked="" type="checkbox"/>	
6	17/09/18 17:20	Accident Photo [Linked Accident Report Documents]	Load JPG	<input checked="" type="checkbox"/>	
7	17/09/18 17:20	Accident Photo [Linked Accident Report Documents]	Load JPG	<input checked="" type="checkbox"/>	
		LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print	
1	21/09/18 14:42	General View	Load PDF		
2	12/11/18 11:34	Reinspection Photo (1)	Load PDF		
3	12/11/18 11:34	Reinspection Photo (2)	Load PDF		
Documentation				1 per page	<input checked="" type="checkbox"/>
No	Finalized On	Cheng Hoe Motor Pte Ltd (Yishun)	Thumbnail	Print	
1	17/09/18 17:19	Sketch Plan [Linked Accident Report Documents]	Load JPG	<input checked="" type="checkbox"/>	
2	17/09/18 17:19	Sketch Plan #2 [Linked Accident Report Documents]	Load JPG	<input checked="" type="checkbox"/>	
3	17/09/18 17:19	Sketch Plan #3 [Linked Accident Report Documents]	Load JPG	<input checked="" type="checkbox"/>	
4	17/09/18 17:19	Sketch Plan #4 [Linked Accident Report Documents]	Load JPG	<input checked="" type="checkbox"/>	
5	17/09/18 17:19	Sketch Plan #5 [Linked Accident Report Documents]	Load JPG	<input checked="" type="checkbox"/>	
6	17/09/18 17:19	Sketch Plan #6 [Linked Accident Report Documents]	Load JPG	<input checked="" type="checkbox"/>	
7	19/09/18 14:04	OWNER IC FRONT	Load JPG	<input checked="" type="checkbox"/>	
8	19/09/18 14:04	OWNER IC BACK	Load JPG	<input checked="" type="checkbox"/>	
9	19/09/18 14:04	DRIVER IC & DL	Load JPG	<input checked="" type="checkbox"/>	
		LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print	
1	21/09/18 14:42	ESTIMATE MARKING	Load PDF		
2	21/09/18 14:43	AUDATEX	Load PDF		

Linked Accident Report Documents

Assessment Reports			View	View in Browser
No	Finalized On	Cheng Hoe Motor Pte Ltd (Yishun)	1 per page	<input checked="" type="checkbox"/>
1	17/09/18 17:20	Accident Statement	 Load HTML	<input type="checkbox"/>
2	18/09/18 14:47	Addendum Sheet	 Load JPG	<input checked="" type="checkbox"/>
3	18/09/18 14:48	Accident Statement Addm. #1	 Load HTML	<input type="checkbox"/>
Photos/Images			3 per page	<input checked="" type="checkbox"/>
No	Finalized On	Cheng Hoe Motor Pte Ltd (Yishun)	Thumbnail	Print
1	17/09/18 17:20	IC & DL	 Load JPG	<input checked="" type="checkbox"/>
2	17/09/18 17:20	Accident Photo	 Load JPG	<input checked="" type="checkbox"/>
3	17/09/18 17:20	Accident Photo	 Load JPG	<input checked="" type="checkbox"/>
4	17/09/18 17:20	Accident Photo	 Load JPG	<input checked="" type="checkbox"/>
5	17/09/18 17:20	Accident Photo	 Load JPG	<input checked="" type="checkbox"/>
6	17/09/18 17:20	Accident Photo	 Load JPG	<input checked="" type="checkbox"/>
7	17/09/18 17:20	Accident Photo	 Load JPG	<input checked="" type="checkbox"/>
Documentation			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	Cheng Hoe Motor Pte Ltd (Yishun)	Thumbnail	Print
1	17/09/18 17:19	Sketch Plan	 Load JPG	<input checked="" type="checkbox"/>
2	17/09/18 17:19	Sketch Plan #2	 Load JPG	<input checked="" type="checkbox"/>
3	17/09/18 17:19	Sketch Plan #3	 Load JPG	<input checked="" type="checkbox"/>
4	17/09/18 17:19	Sketch Plan #4	 Load JPG	<input checked="" type="checkbox"/>
5	17/09/18 17:19	Sketch Plan #5	 Load JPG	<input checked="" type="checkbox"/>
6	17/09/18 17:19	Sketch Plan #6	 Load JPG	<input checked="" type="checkbox"/>

Documents Checklist

DOCUMENTS CHECKLIST		Reset	Save	Print
There are no document checklists configured.				
Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)				
<div></div>				
Show Remarks To: <input type="checkbox"/> Repairer <input type="checkbox"/> Handling Insurer				
Note: Remarks are private unless you show it to other parties.				

LKK Auto Consultants Pte Ltd

(Co.Reg No: 199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

China Taiping Insurance (Singapore) Pte. Ltd.
3 Anson Road, #16-00 Springleaf Tower
Singapore 079909

Our File No: CS/CTI18017080/KVD3E2

Date: 15/11/2018

REFERENCE

Insured/Claimant: LEE CHOON HUAT Policy No: DMPCSN1717471801
Date of Loss: 17/09/2018 Nature of Claim: OD Claim No: SNM18D04519C01

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SKG9618S**
Make & Model: HYUNDAI ELANTRA, 1.6 (A) Engine No: G4FGCU641280
Reg. Date: 25/10/2012 (Man. Year: 2012) Chassis No: KMHDH41CMDU648446
Colour: Metallic Silver Odometer: 84014 km
Engine Capacity: 1591 cc
Market Value/New Car Price: S\$42,000.00
Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 205/55 R16 Rear Tyre Size: 205/55 R16
Front Left Side: Bridgestone 8 mm Rear Left Side: Yokohama 6 mm
Front Right Side: Bridgestone 8 mm Rear Right Side: Yokohama 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	1,896.00	1,834.00	62.00	3.27
Miscellaneous Items	335.00	335.00	0.00	0.00
Labour	1,594.44	1,146.07	448.37	28.12
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	3,825.44	3,315.07	510.37	13.34
Approved Total (Overridden) (S\$)		3,200.00		
(S\$)	3,825.44	3,200.00	625.44	16.35
+ GST 7.00/7.00% (S\$)	267.78	224.00	43.78	16.35
Nett Amount (S\$)	4,093.22	3,424.00	669.22	16.35

INSPECTION

Date of Assignment: 19/09/2018 Present Location: Cheng Hoe Motor Pte Ltd (Yishun)
Date Inspected: 20/09/2018 Inspected At: Cheng Hoe Motor Pte Ltd (Yishun)
Blk 1019 #01-374/382, Yishun Industrial Park A
Singapore 768761
Estimated Period of Repair: 5.0 days

Adjuster: KENNETH KONG**Manager:** VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 15 Nov 2018)
Parts:	143	HYUNDAI ELANTRA 1.6 (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SKG9618S)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1	NA	*BADGE "HYUNDAI"	Necessary	22.00 F	*22.00 F
2	1	NA	*BADGE MODEL	Necessary	30.00 F	*30.00 F
3	1	NA	*BOOTLID	Bent	410.00 F	*410.00 F
4	1	NA	*BOOTLID LOCK	Dented	85.00 F	*85.00 F
5	1	NA	*BOOTLID SEAL	Distorted / Dented	50.00 F	*50.00 F
6	1	NA	*L/BOOTLID HINGE	Bent	45.00 F	*45.00 F
7	1	NA	*L/R INNER LAMP	Cracked	130.00 F	*130.00 F
8	1	NA	*L/R OUTER LAMP	Cracked	170.00 F	*170.00 F
9	1	NA	*MANUFACTURER BADGE	Necessary	22.00 F	*22.00 F
10	1	NA	*R/BOOTLID HINGE	Repair	45.00 F	*- F
11	1	NA	*R/R BUMPER BRACKET	Serviceable	17.00 F	*- F
12	1	NA	*R/R INNER LAMP	Cut	130.00 F	*130.00 F
13	1	NA	*R/R OUTER LAMP	Cracked	170.00 F	*170.00 F
14	1	NA	*R/R REFLECTOR	Cracked	22.00 F	*22.00 F
15	1	NA	*REAR BUMPER	Bent	195.00 F	*195.00 F
16	1	NA	*REAR BUMPER SUPPORT	Cracked	130.00 F	*130.00 F
17	1	NA	*REAR PANEL	Bent	160.00 F	*160.00 F
18	1	NA	*REAR PANEL TRIM	Buckled	38.00 F	*38.00 F
19	1	NA	*REAR STRIKER	Distorted	25.00 F	*25.00 F

F=Franchise part.

Total Parts (S\$)	1,896.00	1,834.00
--------------------------	-----------------	-----------------

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

No	Qty	Particulars	Repairer's	Amount
Miscellaneous Items				
1	1	SPECIALIST REAR NO PLATE (SCRATCHED)	35.00	35.00
2	1	SPECIALIST REVERSE SENSORS (SHORTED)	200.00	200.00
3	1	SUNDRY PARTS (NECESSARY)	100.00	100.00
Sub Total (S\$)			335.00	335.00

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	Total Paint Labour	New	504.00	441.00
2	Total Paint Materials	New	250.44	213.67
3	Total Panel/Mechanical Labour	New	840.00	491.40
Gross Labour Cost (S\$)			1,594.44	1,146.07

Report was unsubmitted during this print-out.

< END OF ESTIMATES >