

Surrogate: NAZ REF: NS/2NC18017091/NH622 TAX/09/18/2047

### ASSIGNMENT

From: \_\_\_\_\_ Date: \_\_\_\_\_  
 Estimated Cost: \_\_\_\_\_  
OD / TP / WS / TP RES / OD RES / EVA / INV / MV  
 To Inspect Vehicle No: \_\_\_\_\_  
 at Workshop m/s \_\_\_\_\_  
 of \_\_\_\_\_  
 Insured: PC 5013A  
 Policy No. 508039 0393-02 180518-170519  
 Claims No. WT/1011704-002  
 Sum Insured: \_\_\_\_\_ Excess: \_\_\_\_\_  
 (Client's Record)  
 Make of Veh: \_\_\_\_\_

(Policy Condition)

Remark: The veh had commenced its  
 repair at the time of inspection.

N/S	O/S

Bal. or Market Value: \_\_\_\_\_  
 IDAC Accident Rpt: \_\_\_\_\_ Consistent? : Yes or No  
 GIA / PR Seen: \_\_\_\_\_ Consistent? : Yes or No  
 Est. Repairs: 3 days Res.: Yes or No  
 Lum Sum: \_\_\_\_\_ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: \_\_\_\_\_ Person Contacted: \_\_\_\_\_

Veh No: SHB 360E Yr Regn: 27 AUG 2014  
 Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: TOYOTA PRINS c.c. 1,798  
 Colour BROWN MAVEON A/C: Insured / Std / NI / NA  
 Sp. Reading 433,456 T/Radio: Insured / Std / NI / NA

Eng/No: \_\_\_\_\_  
 C/No: JTDKN364105747874

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 195/65 R15

R: 11

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or FALKEN

Front

Rear

R/Bal. 5 mm

R/Bal. 5 mm

L/Bal. 5 mm

L/Bal. 5 mm

D.O.A. 11/9/18

D.O.I. 12/9/18

Survey held at SMRT WOODLAND 3

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

O/S REAR

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
	<u>SHB 360E - C3/TLT08183716 / Z</u>
	<u>PC 5013A - X</u>
	<u>lump sum \$2200, 3 days cred: 5939.20, 57%</u>
	<u>RECEIVED 11 JAN 2018</u>

Date/Time, File Pass to?

1) 1011 Typist

Date/Time, File Return to?

2)

☐ : Prel. Report  
☒ : Final Report

Days Of Repair: 3

Resurvey No. of Trip: 1

Survey Fee:

Transportation:

Add Fee: ☐ : Site Insp (\$ ) S + RS \$  
☐ : Interview (\$ ) Photos  
☐ : Tech. Invs (\$ ) Others  
☐ : Weekend (\$ )

Report Format: TP

Lump Sum / I.B.I: (\$ 2200)

TOTAL



# National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



NTUC INCOME INSURANCE CO-OPERATIVE LTD Ref: NS/INC18017091/Ntb

73 BRAS BASAH ROAD

#05-01 NTUC TRADE UNION HOUSESINGAPORE Date: 19-09-2018

189556



Code: INC4

## 1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	PC 5013	Veh. Inspected	SHB 360E
Policy No.	5080390393-02	Coverage (\$)	0.00
Claim No.		Excess (\$)	0.00
Assign From		Assign Date	12/09/2018

## 2. Vehicle Particulars & Condition

Make & Model	c.c	0
Engine No.	HIDDEN	Year of Reg.
Chassis No.		Colour
Odometer	-	Steering
Brakes		Modification
General		

## 3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm

## 4. Description of Damages

## 5. General Information

Accident Date	11/09/2018	Inspection Date	12/09/2018
Survey held at	SMRT AUTOMOTIVE SERVICES PTE LTD 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705		

## 5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.  
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

S/No	Income Reference	Claimant (Owner / Taxi Company)	Claimant Vehicle No.	Income Vehicle No.	Date of Accident	Estimate
1	MT/1018818-003	SMRT TAXIS PTE LTD	SHB 996X	GQ 8343K	05/11/2018	\$ 13,972.60
2	MT/1024768-002	CITYCAB PTE LTD	SHA 9592Z	SKA 5169D	19/12/2018	\$ 2,273.54
3	MT/1024650-002	COMFORT TRANSPORTATION PTE LTD	SHD 3102D	SJQ 7181G	19/12/2018	\$ 4,301.92
4	MT/1025318-002	COMFORT TRANSPORTATION PTE LTD	SH 8356D	SMC 3831D	26/12/2018	\$ 1,868.80
5	MT/1025432-002	COMFORT TRANSPORTATION PTE LTD	SHA 3267C	SGU 5180L	26/12/2018	\$ 6,430.12
6	MT/1027231-001	COMFORT TRANSPORTATION PTE LTD	SHC 8082A	SJN 5816M	21/12/2018	\$ 4,226.00
7	MT/1011204-002	SMRT TAXIS PTE LTD	SHB 360E	PC 5013A	11/09/2018	\$ 9,044.20

eBaoTech

GeneralClaim

Hello, NAC\_PAYA\_UBT\_800601

[Change Language](#)[Change Password](#)[Log Out](#)[My Desktop](#)[Notice of Loss](#)

## Policy Query

Policy No.  Date of Accident   
Vehicle No.(For Motor)  Certificate Number

Select	Policy No.	Certificate Number	Policyholder Name	Policyholder NRIC	Product	Cover Type	Vehicle No.	Insured Object	Commence Date	Expiry Date
<input checked="" type="radio"/>	5080390393-02		LOGOS CHRISTIAN CHURCH	S89550079F	GBS	Comprehensive	PC5013A	PC5013A	18/05/2018	17/05/2019

## SINGAPORE ACCIDENT STATEMENT

### IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

### ACCIDENT STATEMENT

Date Of Report	12/09/2018 10:48
Date Of Accident	11/09/2018 19:10
Exact Location Of Accident	UPPER SERANGOON ROAD /HOUGANG AVE 7 JUNCTION
Country/State of Loss	SINGAPORE

### DETAILS OF OWN VEHICLE

Vehicle Registration Number	SHB360E
<b>Insured/Policyholder</b>	
Name Of Registered Owner	SMRT TAXIS PTE LTD
Co Reg No	198905369K
Email Address	NOEMAIL
Mobile Phone No	
Alternative Phone No	OFFICE-80000000

### Vehicle Particulars

Manufacturer	TOYOTA
Model	PRIUS TAXI-1.8 (A)
Exact Purpose for which vehicle was being used at time of accident	HIRE AND REWARD
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	TAXI

### Insurance Company

Name of Insurance Company	MS FIRST CAPITAL INSURANCE LTD
Type Of Coverage	THIRD PARTY
Fleet Policy	YES
Policy Number	D-18090213MFSH
Cover Note Number	

### Driver

Name of Driver	MOHAMMED TAHIR BIN ABDUL
NRIC No	S2172204I
Date Of Birth	09/10/1958
Occupation	OUTDOOR
Date Of Driving Pass	29/08/2002
Driving Experience	16 YEARS AND 0 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-80000000
Fax Number	
Contact Number	
E-Mail Address	NOEMAIL

Address	11
Postcode	
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OTHER - HIRER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

#### General Information of the Accident

Type Of Accident	SIDE SWIPE
Weather Conditions	CLEAR
Road Surface	DRY

#### Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles involved in the accident	
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	4

Passenger 1	NAME: : UNKNOWN
	GENDER: : FEMALE
Passenger 2	NAME: : UNKNOWN
	GENDER: : MALE
Passenger 3	NAME: : UNKNOWN
	GENDER: : MALE

#### Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

#### Circumstances of Accident

I WAS STATIONARY ALONG UPPER SERANGOON ROAD TOWARDS SENGKANG WITH THREE PASSENGERS ON BOARD (FEMALE ADULT / 2 CHILDREN BOYS CHINESE) AS IT WAS THE RED TRAFFIC LIGHT. WHILST I WAS STILL STATIONARY, I FELT AN IMPACT AT THE RIGHT PORTION OF MY TAXI. A VEHICLE PC5013A HAD COLLIDED ONTO THE RIGHT REAR PORTION OF MY TAXI.

#### Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

#### DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	PC5013A
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	COMMERCIAL VEHICLE
Name of Driver	WONG CHIAU YOU

NRIC/Passport Number

S1441619F

Contact Number

Address

Postcode

Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)





SKETCH PLANIMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
  - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
  - (ii) investigating the accident and/or my claims;
  - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
  - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
  - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
  - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
  - (ii) for complying with requirements under any regulations, laws or court orders.



Policyholder's Signature  
Date & Time:

Driver's Signature  
(If driver is not the policyholder)

Date & Time: 12/9/2018

Reporting Centre Personnel's Signature  
Name:  
NRIC/FIN No.:

> [Back to OneMotoring](#)

## Enquire Transfer Fee

### Vehicle Details

Vehicle No. :	SHB360E
Vehicle Type :	H10 - Public Transport Taxi (Motor Car)
Vehicle Attachment 1 :	Air-Con (Taxi)
Vehicle Scheme :	Taxi (Company)
Vehicle Make :	TOYOTA
Vehicle Model :	PRIUS TAXI (SMRT)
Chassis No. :	JTDKN36U105747874
Propellant :	Petrol-Electric
Engine No. :	2ZR6113368
Motor No. :	3JM6113368
Engine Capacity :	1798 cc
Power Rating :	60.0 kW
Maximum Power Output :	100.0 kW ( 134 bhp )
Maximum Laden Weight :	1805 kg
Unladen Weight :	1370 kg
Year Of Manufacture :	2014
Original Registration Date :	27 Aug 2014
Lifespan Expiry Date :	26 Aug 2022
COE Category :	A - Car up to 1600cc & 97kW (130bhp)
PQP Paid :	\$50,088.00
COE Expiry Date :	26 Aug 2022
Road Tax Expiry Date :	26 Feb 2019
PARF Eligibility Expiry Date :	26 Aug 2022
Inspection Due Date :	26 Feb 2019
Intended Transfer Date :	11 Jan 2019
CO2 Emission :	92.00 (g/km)
CEV/VES Rebate Utilised Amount :	\$30,000.00
CO Emission :	-
HC Emission :	-
NOx Emission :	-
PM Emission :	-

The current road tax expiry is 26 Feb 2019. You may renew the road tax from 27 Nov 2018 with all pre-requisite(s) fulfilled. If the road tax is renewed after 26 Feb 2019, late renewal fee(s) will be imposed. Please use [Enquire Road Tax Payable](#) to check on the late fee(s) payable.

Road tax, including Over Payment (if any), of a vehicle will follow the vehicle to the new registered owner when its ownership is being transferred.

### Amount Payable (From 27 Feb 2019 to 26 Aug 2019)

	Amount Before GST (S\$)	GST Amount (S\$)	Amount After GST (S\$)
Transfer Fee :	25.00	-	25.00
<b>Sub Total :</b>			<b>25.00</b>
Nett Road Tax Amount (After Offsetting Over Payment) :	510.00	-	510.00
<b>Total Amount Payable :</b>			<b>535.00</b>

### Message

Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.

You may print this page for reference.

[OK](#)

[Print](#)

## Section A - Accident Details

Registration Number	SHB360E
Case Reference Number	TAX/09/16/2047
Registration Date	27/08/14
Company Type	SMRT Taxis Pte Ltd
Make	TOYOTA
Model	PRIUS
Name of Driver	MOHAMMED TAHIR BIN ABDUL LATIFF
Type of Accident	Side Swipe
Accident Date and Time	11/09/18 7:10 PM
Accident Reported Date and Time	12/09/18 10:30 AM
Is Surveyor Required?	Yes
Survey by	
Vehicle is Towed Back?	No
Towed Back Date and Time	
Replacement Vehicle issued?	No
Job Card Number	24097909
Special Instruction to ARC, if any	
Prepared Date and Time	14/10/18 11:54 AM
Chassis Number	
Mileage	
Work Shop	
Repair Completion Date and Time	

## Section B - Summary of Repair Estimates

Summary of Repair Estimates		
	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Cost	\$845.00	\$400.00
Total Spray Cost	\$1,494.00	\$730.00
Total Spare Part Cost	\$4,396.76	\$1,396.38
Total Other Cost	\$965.00	(\$326.38)
<b>TOTAL COST</b>	<b>\$7,700.76</b>	<b>\$2,200.00 (L/S)</b>
Lump Sum Total	\$0.00	\$0.00
Number of Repair Days	5.0	3
Prepared / Adjusted By	Kim Ming Chin	Naz (LKK) / NTUC
ARC / Surveyor Sign Off Date		
Signature		
Remarks		

## Section C - Quotation and Accident Invoice Details

Quotation Number	QN-1812-0391	Invoice Number	
Quotation Date	18.12.2018	Invoice Date	
Invoice Amount		Prepared Date	

## Section D - Details of Repair Estimates

## Part 1 - Labour Works

Job Scope	Quotation from AR	Adjusted by Surveyor, if applicable
TO REPAIR RH REAR PORTION	\$845.00	\$400.00
Total Labour	\$845.00	\$400.00

## Part 2 - Spray Painting &amp; Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO RESPRAY REAR DOOR RH	\$378.00	\$200.00
TO RESPRAY REAR FENDER RH	\$378.00	\$200.00
TO RESPRAY RIM	\$180.00	\$50.00
TO RESPRAY ROCKER PANEL MOULDING	\$180.00	\$80.00
TO REPSRAY REAR BUMPER	\$378.00	\$200.00
Total Spray Painting & Panel Beating	\$1,494.00	\$730.00

## Part 3 - Other Costs - Accident and Accident Repair Related Expense

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO CHECK WIRING AND SYSTEM FUNCTION	\$80.00	\$20.00
TO DO WHEEL ALIGNMENT / TYRE BALANCING	\$120.00	\$0.00
TO PROVIDE LABOUR & MATERIAL FOR SOLAR FILM (NET)	\$125.00	\$125.00
TO TEST AND REFIX REVERSE SENSOR SYSTEM	\$120.00	\$20.00
TO TRANSFER DOOR MECHANISM	\$120.00	\$0.00
TO REMOVE & REFIT REAR QUARTER GLASS RH	\$120.00	\$30.00
TO REMOVE AND REFIT TYRE RIM (SPRAYING PURPOSE)	\$120.00	\$30.00
TO WASH AND VACUUM	\$60.00	\$0.00
TO REPLACE SUNDRY PARTS	\$100.00	\$0.00
Lump Sum Adjustment by Surveyor	\$0.00	(\$551.38)
Total Other Costs	\$965.00	(\$326.38)

## Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock Number	Part Name	Quantity	List Price (\$)	Discount (%)	Final Price (\$)	Estimator Approved	Surveyor Approved
		6	DOOR RR/RH	1.00	\$954.50	25.00	\$0.00	Replace	Repair
			PIXEL STICKER	1.00	\$60.00	0.00	\$60.00	Replace	Replace
			FENDER RR/RH	1.00	\$766.80	25.00	\$575.10	Replace	Replace
			STICKER DECAL SMRT	1.00	\$7.80	0.00	\$7.80	Replace	Replace
			STICKER DECAL 6555 8888	1.00	\$21.60	0.00	\$21.60	Replace	Replace
			QUARTER GLASS RR/RH	1.00	\$846.50	25.00	\$634.88	Replace	Replace
			SEALANT W/SCREEN	1.00	\$37.00	0.00	\$37.00	Replace	Replace

	Q		MOULDING BODY, RH	1.00	\$673.60	25.00	\$0.00	Replace	Repair <i>XR</i>
	#	42611-47140	WHEEL, DISC	1.00	\$1,484.20	25.00	\$0.00	Replace	Repair <i>XR</i>
6505548	JP	52159-47905	BUMPER REAR	1.00	\$458.60	25.00	\$0.00	Replace	Repair <i>XR</i>
			PIXEL STICKER	1.00	\$60.00	0.00	\$60.00	Replace	Replace <i>NRG</i>
			BUMPER SIDE RETAINER RR/RH	0.00	\$94.80	25.00	\$0.00	Replace	Not Given <i>X SVC</i>
			BUMPER SIDE RETAINER RR/LH	0.00	\$94.80	25.00	\$0.00	Replace	Not Given <i>X SVC</i>
			SENSOR REVERSE	0.00	\$180.00	0.00	\$0.00	Replace	Not Given <i>X SVC</i>
Total					\$5,740.20		\$1,396.38		

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Stock Number	Part Name	Quantity	List Price \$	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check
Total									

4044.20

1396.38  
+ 400.00  
+ 955.00

2751.38

- 207

2201.10

L/S \$2200

CONFIRMED LUMP SUM REPAIR \$2,200.00 / 3 DAYS.

NAL LKX  
H

## SMRT Accident Taxi Repair Estimates

Section A - To be completed by Claims Advisor/Duty Officer at Accident Reporting Centre

Reg. No. : SHB 360E Ref. No. TAX 9 / 18 / 2047

Make / Model : TOYOTA PRIUS Reg. Date : 27/08/2014

Name of Driver : MOHAMMED TAHIR BIN ABDUL LATIFF

Date/Time of Accident : 11/09/2018 19:10

Surveyer is Required ? YES / NO

If Yes, VICOM / LKK / LH Teo / AIS (Please circle one)


Taxi is Towed Back ? YES / NO

Replacement Taxi Issued ? YES / NO

Accident Repair Job Card No. : 24097909

Special Instruction to ARC, if any :

The damages on the Taxi are as indicated in the following diagram :

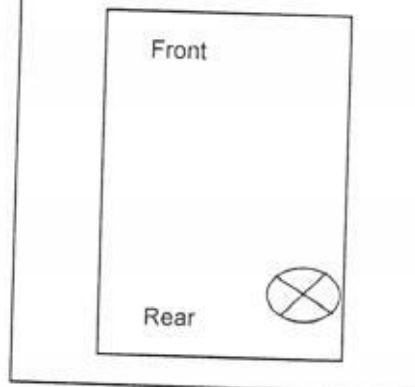

Signed : Date :

Section B - To be Completed by Service Advisor, Accident Repair Centre

Chassis No : JTDKN36U105747874 Mileage :

Date Prepared : Repair Completed date/time:

### Summary of Repair Estimates

	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Charges :	\$ 845.00	\$
Total Spray Painting Charges :	\$ 1494.00	\$
Total Material Charges :	\$ 3517.40	\$
Other Charges :	\$ 965.00	\$
<b>TOTAL</b> :	<b>\$ 6821.40</b>	<b>\$ ( )</b>
No. of Repair Days :	[ 5 ] days	[ 3 ] days

Signature : Prepared by: ZHI YANG  
13/09/2018 11:54

Adjusted by:

Section C - To be Completed by Admin Assistant, Accident Repair Centre, Upon Completion of Repair

QN No. Invoice No. Invoice Date

Signed : Date :



## Part 1 - Labour Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPAIR RH REAR PORTION	\$ 845.00	400
<b>Total Labour</b>	\$ 845.00	\$

## Part 2 - Spray Painting &amp; Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO RESPRAY DOOR REAR RH	\$ 378.00	200
TO RESPRAY REAR FENDER RH	\$ 378.00	200
TO RESPRAY MOULDING BODY RH	\$ 180.00	80
TO RESPRAY RIM	\$ 180.00	50
TO RESPRAY REAR BUMPER	\$ 378.00	200
<b>Total Spray Painting &amp; Panel Beating</b>	\$ 1,494.00	\$

## Part 3 - Other Costs - Accident and Accident Repair Related Expenses

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO CHECK WIRING AND SYSTEM FUNCTION	\$ 80.00	20
TO DO WHEEL ALIGNMENT / TYRE BALANCING	\$ 120.00	X m
TO PROVIDE LABOUR & MATERIAL FOR SOLAR FILM (NET)	\$ 125.00	me
TO TEST AND REFIX REVERSE SENSOR SYSTEM	\$ 120.00	20
TO TRANSFER DOOR MECHANISM	\$ 120.00	X m
TO REMOVE & REFIT REAR QUARTER GLASS RH	\$ 120.00	30
TO REMOVE AND REFIT TYRE RIM (SPRAYING PURPOSE)	\$ 120.00	30
TO WASH AND VACUUM	\$ 100.00	X m
TO REPLACE SUNDRY PARTS	\$ 60.00	X m
<b>Total Other Costs</b>	\$ 965.00	\$







## National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



NTUC INCOME INSURANCE CO-OPERATIVE LTD Ref: NS/INC18017091/Ntbs2

73 BRAS BASAH ROAD

#05-01 NTUC TRADE UNION HOUSESINGAPORE Date: 11-01-2019

189556



Code: INC4

### 1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	PC 5013	Veh. Inspected	SHB 360E
Policy No.	5080390393-02	Coverage (\$)	0.00
Claim No.	MT/1011204-002	Excess (\$)	0.00
Assign From		Assign Date	13/09/2018

### 2. Vehicle Particulars & Condition

Make & Model	TOYOTA PRIUS	c.c	1798
Engine No.	HIDDEN	Year of Reg.	2014
Chassis No.	JTDKN36U105747874	Colour	MAROON
Odometer	433456	Steering	IN ORDER
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
General	FAIR		

### 3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	195/65R15	FALKEN	5 mm
L/H Front Tyre	195/65R15	FALKEN	5 mm
R/H Rear Tyre	195/65R15	FALKEN	5 mm
L/H Rear Tyre	195/65R15	FALKEN	5 mm

### 4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE O/S REAR PORTION. DAMAGES SEE DETAILS.
--------------------------------------------------------------------------------

### 5. General Information

Accident Date	11/09/2018	Inspection Date	13/09/2018
Survey held at	SMRT AUTOMOTIVE SERVICES PTE LTD 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705		

### 5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
----------------------------------------------------------------------------------------------------------------------------------------

### 5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	3 Working Days
-------------------------------------	----------------

**National Assessment Centre Services**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



Page No.: 1 of 2

**ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHB 360E**

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b><u>REPLACEMENT OF PARTS</u></b>				
1	FENDER RR/RH (DISC 25%)	DENTED	766.80	575.10
1	QUARTER GLASS RR/RH (DISC 25%)	NECESSARY	846.50	634.88
1	PIXEL STICKER (SN)	NECESSARY	60.00	60.00
1	STICKER DECAL SMRT (SN)	NECESSARY	7.80	7.80
1	STICKER DECAL 6555 8888 (SN)	NECESSARY	21.60	21.60
1	SEALANT W/SCREEN (SN)	NECESSARY	37.00	37.00
1	PIXEL STICKER (SN)	NECESSARY	60.00	60.00
1	BUMPER SIDE RETAINER RR/RH	SERVICEABLE	94.80	-
1	BUMPER SIDE RETAINER RR/LH	SERVICEABLE	94.80	-
1	SENSOR REVERSE	SERVICEABLE	180.00	-
1	DOOR RR/RH	TO REPAIR SEE LABOUR	954.50	-
1	MOULDING BODY, RH	TO REPAIR SEE LABOUR	673.60	-
1	WHEEL, DISC	TO REPAIR SEE LABOUR	1,484.20	-
1	BUMPER REAR	TO REPAIR SEE LABOUR	458.60	-
1	SOLAR FILM (SN)	NECESSARY	125.00	125.00
			5,865.20	1,521.38
<b><u>LABOUR</u></b>				
PANEL BEATING & BODYWORK. INCLUSIVE OF THE REPAIR OF DOOR RR/RH; MOULDING BODY, RH; WHEEL, DISC AND BUMPER REAR.			845.00	400.00
SPRAY PAINT.			1,494.00	730.00
TO CHECK WIRING AND SYSTEM FUNCTION.			80.00	20.00
TO DO WHEEL ALIGNMENT / TYRE BALANCING.		NOT NECESSARY	120.00	-
TO TEST AND REFIX REVERSE SENSOR SYSTEM.			120.00	20.00
TO TRANSFER DOOR MECHANISM.		NOT NECESSARY	120.00	-
TO REMOVE & REFIT REAR QUARTER GLASS RH.			120.00	30.00
TO REMOVE AND REFIT TYRE RIM (SPRAYING PURPOSE)			120.00	30.00

Report Ref No. NS/INC18017091/Ntbs2



## National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO WASH AND VACUUM.	NOT NECESSARY	60.00	-
	TO REPLACE SUNDRY PARTS.	NOT NECESSARY	100.00	-
			3,179.00	1,230.00
GRAND TOTAL			9,044.20	2,751.38
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION) (CONFIRMED)				2,200.00

Report Ref No. NS/INC18017091/Ntbs2

MUHAMMAD NAZRIL BIN ABDULLAH

Automotive Assessor

K.K.LAU CPT(RET)

BEng(Hons),B.Bus,MBA,PEng,PE,  
MInstAEA,MASME,MIRTE

REGD Auto Consultant-SAE, Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.