

CSN REC BY

REP CS3/LPC18009058/Bsd3-1

Instruction

AMV/CA

Rasul

ASSIGNMENT (Office)

From (Person)

ong Li Li

of

LPC

Date/Time

21/09/2018

Estimated Cost

Bill to

OD / TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To inspect Vehicle No

SJN 2823L

Insured

SJM 4176M

at Workshop m/s

Autowerke Automotive

Tel

9630 1281

of

8 kaki Bukit Ave 4 # 05-01/02

Policy No

Claim No

18/18/18/vp05/020616

Sum Insured

Excess

Make of Veh

(Client's Record)

D.O.A

16/05/2018

CA / REV / REP / REV 24 HRS wpt

18052018

H.O.D. Endorsement

Date/Time

17052018 557pm

Person Contacted

Aux

Vehicle IN/OUT

Date/Time

Action/Instruction (X) Estimate

SJN 2823L - X


SJM 4176M - NA/LPC 18008890/h-1

NOA 16/5/2018

26/09/18

Submit H/s \$2,200/- @ 5 days, checked by Limon.

( \$3,200/- Red - 53% )

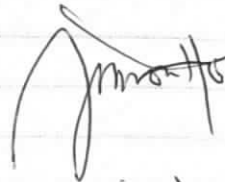

25/9/2018

Lim

This case is for paper survey.

RECEIVED 26 SEP 2018

  
25/9

TGLim



25/9/18

Signature

PR3 / KRM

REF: LPC

10900

COTXPMY: 20/6/18

# ASSIGNMENT

From: Date: 18/5/18

Estimated Cost:

OD (TP) WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SJN 2823L

at Workshop m/s Autowerke Automotive  
of 8 kaki Bukit Ave 4 # 05-01/02

Insured:

Policy No.

Claims No.


Sum Insured: Excess:

(Client's Record)

Make of Veh: Alex @ 96301281

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

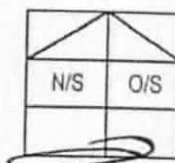

Bal. or Market Value: 14K

IDAC Accident Rpt: Consistent? : Yes or No

GIA / PR Seen: Consistent? : Yes or No

Est. Repairs: days Res.: Yes or No

Lum Sum: % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS (up)

Date: Person Contacted:

Vehicle: IN / OUT

Date / Time Action / Instruction

20/06/18 Submit Pre-repair report  
20/06/18 Submit PRS report

RECEIVED 20 JUN 2018

Veh No: SJN 2823L Yr Regn: 2009 / P65

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Suzuki SX4 1.6 MHA c.c. 1586

Colour: Blue A/C: Insured / Std / NI / NA

Sp. Reading: 91339 T/Radio: Insured / Std / NI / NA

Eng/No:

C/No: JSAG 4021500202756

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / 8/Rim / STD A/Rim or

Tyre Size: F: 195/65R15

R: 22

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or PRLEN

Front

Rear

R/Bal. 5 mm R/Bal. 5 mm

L/Bal. 5 mm L/Bal. 5 mm

D.O.A. 16/05/18 D.O.I. 18/05/18 @ 1219 pm

Survey held at Autowerke Automotive

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date/Time: File Pass to?

20/06/18

1) Expert

Date/Time: File Return to?

2)

☐ : Preli. Report

☐ : Final Report

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation

) S + RS. \$

) Photos

) Others

TOTAL

Add Fee: ☐ : Site Insp (\$

☐ : Interview (\$

☐ : Tech. Invs (\$

☐ : Weekend (\$

Report Format : PRS

Lump Sum / I.B.I: (\$

450

450

## Nivitha (LKK Auto)

---

**From:** ONG LI LI <llong@lonpac.com>  
**Sent:** Friday, 21 September 2018 2:52 PM  
**To:** Nivitha (LKK Auto); assignments@lkkauto.com  
**Cc:** MT\_Claim\_SG; 'SUR'  
**Subject:** RE: Our Ref: 18/18/18/VP05/020616 Your Ref: 2018.1232.PD.AWA (SLN2823L)  
Our client's vehicle no. SJN2823L; Your insured's vehicle no. SJM4176M - PRI Notice  
**Attachments:** 20616 TP SURVEY.pdf

Hi Nivitha

Attached is the TP survey report.

Please let us have your surveyor's comment/report.

Regards,  
Ong Li Li  
Senior Claims Executive | Lonpac Insurance Bhd  
300 Beach Road #17-04/07 The Concourse Singapore 199555  
Tel : (65) 6250 7388 Ext. 254 Fax: (65) 6296 2706

---

**From:** Nivitha (LKK Auto) [mailto:admin-d@lkkauto.com]  
**Sent:** Thursday, 17 May, 2018 6:00 PM  
**To:** ONG LI LI; assignments@lkkauto.com  
**Cc:** MT\_Claim\_SG; 'SUR'  
**Subject:** RE: Our Ref: 18/18/18/VP05/020616 Your Ref: 2018.1232.PD.AWA (SLN2823L) Our client's vehicle no. SJN2823L; Your insured's vehicle no. SJM4176M - PRI Notice

Dear Sir/Mdm,

Thank you for the assignment.

BEST REGARDS,

G.Nivitha | Admin

**LKK Auto Consultants Pte Ltd**

Phone: 6841-1972 | email: [assignments@lkkauto.com](mailto:assignments@lkkauto.com) | fax: 6256-4315  
Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

---

**From:** ONG LI LI [mailto:llong@lonpac.com]  
**Sent:** Thursday, 17 May 2018 4:15 PM  
**To:** [assignments@lkkauto.com](mailto:assignments@lkkauto.com); 'SUR' ([sur@lkkauto.com](mailto:sur@lkkauto.com)) <[sur@lkkauto.com](mailto:sur@lkkauto.com)>  
**Cc:** MT\_Claim\_SG <[mt\\_claim@lonpac.com](mailto:mt_claim@lonpac.com)>  
**Subject:** RE: Our Ref: 18/18/18/VP05/020616 Your Ref: 2018.1232.PD.AWA (SLN2823L) Our client's vehicle no. SJN2823L; Your insured's vehicle no. SJM4176M - PRI Notice

Dear Catherine

Please note that our Insured vehicle no. should be SJM4176M.

Attached are our Insured & TP GIA report and the workshop details for you to arrange survey.

Regards,  
Ong Li Li  
Senior Claims Executive | Lonpac Insurance Bhd  
300 Beach Road #17-04/07 The Concourse Singapore 199555  
Tel : (65) 6250 7388 Ext. 254 Fax: (65) 6296 2706

---

**From:** ONG LI LI  
**Sent:** Thursday, 17 May, 2018 3:53 PM  
**To:** Claims; [assignments@lkkauto.com](mailto:assignments@lkkauto.com); 'SUR' ([sur@lkkauto.com](mailto:sur@lkkauto.com))  
**Cc:** MT\_Claim\_SG  
**Subject:** RE: Our Ref: 18/18/18/VP05/020616 Your Ref: 2018.1232.PD.AWA (SLN2823L) Our client's vehicle no. SJN2823L; Your insured's vehicle no. SJM17964M - PRI Notice

Without Prejudice  
Save as to Costs

Dear Justin

Under the NIMA protocol, if you object to all motor surveyors proposed, you must include a list of **at least 10** motor surveyors. Since you have not and only provide seven which we are not agreeable, we shall appoint our surveyor to conduct the pre-repair survey.

We urge you to agree to our surveyor as the single joint expert to avoid unnecessary delay/disputes on the cost of repairs.

Dear Catherine

New case - Please assign any of your 10 surveyors to conduct PRI.

Regards,  
Ong Li Li  
Senior Claims Executive | Lonpac Insurance Bhd  
300 Beach Road #17-04/07 The Concourse Singapore 199555  
Tel : (65) 6250 7388 Ext. 254 Fax: (65) 6296 2706

---

**From:** Claims [<mailto:claims@esthermoey.com>]  
**Sent:** Thursday, 17 May, 2018 3:44 PM  
**To:** ERIC WOO JUN KIAT  
**Cc:** MT\_Claim\_SG  
**Subject:** RE: Our Ref: 18/18/18/VP05/020616 Your Ref: 2018.1232.PD.AWA (SLN2823L) Our client's vehicle no. SJN2823L; Your insured's vehicle no. SJM17964M - PRI Notice

Your Attention is Drawn to the Confidentiality Notice Below:  
=====

Dear sirs,

We refer to your email of even date.

Our client objects appointing your surveyors as a single joint expert.

We propose on the following surveyors named in the list below to conduct the joint pre-repair survey as a single joint expert:

1. Andrew How

2. Ho Joo Loong, Danny
3. Lee Kok Weng
4. Seah Kwang Boon
5. Winson Goh
6. S. Kumanan
7. Cheong K H

Please let us know within two (2) working days whether you are agreeable to the appointment of any of the above motor surveyors as a single joint expert.

Thank you.

Yours sincerely,

*Justin Yap*

Secretary to Esther Moey  
Amy Lim Law Practice  
[claims@esthermoey.com](mailto:claims@esthermoey.com)

Tel: (+65) 9625 8742 (Justin) / (+65) 9639 3110 (Esther)  
Fax: (+65) 6491 5638

**CONFIDENTIALITY NOTICE**

This e-mail from Amy Lim Law Practice (including any attachment(s) to it) is confidential and may also be privileged and exempt from disclosure under applicable law. Accordingly, if you are not the intended recipient please notify us immediately, delete this e-mail (including any attachment to it) from your computer system and do not disclose or distribute it to any other person or continue to read this e-mail. Thank you.

Amy Lim Law Practice DOES NOT ACCEPT SERVICE OF COURT DOCUMENTS OR NOTICE OF ANY PROCEEDINGS BY FACSIMILE OR EMAIL

---

**From:** ERIC WOO JUN KIAT <[ericwoo@lonpac.com](mailto:ericwoo@lonpac.com)>

**Sent:** Thursday, 17 May, 2018 3:14 PM

**To:** Claims <[claims@esthermoey.com](mailto:claims@esthermoey.com)>

**Cc:** MT\_Claim\_SG <[mt\\_claim@lonpac.com](mailto:mt_claim@lonpac.com)>

**Subject:** RE: Our Ref: 18/18/18/VP05/020616 Your Ref: 2018.1232.PD.AWA (SLN2823L) Our client's vehicle no. SJN2823L; Your insured's vehicle no. SJM17964M - PRI Notice

WITHOUT PREJUDICE  
SAVE AS TO COST

Dear Justin,

We refer to your fax of 17 May 2018.

We will proceed to conduct a pre-repair survey of the damage to your client's vehicle jointly with your workshop. We propose to use one of the motor surveyors named in the attached list to conduct the joint pre-repair survey as a single joint expert. (Please see attached).

Please let us know within 2 working days whether you are agreeable to the appointment of any of the motor surveyors provided to you as a single joint expert. You may select one of the listed motor surveyors.

Thank you.

Best Regards,  
Eric Woo  
Claims Executive | Lonpac Insurance Bhd  
300 Beach Road, #17-04/07 The Concourse, Singapore 199555  
Tel: (65) 6279 9253 | Fax: (65) 6296 3767

---

**From:** Claims [<mailto:claims@esthermoey.com>]  
**Sent:** Thursday, 17 May, 2018 11:38 AM  
**To:** GERALD POH WEE BIN  
**Subject:** Our client's vehicle no. SJN2823L; Your insured's vehicle no. SJM17964M - PRI Notice  
**Importance:** High

**Your Attention is Drawn to the Confidentiality Notice Below:**  
=====

Dear Sirs,

We refer to our attached PRI Notice dated 17 May 2018 for your urgent attention.

Thank you.

Yours sincerely,

*Justin Yap*

Secretary to Esther Moey  
Amy Lim Law Practice  
[claims@esthermoey.com](mailto:claims@esthermoey.com)

Tel: (+65) 9625 8742 (Justin) / (+65) 9639 3110 (Esther)  
Fax: (+65) 6491 5638

**CONFIDENTIALITY NOTICE**

This e-mail from Amy Lim Law Practice (including any attachment(s) to it) is confidential and may also be privileged and exempt from disclosure under applicable law. Accordingly, if you are not the intended recipient please notify us immediately, delete this e-mail (including any attachment to it) from your computer system and do not disclose or distribute it to any other person or continue to read this e-mail. Thank you.

Amy Lim Law Practice DOES NOT ACCEPT SERVICE OF COURT DOCUMENTS OR NOTICE OF ANY PROCEEDINGS BY FACSIMILE OR EMAIL

# S K AUTO CONSULTANTS

## AUTOMOBILE ASSESSMENT REPORT

Page No. 1

Our Reference: TP/018/0312SK  
Your Reference: TBA

Date: June 27, 2018

TO: WU HUITING MICHELLE  
c/o AUTOWERKE AUTOMOTIVE PTE LTD  
8 KAKI BUKIT AVE 4  
#05-01 PREMIER @ KAKI BUKIT  
Singapore 415875

Assessment of Vehicle No : SJN 2823 L  
Date of Accident : 16/05/2018  
Date of Inspection : 17/05/2018

We have carried out a physical assessment of SJN 2823 L at Autowerke Automotive Pte Ltd according to your instructions on 17/05/2018 and are pleased to submit our report as follows;

### 1.VEHICLE PARTICULARS

Registration No. : SJN 2823 L  
Make & Model : SUZUKI SX4  
Year of Registration : 2009  
Engine Capacity (cc) : 1586  
Chassis No. : JSAGYC21S00202756  
Engine No. : M16A1443278  
Colour : BLUE  
Mileage (km) : 91339

### 2.VEHICLE CONDITION

Body Paint: : Good  
Steering : Serviceable  
Foot Brake : Serviceable  
Parking Brake : Serviceable

### 3.TYRE PARTICULARS & CONDITION

#### Front

RH Make/Size : DUNLOP 215/55R16 - 70%  
LH Make/Size : DUNLOP 215/55R16 - 70%

#### Rear

RH Make/Size : DUNLOP 215/55R16 - 70%  
LH Make/Size : DUNLOP 215/55R16 - 70%

Note: % denotes the remaining percentage of the tyre

# S K AUTO CONSULTANTS


Page No. 2

Our Reference      TP/018/0312SK  
Vehicle No.        SJN 2823 L

## 4.DESRIPTION OF DAMAGE

At the time of inspection observed that this vehicle had sustained damages to the REAR portion

Please see attached schedule for details.

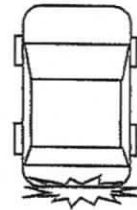

Estimated Amount                : S\$9,471.35  
Adjusted Amount                : S\$6,000/-  
Estimated Repair Days         : 6 days

Pursuant to your instruction, we have **NOT AUTHORIZED** repair.

The assessment was conducted on a "**Without Prejudice**" basis.

If we are not notified of anything to the contrary within **14 Days** from the date hereof, this report shall be treated as correct

### Disclaimer

This report is intended for the exclusive use of the addressee solely in relation to the loss occurrence in which the assessed vehicle is involved. No liability or responsibility whatsoever shall be held by **S K AUTO CONSULTANTS** for any reliance on this report by any third party.



# S K AUTO CONSULTANTS

Page No. 3

Our Reference TP/018/0312SK

Vehicle No. SJN 2823 L

QTY	DESCRIPTION	CONDITION	REPAIRER'S ESTIMATE(\$\$)		OUR ASSESSMENT(\$\$)	
<b><u>PARTS (NETT ITEMS)</u></b>						
1	Rear bumper	Deformed	1050.00		549.65	1050.00
2	Rear bumper side retainer	Necessary	128.00		65.20	128.00
2	Rear bumper brackets @32.50	Bent	65.00		✓ 65.00	
1	Rear bumper lower spoiler	Deformed	780.00			780.00
2	Rear bumper side reflector @\$65	Cracked	130.00			130.00
1	Rear bumper reinforcement	Bent	578.00		227.20	578.00
1	Rear bootlid	Bent	1124.00		756.00	1124.00
2	Rear bootlid hinge @\$75	Refix	150.00			0.00
1	Rear bootlid inner lock	Damaged	325.00		135.00	325.00
1	Rear bootlid logo emblem	Necessary	85.00			85.00
1	Rear bootlid SX4 emblem	Necessary	78.00			78.00
1	Rear boot edge weatherstrip	Deformed	178.00			178.00
1	Rear end panel	Distorted	850.00			850.00
2	Rear end panel outer beam	Bent	98.00			98.00
1	Rear end panel top garnish	Deformed	315.00		127	315.00
2	Rear taillamp @ \$748.50	Refix	1497.00			0.00
				7431.00		5784.00
			less 15%	1114.65	15%	867.60
				6316.35		4916.40
<b><u>SPECIAL NETT ITEMS</u></b>						
1	Rear number plate with garnish	Cracked	75.00			55.00
1 set	Reverse sensor	Damaged	280.00		200.00	250.00
TOTAL PARTS			6671.35			5221.40

# S K AUTO CONSULTANTS

Page No. 4

Our Reference TP/018/0312SK



Vehicle No. SJN 2823 L

S/N	DESCRIPTION	REPAIRER'S ESTIMATE (S\$)	OUR ASSESSMENT (S\$)
	<b><u>LABOUR</u></b>		
1	To remove the affected parts & fittings to commence repairs; panel beat & reshape the affected areas and replace the damaged parts and components.	1200.00	1000.00 <del>600.00</del>
2	To supply paint materials, expandable items & putty, respray paint on parts replaced and repaired areas	1000.00	400.00 + 100 800.00
3	To remove, refix wiring system at accident damaged areas and check for proper function	150.00	50.00 + 30 120.00
4	To remove / refix inner trims, fittings, garnish etc at rear compartment so as to facilitate repairs at rear.	150.00	50.00 120.00
5	To remove and replace reverse sensors and check for proper function	120.00	60.00 80.00
6	To perform anti-rust treatment on affected areas	180.00	60.00 150.00
Labour Total :		2800.00	2270.00
TOTAL (PARTS & LABOUR):		9471.35	7491.40

**Note: (For Lump Sum Repair)**

The workshop has agreed to undertake the repair on a Lump Sum Basis, and/or the use of ex stock/reconditioned parts whichever is possible (having taken into consideration to repair instead of replacements.

**The final adjusted Lump Sum contract amount is S\$6,000/-**

  
  
 S/Kumanan  
 Motor Surveyor

Repair days 5




# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD			Ref : CS3/LPC18009058/Bsd3e2-1	
300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555			Date : 28-09-2018	
			Code : LPC2	
<b>1. Policy Particulars :- THIRD PARTY CLAIM</b>				
Insured Veh.	SJM 4176M	Veh. Inspected	SJN 2823L	
Policy No.		Coverage (\$)	0.00	
Claim No.	18/18/18/VP05/020616	Excess (\$)	0.00	
Assign From	ONG LI LI	Assign Date	21/09/2018	
<b>2. Vehicle Particulars &amp; Condition</b>				
Make & Model	SUZUKI SX4 1.6NB AT	c.c	1586	
Engine No.	HIDDEN	Year of Reg.	2009	
Chassis No.	JSAGYC21S00202756	Colour	BLUE	
Odometer	91339	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	FAIR			
<b>3. Conditions of Tyres</b>				
	Size	Make	Balance	
R/H Front Tyre	195/65 R15	FALKEN	5 mm	
L/H Front Tyre	195/65 R15	FALKEN	5 mm	
R/H Rear Tyre	195/65 R15	FALKEN	5 mm	
L/H Rear Tyre	195/65 R15	FALKEN	5 mm	
<b>4. Description of Damages</b>				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
<b>5. General Information</b>				
Accident Date	16/05/2018	Inspection Date	18/05/2018	
Survey held at	AUTOWERKE AUTOMOTIVE-8 KAKI BKT AVE 4# 05-01			
Repairer	-			
<b>5a. Remarks</b>				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
<b>5b. Estimate Days of Repair</b>				
ESTIMATED NORMAL PERIOD FOR REPAIR:			<b>5 Working Days</b>	



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJN 2823L

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b><u>REPLACEMENT OF PARTS</u></b>				
1	REAR BUMPER	CUT	1,050.00	549.65
2	REAR BUMPER SIDE RETAINER	NECESSARY	128.00	65.20
2	REAR BUMPER BRACKETS @\$32.50	BENT	65.00	65.00
1	REAR BUMPER LOWER SPOILER	NOT NECESSARY	780.00	-
2	REAR BUMPER SIDE REFLECTOR @\$65.00	NOT NECESSARY	130.00	-
1	REAR BUMPER REINFORCEMENT	BENT	578.00	227.20
1	REAR BOOTLID	BENT	1,124.00	756.00
2	REAR BOOTLID HINGE @\$75.00	REFIX	150.00	-
1	REAR BOOTLID INNER LOCK	BENT	325.00	135.00
1	REAR BOOTLID LOGO EMBLEM	NECESSARY	85.00	85.00
1	REAR BOOTLID SX4 EMBLEM	NECESSARY	78.00	78.00
1	REAR BOOT EDGE WEATHERSTRIP	CUT	178.00	178.00
1	REAR END PANEL	TO REPAIR SEE LABOUR	850.00	-
2	REAR END PANEL OUTER BEAM	BENT	98.00	98.00
1	REAR END PANEL TOP GARNISH	CRACKED	315.00	127.00
2	REAR TAILLAMP @\$748.50	REFIX	1,497.00	-
	LESS 15% DISCOUNT		-1,114.65	-354.61
			6,316.35	2,009.44
<b><u>SPECIAL NETT ITEMS</u></b>				
1	REAR NUMBER PLATE WITH GARNISH (SN)	NOT NECESSARY	75.00	-
1	SET REVERSE SENSOR (SN)	CUT	280.00	200.00
			355.00	200.00
<b><u>LABOUR</u></b>				
	TO REMOVE THE AFFECTED PARTS & FITTINGS TO COMMENCE REPAIRS; PANEL BEAT & RESHAPE THE AFFECTED AREAS AND REPLACE THE DAMAGED PARTS AND COMPONENTS. INCLUSIVE OF THE REPAIR OF REAR END PANEL.		1,200.00	600.00
	TO SUPPLY PAINT MATERIALS, EXPANDABLE ITEMS & PUTTY, RESPRAY PAINT ON PARTS REPLACED AND REPAIRED AREAS.		1,000.00	500.00

Report Ref No. CS3/LPC18009058/Bsd3e2-1



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO REMOVE, REFIX WIRING SYSTEM AT ACCIDENT DAMAGED AREAS AND CHECK FOR PROPER FUNCTION.		150.00	30.00
	TO REMOVE / REFIX INNER TRIMS, FITTINGS, GARNISH ETC AT REAR COMPARTMENT SO AS TO FACILITATE REPAIRS AT REAR.		150.00	50.00
	TO REMOVE AND REPLACE REVERSE SENSORS AND CHECK FOR PROPER FUNCTION.		120.00	60.00
	TO PERFORM ANTI-RUST TREATMENT ON AFFECTED AREAS.		180.00	60.00
			2,800.00	1,300.00
GRAND TOTAL			9,471.35	3,509.44

RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				2,800.00
--	--	--	--	----------

Report Ref No. CS3/LPC18009058/Bsd3e2-1

LIM TEOW GUAN

Asst. Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.