

**Claim Reference:**  
**Assessment Number: CSCR7268**  
**Version: CHENGHOE/4**  
**Date Calculated: 22/02/2019 04:30**

**Full Report - V1**  
**Registration: SCR7268T**  
**Printed: 22/02/2019 12:30**

## Summary Information

### Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	LKK AUTO	Date of Incident:	17/09/2018
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	China Taiping Insurance (S) Pt	Repairs Authorised:	TBA
Claim Reference:		Estimated Repair Time:	
Policy Number:	TP/CHINA	Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

### Vehicle Details

#### Vehicle

Manufacturer:	VOLKSWAGEN
Model:	Polo
Sub Model:	COMFORTLINE
Model Sheet Number:	6P6 02
Registration:	SCR7268T
Registration Month:	
Registration Year:	
VIN Number:	WVWZZZ6RZAU046722
Odometer:	Not Known
Colour:	
Engine Number:	CGG336960
Fuel Level:	%


#### Model Specs

FROM 03.2010	AIR CONDITIONING
FRT/RR ELECT WINDOWS	REM CENTRAL LOCKING
ELECTRIC DOOR MIRROR	RADIO RCD 210
TWIN HEADLAMP	TRIM FONZIE
R/SEAT HEIGHT ADJUST	SPLIT REAR SEAT
DOOR TRIM CLOTH	LEATHER STRG WHEEL
VARIABLE LOAD FLOOR	OIL LEVEL GAUGE
PADDED INSTR PANEL	L/SEAT HEIGHT ADJUST
FRONT CENTRE ARMREST	ALTERNATOR 110A
HD COOLING	1.4 LTR 63 KW
7-SPEED DSG	TYRES 185/60 TR 15
WHEELS 6J X 15	SPARE WHEEL STEEL
CHROME PACKAGE	STABILITY PROGR/ABS
REAR DISC BRAKE	5-DOOR
TWO COAT METALLIC	PREPARE OFF VEHICLE
ACTIVE CARBON FILTER	


## Vehicle Condition

### Vehicle Status

Pre-Accident Condition:	Severity of Impact:
Steering:	Vehicle Status on Inspection:
	Date of Inspection:
Brakes Pedal Travel:	24/09/2018
Place of Inspection:	
Pre-Accident Damage:	
Tyres Condition:	
Tread Depth LHF:	Tread Depth RHF:
Tread Depth LHR:	Tread Depth RHR:
Damage Areas:	Direction of Impact:

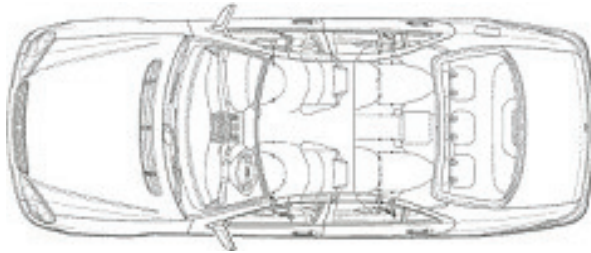

All

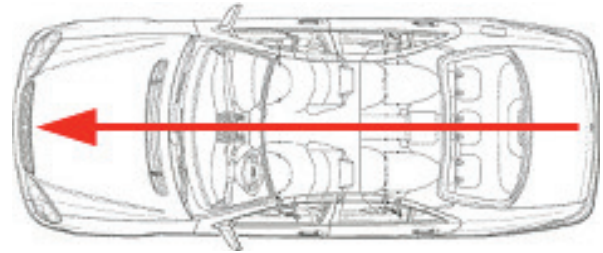

## Addresses

### Repairer

Name : CHENG HOE MOTOR PL

Address :

BLK 1019 YISHUN IND PARK A

#01-374

Post Code : 768761

### Cost Summary

Total Labour	\$1,507.80
Total Paint/Material	\$334.75
Total Parts	\$3,652.00
Total of Additional Costs	\$365.00
Excess:	TBA
Grand Total Exc GST:	\$5,859.55
7 % GST:	\$410.17
Grand Total Inc GST:	\$6,269.72

## Repair Information

### LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$42.00/HR

Price/Dent = \$42.00/HR

### Repair /

Guide Number	Repair Details	WU	Cost Price (\$)
51 01 75 00)	RUST PROOFING BODY SHELL PART	2.0	8.40
51 01 75 50	APPLY RUST PROOFING AT BONNET (COMPOSITE WORK)	1.0	4.20
51 01 75 50	APPLY CAVITY SEALING ON LEFT FRONT WING (COMPOSITE WORK)	1.0	4.20
51 01 75 50	APPLY CAVITY SEALING ON RIGHT FRONT WING (COMPOSITE WORK)	1.0	4.20
51 01 75 50	INJECT PROTECTIVE WAX REAR END PANEL CAVITY (ASSEMBLY OPERATION)	1.0	4.20
50 38 19 60)	R + R FRONT LOCK CARRIER (BUMPER COVER AND NOISE CONTROL PAN REMOVED)	3.0	12.60
	DOES NOT INCLUDE: ADJUST HEADLAMPS, DRAIN + REFILL REFRIGERANT		
50 38 55 50	RENEW FRONT LOCK CARRIER (REMOVED)	7.0	29.40
	INCLUDES: R + R LOWER LOCK PART, BONNET SUPPORT AND CROSSMEMBER, ADJUST LOWER LOCK PART		
94 15 20 00	R + R HEADLAMPS DOES NOT INCLUDE: ADJUST HEADLAMPS	4.0	16.80

**Claim Reference:**

**Full Report - V1**

**Assessment Number: CSCR7268**

**Registration: SCR7268T**

**Version: CHENGHOE/4**

**Printed: 22/02/2019 12:30**

**Date Calculated: 22/02/2019 04:30**

63 29 19 50	R + R FRONT BUMPER COVER (HEADLAMP REMOVED)	<b>4.0</b>	<b>16.80</b>
63 29 55 50	RENEW FRONT BUMPER COVER (REMOVED)	<b>5.0</b>	<b>21.00</b>
	INCLUDES: R + R NUMBER PLATE, FRONT SPOILER, VENTILATION GRILLE AND RADIATOR GRILLE		
50 55 19 50	R + R L/F WING (BUMPER COVER REMOVED)	<b>5.0</b>	<b>21.00</b>
	INCLUDES: R + R WHEELHOUSE SHELL		
50 55 51 50	L/F WING SEAL (COMPOSITE WORK)	<b>3.0</b>	<b>12.60</b>
50 55 19 50	R + R R/F WING (BUMPER COVER REMOVED)	<b>5.0</b>	<b>21.00</b>
	INCLUDES: R + R WHEELHOUSE SHELL		
50 55 51 50	R/F WING SEAL (COMPOSITE WORK)	<b>3.0</b>	<b>12.60</b>
55 22 19 00	R + R BONNET	<b>7.0</b>	<b>29.40</b>
	INCLUDES: R + R WASHER JETS, ADJUST BONNET		
55 22 55 50	RENEW BONNET (BONNET REMOVED)	<b>3.0</b>	<b>12.60</b>
	INCLUDES: R + R ALL PARTS		
94 15 56 00)	RENEW HEADLAMPS (REMOVED)	<b>1.0</b>	<b>4.20</b>
53 16 53 00	REMOVE PARTS END CROSSMEMBER	<b>7.0</b>	<b>29.40</b>
	INCLUDES: REMOVE TAILLAMPS, BUMPER COVER, BOOT TRIM, BOOT COVER, TAILGATE SEAL, CROSSMEMBER, BOOT SIDE TRIMS AND LOWER LOCK		
53 16 55 00	RENEW END CROSSMEMBER	<b>33.0</b>	<b>138.60</b>
53 16 59 00	FIT PARTS END CROSSMEMBER	<b>11.0</b>	<b>46.20</b>
	INCLUDES: FIT REMOVED PARTS, RENEW IF NECESSARY, CHECK LIGHTING		
70 92 19 00	R + R TAILGATE TRIM	<b>3.0</b>	<b>12.60</b>
63 69 55 50	RENEW REAR BUMPER COVER (REMOVED)	<b>2.0</b>	<b>8.40</b>
	INCLUDES: R + R NUMBER PLATE LAMPS AND NUMBER PLATE		
97 85 09 50	DETACH + REFIT BATTERY EARTH STRAP	<b>1.0</b>	<b>4.20</b>
19 38 17 00)	DRAIN + REFILL COOLANT	<b>4.0</b>	<b>16.80</b>
10 82 19 00	R + R SOUND INSULATION PAN	<b>3.0</b>	<b>12.60</b>
51 01 73 00)	APPLY UNDERSEALANT ON BODY SHELL	<b>2.0</b>	<b>8.40</b>
51 01 73 50	REAR INNER END PANEL CAVITY PROTECTION	<b>1.0</b>	<b>4.20</b>
87 50 19 50	R + R CONDENSER (BUMPER COVER REMOVED) (LOCK CARRIER DETACHED)	<b>3.0</b>	<b>12.60</b>
	DOES NOT INCLUDE: DRAIN + REFILL COOLANT		
87 03 17 00	DRAIN + REFILL REFRIGERANT	<b>5.0</b>	<b>21.00</b>
94 15 06 50	ADJUST HEADLAMPS	<b>2.0</b>	<b>8.40</b>
0340	REPAIR FRT BUMPER SUPPORT	<b>5.0*</b>	<b>21.00</b>
0475	REPAIR LEFT BONNET HINGE	<b>5.0*</b>	<b>21.00</b>
0476	REPAIR RIGHT BONNET HINGE	<b>5.0*</b>	<b>21.00</b>
1117	REPAIR L/F WHEELHOUSE	<b>6.0*</b>	<b>25.20</b>

Claim Reference:

Full Report - V1

Assessment Number: CSCR7268

Registration: SCR7268T

Version: CHENGHOE/4

Printed: 22/02/2019 12:30

Date Calculated: 22/02/2019 04:30

1118	REPAIR R/F WHEELHOUSE	6.0*	25.20
2711	REPAIR REAR PANEL	10.0*	42.00
2931	REPAIR BOOTLID/TAILGATE	10.0*	42.00
8833	REPAIR RR EXHAUST SILENCER	10.0*	42.00
<b>LABOUR COST</b>			
<b>Total Work Units</b>		<b>190.0</b>	
<b>Corrosion Protection</b>			
<b>Corrosion Protection External Labour</b>		<b>0.3HRS</b>	<b>12.60</b>
<b>Corrosion Protection Internal Labour</b>		<b>0.6HRS</b>	<b>25.20</b>
<b>Sub Total</b>		<b>19.0HRS</b>	<b>\$798.00</b>
<b>Paint Labour</b>		<b>16.9HRS</b>	<b>\$709.80</b>
<b>Total Labour</b>		<b>35.9HRS</b>	<b>\$1,507.80</b>

<b>PAINT WORK</b>		<b>Time Basis 10 WU = 1 HR. Price = \$42.00/HR</b>	
<b>Guide Number</b>	<b>Description</b>	<b>WU</b>	<b>Cost Price (\$)</b>
	- TWO COAT METALLIC		
	- PREPARE OFF VEHICLE		
471	BONNET NEW PART PAINTING	20.0	
741	L/F WING NEW PART PAINTING	10.0	
742	R/F WING NEW PART PAINTING	10.0	
2719	REAR PANEL C-MEMBER NEW PART PAINTING	14.0	
283	FRONT BUMPER COVER NEW PART PAINT K1R	10.0	
2583	REAR COVER BUMPER NEW PART PAINT K1R	13.0	
1117	L/F WHEELHOUSE CPL SURFACE PAINT	6.0	
1118	R/F WHEELHOUSE CPL SURFACE PAINT	6.0	
2711	REAR PANEL REPAIR PAINTING >50%	18.0	
2931	TAILGATE/BOOTLID REPAIR PAINTING >50%	24.0	
4101	L/INNER SIDE PANEL SURFACE PAINT	4.0	
4102	R/INNER SIDE PANEL SURFACE PAINT	4.0	
<b>LABOUR COST - PAINT</b>			
<b>TIME(PAINT)</b>		<b>139.0</b>	
<b>Preparation Main Work Plastic</b>		<b>5.0</b>	
<b>Preparation Main Work Metal</b>		<b>25.0</b>	
<b>Preparation Work Multi Layer Paint</b>		<b>0.0</b>	
<b>Total Work Units (10WU/HR)</b>		<b>169.0</b>	
<b>Total Paintwork Labour</b>		<b>16.9HRS</b>	<b>\$709.80</b>
<b>MATERIAL COST - PAINT</b>			
			<b>Cost Price</b>
<b>New Part Painting</b>			<b>\$109.63</b>
<b>New Part Painting - Plastic K1R</b>			<b>\$111.69</b>
<b>Material-Constant Main Work Metal</b>			<b>\$28.60</b>
<b>Surface-/Blend Paint</b>			<b>\$22.90</b>
<b>Repair Painting</b>			<b>\$52.93</b>
<b>Material-Const Main Work Plastic</b>			<b>\$9.00</b>
<b>Total Excluding Pearlescent Uplift</b>			<b>\$334.75</b>
<b>Pearlescent Uplift @ 0.0%</b>			<b>\$0.00</b>
<b>Total Paint Material Cost</b>			<b>\$334.75</b>

**PARTS**

<b>Guide No.</b>	<b>Qty</b>	<b>Description</b>	<b>Part Number</b>	<b>Supplier</b>	<b>Bet.</b>	<b>Price (\$)</b>
471	1	BONNET	6R0 823 031 G		0%	430.00*
493	1	BONNET LOCK	6R2 823 509 H		0%	120.00*

Price Valid: 01/06/2015

**Claim Reference:**

**Full Report - V1**

**Assessment Number: CSCR7268**

**Registration: SCR7268T**

**Version: CHENGHOE/4**

**Printed: 22/02/2019 12:30**

**Date Calculated: 22/02/2019 04:30**

4465	1	CONDENSER	6C0 816 411 B	0%	<b>260.00*</b>
283	1	FRONT BUMPER	6R0 807 221 R	0%	<b>450.00*</b>
			GRU		
930	1	FRT LOCK CARRIER	6R0 805 588 AH	0%	<b>390.00*</b>
410	1	GRILLE	6R0 853 651 C RYP	0%	<b>155.00*</b>
341	1	L/F BUMPER FILLER	6R0 807 248 A	0%	<b>13.00*</b>
741	1	L/F WING	6R0 821 105 H	0%	<b>198.00*</b>
1281	1	L/HEADLAMP MOUNTING	6R0 805 071 E	0%	<b>30.00*</b>
2617	1	L/R BUMPER GUIDE	6R6 807 393 A	0%	<b>35.00*</b>
561	1	LEFT HEADLAMP ASSY	6R2 941 007 F	0%	<b>225.00*</b>
1000	1	LH HLAMP LWR BRKT	Renew	0%	<b>75.00*</b>
342	1	R/F BUMPER FILLER	6R0 807 248 B	0%	<b>13.00*</b>
742	1	R/F WING	6R0 821 106 J	0%	<b>198.00*</b>
1282	1	R/HEADLAMP MOUNTING	6R0 805 072 E	0%	<b>30.00*</b>
2583	1	REAR BUMPER	6R6 807 421 BK	0%	<b>450.00*</b>
			GRU		
2640	1	REAR BUMPER SUPPORT	6R0 807 305 A	0%	<b>180.00*</b>
2719	1	REAR PANEL C-MEMBER	6R6 813 309 A	0%	<b>0.00F</b>
1000	1	RH HLAMP LWR BRKT	Renew	0%	<b>75.00*</b>
562	1	RIGHT HEADLAMP ASSY	6R2 941 008 F	0%	<b>225.00*</b>
f: OEM Parts			Saving		<b>\$32.20</b>
g: Original			Sub Total		<b>\$3,552.00</b>
h: Secondhand			Sundry Parts	(Fixed)	<b>\$100.00</b>
p: Parallel			<b>Total Parts</b>		<b>\$3,652.00</b>
x: Exchange					

THIS ASSESSMENT CONTAINS UNPRICED PARTS  
NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

**Extras**

Description		Betterment	Price
TOWING	SPECIALIST	0%	\$50.00
FRT NO PLATE	SPECIALIST		\$35.00
REAR NO PLATE	SPECIALIST	0%	\$30.00
REVERSE SENSOR	SPECIALIST		\$200.00
ACON	SPECIALIST	0%	\$50.00
<b>Total Extras</b>			<b>\$365.00</b>

**Final Calculation**

<b>Total Parts</b>	<b>\$3,652.00</b>
<b>Labour</b>	
Total Panel/Mechanical	\$760.20
Total Paintwork	\$709.80
Corr Prot External 3 WU	\$12.60
Corr Prot Internal 6 WU	\$25.20
<b>Total Labour</b>	<b>\$1,507.80</b>
<b>Additional Costs</b>	
Corr Prot Materials External	\$0.00
Cost of Specialist	\$365.00
<b>Total of Additional Costs</b>	<b>\$365.00</b>
<b>Total Paint/Material Costs</b>	<b>\$334.75</b>
<b>Grand Total Excludes GST</b>	<b>\$5,859.55</b>
GST @ 7 %	<b>\$410.17</b>
<b>Grand Total Includes GST</b>	<b>\$6,269.72</b>

**Assessment Notes**

---