

ASS. REC. BY:

REF: CS/CTI18017332/Kwd30

Special Instruction:

Surveyor

menmen

Kenneth

ASSIGNMENT (Office)

From (Person):

Chong Boon Sen

of

CTI

Date/Time:

21/9/18 4:39pm

Estimated Cost:

Bill to:

OD ☒ TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

SCR 7268T

Insured:

SKH 4674G

at Workshop n/z:

Cheng Hoe Motor

Tel:

of

Blk 1019, Yishun Ind. Park A #01-374/382

Policy No:

DMPCSN 3042991701

Claim No:

SNM18D04518C02

Sum Insured:

Excess:

Make of Veh:

(Client's Record)

D.O.A.

17/08/18

CA / REV / REP. / REV 24 HRS

'up

25/9/18

H.O.D. Endorsement:

Date/Time:

4:45pm @ 21/9/18

Person Contacted:

Sharon

Vehicle:

☒ IN / OUT

Date/Time

Action/Instruction

(✓) Estimate

SCR 7268T - CC3/A1G07004685/V/n

Date: 8/12/2007

SKH 4674G - CS/CTI16018110/Ggh3m2

Date: 20/9/18

22/2/19

Final fig \$ 5859.55 confirmed by email (Ref 1503.04, 20/9)
(No LS)

REF: CTI

ASSIGNMENT

From: Date: 25/9/18

Estimated Cost:

OD (P) WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No: SCR 7268T

at Workshop no/s: cheng hoo motor

of BK 1019, Yishun Ind. park A #01-374

Insured:

Policy No.:

Claims No.:

Sum Insured: Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value: 821K

IDAC Accident Report: Consistent? Yes or No

GIA / PR Seen: Consistent? Yes or No

Est. Repairs: 07 days Res: Yes or No

Lum Sum: 1.3.1 % 3 Val: Yes or No

CA / REV / REP. / 24 HRS ^{up}

Date: Person Contacted:

Vehicle: IN / OUT

Veh No: SCR 7268T Yr Regn: 06 / 10

Type: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Volkswagen Polo cc 1390

Colour: M-Black AC: Insured / Std / NI / NA

Sp Reading: 105515 T/Radio: Insured / Std / NI / NA

Eng No:

C/No: WVW ZZZ6R ZAU 046722

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD / Rim or

Tyre Size: F: 205/458R16

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front	Rear
R/Bal: 8 mm	R/Bal: 8 mm
L/Bal: 8 mm	L/Bal: 8 mm
D.O.A: 17/9/18	D.O.I: 25/9/18
Survey held at	

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision

Date / Time: 26/9 12h pass to Coroner

RECEIVED 22 FEB 2019

22/2/2019

Date/Time, File Pass to? ☐ : Prel. Report1) ☐ : Final Report

Date/Time, File Return to?

2) 22/2 - typist

Report Format: merimen

Lump Sum / I.B.I: (\$) 5859.55

Days Of Repair: 7

Resurvey No. of Trip: 2

Add Fee: ☐ : Site Insp (\$)☐ : Interview (\$)☐ : Tech. Invs (\$)☐ : Weekend (\$)

Survey Fee:

Transportation:

3 - RS - JR

Photos

Other

TOTAL

220



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

CHINA TAIPING INSURANCE (S) PTE LTD

Ref : CS/CT118017332/Kvd3

3 ANSON ROAD #16-00
SPRINGLEAF TOWERS SINGAPORE 079909

Date : 24-09-2018



Code : CTI

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SKH 4674G	Veh. Inspected	SCR 7268T
Policy No.	DMPCSN3042991701	Coverage (\$)	0.00
Claim No.	SNM18D04518C02	Excess (\$)	0.00
Assign From	MERIMEN (CHONG BOON SEN)	Assign Date	24/09/2018

2. Vehicle Particulars & Condition

Make & Model	c.c	0
Engine No.	HIDDEN	Year of Reg.
Chassis No.		Colour
Odometer	-	Steering
Brakes		Modification
General		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm

4. Description of Damages

--

5. General Information

Accident Date	17/08/2018	Inspection Date	25/09/2018
Survey held at	CHENG HOE MOTOR PL BLK 1019 YISHUN IND. PARK A #01-374/382 SINGAPORE 768761		

5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

...CLAIM SUBFOLDER...(New Assignment)

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	24 Sep 2018 Sendback Est	24 Sep 2018 12:25 \$57,212.59	24 Sep 2018 16:39 Assign				New Assignment Cancel Case

Main

Reference

Claim Details

Documents

[Show All](#)

CLAIM SUBFOLDER DETAILS

Insured:	IRFAN, ID: S94379841		
Main Claimant:	YOUR TECK MENG		
Vehicle Reg. No.:	SCR7268T	Date of Loss:	17/09/2018 19:00 - :59 (98 Months and 27 Days From LTA Reg Date (Man Yr))
Claim Type:	TP / SNM18D04518C02	Policy/Cover Note No.:	DMPCSN3042991701
Vehicle Reg. No. (Insured):	SKH4674G	Policy No. (Claimant):	
		Excess:	S\$0.00
Repairer:	Cheng Hoe Motor Pte Ltd (Yishun) Blk 1019 #01-374/382, Yishun Industrial Park A, 768761 Yishun - Tel: 6755 6142		
Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd. (HQ) - Tel: 6389 6111 ... [Handled by Chong Boon Sen]		
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Final Rpt due 03/10/2018]		
Driver/Custodian (Insured):	IRFAN (/ Male), NRIC: S94379841		
Adj Asg. Remarks:	EST \$7717.47, CASE WITH SJE.		

ASSOCIATED MAIL RECEIVED

There are no mail for this case.

[View All](#)[Compose Case Mail](#)

ALL ASSOCIATED TASKS

[View All](#)
[Search Tasks](#)
[Create New Task](#)
[Complete](#)

Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

[> Back to OneMotoring](#)**Enquire PARF/COE Rebate for Registered Vehicle**

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	1153F
Vehicle Details	
Vehicle No.:	SCR7268T
Vehicle to be Exported:	No
Intended Deregistration Date:	18 Sep 2018
Vehicle Make:	VOLKSWAGEN
Vehicle Model:	POLO 1.4 AT 6R13E7
Primary Colour:	Black
Manufacturing Year:	2010
Engine No.:	CGG336960
Chassis No.:	WVWZZZ6RZAU046722
Maximum Power Output:	63.0 kW (84 bhp)
Open Market Value:	\$15,062.00
Original Registration Date:	21 Jun 2010
First Registration Date:	21 Jun 2010
Transfer Count:	2
Actual ARF Paid:	\$15,062.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	20 Jun 2020
PARF Rebate Amount:	\$8,284.00
Intended COE Rebate Details	
COE Expiry Date:	20 Jun 2020
COE Category:	A - Car (1600cc & below)
COE Period(Years):	10
QP Paid:	\$19,989.00
COE Rebate Amount:	\$3,509.00
Total Rebate Amount:	\$11,793.00

The information contained herein is correct as at 18 Sep 2018

OK

Cheap Car Insurance Renewal

Is your car insurance expiring soon?

Receive best quotations from multiple insurers in as little as 2 hours.

VOLKSWAGEN POLO

Price Range

Depreciation

2010

Vehicle Type

Submit

Advanced Search

Home » Used Cars » Just Carz Auto » Volkswagen Polo 1.4A

Resources

- Car Buying
- Car Selling
- Car Ownership
- Car Aftermarket
- On The Move
- Lifestyle

Car Tyres



Buying your First Property?
Compare & apply to multiple banks in just one click.

Compare

Volkswagen Polo 1.4A

Overview Financial Accessories Similar Research Photos Map

Add to Shortlist

Add to Compare

Add a Note

Report Error

More Actions

Share

Car Details

Price	\$21,800	
Depreciation	\$8,300 /yr	View models with similar depreciation
Reg Date	15-Jun-2010 (1yr 8mths 20days COE left)	
Manufactured	2010	
Mileage	-	
Transmission	Auto	
Engine Cap	1,390 cc	
Road Tax	\$620 /yr	
Power	63.0 kW (84 bhp)	View specs of the Volkswagen Polo (2009-2018)
Curb Weight	1,129 kg	
Features	Powered By 1.4L 4 Cylinders 16 Valves DOHC Engine, 7 Speed DSG Automatic Transmission With Tiptronic, ABS, 4 Disc Brakes, SRS Airbags.	
Accessories	Sports Rims, Reverse Sensors, Fog Lamps, Factory Fitted Audio System, Leather Seats, Knockdown Rear Seats, Side Mirrors With Indicators.	
Description	Sporty And Powerful, Low Mileage Done, Awesome Condition. Striking Hot Red Colour With Black Leather Interior, Drive With Passion! Ideally For Small Family Or Grabber. Excellent Fuel Consumption Efficiency. You Can Get All The Power You Needed Whenever You Deem Fit. Trade In Available. Major Bank Loan, High In House Loan And Balloon/Leasing Scheme Available. Please Call For Appointment.	
COE	\$18,502	
OMV	\$15,041	
ARF	\$15,041	
Dereg Value	\$11,456 as of today (change)	
No. of Owners	2	
Type of Veh	Hatchback	
Category	BARF Car, Premium Ad Car	
Availability	Available	

Add to Shortlist

Add to Compare

Add a Note

Posted on: 25-Sep-2018 | Last Updated on: 25-Sep-2018

Tags: volkswagen polo, volkswagen polo, 2010 volkswagen polo, 2010 volkswagen polo, Volkswagen, Polo, polo, Used Volkswagen

Upfront Payment

» more Financial info

Transfer Fee	\$25	
Down Payment	\$6,540 (change)	Maximum 70% Loan
1st Instalment	\$801	



Seller Information

Company	Just Carz Auto » dealer's price list » 40 vehs sold 38 vehs available	
Address	73 Mackenzie Road Lot 5 Search cars nearby this location	
Location	Mackenzie Used Car Centre	
Office No	63383813	
Contact Person(s)	Joey Lim	97898277
	James Li	88588666
	Shawn Zheng	97520620
	Philip Koh	82338484

Useful Services



Afraid of lemons? Request to have this car evaluated professionally.

Vehicle Evaluation



Find out the market value for your car. Get a free Car Valuation.

Free Valuation

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT	
Date Of Report	18/09/2018 11:52
Date Of Accident	17/09/2018 19:15
Exact Location Of Accident	TAMPINES AVE 10 SLIP RD TWDS SLE
Country/State of Loss	SINGAPORE
DETAILS OF OWN VEHICLE	
Vehicle Registration Number	SCR7268T
Insured/Policyholder	
Name Of Registered Owner	YOUR TECK MENG (YANG DEMING)
NRIC No	S7241153F
Email Address	ALEXYOUR@HOTMAIL.COM
Mobile Phone No	(LOCAL) +65-97427690
Alternative Phone No	OTHERS-97427690
Vehicle Particulars	
Manufacturer	VOLKSWAGEN
Model	POLO 1.4 AT 6R13E7
Exact Purpose for which vehicle was being used at time of accident	PTE USE
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	PRIVATE CAR
Insurance Company	
Name of Insurance Company	NTUC INCOME INSURANCE CO-OPERATIVE LTD
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	5072280084-03
Cover Note Number	27/06/18 - 26/06/19
Driver	
Name of Driver	CHAN GIEK FAR
NRIC No	S7965383G
Date Of Birth	23/04/1979
Occupation	INDOOR
Date Of Driving Pass	23/07/2010
Driving Experience	8 YEARS AND 1 MONTH
Gender	FEMALE
Mobile Number	(LOCAL) +65-81008896
Fax Number	
Contact Number	
EEmail Address	GIEKFAR@GMAIL.COM

Address	BLK 886A WOODLANDS DRD.50 #14-523
Postcode	731886
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	SPOUSE
Vehicle Registration Number of Driver's Own Vehicle	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	CHAIN COLLISION
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles involved in the accident	
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

I was moving slowly behind vehicle C into the slip road when vehicle C brake to stop. I followed to applied brake but suddenly a great impact came from behind causing my car forward to hit the rear of vehicle C. Upon alighted to check, I realised car B had collided onto the rear of my car resulted in a 3 vehicles chain collision. I felt unwell after the accident and may consult doctor if necessary.

Attachment(s)


Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SKH4674G
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	PRIVATE CAR
Name of Driver	MR. IRFAN
NRIC/Passport Number	S9437984I
Contact Number	82884464
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

DETAILS OF OTHER VEHICLE PROPERTY 2

SKETCH PLAN

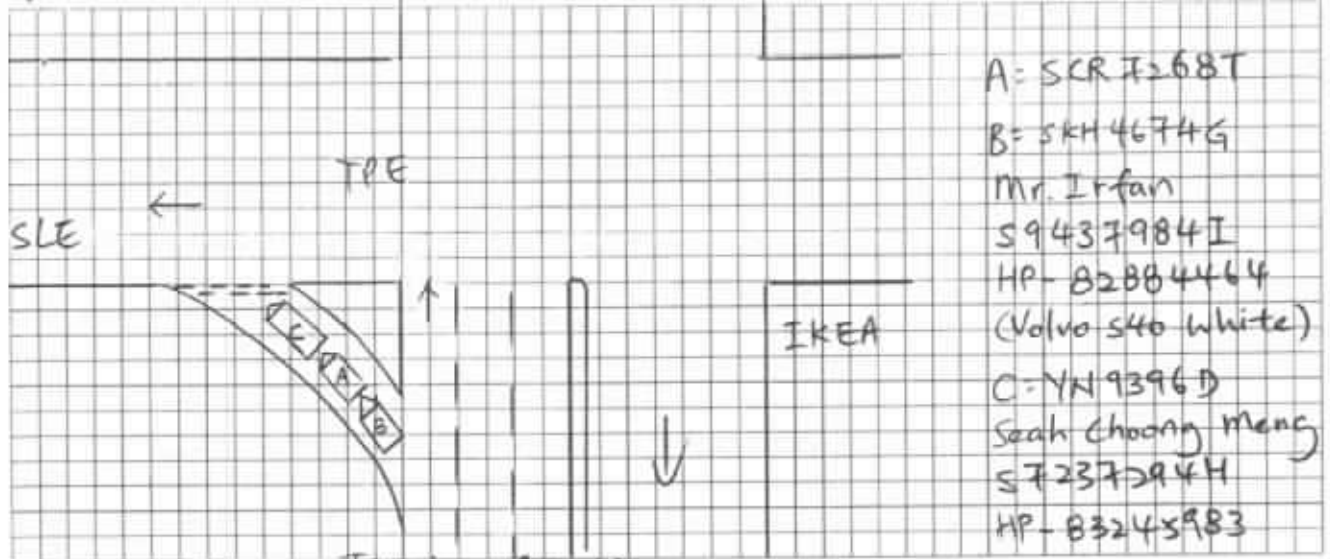

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

I was moving slowly behind vehicle C into the slip road when vehicle C brake to stop. I followed to applied brake but suddenly a great impact came from behind causing my car forward to hit the rear of vehicle C. Upon alighted to check, I realized car B had collided onto the rear of my car resulted in a 3 vehicles chain collision. I felt unwell after the accident and may consult doctor if necessary.

Note : Please note that your insurer may have 14days Time Frame for you to submit an Own Damage Claim under your own comprehensive policy. Please check with your policy for more information.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name: (YS)
NRIC/FIN No.:

GIAMC SketchPlanForm_V3 () Claim Own Policy (☒) Claim Third Party () Reporting Only
() Claim OD/TP at other workshop ()

CHENG HOE MOTOR PTE
LTD
BLK 1019, YISHUN
INDUSTRIAL PARK A
#01-374/382
SINGAPORE 768761

SCR7268T
TP/china

Claim Reference:
Assessment Number: CSCR7268
Version: CHENGHOE/2
Date Calculated: 24/09/2018 04:31

Full Report - V1
Registration: SCR7268T
Printed: 24/09/2018 17:20

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	CHENG HOE MOTOR PTE LTD	Date of Incident:	17/09/2018
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	China Taiping Insurance (S) Pt	Repairs Authorised:	TBA
Claim Reference:		Estimated Repair Time:	
Policy Number:	TP/CHINA	Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	VOLKSWAGEN
Model:	Polo
Sub Model:	COMFORTLINE
Model Sheet Number:	6P6 02
Registration:	SCR7268T
Registration Month:	
Registration Year:	
VIN Number:	WVWZZZ6RZAU046722
Odometer:	Not Known
Colour:	
Engine Number:	CGG336960
Fuel Level:	%

Model Specs

FROM 03.2010	AIR CONDITIONING
FRT/RR ELECT WINDOWS	REM CENTRAL LOCKING
ELECTRIC DOOR MIRROR	RADIO RCD 210
TWIN HEADLAMP	TRIM FONZIE
R/SEAT HEIGHT ADJUST	SPLIT REAR SEAT
DOOR TRIM CLOTH	LEATHER STRG WHEEL
VARIABLE LOAD FLOOR	OIL LEVEL GAUGE
PADDED INSTR PANEL	L/SEAT HEIGHT ADJUST
FRONT CENTRE ARMREST	ALTERNATOR 110A
HD COOLING	1.4 LTR 63 KW
7-SPEED DSG	TYRES 185/60 TR 15
WHEELS 6J X 15	SPARE WHEEL STEEL
CHROME PACKAGE	STABILITY PROGR/ABS
REAR DISC BRAKE	5-DOOR
TWO COAT METALLIC	PREPARE OFF VEHICLE
ACTIVE CARBON FILTER	

Vehicle Condition

Vehicle Status



Pre-Accident Condition:	Severity of Impact:
Steering:	Vehicle Status on
	Inspection:
Brakes Pedal Travel:	Date of Inspection:
Place of Inspection:	24/09/2018
Pre-Accident Damage:	
Tyres Condition:	

Not with hand
1. B.1
Preliminary Report

CHENG HOE MOTOR PTE LTD**Claim Reference:****Assessment Number: CSCR7268****Version: CHENGHOE/2****Date Calculated: 24/09/2018 04:31****Full Report - V1****Registration: SCR7268T****Printed: 24/09/2018 17:20**

Tread Depth LHF:
Tread Depth LHR:
Damage Areas:

Tread Depth RHF:
Tread Depth RHR:
Direction of Impact:

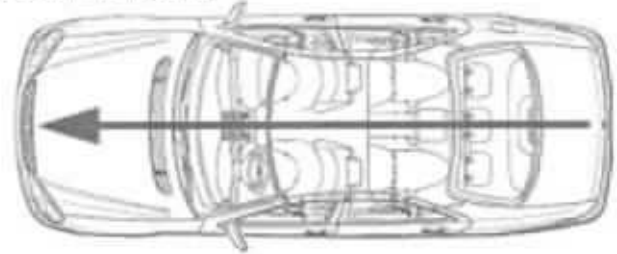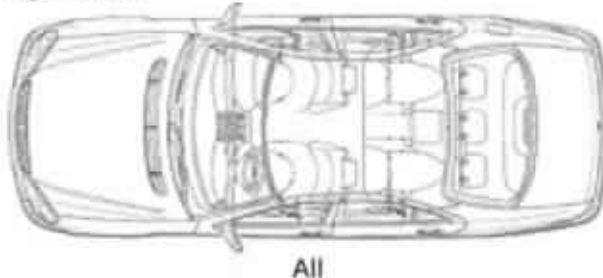**Addresses****Repairer**

Name : CHENG HOE MOTOR PL
Address :
BLK 1019 YISHUN IND PARK A
#01-374
Post Code : 768761

Cost Summary

Total Labour	\$1,890.00
Total Paint/Material	\$361.59
Total Parts	\$4,596.00
Total of Additional Costs	\$365.00
Excess:	TBA
Grand Total Exc GST:	\$7,212.59
7 % GST:	\$504.88
Grand Total Inc GST:	\$7,717.47

Repair Information**LABOUR**

Time Basis 10 WU = 1 HR. Price/CL 1 = \$42.00/HR
Price/Dent = \$42.00/HR

Repair /

Guide Number	Repair Details	WU	Cost Price (\$)
51 01 75 00)	RUST PROOFING BODY SHELL PART	2.0	8.40
51 01 75 50	APPLY RUST PROOFING AT BONNET (COMPOSITE WORK)	1.0	4.20
51 01 75 50	APPLY CAVITY SEALING ON LEFT FRONT WING (COMPOSITE WORK)	1.0	4.20
51 01 75 50	APPLY CAVITY SEALING ON RIGHT FRONT WING (COMPOSITE WORK)	1.0	4.20
51 01 75 50	INJECT PROTECTIVE WAX REAR END PANEL CAVITY (ASSEMBLY OPERATION)	1.0	4.20
50 38 19 60)	R + R FRONT LOCK CARRIER (BUMPER COVER AND NOISE CONTROL PAN REMOVED)	3.0	12.60
50 38 55 50	DOES NOT INCLUDE: ADJUST HEADLAMPS, DRAIN + REFILL REFRIGERANT RENEW FRONT LOCK CARRIER (REMOVED)	7.0	29.40

CHENG HOE MOTOR PTE LTD

Claim Reference:

Assessment Number: CSCR7268

Version: CHENGHOE/2

Date Calculated: 24/09/2018 04:31

Full Report - V1

Registration: SCR7268T

Printed: 24/09/2018 17:20

	INCLUDES: R + R LOWER LOCK PART, BONNET SUPPORT AND CROSSMEMBER, ADJUST LOWER LOCK PART		
94 15 20 00	R + R HEADLAMPS	4.0	16.80
	DOES NOT INCLUDE: ADJUST HEADLAMPS		
63 29 19 50	R + R FRONT BUMPER COVER (HEADLAMP REMOVED)	4.0	16.80
63 29 55 50	RENEW FRONT BUMPER COVER (REMOVED)	5.0	21.00
	INCLUDES: R + R NUMBER PLATE, FRONT SPOILER, VENTILATION GRILLE AND RADIATOR GRILLE		
63 17 19 50	R + R FRONT CENTRE BRACKET RAIL	1.0	4.20
50 55 19 50	R + R L/F WING (BUMPER COVER REMOVED)	5.0	21.00
	INCLUDES: R + R WHEELHOUSE SHELL		
50 55 51 50	L/F WING SEAL (COMPOSITE WORK)	3.0	12.60
50 55 19 50	R + R R/F WING (BUMPER COVER REMOVED)	5.0	21.00
	INCLUDES: R + R WHEELHOUSE SHELL		
50 55 51 50	R/F WING SEAL (COMPOSITE WORK)	3.0	12.60
55 22 19 00	R + R BONNET	7.0	29.40
	INCLUDES: R + R WASHER JETS, ADJUST BONNET		
55 22 55 50	RENEW BONNET (BONNET REMOVED)	3.0	12.60
	INCLUDES: R + R ALL PARTS		
94 15 56 00)	RENEW HEADLAMPS (REMOVED)	1.0	4.20
53 16 53 00	REMOVE PARTS END CROSSMEMBER	7.0	29.40
	INCLUDES: REMOVE TAILLAMPS, BUMPER COVER, BOOT TRIM, BOOT COVER, TAILGATE SEAL, CROSSMEMBER, BOOT SIDE TRIMS AND LOWER LOCK		
53 16 55 00	RENEW END CROSSMEMBER	33.0	138.60
53 16 59 00	FIT PARTS END CROSSMEMBER	11.0	46.20
	INCLUDES: FIT REMOVED PARTS, RENEW IF NECESSARY, CHECK LIGHTING		
53 05 55 50	RENEW REAR END PANEL (COMPOSITE WORK)	33.0	138.60
70 92 19 00	R + R TAILGATE TRIM	3.0	12.60
63 69 55 50	RENEW REAR BUMPER COVER (REMOVED)	2.0	8.40
	INCLUDES: R + R NUMBER PLATE LAMPS AND NUMBER PLATE		
97 85 09 50	DETACH + REFIT BATTERY EARTH STRAP	1.0	4.20
19 70 19 56)	R + R RADIATOR (SOUND PROTECTION PAN AND COVER BUMPER REMOVED)	6.0	25.20
	INCLUDES: DRAIN + REFILL COOLANT		
19 70 55 50	RENEW RADIATOR (REMOVED)	2.0	8.40
	INCLUDES: CONVERT ATTACHED PARTS		
10 82 19 00	R + R SOUND INSULATION PAN	3.0	12.60
26 33 19 00	R + R REAR MUFFLER	5.0	21.00
87 50 19 50	R + R CONDENSER	3.0	12.60

CHENG HOE MOTOR PTE LTD

Claim Reference:

Assessment Number: CSCR7268

Version: CHENGHOE/2

Date Calculated: 24/09/2018 04:31

Full Report - V1

Registration: SCR7268T

Printed: 24/09/2018 17:20

	(BUMPER COVER REMOVED)		
	(LOCK CARRIER DETACHED)		
	DOES NOT INCLUDE: DRAIN + REFILL COOLANT		
87 03 17 00	DRAIN + REFILL REFRIGERANT	5.0	21.00
94 15 06 50	ADJUST HEADLAMPS	2.0	8.40
0475	REPAIR LEFT BONNET HINGE	5.0*	21.00
0476	REPAIR RIGHT BONNET HINGE	5.0*	21.00
1117	REPAIR L/F WHEELHOUSE	6 10.0*	42.00
1118	REPAIR R/F WHEELHOUSE	6 10.0*	42.00
1201	REPAIR L/F SIDE MEMBER CPL	20.0*	84.00
1202	REPAIR R/F SIDE MEMBER CPL	20.0*	84.00
2931	REPAIR BOOTLID/TAILGATE	10 20.0*	84.00
3901	REPAIR REAR BOOT FLOOR	10.0*	42.00

LABOUR COST

Total Work Units	273.0	
Corrosion Protection		
Corrosion Protection External Labour	0.0HRS	0.00
Corrosion Protection Internal Labour	0.6HRS	25.20
Sub Total	27.3HRS	\$1,146.60
Paint Labour	17.7HRS	\$743.40
Total Labour	45.0HRS	\$1,890.00

PAINT WORK		Time Basis 10 WU = 1 HR. Price = \$42.00/HR	
Guide Number	Description	WU	Cost Price (\$)
	- TWO COAT METALLIC		
	- PREPARE OFF VEHICLE		
471	BONNET NEW PART PAINTING	20.0	
741	L/F WING NEW PART PAINTING	10.0	
742	R/F WING NEW PART PAINTING	10.0	
2711	REAR PANEL NEW PART PAINTING	23.0	
	INCLUDES: END CROSSMEMBER		
283	FRONT BUMPER COVER NEW PART PAINT K1R	10.0	
2583	REAR COVER BUMPER NEW PART PAINT K1R	13.0	
1117	L/F WHEELHOUSE CPL SURFACE PAINT	6.0	
1118	R/F WHEELHOUSE CPL SURFACE PAINT	6.0	
1201	L/F SIDE MEMBER CPL SURFACE PAINT	4.0	
1202	R/F SIDE MEMBER CPL SURFACE PAINT	4.0	
2931	TAILGATE/BOOTLID REPAIR PAINTING >50%	24.0	
3901	REAR BOOT FLOOR SURFACE PAINT	9.0	
4101	L/INNER SIDE PANEL SURFACE PAINT	4.0	
4102	R/INNER SIDE PANEL SURFACE PAINT	4.0	

LABOUR COST - PAINT

TIME(PAINT)	147.0	
Preparation Main Work Plastic	5.0	
Preparation Main Work Metal	25.0	
Preparation Work Multi Layer Paint	0.0	
Total Work Units (10WU/HR)	177.0	
Total Paintwork Labour	17.7HRS	\$743.40

MATERIAL COST - PAINT

New Part Painting	\$126.13
New Part Painting - Plastic K1R	\$111.69
Material-Constant Main Work Metal	\$28.60

CHENG HOE MOTOR PTE LTD

Claim Reference:

Assessment Number: CSCR7268

Version: CHENGHOE/2

Date Calculated: 24/09/2018 04:31

Full Report - V1

Registration: SCR7268T

Printed: 24/09/2018 17:20

Surface-/Blend Paint	\$53.78
Repair Painting	\$32.39
Material-Const Main Work Plastic	\$9.00
Total Excluding Pearlescent Uplift	\$361.59
Pearlescent Uplift @ 0.0%	\$0.00
Total Paint Material Cost	\$361.59

PARTS

Guide No.	Qty	Description	Part Number	Supplier	Bet.	Price (\$)	
471	1	BONNET	6R0 823 031 G		0%	430.00*	✓
493	1	BONNET LOCK	6R2 823 509 H		0%	120.00*	✓
4465	1	CONDENSER	6C0 816 411 B		0%	260.00*	✓
283	1	FRONT BUMPER	6R0 807 221 R		0%	450.00*	✓
			GRU				
339	1	FRT BUMPER C-MEMBER	6R0 807 651 A		0%	0.00F	X
340	1	FRT BUMPER SUPPORT	6R0 807 109 D	5NH R	0%	195.00*	X
930	1	FRT LOCK CARRIER	6R0 805 588 AH	CMH	0%	390.00*	✓
410	1	GRILLE	6R0 853 651 C RYP	155	0%	160.00*	✓
341	1	L/F BUMPER FILLER	6R0 807 248 A	13	0%	15.00*	✓
741	1	L/F WING	6R0 821 105 H		0%	198.00*	✓
1281	1	L/HEADLAMP MOUNTING	6R0 805 071 E		0%	30.00*	✓
2617	1	L/R BUMPER GUIDE	6R6 807 393 A		0%	35.00*	✓
561	1	LEFT HEADLAMP ASSY	6R2 941 007 F		0%	225.00*	✓
342	1	R/F BUMPER FILLER	6R0 807 248 B	13	0%	15.00*	✓
742	1	R/F WING	6R0 821 106 J		0%	198.00*	✓
1282	1	R/HEADLAMP MOUNTING	6R0 805 072 E		0%	30.00*	✓
7761	1	RADIATOR	6R0 121 253		0%	305.00*	X
2583	1	REAR BUMPER	6R6 807 421 BK		0%	450.00*	✓
			GRU				
2640	1	REAR BUMPER SUPPORT	6R0 807 305 A		0%	180.00*	✓
2711	1	REAR PANEL	6R6 813 301 C	10NH	0%	280.00*	X
2719	1	REAR PANEL C-MEMBER	6R6 813 309 A		0%	0.00F	X
562	1	RIGHT HEADLAMP ASSY	6R2 941 008 F	Arg CMH	0%	225.00*	✓
8833	1	RR EXHAUST SILENCER	6Q6 253 609 J		0%	305.00*	X
f: OEM Parts			Saving			\$73.25	10x
g: Original			Sub Total			\$4,496.00	
h: Secondhand			Sundry Parts	(Fixed)		\$100.00	
p: Parallel			Total Parts			\$4,596.00	
x: Exchange							

THIS ASSESSMENT CONTAINS UNPRICED PARTS

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description	Betterment	Price	
TOWING	0%	\$50.00	✓
FRT NO PLATE		\$35.00	✓
REAR NO PLATE		\$30.00	✓
REVERSE SENSOR		\$200.00	✓
ACON		\$50.00	✓
		\$365.00	

Final Calculation

Total Parts

Labour

100% Auto Consultants hence notify

Total Extras following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation

- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Audatex System Using Manufacturer Times

CHENG HOE MOTOR PTE LTD**Claim Reference:****Assessment Number: CSCR7268****Version: CHENGHOE/2****Date Calculated: 24/09/2018 04:31****Full Report - V1****Registration: SCR7268T****Printed: 24/09/2018 17:20**

Total Panel/Mechanical	\$1,121.40	760.20
Total Paintwork	\$743.40	709.80
Corr Prot Internal 6 WU	\$25.20	
Total Labour		\$1,890.00
Additional Costs		
Corr Prot Materials External	\$0.00	
Cost of Specialist	\$365.00	
Total of Additional Costs		\$365.00
Total Paint/Material Costs		\$361.59
Grand Total Excludes GST		\$7,212.59
GST @ 7 %		\$504.88
Grand Total Includes GST		\$7,717.47
		7362.59

Assessment Notes

Suppl 1

REPAIR DETAILS**Reference****Part Source:** MRM-SG **Version:** 1.0 (Last Synchronised: 05 Oct 2018)**Parts:** 144 VOLKSWAGEN POLO 1.4 (A) (Catalogue:Merimen Singapore 1.0)**Labour:** Repairer's (Price-denominated Standard List)**Print Code:** Cheng Hoe Motor Pte Ltd/SCR7268T/05/10/2018 17:55**Validity:** These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page**Further Info:** Items/values not in reference catalogue are prefixed with an asterisk ***Estimates on Parts**

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount
1	1		*2 pcs Headlamp lower brackets (\$75/pce)	CM 0.00	0.00	*150.00 F
Total Parts (S\$)						150.00

F=Franchise part.

Cheng Hoe Motor Pte Ltd/SCR7268T/05/10/2018 17:55. Not valid without Reference section.
Generated using Merimen e-Claims IEAS

Estimates on Miscellaneous Items


There are no new miscellaneous items selected.

Estimates on Labour

There are no labour items selected.

Cheng Hoe Motor Pte Ltd/SCR7268T/05/10/2018 17:55. Not valid without Reference section.
Generated using Merimen e-Claims IEAS

< END OF ESTIMATES >

**CHENG HOE MOTOR PTE LTD**

Blk 1019, Yishun Industrial Park A, #01-374/382, Singapore 768761

Tel : 67556142 Fax : 67557719

Email: chmotor@singnet.com.sg

TP INSURER: China Taiping Insurance (Singapore) Pte. Ltd. (HQ)**IRFAN**

Singapore

PARTICULARS OF CLAIM

Claim Type:	THIRD PARTY	Ref. No:	
Policy No:		Date of Loss:	17/09/2018
Vehicle Reg. No.:	SCR7268T	Driveable?	
Party At Fault:	UNKNOWN		
Driver (TP):	CHAN GIEK FAR	Driver (Insured):	IRFAN
Make/Model:	VOLKSWAGEN POLO, 1.4 (A)	Vehicle Reg. Date:	21/06/2010
Vehicle Colour:	BLACK		
Engine No:	CGG336960	Chassis No:	WWZZZ6RZAU046722
Odometer:	0 KM		
Paint Type:			
Total Loss?	NO		
Est. Duration of Repair (day)	0		
Description of Accident/Loss	REFER TO GIA REPORT ATTACHED		
Present Location:	CHENG HOE MOTOR PTE LTD (YISHUN)		

COST OF CLAIMS	Amount
Parts	4,496.00
Miscellaneous Items	465.00
Labour	2,251.59
Paintwork Labour	0.00
Towing	0.00
Gross Total (S\$)	7,212.59
+ GST 7.00% (S\$)	504.88
Nett Amount (S\$)	7,717.47

This claim is handled by: EFEEDA BINTE MOHAMED OTHMAN

Generated using Merimen e-Claims Internet Estimation & Adjusting System

REPAIR DETAILS

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 24 Sep 2018)
 Parts: 144 VOLKSWAGEN POLO 1.4 (A) (Catalogue:Merimen Singapore 1.0)
 Labour: Repairer's (Price-denominated Standard List)
 Print Code: Cheng Hoe Motor Pte Ltd/SCR7268T/24/09/2018 12:25
 Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
 Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Estimates on Parts

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount
1	1	NA	*BONNET BT	0.00	0.00	*430.00F
2	1	NA	*BONNET LOCK DIS	0.00	0.00	*120.00F
3	1	NA	*CONDENSER BT	0.00	0.00	*260.00F
4	1	NA	*FRONT BUMPER Buc	0.00	0.00	*450.00F
5	1	NA	*FRT BUMPER C-MEMBER MSP	0.00	0.00	*-F
6	1	NA	*FRT BUMPER SUPPORT R	0.00	0.00	*195.00F
7	1	NA	*FRT LOCK CARRIER CRA	0.00	0.00	*390.00F
8	1	NA	*GRILLE DD	0.00	0.00	*160.00F
9	1	NA	*L/F BUMPER FILLER DIS	0.00	0.00	*15.00F
10	1	NA	*L/F WING Buc	0.00	0.00	*198.00F
11	1	NA	*L/HEADLAMP MOUNTING Buc	0.00	0.00	*30.00F
12	1	NA	*L/R BUMPER GUIDE CRA	0.00	0.00	*35.00F
13	1	NA	*LEFT HEADLAMP ASSY mtg CRA	0.00	0.00	*225.00F
14	1	NA	*R/F BUMPER FILLER DIS	0.00	0.00	*15.00F
15	1	NA	*R/F WING Buc	0.00	0.00	*198.00F
16	1	NA	*R/HEADLAMP MOUNTING Buc	0.00	0.00	*30.00F
17	1	NA	*RADIATOR SVC	0.00	0.00	*305.00F
18	1	NA	*REAR BUMPER Buc	0.00	0.00	*450.00F
19	1	NA	*REAR BUMPER SUPPORT BT	0.00	0.00	*180.00F
20	1	NA	*REAR PANEL R	0.00	0.00	*280.00F
21	1	NA	*REAR PANEL C-MEMBER R	0.00	0.00	*-F
22	1	NA	*RIGHT HEADLAMP ASSY mtg CRA	0.00	0.00	*225.00F
23	1	NA	*RR EXHAUST SILENCER R	0.00	0.00	*305.00F

F=Franchise part.

Total Parts (S\$) **4,496.00**

Cheng Hoe Motor Pte Ltd/SCR7268T/24/09/2018 12:25. Not valid without Reference section.
 Generated using Merimen e-Claims IEAS

Estimates on Miscellaneous Items

No	Qty	Particulars	Amount
Miscellaneous Items			
1	1	ACON	50.00
2	1	FRT NO PLATE mis	35.00
3	1	REAR NO PLATE DD	30.00
4	1	REVERSE SENSOR Short	200.00
5	1	SUNDRY PARTS	100.00
6	1	TOWING	50.00
Sub Total (S\$)			465.00

Estimates on Labour

No	Particulars	Lab.Type	Amount
Labour Items			
1	Total Paint Labour	New	743.40
2	Total Paint Materials	New	361.59
3	Total Panel/Mechanical Labour	New	1,146.60
Gross Labour Cost (S\$)			2,251.59

Cheng Hoe Motor Pte Ltd/SCR7268T/24/09/2018 12:25. Not valid without Reference section.
Generated using Merimen e-Claims IEAS

< END OF ESTIMATES >

CHENG HOE MOTOR PTE
LTD
BLK 1019, YISHUN
INDUSTRIAL PARK A
#01-374/382
SINGAPORE 768761

Repairer Finalise

Claim Reference:
Assessment Number: CSCR7268
Version: CHENGHOE/3
Date Calculated: 31/12/2018 09:01

Full Report - V1
Registration: SCR7268T
Printed: 31/12/2018 17:01

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	CHENG HOE MOTOR PTE LTD	Date of Incident:	17/09/2018
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	China Taiping Insurance (S) Pt	Repairs Authorised:	TBA
Claim Reference:		Estimated Repair Time:	
Policy Number:	TP/CHINA	Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	VOLKSWAGEN
Model:	Polo
Sub Model:	COMFORTLINE
Model Sheet Number:	6P6 02
Registration:	SCR7268T
Registration Month:	
Registration Year:	
VIN Number:	WVWZZZ6RZAU046722
Odometer:	Not Known
Colour:	
Engine Number:	CGG336960
Fuel Level:	%

Model Specs

FROM 03.2010	AIR CONDITIONING
FRT/RR ELECT WINDOWS	REM CENTRAL LOCKING
ELECTRIC DOOR MIRROR	RADIO RCD 210
TWIN HEADLAMP	TRIM FONZIE
R/SEAT HEIGHT ADJUST	SPLIT REAR SEAT
DOOR TRIM CLOTH	LEATHER STRG WHEEL
VARIABLE LOAD FLOOR	OIL LEVEL GAUGE
PADDED INSTR PANEL	L/SEAT HEIGHT ADJUST
FRONT CENTRE ARMREST	ALTERNATOR 110A
HD COOLING	1.4 LTR 63 KW
7-SPEED DSG	TYRES 185/60 TR 15
WHEELS 6J X 15	SPARE WHEEL STEEL
CHROME PACKAGE	STABILITY PROGR/ABS
REAR DISC BRAKE	5-DOOR
TWO COAT METALLIC	PREPARE OFF VEHICLE
ACTIVE CARBON FILTER	


Vehicle Condition

Vehicle Status

Pre-Accident Condition:	Severity of Impact:
Steering:	Vehicle Status on Inspection:
	Date of Inspection:
Brakes Pedal Travel:	24/09/2018
Place of Inspection:	
Pre-Accident Damage:	
Tyres Condition:	


CHENG HOE MOTOR PTE LTD**Claim Reference:****Assessment Number: CSCR7268****Version: CHENGHOE/3****Date Calculated: 31/12/2018 09:01****Full Report - V1****Registration: SCR7268T****Printed: 31/12/2018 17:01**

Tread Depth LHF:
Tread Depth LHR:
Damage Areas:

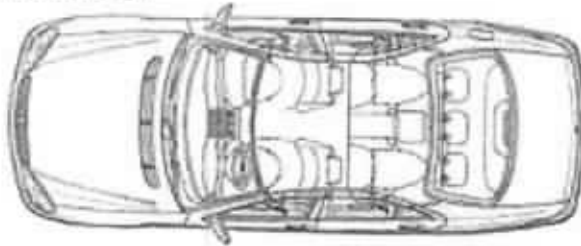

All

Tread Depth RHF:
Tread Depth RHR:
Direction of Impact:

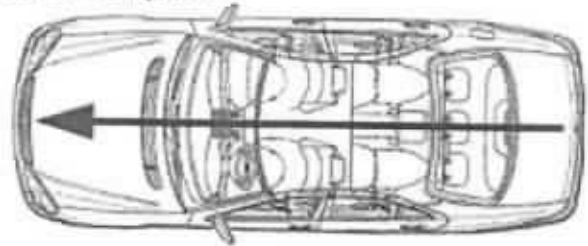**Addresses****Repairer**

Name : CHENG HOE MOTOR PL

Address :

BLK 1019 YISHUN IND PARK A

#01-374

Post Code : 768761

Cost Summary

Total Labour	\$1,512.00
Total Paint/Material	\$334.75
Total Parts	\$3,652.00
Total of Additional Costs	\$365.00
Excess:	TBA
Grand Total Exc GST:	\$5,863.75
7 % GST:	\$410.46
Grand Total Inc GST:	\$6,274.21

Repair Information**LABOUR**

Time Basis 10 WU = 1 HR. Price/CL 1 = \$42.00/HR
Price/Dent = \$42.00/HR

Repair /**Guide Number Repair Details**

		WU	Cost Price (\$)
51 01 75 00)	RUST PROOFING BODY SHELL PART	2.0	8.40
51 01 75 50	APPLY RUST PROOFING AT BONNET (COMPOSITE WORK)	1.0	4.20
51 01 75 50	APPLY CAVITY SEALING ON LEFT FRONT WING (COMPOSITE WORK)	1.0	4.20
51 01 75 50	APPLY CAVITY SEALING ON RIGHT FRONT WING (COMPOSITE WORK)	1.0	4.20
51 01 75 50	INJECT PROTECTIVE WAX REAR END PANEL CAVITY (ASSEMBLY OPERATION)	1.0	4.20
50 38 19 60)	R + R FRONT LOCK CARRIER (BUMPER COVER AND NOISE CONTROL PAN REMOVED)	3.0	12.60
50 38 55 50	DOES NOT INCLUDE: ADJUST HEADLAMPS, DRAIN + REFILL REFRIGERANT RENEW FRONT LOCK CARRIER (REMOVED)	7.0	29.40

CHENG HOE MOTOR PTE LTD

Claim Reference:

Assessment Number: CSCR7268

Version: CHENGHOE/3

Date Calculated: 31/12/2018 09:01

Full Report - V1

Registration: SCR7268T

Printed: 31/12/2018 17:01

	INCLUDES: R + R LOWER LOCK PART, BONNET SUPPORT AND CROSSMEMBER, ADJUST LOWER LOCK PART		
94 15 20 00	R + R HEADLAMPS	4.0	16.80
	DOES NOT INCLUDE: ADJUST HEADLAMPS		
63 29 19 50	R + R FRONT BUMPER COVER (HEADLAMP REMOVED)	4.0	16.80
63 29 55 50	RENEW FRONT BUMPER COVER (REMOVED)	5.0	21.00
	INCLUDES: R + R NUMBER PLATE, FRONT SPOILER, VENTILATION GRILLE AND RADIATOR GRILLE		
63 17 19 50	R + R FRONT CENTRE BRACKET RAIL	1.0	4.20
50 55 19 50	R + R L/F WING (BUMPER COVER REMOVED)	5.0	21.00
	INCLUDES: R + R WHEELHOUSE SHELL		
50 55 51 50	L/F WING SEAL (COMPOSITE WORK)	3.0	12.60
50 55 19 50	R + R R/F WING (BUMPER COVER REMOVED)	5.0	21.00
	INCLUDES: R + R WHEELHOUSE SHELL		
50 55 51 50	R/F WING SEAL (COMPOSITE WORK)	3.0	12.60
55 22 19 00	R + R BONNET	7.0	29.40
	INCLUDES: R + R WASHER JETS, ADJUST BONNET		
55 22 55 50	RENEW BONNET (BONNET REMOVED)	3.0	12.60
	INCLUDES: R + R ALL PARTS		
94 15 56 00)	RENEW HEADLAMPS (REMOVED)	1.0	4.20
53 16 53 00	REMOVE PARTS END CROSSMEMBER	7.0	29.40
	INCLUDES: REMOVE TAILLAMPS, BUMPER COVER, BOOT TRIM, BOOT COVER, TAILGATE SEAL, CROSSMEMBER, BOOT SIDE TRIMS AND LOWER LOCK		
53 16 55 00	RENEW END CROSSMEMBER	33.0	138.60
53 16 59 00	FIT PARTS END CROSSMEMBER	11.0	46.20
	INCLUDES: FIT REMOVED PARTS, RENEW IF NECESSARY, CHECK LIGHTING		
70 92 19 00	R + R TAILGATE TRIM	3.0	12.60
63 69 55 50	RENEW REAR BUMPER COVER (REMOVED)	2.0	8.40
	INCLUDES: R + R NUMBER PLATE LAMPS AND NUMBER PLATE		
97 85 09 50	DETACH + REFIT BATTERY EARTH STRAP	1.0	4.20
19 38 17 00)	DRAIN + REFILL COOLANT	4.0	16.80
10 82 19 00	R + R SOUND INSULATION PAN	3.0	12.60
51 01 73 00)	APPLY UNDERSEALANT ON BODYSHELL	2.0	8.40
51 01 73 50	REAR INNER END PANEL CAVITY PROTECTION	1.0	4.20
87 50 19 50	R + R CONDENSER (BUMPER COVER REMOVED) (LOCK CARRIER DETACHED)	3.0	12.60
	DOES NOT INCLUDE: DRAIN + REFILL COOLANT		
87 03 17 00	DRAIN + REFILL REFRIGERANT	5.0	21.00
94 15 06 50	ADJUST HEADLAMPS	2.0	8.40

CHENG HOE MOTOR PTE LTD

Claim Reference:

Assessment Number: CSCR7268

Version: CHENGHOE/3

Date Calculated: 31/12/2018 09:01

Full Report - V1

Registration: SCR7268T

Printed: 31/12/2018 17:01

0340	REPAIR FRT BUMPER SUPPORT	5.0*	21.00
0475	REPAIR LEFT BONNET HINGE	5.0*	21.00
0476	REPAIR RIGHT BONNET HINGE	5.0*	21.00
1117	REPAIR L/F WHEELHOUSE	6.0*	25.20
1118	REPAIR R/F WHEELHOUSE	6.0*	25.20
2711	REPAIR REAR PANEL	10.0*	42.00
2931	REPAIR BOOTLID/TAILGATE	10.0*	42.00
8833	REPAIR RR EXHAUST SILENCER	10.0*	42.00

LABOUR COST

Total Work Units	191.0	
Corrosion Protection		
Corrosion Protection External Labour	0.3HRS	12.60
Corrosion Protection Internal Labour	0.6HRS	25.20
Sub Total	19.1HRS	\$802.20
Paint Labour	16.9HRS	\$709.80
Total Labour	36.0HRS	\$1,512.00

PAINT WORK

Guide Number	Description	Time Basis 10 WU = 1 HR. Price = \$42.00/HR	WU	Cost Price (\$)
	- TWO COAT METALLIC			
	- PREPARE OFF VEHICLE			
471	BONNET NEW PART PAINTING		20.0	
741	L/F WING NEW PART PAINTING		10.0	
742	R/F WING NEW PART PAINTING		10.0	
2719	REAR PANEL C-MEMBER NEW PART PAINTING		14.0	
283	FRONT BUMPER COVER NEW PART PAINT K1R		10.0	
2583	REAR COVER BUMPER NEW PART PAINT K1R		13.0	
1117	L/F WHEELHOUSE CPL SURFACE PAINT		6.0	
1118	R/F WHEELHOUSE CPL SURFACE PAINT		6.0	
2711	REAR PANEL REPAIR PAINTING >50%		18.0	
2931	TAILGATE/BOOTLID REPAIR PAINTING >50%		24.0	
4101	L/INNER SIDE PANEL SURFACE PAINT		4.0	
4102	R/INNER SIDE PANEL SURFACE PAINT		4.0	

LABOUR COST - PAINT

TIME(PAINT)	139.0	
Preparation Main Work Plastic	5.0	
Preparation Main Work Metal	25.0	
Preparation Work Multi Layer Paint	0.0	
Total Work Units (10WU/HR)	169.0	
Total Paintwork Labour	16.9HRS	\$709.80

MATERIAL COST - PAINT

New Part Painting	Cost Price
New Part Painting - Plastic K1R	\$109.63
Material-Constant Main Work Metal	\$111.69
Surface-/Blend Paint	\$28.60
Repair Painting	\$22.90
Material-Const Main Work Plastic	\$52.93
Total Excluding Pearlescent Uplift	\$9.00
Pearlescent Uplift @ 0.0%	\$334.75
Total Paint Material Cost	\$0.00
	\$334.75

PARTS

Price Valid: 01/06/2015

CHENG HOE MOTOR PTE LTD

Claim Reference:

Assessment Number: CSCR7268

Version: CHENGHOE/3

Date Calculated: 31/12/2018 09:01

Full Report - V1

Registration: SCR7268T

Printed: 31/12/2018 17:01

Guide No.	Qty	Description	Part Number	Supplier	Bet.	Price (\$)
471	1	BONNET	6R0 823 031 G		0%	430.00*
493	1	BONNET LOCK	6R2 823 509 H		0%	120.00*
4465	1	CONDENSER	6C0 816 411 B		0%	260.00*
283	1	FRONT BUMPER	6R0 807 221 R		0%	450.00*
			GRU			
339	1	FRT BUMPER C-MEMBER	6R0 807 651 A		0%	0.00F
930	1	FRT LOCK CARRIER	6R0 805 588 AH		0%	390.00*
410	1	GRILLE	6R0 853 651 C RYP		0%	155.00*
341	1	L/F BUMPER FILLER	6R0 807 248 A		0%	13.00*
741	1	L/F WING	6R0 821 105 H		0%	198.00*
1281	1	L/HEADLAMP MOUNTING	6R0 805 071 E		0%	30.00*
2617	1	L/R BUMPER GUIDE	6R6 807 393 A		0%	35.00*
561	1	LEFT HEADLAMP ASSY	6R2 941 007 F		0%	225.00*
1000	1	LH HLAMP LWR BRKT	Renew		0%	75.00* (A)
342	1	R/F BUMPER FILLER	6R0 807 248 B		0%	13.00*
742	1	R/F WING	6R0 821 106 J		0%	198.00*
1282	1	R/HEADLAMP MOUNTING	6R0 805 072 E		0%	30.00*
2583	1	REAR BUMPER	6R6 807 421 BK		0%	450.00*
			GRU			
2640	1	REAR BUMPER SUPPORT	6R0 807 305 A		0%	180.00*
2719	1	REAR PANEL C-MEMBER	6R6 813 309 A		0%	0.00F
1000	1	RH HLAMP LWR BRKT	Renew		0%	75.00* (A)
562	1	RIGHT HEADLAMP ASSY	6R2 941 008 F		0%	225.00*
f: OEM Parts			Saving			\$73.25
g: Original			Sub Total			\$3,552.00
h: Secondhand			Sundry Parts	(Fixed)		\$100.00
p: Parallel			Total Parts			\$3,652.00
x: Exchange						

THIS ASSESSMENT CONTAINS UNPRICED PARTS
NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description	Specialist	Betterment	Price
TOWING	SPECIALIST	0%	\$50.00
FRT NO PLATE	SPECIALIST		\$35.00
REAR NO PLATE	SPECIALIST	0%	\$30.00
REVERSE SENSOR	SPECIALIST		\$200.00
ACON	SPECIALIST	0%	\$50.00
		Total Extras	\$365.00

Final Calculation

Total Parts		\$3,652.00
Labour		
Total Panel/Mechanical	\$764.40	
Total Paintwork	\$709.80	
Corr Prot External 3 WU	\$12.60	
Corr Prot Internal 6 WU	\$25.20	
Total Labour		\$1,512.00
Additional Costs		
Corr Prot Materials External	\$0.00	
Cost of Specialist	\$365.00	
Total of Additional Costs		\$365.00
Total Paint/Material Costs		\$334.75

CHENG HOE MOTOR PTE LTD

Claim Reference:

Assessment Number: CSCR7268

Version: CHENGHOE/3

Date Calculated: 31/12/2018 09:01

Full Report - V1

Registration: SCR7268T

Printed: 31/12/2018 17:01

Grand Total Excludes GST

\$5,863.75

GST @ 7 %

\$410.46

Grand Total Includes GST

\$6,274.21

Assessment Notes

Suppl 1

REPAIR DETAILS**Reference**

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 05 Oct 2018)
 Parts: 144 VOLKSWAGEN POLO 1.4 (A) (Catalogue:Merimen Singapore 1.0)
 Labour: Repairer's (Price-denominated Standard List)
 Print Code: Cheng Hoe Motor Pte Ltd/SCR7268T/05/10/2018 17:55
 Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
 Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Estimates on Parts

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount
1	1		*2 pcs Headlamp lower brackets (\$75/pce)	CM 0.00	0.00	*150.00F
Total Parts (\$\$)						150.00

F=Franchise part.

Cheng Hoe Motor Pte Ltd/SCR7268T/05/10/2018 17:55. Not valid without Reference section.
 Generated using Merimen e-Claims IEAS

Estimates on Miscellaneous Items

There are no new miscellaneous items selected.

Estimates on Labour

There are no labour items selected.

Cheng Hoe Motor Pte Ltd/SCR7268T/05/10/2018 17:55. Not valid without Reference section.
 Generated using Merimen e-Claims IEAS

< END OF ESTIMATES >

CHENG HOE MOTOR PTE LTD
BLK 1019 #01-374
YISHUN IND PARK A 3(768761)

TEL: 67556142 / 67586163 FAX: 67557719
ATTN: MR. ANG/DORLYN

TAX INVOICE : AR201809-1417R
DATE : 27/09/2018
CUSTOMER ID : CHE002
VEH REG. NO. : SCRT268T
TERMS : 30 days
PO NO. :
PAGE NO. :
CURR : SGD

SO STOCK ID	DESCRIPTION	Sk Loc	QTY	UPPRICE	AMOUNT
6R0805071E	HEADLAMP BRACKET LH (01)		1	75.00	75.00
6R0805072E	HEADLAMP BRACKET RH (01)		1	75.00	75.00

Suppl

SUB-TOTAL: 150.00	
ADD GST 7.00 % 10.50	
TOTAL AMOUNT: SGD 160.50	
[E] 27/09/2018 4:48:01PM	

[P] 27/09/2018 4:51:42PM
Goods Sold are not refundable for Cash
Interest Rate of 1.5% per month will be imposed on OverDue Account(s)



JAE Auto Pte. Ltd.
Sales Executive: ANN

This is computer generated document.
No signature is required.

Signature / Co Stamp / Date

ORIGINAL

Goods Received in Good Order

CHENG HOE MOTOR PTE LTD
BLK 1019 #01-374
YISHUN IND PARK A 3(768761)

TEL: 67556142 / 67586163 FAX: 67557719
ATTN: MR. ANG/DORLYN

TAX INVOICE : AR201809-13551
DATE : 26/09/2018
CUSTOMER ID : CHE002
VEH REG. NO. : SCRT268T
TERMS : 30 days
PO NO. :
PAGE NO. :
CURR : SGD

SO STOCK ID	DESCRIPTION	Sk Loc	QTY	UPPRICE	AMOUNT
6R0805588A/AH/K	SURPPORT PANEL (05)	UI	1	390.00	390.00

Suppl

SUB-TOTAL: 390.00	
ADD GST 7.00 % 27.30	
TOTAL AMOUNT: SGD 417.30	
[E] 26/09/2018 5:17:01PM	

[P] 27/09/2018 10:51:34AM
Goods Sold are not refundable for Cash
Interest Rate of 1.5% per month will be imposed on OverDue Account(s)



JAE Auto Pte. Ltd.
Sales Executive: ANN

This is computer generated document.
No signature is required.

Signature / Co Stamp / Date

ORIGINAL

Goods Received in Good Order

51 Ubi Avenue 1, #01-25
Paya Ubi Industrial Park
Singapore
408933

Finalised

Claim Reference:
Assessment Number: CSCR7268
Version: CHENGHOE/4
Date Calculated: 22/02/2019 04:30

Full Report - V1
Registration: SCR7268T
Printed: 22/02/2019 12:30

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	LKK AUTO	Date of Incident:	17/09/2018
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	China Taiping Insurance (S) Pt	Repairs Authorised:	TBA
Claim Reference:		Estimated Repair Time:	
Policy Number:	TP/CHINA	Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	VOLKSWAGEN
Model:	Polo
Sub Model:	COMFORTLINE
Model Sheet Number:	6P6 02
Registration:	SCR7268T
Registration Month:	
Registration Year:	
VIN Number:	WVWZZZ6RZAU046722
Odometer:	Not Known
Colour:	
Engine Number:	CGG336960
Fuel Level:	%


Model Specs

FROM 03.2010	AIR CONDITIONING
FRT/RR ELECT WINDOWS	REM CENTRAL LOCKING
ELECTRIC DOOR MIRROR	RADIO RCD 210
TWIN HEADLAMP	TRIM FONZIE
R/SEAT HEIGHT ADJUST	SPLIT REAR SEAT
DOOR TRIM CLOTH	LEATHER STRG WHEEL
VARIABLE LOAD FLOOR	OIL LEVEL GAUGE
PADDED INSTR PANEL	L/SEAT HEIGHT ADJUST
FRONT CENTRE ARMREST	ALTERNATOR 110A
HD COOLING	1.4 LTR 63 KW
7-SPEED DSG	TYRES 185/60 TR 15
WHEELS 6J X 15	SPARE WHEEL STEEL
CHROME PACKAGE	STABILITY PROGR/ABS
REAR DISC BRAKE	5-DOOR
TWO COAT METALLIC	PREPARE OFF VEHICLE
ACTIVE CARBON FILTER	


Vehicle Condition

Vehicle Status

Pre-Accident Condition:	Severity of Impact:	
Steering:	Vehicle Status on Inspection:	
Brakes Pedal Travel:	Date of Inspection:	24/09/2018
Place of Inspection:		
Pre-Accident Damage:		
Tyres Condition:		
Tread Depth LHF:	Tread Depth RHF:	
Tread Depth LHR:	Tread Depth RHR:	
Damage Areas:	Direction of Impact:	

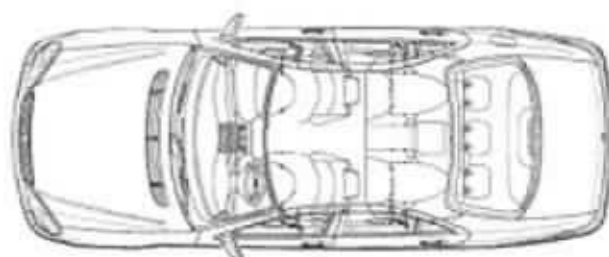

All

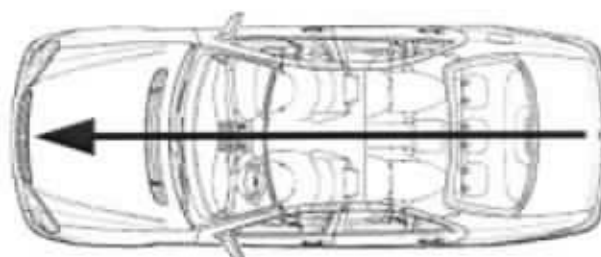

Addresses

Repairer

Name : CHENG HOE MOTOR PL

Address :

BLK 1019 YISHUN IND PARK A

#01-374

Post Code : 768761

Cost Summary

Total Labour	\$1,507.80
Total Paint/Material	\$334.75
Total Parts	\$3,652.00
Total of Additional Costs	\$365.00
Excess:	TBA
Grand Total Exc GST:	\$5,859.55
7 % GST:	\$410.17
Grand Total Inc GST:	\$6,269.72

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$42.00/HR

Price/Dent = \$42.00/HR

Repair /

Guide Number Repair Details

	WU	Cost Price (\$)
51 01 75 00) RUST PROOFING BODY SHELL PART	2.0	8.40
51 01 75 50) APPLY RUST PROOFING AT BONNET (COMPOSITE WORK)	1.0	4.20
51 01 75 50) APPLY CAVITY SEALING ON LEFT FRONT WING (COMPOSITE WORK)	1.0	4.20
51 01 75 50) APPLY CAVITY SEALING ON RIGHT FRONT WING (COMPOSITE WORK)	1.0	4.20
51 01 75 50) INJECT PROTECTIVE WAX REAR END PANEL CAVITY (ASSEMBLY OPERATION)	1.0	4.20
50 38 19 60) R + R FRONT LOCK CARRIER (BUMPER COVER AND NOISE CONTROL PAN REMOVED)	3.0	12.60
50 38 55 50) RENEW FRONT LOCK CARRIER (REMOVED)	7.0	29.40
94 15 20 00) R + R HEADLAMPS DOES NOT INCLUDE: ADJUST HEADLAMPS	4.0	16.80

63 29 19 50	R + R FRONT BUMPER COVER (HEADLAMP REMOVED)	4.0	16.80
63 29 55 50	RENEW FRONT BUMPER COVER (REMOVED)	5.0	21.00
	INCLUDES: R + R NUMBER PLATE, FRONT SPOILER, VENTILATION GRILLE AND RADIATOR GRILLE		
50 55 19 50	R + R L/F WING (BUMPER COVER REMOVED)	5.0	21.00
	INCLUDES: R + R WHEELHOUSE SHELL		
50 55 51 50	L/F WING SEAL (COMPOSITE WORK)	3.0	12.60
50 55 19 50	R + R R/F WING (BUMPER COVER REMOVED)	5.0	21.00
	INCLUDES: R + R WHEELHOUSE SHELL		
50 55 51 50	R/F WING SEAL (COMPOSITE WORK)	3.0	12.60
55 22 19 00	R + R BONNET	7.0	29.40
	INCLUDES: R + R WASHER JETS, ADJUST BONNET		
55 22 55 50	RENEW BONNET (BONNET REMOVED)	3.0	12.60
	INCLUDES: R + R ALL PARTS		
94 15 56 00)	RENEW HEADLAMPS (REMOVED)	1.0	4.20
53 16 53 00	REMOVE PARTS END CROSSMEMBER	7.0	29.40
	INCLUDES: REMOVE TAILLAMPS, BUMPER COVER, BOOT TRIM, BOOT COVER, TAILGATE SEAL, CROSSMEMBER, BOOT SIDE TRIMS AND LOWER LOCK		
53 16 55 00	RENEW END CROSSMEMBER	33.0	138.60
53 16 59 00	FIT PARTS END CROSSMEMBER	11.0	46.20
	INCLUDES: FIT REMOVED PARTS, RENEW IF NECESSARY, CHECK LIGHTING		
70 92 19 00	R + R TAILGATE TRIM	3.0	12.60
63 69 55 50	RENEW REAR BUMPER COVER (REMOVED)	2.0	8.40
	INCLUDES: R + R NUMBER PLATE LAMPS AND NUMBER PLATE		
97 85 09 50	DETACH + REFIT BATTERY EARTH STRAP	1.0	4.20
19 38 17 00)	DRAIN + REFILL COOLANT	4.0	16.80
10 82 19 00	R + R SOUND INSULATION PAN	3.0	12.60
51 01 73 00)	APPLY UNDERSEALANT ON BODYSHELL	2.0	8.40
51 01 73 50	REAR INNER END PANEL CAVITY PROTECTION	1.0	4.20
87 50 19 50	R + R CONDENSER (BUMPER COVER REMOVED) (LOCK CARRIER DETACHED)	3.0	12.60
	DOES NOT INCLUDE: DRAIN + REFILL COOLANT		
87 03 17 00	DRAIN + REFILL REFRIGERANT	5.0	21.00
94 15 06 50	ADJUST HEADLAMPS	2.0	8.40
0340	REPAIR FRT BUMPER SUPPORT	5.0*	21.00
0475	REPAIR LEFT BONNET HINGE	5.0*	21.00
0476	REPAIR RIGHT BONNET HINGE	5.0*	21.00
1117	REPAIR L/F WHEELHOUSE	6.0*	25.20

Claim Reference:

Full Report - V1

Assessment Number: CSCR7268

Registration: SCR7268T

Version: CHENGHOE/4

Printed: 22/02/2019 12:30

Date Calculated: 22/02/2019 04:30

1118	REPAIR R/F WHEELHOUSE	6.0*	25.20
2711	REPAIR REAR PANEL	10.0*	42.00
2931	REPAIR BOOTLID/TAILGATE	10.0*	42.00
8833	REPAIR RR EXHAUST SILENCER	10.0*	42.00

LABOUR COST

Total Work Units	190.0	
Corrosion Protection		
Corrosion Protection External Labour	0.3HRS	12.60
Corrosion Protection Internal Labour	0.6HRS	25.20
Sub Total	19.0HRS	\$798.00
Paint Labour	16.9HRS	\$709.80
Total Labour	35.9HRS	\$1,507.80

PAINT WORK	Time Basis 10 WU = 1 HR. Price = \$42.00/HR	
Guide Number Description	WU	Cost Price (\$)

- TWO COAT METALLIC
- PREPARE OFF VEHICLE

471	BONNET NEW PART PAINTING	20.0
741	L/F WING NEW PART PAINTING	10.0
742	R/F WING NEW PART PAINTING	10.0
2719	REAR PANEL C-MEMBER NEW PART PAINTING	14.0
283	FRONT BUMPER COVER NEW PART PAINT K1R	10.0
2583	REAR COVER BUMPER NEW PART PAINT K1R	13.0
1117	L/F WHEELHOUSE CPL SURFACE PAINT	6.0
1118	R/F WHEELHOUSE CPL SURFACE PAINT	6.0
2711	REAR PANEL REPAIR PAINTING >50%	18.0
2931	TAILGATE/BOOTLID REPAIR PAINTING >50%	24.0
4101	L/INNER SIDE PANEL SURFACE PAINT	4.0
4102	R/INNER SIDE PANEL SURFACE PAINT	4.0

LABOUR COST - PAINT

TIME(PAINT)	139.0	
Preparation Main Work Plastic	5.0	
Preparation Main Work Metal	25.0	
Preparation Work Multi Layer Paint	0.0	
Total Work Units (10WU/HR)	169.0	
Total Paintwork Labour	16.9HRS	\$709.80

MATERIAL COST - PAINT

New Part Painting	Cost Price
New Part Painting - Plastic K1R	\$109.63
Material-Constant Main Work Metal	\$111.69
Surface-/Blend Paint	\$28.60
Repair Painting	\$22.90
Material-Const Main Work Plastic	\$52.93
Total Excluding Pearlescent Uplift	\$9.00
Pearlescent Uplift @ 0.0%	\$334.75
Total Paint Material Cost	\$0.00
	\$334.75

PARTS

Guide No.	Qty	Description	Part Number	Supplier	Price Valid: 01/06/2015	Bet.	Price (\$)
471	1	BONNET	6R0 823 031 G		0%		430.00*
493	1	BONNET LOCK	6R2 823 509 H		0%		120.00*

Claim Reference:

Full Report - V1

Assessment Number: CSCR7268

Registration: SCR7268T

Version: CHENGHOE/4

Printed: 22/02/2019 12:30

Date Calculated: 22/02/2019 04:30

4465	1	CONDENSER	6C0 816 411 B	0%	260.00*
283	1	FRONT BUMPER	6R0 807 221 R	0%	450.00*
			GRU		
930	1	FRT LOCK CARRIER	6R0 805 588 AH	0%	390.00*
410	1	GRILLE	6R0 853 651 C RYP	0%	155.00*
341	1	L/F BUMPER FILLER	6R0 807 248 A	0%	13.00*
741	1	L/F WING	6R0 821 105 H	0%	198.00*
1281	1	L/HEADLAMP MOUNTING	6R0 805 071 E	0%	30.00*
2617	1	L/R BUMPER GUIDE	6R6 807 393 A	0%	35.00*
561	1	LEFT HEADLAMP ASSY	6R2 941 007 F	0%	225.00*
1000	1	LH HLAMP LWR BRKT	Renew	0%	75.00*
342	1	R/F BUMPER FILLER	6R0 807 248 B	0%	13.00*
742	1	R/F WING	6R0 821 106 J	0%	198.00*
1282	1	R/HEADLAMP MOUNTING	6R0 805 072 E	0%	30.00*
2583	1	REAR BUMPER	6R6 807 421 BK	0%	450.00*
			GRU		
2640	1	REAR BUMPER SUPPORT	6R0 807 305 A	0%	180.00*
2719	1	REAR PANEL C-MEMBER	6R6 813 309 A	0%	0.00F
1000	1	RH HLAMP LWR BRKT	Renew	0%	75.00*
562	1	RIGHT HEADLAMP ASSY	6R2 941 008 F	0%	225.00*
f: OEM Parts			Saving		\$32.20
g: Original			Sub Total		\$3,552.00
h: Secondhand			Sundry Parts	(Fixed)	\$100.00
p: Parallel			Total Parts		\$3,652.00
x: Exchange					

THIS ASSESSMENT CONTAINS UNPRICED PARTS
NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description		Betterment	Price
TOWING	SPECIALIST	0%	\$50.00
FRT NO PLATE	SPECIALIST		\$35.00
REAR NO PLATE	SPECIALIST	0%	\$30.00
REVERSE SENSOR	SPECIALIST		\$200.00
ACON	SPECIALIST	0%	\$50.00
Total Extras			\$365.00

Final Calculation

Total Parts		\$3,652.00
Labour		
Total Panel/Mechanical	\$760.20	
Total Paintwork	\$709.80	
Corr Prot External 3 WU	\$12.60	
Corr Prot Internal 6 WU	\$25.20	
Total Labour		\$1,507.80
Additional Costs		
Corr Prot Materials External	\$0.00	
Cost of Specialist	\$365.00	
Total of Additional Costs		\$365.00
Total Paint/Material Costs		\$334.75
Grand Total Excludes GST		\$5,859.55
GST @ 7 %		\$410.17
Grand Total Includes GST		\$6,269.72

Assessment Notes

Veron Chen (LKKAUTO)

From: Veron Chen (LKKAUTO)
Sent: Friday, 22 February 2019 1:28 PM
To: Efeeda (Cheng Hoe -Yishun); SUR
Subject: RE: SCR 7268T-DOA: 17/8/2018

Dear Efeeda,

Noted with thanks.

Kindly send Final invoice and all supporting documents to CHINA TAIPING

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Efeeda (Cheng Hoe -Yishun) <chmotor@singnet.com.sg>
Sent: Friday, 22 February 2019 12:49 PM
To: Veron Chen (LKKAUTO) <veronchen@lkkauto.com>
Subject: Re: SCR 7268T-DOA: 17/8/2018

Hi Veron,

Confirmed.

Rgds
Efeeda
Cheng Hoe Motor PL

From: Veron Chen (LKKAUTO)
Sent: Friday, February 22, 2019 12:42 PM
To: Efeeda (Cheng Hoe -Yishun) ; SUR
Subject: SCR 7268T-DOA: 17/8/2018

Dear Efeeda,

WITHOUT PREJUDICE

Finalise amount \$5859.55 before GST @ 7 working days.

Please check and confirm.

Best Regards,

* **Veron Chen** | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	24 Sep 2018 Sendback Est	24 Sep 2018 12:25 \$57,212.59	24 Sep 2018 16:39 Edit Adj Rpt	\$55,859.55 Edit Estimates	\$55,859.55 View Rpt		Pending for Survey Report Cancel Case
Supp #1	05 Oct 2018 13:38	05 Oct 2018 17:55 \$5150.00	05 Oct 2018 17:55			(Combined)	Combined with Main Uncombine Suppl.

Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS									
Insured: IRFAN , ID: S94379841									
Main Claimant: YOUR TECK MENG									
Vehicle Reg. No.: SCR7268T		Date of Loss: 17/09/2018 19:00 - :59 [98 Months and 27 Days From LTA Reg Date (Man Yr)]							
Claim Type: TP / SNM18D04518C02		Policy/Cover Note No.: DMPCSN3042991701							
Vehicle Reg. No. (Insured): SKH4674G		Policy No. (Claimant):							
		Excess: \$0.00							
Repairer: Cheng Hoe Motor Pte Ltd (Yishun) Blk 1019 #01-374/382, Yishun Industrial Park A, 768761 Yishun - Tel: 6755 6142									
Handling Insurer: China Taiping Insurance (Singapore) Pte. Ltd. (HQ) - Tel: 6389 6111 ... [Handled by Chong Boon Sen]									
Adjuster: LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by KENNETH KONG] ... [Final Rpt due 03/10/2018]									
Driver/Custodian (Insured): IRFAN (/ Male) , NRIC: S94379841 Email:									
Adj Asg. Remarks: EST \$7717.47, CASE WITH SJE.									
ASSOCIATED MAIL RECEIVED View All Compose Case Mail									
There are no mail for this case.									
ALL ASSOCIATED TASKS View All Search Tasks Create New Task Complete									
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

SCR7268T (SNM18D04518C02)
[SKH4674G]
TP
YOUR TECK MENG
Sep 17 2018 7:00PM
[IRFAN]
Cheng Hoe Motor Pte Ltd

Upload Documents		Upload Photos	Compose New Letter	View View in Browser	
Assessment Reports				1 per page	☒
No	Finalized On			Thumbnail	Print
1	24/09/18 12:25	Cheng Hoe Motor Pte Ltd (Yishun)	Repairer Estimates	Load HTM	
2	05/10/18 17:55		Repairer Estimates Suppl. #1	Load HTM	
Photos/Images				3 per page	☒
No	Relabel/Reorder			Thumbnail	Print
1	22/02/19 14:01	LKK Auto Consultants Pte Ltd (HQ)	General View	Load PDF	
2	22/02/19 14:01		Reinspection Photo (1)	Load PDF	
3	22/02/19 14:01		Reinspection Photo (2)	Load PDF	
Documentation				1 per page	☒
No	Finalized On			Thumbnail	Print
1	24/09/18 12:25	Cheng Hoe Motor Pte Ltd (Yishun)	E-filed GIA report	Load PDF	
No	Finalized On			Thumbnail	Print
1	24/09/18 16:35	China Taiping Insurance (Singapore) Pte. Ltd. (HQ)	OI GIA	Load PDF	
No	Relabel/Reorder			Thumbnail	Print
1	25/02/19 11:18	LKK Auto Consultants Pte Ltd (HQ)	Supplementary	Load PDF	

Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			
Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)			
Show Remarks To: ☐ Repairer ☐ Handling Insurer Note: Remarks are private unless you show it to other parties.			

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/CTI18017332/KVD3E2

Date: 25/02/2019

REFERENCE

Handling Insurer: China Taiping Insurance (Singapore) Pte. Ltd. Policy No: DMPCSN3042991701

Claimant Vehicle No: SCR7268T Insured Vehicle No: SKH4674G

Date of Loss: 17/09/2018 Nature of Claim: TP Claim No: SNM18D04518C02

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: SCR7268T

Make & Model: VOLKSWAGEN POLO, 1.4 (A) Engine No: CGG336960

Reg. Date: 21/06/2010 (Man. Year: 2010) Chassis No: WJWZZZ6RZAU046722

Colour: Metallic Black Odometer: 105515 km

Engine Capacity: 1390 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition: Yes

CONDITION OF TYRES

Front Tyre Size: 205/45Z R16 Rear Tyre Size: 205/45Z R16

Front Left Side: Michelin 8 mm Rear Left Side: Michelin 8 mm

Front Right Side: Michelin 8 mm Rear Right Side: Michelin 8 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	4,646.00	3,552.00	1,094.00	23.55
Miscellaneous Items	465.00	465.00	0.00	0.00
Labour	2,251.59	1,842.55	409.04	18.17
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	7,362.59	5,859.55	1,503.04	20.41
+ GST 7.00/7.00% (S\$)	515.38	410.17	105.21	20.41
Nett Amount (S\$)	7,877.97	6,269.72	1,608.25	20.41

INSPECTION

Date of Assignment: 24/09/2018 Present Location: Cheng Hoe Motor Pte Ltd (Yishun)

Date Inspected: 25/09/2018 Inspected At: Cheng Hoe Motor Pte Ltd (Yishun)
Blk 1019 #01-374/382, Yishun Industrial Park A
Singapore 768761

Estimated Period of Repair: 7.0 days

Adjuster: KENNETH KONG

Manager: VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference	
Part Source: MRM-SG	Version: 1.0 (Last Synchronised: 25 Feb 2019)
Parts: 144	VOLKSWAGEN POLO 1.4 (A) (Catalogue:Merimen Singapore 1.0)
Labour: Repairer's	(Price-denominated Standard List)
Print Code: (Unsubmitted, no print-code for SCR7268T)	
Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info: Items/values not in reference catalogue are prefixed with an asterisk *	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1	NA	*BONNET	Bent	430.00 F	*430.00 F
2	1	NA	*BONNET LOCK	Distorted	120.00 F	*120.00 F
3	1	NA	*CONDENSER	Bent	260.00 F	*260.00 F
4	1	NA	*FRONT BUMPER	Buckled	450.00 F	*450.00 F
5	1	NA	*FRT BUMPER C-MEMBER (NPA)	No such part	0.00 F	*- F
6	1	NA	*FRT BUMPER SUPPORT	Repair	195.00 F	*- F
7	1	NA	*FRT LOCK CARRIER	Cracked	390.00 F	*390.00 F
8	1	NA	*GRILLE	Dented	160.00 F	*155.00 F
9	1	NA	*L/F BUMPER FILLER	Distorted	15.00 F	*13.00 F
10	1	NA	*L/F WING	Buckled	198.00 F	*198.00 F
11	1	NA	*L/HEADLAMP MOUNTING	Buckled	30.00 F	*30.00 F
12	1	NA	*L/R BUMPER GUIDE	Cracked	35.00 F	*35.00 F
13	1	NA	*LEFT HEADLAMP ASSY	Mtg Cracked	225.00 F	*225.00 F
14	1	NA	*R/F BUMPER FILLER	Distorted	15.00 F	*13.00 F
15	1	NA	*R/F WING	Buckled	198.00 F	*198.00 F
16	1	NA	*R/HEADLAMP MOUNTING	Buckled	30.00 F	*30.00 F
17	1	NA	*RADIATOR	Serviceable	305.00 F	*- F
18	1	NA	*REAR BUMPER	Buckled	450.00 F	*450.00 F
19	1	NA	*REAR BUMPER SUPPORT	Bent	180.00 F	*180.00 F
20	1	NA	*REAR PANEL	Repair	280.00 F	*- F
21	1	NA	*REAR PANEL C-MEMBER (NPA)	Repair	0.00 F	*- F
22	1	NA	*RIGHT HEADLAMP ASSY	Mtg Cracked	225.00 F	*225.00 F
23	1	NA	*RR EXHAUST SILENCER	Repair	305.00 F	*- F
Supplementary #1						
24	1		*2 pcs Headlamp lower brackets (\$75/pce)	Cracked	150.00 F	*150.00 F
					Total Parts (\$\$)	4,646.00 3,552.00

F=Franchise part.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

No	Qty	Particulars	Repairer's	Amount
Miscellaneous Items				
1	1	ACON	50.00	50.00
2	1	FRT NO PLATE (MISSING)	35.00	35.00
3	1	REAR NO PLATE (DENTED)	30.00	30.00
4	1	REVERSE SENSOR (SHORTED)	200.00	200.00
5	1	SUNDRY PARTS (NECESSARY)	100.00	100.00
6	1	TOWING	50.00	50.00
Sub Total (S\$)			465.00	465.00

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	Total Paint Labour	New	743.40	709.80
2	Total Paint Materials	New	361.59	347.35
3	Total Panel/Mechanical Labour	New	1,146.60	785.40
Gross Labour Cost (S\$)			2,251.59	1,842.55

Report was unsubmitted during this print-out.

< END OF ESTIMATES >