

FormTeam Consultancy Pte Ltd33 Ubi Avenue 3 #02-15 Vertex
Singapore 408868

Tel : 6509 1788 Fax : 6509 6221


UEN No : 200819280D

Bill To:NTUC Income Insurance Co-operative Limited
73 Bras Basah Road
#05-01
NTUC Trade Union House
Singapore 189556**Attn:** Ms Rajeswary**Tax Invoice**

GST Reg No : 200819280D

| | |
|--------------|------------------------------|
| Invoice No : | 13021964 |
| Date : | 28/4/2017 |
| Page : | 1 |
| Your Ref : | MT/0936110-002 |
| Our Ref : | RRN17-031301/PRS/YH/ADJ/YH/b |

| Description | Amount (\$\$) |
|--|----------------------|
| GBC 9742T - Balance bill for repair cost above 10K | \$50.00 |
| Total | \$50.00 |
| We would appreciate your cheque crossed and make payable to : Add: 7% GST | \$3.50 |
| FormTeam Consultancy Pte Ltd | Total Inc GST |
| | \$53.50 |
| | Less: Deposit |
| | \$0.00 |
| E. & O. E | Balance Due |
| | \$53.50 |

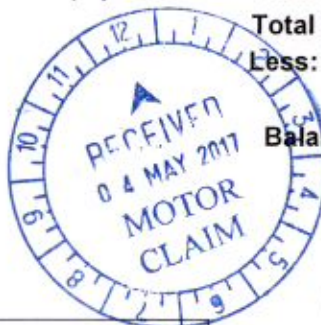

| RECEIVED BY | DATE | COMPANY STAMP |
|-------------|------|---------------|
| | | |

FormTeam Consultancy Pte Ltd

FormTeam Consultancy Pte Ltd

No.33, Ubi Ave 3
#02-15, Vertex
Singapore 408868

Tel : (65) 6509 1788
Fax : (65) 6509 6221

Email: motorsurvey@fta.com.sg

Co.Reg No: 200819280D

GST Reg No: 200819280D

Our Reference : RRN17-031301/PRS/YH/ADJ/YH/bb

Your Reference: MT/0936110-002

Date : 27-Apr-2017

Motor Claims Department
NTUC Income Insurance Co-operative Limited
73 Bras Basah Road
#05-01 NTUC Trade Union House
Singapore 189556

Attention : Ms Rajeswary

Dear Sir/Mdm,

SURVEY OF VEHICLE NO. GBC 9742T

Pursuant to your instruction on **20 April 2017**.

We recommend a repair cost of **\$5,400.00** (see report) based on lump sum repair and the estimated duration of repairs would take **06 days**.

Thank you for this assignment.

Your faithfully

FormTeam Consultancy Pte Ltd
Adjusters & Surveyors (Licensed Appraiser)



Ng You Han
Automobile Appraiser

(Email : yhng@fta.com.sg)

Encl. Survey Report

FormTeam Consultancy Pte Ltd

AUTOMOBILE ASSESSMENT REPORT

Page No. 1

Our Reference : RRN17-031301/PRS/YH/ADJ/YH/bb

Your Reference: MT/0936110-002

Date : 27-Apr-17

Attention : Ms Rajeswary

TO : Motor Claims Department
NTUC Income Insurance Co-operative Limited
73 Bras Basah Road
#05-01 NTUC Trade Union House
Singapore 189556

Assessment of Vehicle No : **GBC 9742T**
Date of Accident : **02-March-2017**
Date of Inspection : **13-March-2017**
Address of Inspection : **4 Woodlands Road 393J Yew Tee Industrial Estate S'677978**

We have carried out a physical assessment of **GBC 9742T** at **M/S Eng Soon Painting Service** according to your instructions on **10 March 2017**, dismantled items on **15 March 2017**, post repair survey on **17 March 2017** and are pleased to submit our report herewith.

1. VEHICLE PARTICULARS

Registration No. : GBC 9742T
Make & Model : NISSAN CABSTAR
Year of Registration : 2014
Engine Capacity : 2953 cc
Chassis No. : JN1SC2F24Z0855614
Engine No. : ZD30336548K
Colour : Blue
Mileage (km) : 141660

2. VEHICLE CONDITION

Body Paint : Fair
Steering : Serviceable
Foot Brake : Serviceable
Parking Brake : Serviceable

3. TYRE PARTICULARS & CONDITION

Front

RH Make/Size : Yokohama 195/80R15 50%
LH Make/Size : Yokohama 195/80R15 50%

Rear

RH Make/Size : Dunlop 155R13 50%
LH Make/Size : Dunlop 155R13 50%

Note : % denotes the remaining percentage of the tyre


FormTeam Consultancy Pte Ltd

Our Reference : RRN17-031301/PRS/YH/ADJ/YH/bb
Your Reference : MT/0936110-002
Vehicle Number : GBC 9742T

Page No. 2

4. DESCRIPTION OF DAMAGE

At the time of inspection, this vehicle sustained damages to the **RHS** portion. Please see attached scheduled for details.

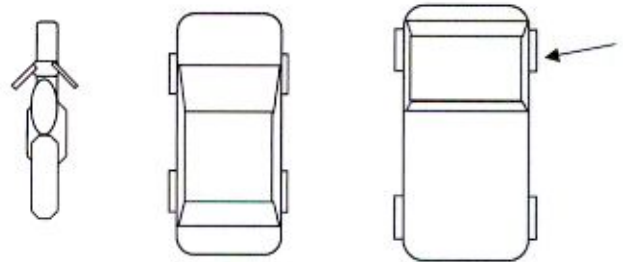

5. REMARKS

Market Value : -
Salvage Value : -
Repair Limit (Nett Loss) : -
Repairer's estimate : **Not Provided**
Nett Saving : -
Excess : -
Sum Insured : -
Our adjusted amount : \$ **5,400.00**
Estimated Repair Days : **06 days**

Additional photographs will be submitted upon request by our principal.

Pursuant to your instruction, we have **NOT AUTHORIZED** repair.

The assessment was conducted on a "**Without Prejudice**" basis.

If we are not notified of anything to the contrary within **14 days** from the date hereof, this report shall be treated as correct.

Disclaimer

This report is intended for the exclusive use of the addressee solely in relation to the loss occurrence in which the assessed vehicle is involved. No liability or responsibility whatsoever shall be held by

FormTeam Consultancy Pte Ltd for any reliance on this report by any third party, unless with the permission of the addressee.

FormTeam Consultancy Pte Ltd

Our Reference : RRN17-031301/PRS/YH/ADJ/YH/bb

Page No. 3

Your Reference : MT/0936110-002

Vehicle Number : GBC 9742T

| QTY | DESCRIPTION | CONDITION | REPAIRER'S ESTIMATE (\$\$) | | CUR ASSESSMENT (\$\$) | |
|------------|-------------------------------------|------------------|-----------------------------------|---|------------------------------|-----------------|
| | PARTS (LIST ITEMS) | | | | | |
| 1 | Front Door Assembly RH | Bent | | | | 1,696.40 |
| 1 | Front Door Run Rubber RH | Deformed | | | | 109.40 |
| 1 | Front Door Checker RH | Bent | | | | 65.60 |
| 1 | Front Door Side Step Finisher RH | Bent | | | | 98.60 |
| 1 | Front Bumper Assembly | Bent | | | | 585.60 |
| | | | | - | | 2,555.60 |
| | Less Discount : | | 30% | - | 30% | 766.68 |
| | Parts Total : | | | - | | 1,788.92 |
| | PARTS (NETT ITEMS) | | | | | |
| 1 | Front Mirror Bracket RH | Broken/Deformed | | | | 390.70 |
| 1 | Front Mirror RH | Missing | | | | 89.60 |
| 1 | Front Door Lock RH | Bent/Twisted | | | | 119.80 |
| 2 | Front Door Hinges RH | Bent/Twisted | | | | 194.60 |
| 1 | Front Door Sticker RH | Necessary | | | | 106.50 |
| 1 | Front Door Regulator RH | Damaged | | | | 87.40 |
| 1 | Front Door Regulator Motor RH | Distrupted | | | | 458.80 |
| 1 | Front Door Glass Run RH | Damaged | | | | 43.00 |
| 1 | Front Door Shield Rubber RH | Damaged | | | | 45.00 |
| 1 | Front Door Outer Seal RH | Damaged | | | | 42.00 |
| 1 | Front Door Waist Seal RH | Damaged | | | | 42.00 |
| 1 | Front Door Glass Channel | Damaged | | | | 30.00 |
| 1 | Front Door Glass Channel Run | Damaged | | | | 48.00 |
| 1 | Front Door Sub Upper Seal RH | Damaged | | | | 33.00 |
| 1 | Front Door Signal Light Assembly RH | Damaged | | | | 15.00 |
| 1 | Front Windscreen Rubber | Deformed | | | | 119.50 |
| 1 | Front Windscreen Washer Tank | Damaged | | | | 102.30 |
| 1 | Front Step Finisher | Warped/Deformed | | | | 181.00 |
| 1 | Front Windscreen Glass | Warped/Deformed | | | | 780.00 |
| 1 | Front Rubber Seal RH | Deformed | | | | 94.60 |
| | | | | - | | 3,022.80 |
| | Less Discount : | | 10% | - | 10% | 302.28 |
| | Parts Total : | | | - | | 2,720.52 |

FormTeam Consultancy Pte Ltd

Our Reference : RRN17-031301/PRS/YH/ADJ/YH/bb

Page No. 4

Your Reference : MT/0936110-002

Vehicle Number : GBC 9742T

| QTY | DESCRIPTION | CONDITION | REPAIRER'S ESTIMATE (S\$) | OUR ASSESSMENT (S\$) |
|-----|----------------------------------|-----------------------------|------------------------------|----------------------------|
| | <u>SPECIAL NETT ITEMS</u> | | | |
| 1 | Front Door Lettering Sticker | Essential | | 50.00 |
| 12 | Front Bumper Clips | Essential | | 36.00 |
| | | Special Nett Total : | - | 86.00 |
| | | Parts Total : | - | 4,595.44 |
| | | | | |


FormTeam Consultancy Pte Ltd


Our Reference : RRN17-031301/PRS/YH/ADJ/YH/bb
Your Reference : MT/0936110-002
Vehicle Number : GBC 9742T

Page No. 5

| S/N | DESCRIPTION | REPAIRER'S ESTIMATE (S\$) | OUR ASSESSMENT (S\$) |
|-----|--|------------------------------|-------------------------|
| | <u>LABOUR</u> | | |
| 1 | To remove, refix front windscreen glass. | | 120.00 |
| 2 | To remove, refix door fittings to facilitate repair. | | 60.00 |
| 3 | To remove, refix seats, carpet and trims. | | 80.00 |
| 4 | To remove, cut out damage portion, jack out, straighten, panel beating, welding, align and renew replaced parts. | | 800.00 |
| 5 | To putty and respray painting on affected areas. | | 900.00 |
| 6 | To apply undersealing. | | 60.00 |
| 7 | To supply door sticker. | | 150.00 |
| | Labour Total : | - | 2,170.00 |
| | TOTAL (PARTS & LABOUR) : | - | 6,765.44 |

The final adjusted Lump Sum contract amount is **\$5,400.00**
[SINGAPORE DOLLARS FIVE THOUSAND AND FOUR HUNDRED ONLY]


Frankie Pang
AMSAE(AUST), AMIRTE, AMSOE,
MASPACI, MSAAA
Licensed Appraiser


Ng You Han
Automobile Appraiser