PROGRESSIVE CAR CARE PTE LTD BLK 3022A UBI ROAD 1 #01-45/46 **SINGAPORE 408716**

Email: progauto@procarcar

e.com.sq

Claim Reference: OD 0918 - 6679 Assessment Number: PA001673

Version: PROGRESS/1

Date Calculated: 28/09/2018 04:08

Full Report - V1 Registration: SKH6943S

Printed: 28/09/2018 11:08

SGD

TBA

26/09/2018

Summary Information

Claim

Location:

Printed by: Authorisation Status:

Work Provider:

Claim Reference:

Policy Number:

Other Reference:

Third Party: Insured Amount:

Under Warranty: Warranty Expired: Singapore (SG)

Wayne Lim Interim

AXA Insurance S'pore Pte Repairs Authorised:

Ltd OD 0918 - 6679

OD 0918 - 6679

Quote Due Date:

Currency:

Date of Incident:

Able to Authorise Repairs: TBA

Actual Repair Days: Parts Ordered Date: Hire Car Start: Hire Car End: Vehicle Collected:

Estimated Repair Time:

Vehicle Details

Vehicle Manufacturer:

Model:

Sub Model:

Model Sheet Number: Registration:

Registration Month:

Registration Year:

VIN Number: Manufacture Year:

Odometer:

Colour:

Engine Number:

Fuel Level:

VOLKSWAGEN

Tiguan

SPORT & STYLE

6C3 04 SKH6943S January

2013

WVGZZZ5NZDW043183

2012 Not Known

CAW158855

%

Model Specs FROM 09/2012 CLIMATRONIC RAIN SENSOR

SIDE WINDOW/RR SCRN

8 SPEAKER FOG LAMPS

HEIGHT ADJ PASS SEAT STRG WHEEL LEATHER FRONT SEAT DRAWER VARIABLE LOAD FLOOR FRT SEAT FOLD TABLE

SMOKER EQUIPMENT

HD COOLING

4MOTION (ALL WHEEL) DROWSINESS DETECTION WHEELS 7J X 17 ALLOY SPACE SAVER SP-WHEEL

TYRE PRESSURE CHECK

ROOF RAILS

TWO COAT METALLIC

TYRES 235/55 VR 17

DOOR MIRROR W/MEMORY LIGHT/COMING HOME

AUTO DIPPING MIRROR

RADIO RCD 310 KEYLESS ENTRY ROOF CONSOLE

CLOTH/LEATHER TRIM FRONT LUMBAR SUPPORT

OIL LEVEL SENSOR FRONT CENTRE ARMREST

FRT FOLDING BACKREST

2.0 LTR 125 KW **AUTOMATIC 6-SPEED** CHROME PACKAGE BUMPER COMFORT

EXCLUSIVE

PREPARE OFF VEHICLE

Vehicle Condition

Vehicle Status

Pre-Accident Condition:

Steering:

Brakes Pedal Travel: Place of Inspection: Pre-Accident Damage: Severity of Impact: Vehicle Status on

Inspection:

Date of Inspection:

27/09/2018

Claim Reference: OD 0918 - 6679 Assessment Number: PA001673

Version: PROGRESS/1

Date Calculated: 28/09/2018 04:08

Full Report - V1


Registration: SKH6943S

Printed: 28/09/2018 11:08


Tyres Condition:

Tread Depth LHF: Tread Depth LHR:

Damage Areas:

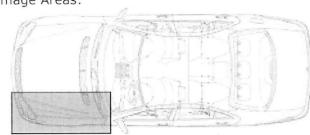

Tread Depth RHF: Tread Depth RHR: Direction of Impact:

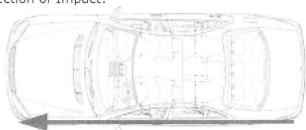

Addresses

Repairer

Name: PROGRESSIVE

Address : Post Code :

Cost Summary

Total Labour	\$409.50
Total Parts	\$2,640.00
Total of Additional Costs	\$380.00
Excess:	TBA
Grand Total Exc GST:	\$3,429.50
7 % GST:	\$240.07
Grand Total Inc GST:	\$3,669.57

Repair Information

LABOUR	Time Basis 10 WU = 1 HR. Price/CL 1 = \$45.00/HR
	Price/Dent = \$45.00/HR

Repair /			*
	r Repair Details	WU	Cost Price (\$)
10 82 19 00	R + R SOUND INSULATION PAN	3.0 <	13.50
97 85 19 00	DETACH + REFIT BATTERY	2.0 X	9.00
27 06 19 00)	R + R BATTERY	1.0 X	4.50
	(BATTERY DETACHED)		
50 84 19 50)	R + R BATTERY CONSOLE	1.0 X	4.50
	(AIR FILTER AND BATTERY REMOVED)	9:	
44 05 19 00	R + R FRONT WHEEL (WHEELS)	2.0	9.00
NO NUMBER	R + R WATER BOX INSULATION	2.0	9.00
24 25 19 40	R + R AIR FILTER CPL	4.0 X	18.00
34 41 19 50	R + R PENDULUM SUPPORT	2.0 🗸	9.00
48 35 19 00)	R + R POWER STEERING GEAR	7.0 🗸	31.50
	(WHEELS, PENDULUM SUPPORT AND SOUND		
	PROTECTION PAN REMOVED)		
	INCLUDES: DETACH + REFIT ASSEMBLIES		
	CARRIER		
	DOES NOT INCLUDE: ALIGN FRONT AND REAR		
	VEHICLE		
40 07 19 02)	R + R ASSEMBLY CARRIER	8.0	36.00
	(SOUND PROTECTION PAN REMOVED)	= m	
	INCLUDES: DETACH + REFIT STEERING GEAR		

Claim Reference: OD 0918 - 6679

Assessment Number: PA001673

Version: PROGRESS/1

Date Calculated: 28/09/2018 04:08

Full Report - V1
Registration: SKH6943S

Printed: 28/09/2018 11:08

44 10 55 50	AND STABILIZER DOES NOT INCLUDE: ALIGN FRONT AND REAR R + R L/F WHEEL/TYRE (WHEEL REMOVED) INCLUDES: R + R TYRE, FIT VALVE,	3.0	13.50
40 85 19 00)	BALANCE WHEEL R + R L/F SPRING STRUT (WHEEL REMOVED)	9.0	40.50
40 90 19 50	DOES NOT INCLUDE: ALIGN FRONT AND REAR R + R LEFT FRONT SHOCK ABSORBER (SPRING STRUT REMOVED) INCLUDES: R + R SPRING STRUT MOUNT AND COIL SPRING	2.0	9.00
40 50 19 00)	R + R L/F WHEEL BEARING HOUSING (WHEEL REMOVED) INCLUDES: R + R SPEED SENSOR AND BRAKE DISC,	9.0 🗸	40.50
40 50 55 50	DETACH + REFIT DRIVE SHAFT DOES NOT INCLUDE: ALIGN FRONT AND REAR RENEW L/F WHEEL BEARING HOUSING (WHEEL BEARING HOUSING REMOVED) INCLUDES: R + R WHEEL BEARING AND WHEEL HUB	3.0	13.50
40 07 55 50	RENEW AGGREGATE CARRIER (REMOVED)	1.0×	4.50
40 41 19 00)	R + R L/F DRIVE SHAFT	2.0	9.00
40 17 09 00)	DETACH + REFIT R/F LOWER SUSPENSION ARM	2.0	9.00
01 50 00 ZAX	GFS / GUIDED FUNCTION (READ AND DELETE ERROR MEMORY AFTER REPAIR)	5.0	22.50
44 95 03 00	ALIGN FRONT AND REAR VEHICLE INCLUDES: CHECK TOE AND CAMBER, R + R BRACKET AND ALIGNMENT SENSOR DOES NOT INCLUDE: ADJUSTMENT	9.0	40.50
44 94 15 50	REAR WHEEL CAMBER ALIGNMENT (COMPOSITE WORK) (FRONT AND REAR VEHICLE ALIGNMENT)	2.0	9.00
44 93 15 50	REAR WHEEL TOE ALIGNMENT (COMPOSITE WORK) (VEHICLE FRONT AND REAR ALIGNMENT)	2.0	9.00
44 89 15 50	ADJUST FRONT CAMBER (COMPOSITE WORK) (FRONT AND REAR ALIGNMENT) INCLUDES: DETACH + REFIT ASSEMBLIES CARRIER	3.0	13.50
44 80 15 50	ADJUST CASTOR INCLUDES: ALIGN FRONT AND REAR	5.0	22.50
44 88 15 50	FRONT WHEEL TOE ALIGNMENT (COMPOSITE WORK)	2.0	9.00
	(VEHICLE FRONT AND REAR ALIGNMENT)		
LAB	OUR COST	98	
	Total Work Units	91.0	1
	Panel / Mechanical Labour	6.8HRS	\$306.00

Claim Reference: OD 0918 - 6679 Assessment Number: PA001673 Full Report - V1
Registration: SKH6943S

Assessment Number: PA001673 Version: PROGRESS/1

Printed: 28/09/2018 11:08

Date Calculated: 28/09/2018 04:08

Visual Alignment Labour	2.3 HRS	\$103.50
Corrosion Protection External Labour	0.0HRS	0.00
Corrosion Protection Internal Labour	0.0HRS	0.00
Sub Total	9.1HRS 9.3	\$409.50 44
Total Labour	9.1HRS9.4	\$409.50

		Total Labout					0121110	44
PAINT W				Tir	ne Basi	s 10 WU =	1 HR. Price =	
Guide Nu	mbei	Description		1.70			WU	Cost Price (\$)
		- TWO COA						
	LAD	- PREPARE	OFF VEH.	ICLE				
	LAD	OUR COST - PAINT TIME(PAINT)					0.0	
		Total Work Units (1	owu/H	R)			0.0	
		Total Paintwork La		11)			0.0HRS	\$0.00
	MAT	ERIAL COST - PAIN						Cost Price
		Total Excluding Pea	arlescen	t Uplift				\$0.00
		Pearlescent Uplift	@ 0.0%					\$0.00
		Total Paint Materia	l Cost	et.				\$0.00
PARTS								
_ ,, ,	٠.			m 1 M		~		alid: 01/06/2015
		Description	Heren	Part Nur		Supplier	Bet. 0%	
7011 7047	1	ASSEMBLY CARRIER L/F TRACK CONT ARM	Bert	3C0 199 5N0 407			0%	680.00* · 260.00* ·
7047	1 1	L/F GUIDE JOINT 3	ent	1KO 407			0%	60.00*3
7081	1	L/WHEEL BEARING H		1KO 407			0%	✓ 280.00*³≥
7081	1	L/F SHOCK ABSORBE		5NO 413			0%	✓ 170.00* ≥
7101	1	L/BUFFER D-	.1\	1KO 412			0%	50.00*≯
7131	1	L/F WHEEL HUB/BRG	Pad	5K0 498			0%	/ 220.00* ²
7201	1	L/F WHEEL GALANTE	- ,	5N0 601		001	0%	680.00*
		at	per	8Z8		210		7
f: OEM Pa	rts	ω		Su	ıb Total			\$2,400.00
g: Origina				Ma	ark Up F	rom Cost	(10 %)	\$240.00
h: Second	lhand				ındry Pa		(Fixed)	\$0.00
p: Parallel				To	otal Par	ts		\$2,640.00
x: Exchan	ge							
_		NB - COLOUR C	CODED IT	EMS/TRIM	1 - PART	NUMBERS M	MAY DIFFER	
Extras		Description			Dot	terment		Price
		Description TYRES THE ME	SPECIAL	ICT	0%	terment		\$380.00
		TIRES /SCI	SPECIAL	_131		al Extras		\$380.00
Final Ca	loul	ation			100	ai Latias		\$300.00
Total Par		ation						\$2,640.00
Labour							/	
	Tota	l Panel/Mechanical					\$306.00 26	
		l Paintwork					\$0.00	
		l Visual Alignment wor	k				\$103.50	/
Total Lab	our							\$409.50

Corr Prot Materials External

Corr Prot Materials Internal

Additional Costs

441

\$0.00

\$0.00

Claim Reference: OD 0918 - 6679 **Assessment Number: PA001673**

Version: PROGRESS/1

Date Calculated: 28/09/2018 04:08

Full Report - V1

Registration: SKH6943S

Printed: 28/09/2018 11:08

Cost of Specialist

Total of Additional Costs Total Paint/Material Costs Grand Total Excludes GST

GST @ 7 %

Grand Total Includes GST

\$380.00

\$380.00

\$0.00

\$3,429.50

\$240.07

\$3,669.57

Assessment Notes

Adrian hiry 7 | 7 28/09/18

Anthonsed Repuire, 03 Days.
Excen: NIL

LKK Auto Consultants hence notify the Repairer of the following:

- · To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- · Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

PEOPLE'S AUTO TRADING

BLK 3007 UBI ROAD 1 #01-400 SINGAPORE 408701

Tel No.: 67414646 Fax No.: 67489194

E-Mail: peoplevehicle@gmail.com

PROGRESSIVE CAR CARE PTE LTD

BLK 3022A UBI ROAD 1 #01-45/46

GST Reg. No.: M9-0001895-E Buss. Reg. No.: 52861999C

000918-6679

Tax Invoice: PA183881

Invoice Date: 29/09/2018 Vehicle Num.: SKH 6943 S

Make/Model: VOLKSWAGEN TIGUAN

Mileage(Km): 152837

POMO/RO#

Ref./Remark: 235-55-17 CSC2

S408716

Contact: 67415336 Fax No.: 67417208

SAV Quantity Particular

Unit Price

Amount S\$

1SER:

CROSS MEMBER TO SYMMETRICAL SPECIFICATIONS

80 00 0

LKK Auto Consultants hence notify the Repairer of the following:

To resurvey before/after spray painting

- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Adrian huh

E & O.E

Total S\$:

GST@7%S\$.

Amount Due S\$:

Terms: 30

Customer's Signature/Co. Stamp

PEOPLE'S AUTO TRADING

No official receipt will be issued. Goods sold are not refundable. Thank you for being our customer.