

51 Ubi Avenue 1, #01-25  
Paya Ubi Industrial Park  
Singapore  
408933

Claim Reference: OD 0918 - 6679  
Assessment Number: PA001673  
Version: LKKAUTOC/4  
Date Calculated: 08/11/2018 00:45

Full Report - V1  
Registration: SKH6943S  
Printed: 08/11/2018 08:47

## Summary Information

### Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	LKK AUTO	Date of Incident:	26/09/2018
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	AXA Insurance S'pore Pte Ltd	Repairs Authorised:	TBA
Claim Reference:	OD 0918 - 6679	Estimated Repair Time:	
Policy Number:		Quote Due Date:	
Other Reference:	OD 0918 - 6679	Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

### Vehicle Details

#### Vehicle

Manufacturer:	VOLKSWAGEN
Model:	Tiguan
Sub Model:	SPORT & STYLE
Model Sheet Number:	6C3 04
Registration:	SKH6943S
Registration Month:	January
Registration Year:	2013
VIN Number:	WVGZZZ5NZDW043183
Manufacture Year:	2012
Odometer:	Not Known
Colour:	
Engine Number:	CAW158855
Fuel Level:	%

#### Model Specs


FROM 09/2012	TYRES 235/55 VR 17
CLIMATRONIC	DOOR MIRROR W/MEMORY
RAIN SENSOR	LIGHT/COMING HOME
SIDE WINDOW/RR SCRNR	AUTO DIPPING MIRROR
8 SPEAKER	RADIO RCD 310
FOG LAMPS	KEYLESS ENTRY
HEIGHT ADJ PASS SEAT	ROOF CONSOLE
STRG WHEEL LEATHER	CLOTH/LEATHER TRIM
FRONT SEAT DRAWER	FRONT LUMBAR SUPPORT
VARIABLE LOAD FLOOR	OIL LEVEL SENSOR
FRT SEAT FOLD TABLE	FRONT CENTRE ARMREST
SMOKER EQUIPMENT	FRT FOLDING BACKREST
HD COOLING	2.0 LTR 125 KW
4MOTION (ALL WHEEL)	AUTOMATIC 6-SPEED
DROWSINESS DETECTION	WHEELS 7J X 17 ALLOY
SPACE SAVER SP-WHEEL	CHROME PACKAGE
TYRE PRESSURE CHECK	BUMPER COMFORT
ROOF RAILS	EXCLUSIVE
TWO COAT METALLIC	PREPARE OFF VEHICLE

## Vehicle Condition


### Vehicle Status

Pre-Accident Condition:	Severity of Impact:	
Steering:	Vehicle Status on	
	Inspection:	
Brakes Pedal Travel:	Date of Inspection:	27/09/2018
Place of Inspection:		
Pre-Accident Damage:		
Tyres Condition:		
Tread Depth LHF:	Tread Depth RHF:	
Tread Depth LHR:	Tread Depth RHR:	

Damage Areas:

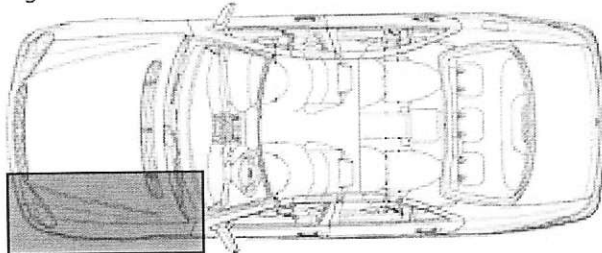

Direction of Impact:

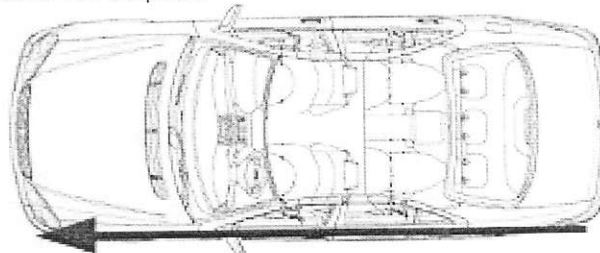

## Addresses

### Repairer

Name : PROGRESSIVE

Address :

Post Code :

### Cost Summary

Total Labour	\$364.50
Total Parts	\$1,144.00
Total of Additional Costs	\$760.00
Excess:	TBA
Grand Total Exc GST:	\$2,268.50
7 % GST:	\$158.80
Grand Total Inc GST:	\$2,427.30

## Repair Information

### LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$45.00/HR  
Price/Dent = \$45.00/HR

### Repair /

#### Guide Number Repair Details

		WU	Cost Price (\$)
10 82 19 00	R + R SOUND INSULATION PAN	3.0	13.50
97 85 09 50	DETACH + REFIT BATTERY EARTH STRAP	A 1.0	4.50
NO NUMBER	R + R WATER BOX INSULATION	2.0	9.00
34 41 19 50	R + R PENDULUM SUPPORT	2.0	9.00
48 40 09 00)	DETACH + REFIT POWER STEERING GEAR	A 4.0	18.00
48 35 19 00)	R + R POWER STEERING GEAR	7.0	31.50
	(WHEELS, PENDULUM SUPPORT AND SOUND PROTECTION PAN REMOVED)		
	INCLUDES: DETACH + REFIT ASSEMBLIES CARRIER		
	DOES NOT INCLUDE: ALIGN FRONT AND REAR VEHICLE		
44 05 19 00	R + R FRONT WHEEL (WHEELS)	2.0	9.00
44 10 55 50	R + R L/F WHEEL/TYRE	3.0	13.50
	(WHEEL REMOVED)		
	INCLUDES: R + R TYRE, FIT VALVE, BALANCE WHEEL		
40 85 19 00)	R + R L/F SPRING STRUT	9.0	40.50
	(WHEEL REMOVED)		
	DOES NOT INCLUDE: ALIGN FRONT AND REAR		
40 90 19 50	R + R LEFT FRONT SHOCK ABSORBER	2.0	9.00
	(SPRING STRUT REMOVED)		
	INCLUDES: R + R SPRING STRUT MOUNT AND		

40 50 19 00)	COIL SPRING R + R L/F WHEEL BEARING HOUSING (WHEEL REMOVED) INCLUDES: R + R SPEED SENSOR AND BRAKE DISC, DETACH + REFIT DRIVE SHAFT DOES NOT INCLUDE: ALIGN FRONT AND REAR	9.0	40.50
40 50 55 50	RENEW L/F WHEEL BEARING HOUSING (WHEEL BEARING HOUSING REMOVED) INCLUDES: R + R WHEEL BEARING AND WHEEL HUB	3.0	13.50
40 17 19 03)	R + R L/FR/LOWER CONTROL ARM	A 2.0	9.00
40 41 19 00)	R + R L/F DRIVE SHAFT	2.0	9.00
40 17 09 00)	DETACH + REFIT R/F LOWER SUSPENSION ARM	2.0	9.00
01 50 00 ZAX	GFS / GUIDED FUNCTION (READ AND DELETE ERROR MEMORY AFTER REPAIR)	5.0	22.50
44 95 03 00	ALIGN FRONT AND REAR VEHICLE INCLUDES: CHECK TOE AND CAMBER, R + R BRACKET AND ALIGNMENT SENSOR DOES NOT INCLUDE: ADJUSTMENT	9.0	40.50
44 94 15 50	REAR WHEEL CAMBER ALIGNMENT (COMPOSITE WORK) (FRONT AND REAR VEHICLE ALIGNMENT)	2.0	9.00
44 93 15 50	REAR WHEEL TOE ALIGNMENT (COMPOSITE WORK) (VEHICLE FRONT AND REAR ALIGNMENT)	2.0	9.00
44 89 15 50	ADJUST FRONT CAMBER (COMPOSITE WORK) (FRONT AND REAR ALIGNMENT) INCLUDES: DETACH + REFIT ASSEMBLIES CARRIER	3.0	13.50
44 80 15 50	ADJUST CASTOR INCLUDES: ALIGN FRONT AND REAR	5.0	22.50
44 88 15 50	FRONT WHEEL TOE ALIGNMENT (COMPOSITE WORK) (VEHICLE FRONT AND REAR ALIGNMENT)	2.0	9.00
<b>LABOUR COST</b>		<b>81.0</b>	
Total Work Units		5.8HRS	\$261.00
Panel / Mechanical Labour		2.3HRS	\$103.50
Visual Alignment Labour		0.0HRS	0.00
Corrosion Protection External Labour		0.0HRS	0.00
Corrosion Protection Internal Labour		8.1HRS	\$364.50
Sub Total		8.1HRS	\$364.50
Total Labour			

<b>PAINT WORK</b>		Time Basis 10 WU = 1 HR. Price = \$45.00/HR	
Guide Number	Description	WU	Cost Price (\$)
	- TWO COAT METALLIC		
	- PREPARE OFF VEHICLE		
<b>LABOUR COST - PAINT</b>			
TIME(PAINT)		0.0	

<b>Total Work Units (10WU/HR)</b>	<b>0.0</b>	
<b>Total Paintwork Labour</b>	<b>0.0HRS</b>	<b>\$0.00</b>
<b>MATERIAL COST - PAINT</b>		<b>Cost Price</b>
<b>Total Excluding Pearlescent Uplift</b>		<b>\$0.00</b>
<b>Pearlescent Uplift @ 0.0%</b>		<b>\$0.00</b>
<b>Total Paint Material Cost</b>		<b>\$0.00</b>

#### PARTS

				Price Valid: 01/06/2015	
Guide No.	Qty	Description	Part Number	Supplier	Bet. Price (\$)
7101	1	L/BUFFER	1K0 412 303 M		0% 50.00*
7061	1	L/F GUIDE JOINT	1K0 407 365 C		0% 60.00*
7087	1	L/F SHOCK ABSORBER	5N0 413 031 AL		0% 170.00*
7047	1	L/F TRACK CONT ARM	5N0 407 151		0% 260.00*
7201	1	L/F WHEEL	5N0 601 025 AJ		0% 0.00F
			8Z8		
7131	1	L/F WHEEL HUB/BRG	5K0 498 621		0% 220.00*
7081	1	L/WHEEL BEARING HSG	1K0 407 255 AA		0% 280.00*
f: OEM Parts			Saving		\$446.00
g: Original			Sub Total		\$1,040.00
h: Secondhand			Mark Up From Cost (10 %)		\$104.00
p: Parallel			Sundry Parts (Fixed)		\$0.00
x: Exchange			<b>Total Parts</b>		<b>\$1,144.00</b>

THIS ASSESSMENT CONTAINS UNPRICED PARTS  
NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

#### Extras

Description	Betterment	Price
L/F WHEEL A SPECIALIST	0%	\$680.00
ADJUSTER A SPECIALIST		\$80.00
CROSSMEMBER		
<b>Total Extras</b>		<b>\$760.00</b>

#### Final Calculation

<b>Total Parts</b>	<b>\$1,144.00</b>
<b>Labour</b>	
Total Panel/Mechanical	\$261.00
Total Paintwork	\$0.00
Total Visual Alignment work	\$103.50
<b>Total Labour</b>	<b>\$364.50</b>
<b>Additional Costs</b>	
Corr Prot Materials External	\$0.00
Corr Prot Materials Internal	\$0.00
Cost of Specialist	\$760.00
<b>Total of Additional Costs</b>	<b>\$760.00</b>
<b>Total Paint/Material Costs</b>	<b>\$0.00</b>
<b>Grand Total Excludes GST</b>	<b>\$2,268.50</b>
GST @ 7 %	\$158.80
<b>Grand Total Includes GST</b>	<b>\$2,427.30</b>

#### Assessment Notes

**51 Ubi Avenue 1, #01-25 Paya Ubi Industrial Park Singapore**

**Claim Reference: OD 0918 - 6679**

**Full Report - V1**

**Assessment Number: PA001673**

**Registration: SKH6943S**

**Version: LKKAUTOC/4**

**Printed: 08/11/2018 08:47**

**Date Calculated: 08/11/2018 00:45**

---