Ah Lim Motor Company 10 Ang Mo Kio Industrial Park 2A #01-09 AMK Autopoint

SURVEYOR COPY Singapore 568047

Claim Reference: 3 PARTY CLAIM **Assessment Number: AH000940** 

Version: AHLIM001/1

Date Calculated: 29/09/2018 04:54

Full Report - V1 Registration: SJB7411Y Printed: 29/09/2018 11:55

**Summary Information** 

Claim

Location: Printed by:

Ahlim ahlim

Authorisation Status: Work Provider:

Interim

TOYOTA

Vios

YF3 04

January

2008

2007

SJB7411Y

Not Known

1NZX688721

MRO53HY9305046438

Claim Reference: Policy Number: Other Reference:

Third Party: Insured Amount: Under Warranty: Warranty Expired: Singapore (SG)

AXA Insurance S'pore Pte Repairs Authorised:

3 PARTY CLAIM

Currency: SGD

Date of Incident:

Able to Authorise Repairs: TBA TRA

Estimated Repair Time: Ouote Due Date: Actual Repair Days: Parts Ordered Date: Hire Car Start: Hire Car End: Vehicle Collected:

**Vehicle Details** 

Vehicle

Manufacturer: Model:

Sub Model: Model Sheet Number:

Registration: Registration Month: Registration Year:

VIN Number:

Manufacture Year:

Odometer:

Colour:

Engine Number:

Fuel Level: 0/0 **Model Specs** 

FROM 02/2008 HEADLAMP TRIM COLOUR FOG LAMPS

1.5 LTR 80 KW TYRES 185/60 HR 15 EQUIPMENT "J" GRADE PREPARE OFF VEHICLE

**BONNET INSULATION** 

4-SPEED AUTOMATIC WHEELS 5.5J X 15 ALU TWO COAT METALLIC

**Vehicle Condition** 

**Vehicle Status** 

Pre-Accident Condition: Steering:

Brakes Pedal Travel: Place of Inspection: Pre-Accident Damage:

Tyres Condition:

Tread Depth LHF: Tread Depth LHR: Damage Areas:

Severity of Impact: Vehicle Status on

Inspection:

Date of Inspection:

29/09/2018


Tread Depth RHF: Tread Depth RHR: Direction of Impact:


Claim Reference: 3 PARTY CLAIM Assessment Number: AH000940

Version: AHLIM001/1

Date Calculated: 29/09/2018 04:54

Full Report - V1 Registration: SJB7411Y Printed: 29/09/2018 11:55

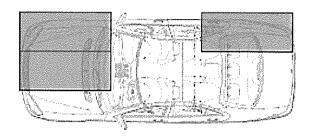

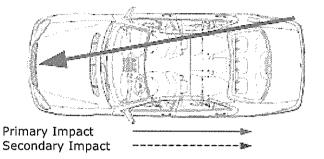

## **Addresses**

Cost Summary
--------------

Total Labour	\$3,753.00
Total Paint/Material	\$429.33
Total Parts	\$10,147.16
Total of Additional Costs	\$1,210.00
Excess:	TBA
Grand Total Exc GST:	\$15,539.49
7 % GST:	\$1,087.76
Grand Total Inc GST:	\$16,627.25

# **Repair Information**

Time Basis 10 WU = 1 HR. Price/CL 1 = \$45.00/HR			
	Price/Dent	: = \$45.00/HR	
	WU	Cost Price (\$)	
ADJUST HEADLAMPS	2.0	9.00	
R + R LEFT FRONT WING	4.0	18.00	
INCLUDES: WHEELHOUSE LINER AND REQUIRED			
ATTACHED PARTS R + R			
NOT INCLUDED: HEADLAMP AND			
R + R BUMPER			
R + R RIGHT FRONT WING	4.0	18.00	
INCLUDES: WHEELHOUSE LINER AND REQUIRED			
ATTACHED PARTS R + R			
NOT INCLUDED: HEADLAMP AND			
R + R BUMPER			
RENEW FRONT PANEL CPL	9.0	40.50	
RENEW RIGHT FRONT WING	2.0	9.00	
INCLUDES: TRANSFER ATTACHED PARTS			
R + R FRONT BUMPER	5.0	22.50	
RENEW FRONT BUMPER (REMOVED)	4.0	18.00	
R + R FRONT BUMPER DAMPER	1.0	4.50	
R + R FRONT BUMPER REINFORCEMENT	2.0	9.00	
RENEW FRONT BUMPER REINFORCEMENT	2.0	9.00	
R + R LEFT HEADLAMP	1.0	4.50	
(BUMPER REMOVED)			
DOES NOT INCLUDE: ADJUST HEADLAMP			
R + R RIGHT HEADLAMP	1.0	4.50	
(BUMPER REMOVED)			
	Repair Details  ADJUST HEADLAMPS R + R LEFT FRONT WING INCLUDES: WHEELHOUSE LINER AND REQUIRED ATTACHED PARTS R + R NOT INCLUDED: HEADLAMP AND R + R BUMPER R + R RIGHT FRONT WING INCLUDES: WHEELHOUSE LINER AND REQUIRED ATTACHED PARTS R + R NOT INCLUDED: HEADLAMP AND R + R BUMPER RENEW FRONT PANEL CPL RENEW RIGHT FRONT WING INCLUDES: TRANSFER ATTACHED PARTS R + R FRONT BUMPER RENEW FRONT BUMPER RENEW FRONT BUMPER (REMOVED) R + R FRONT BUMPER REINFORCEMENT RENEW FRONT BUMPER REINFORCEMENT RENEW FRONT BUMPER REINFORCEMENT R + R LEFT HEADLAMP (BUMPER REMOVED) DOES NOT INCLUDE: ADJUST HEADLAMP R + R RIGHT HEADLAMP	REPAIR DETAILS ADJUST HEADLAMPS R + R LEFT FRONT WING INCLUDES: WHEELHOUSE LINER AND REQUIRED ATTACHED PARTS R + R NOT INCLUDED: HEADLAMP AND R + R BUMPER R + R RIGHT FRONT WING INCLUDES: WHEELHOUSE LINER AND REQUIRED ATTACHED PARTS R + R NOT INCLUDED: HEADLAMP AND R + R BUMPER R + R BUMPER RENEW FRONT PANEL CPL RENEW FRONT PANEL CPL RENEW RIGHT FRONT WING INCLUDES: TRANSFER ATTACHED PARTS R + R FRONT BUMPER RENEW FRONT BUMPER RENEW FRONT BUMPER (REMOVED) R + R FRONT BUMPER REINFORCEMENT R + R FRONT BUMPER REINFORCEMENT RENEW FRONT BUMPER REINFORCEMENT RE	

Claim Reference: 3 PARTY CLAIM

Assessment Number: AH000940

Version: AHLIM001/1

Full Report - V1

Registration: SJB7411Y

Printed: 29/09/2018 11:55

Date Calculated: 29/09/2018 04:54

	DOES NOT INCLUDE: ADJUST HEADLAMP		
B100	R + R LEFT FRONT MUD FLAP	3.0	13.50
NO NUMBER		1.0	4.50
NO NUMBER	RENEW R/F WING BADGE	1.0	4.50
B100	R + R RIGHT FRONT MUD FLAP	3.0	13.50
B060	TRANSFER ATTACHED PARTS FROM BONNET	2.0	9.00
530051)	RENEW BONNET	1.0	4.50
D000	INCLUDES: R + R OR RENEW ATTACHED PARTS		
B080	R + R BONNET HINGE/S	1.0	4.50
530121	RENEW BONNET LOCK RELEASE CABLE	6.0	27.00
851091)	R + R WASHER RESERVOIR	1.0	4.50
B085)	RENEW AIR GRILLE (REMOVED)	2.0	9.00
B310)	RENEW R/R SIDE PANEL	54.0	243.00
D 420)	(COMPOSITE WORK FOR END PANEL)		
B420)	R + R REAR BUMPER REINFORCEMENT	1.0	4.50
B290	RENEW REAR END PANEL	35.0	157.50
	(BUMPER REMOVED)		
	INCLUDES: BOTH REAR LAMPS, FLOOR MAT		
	BOOT COMPARTMENT AND ALL TRIMS IN		
640204	REPAIR AREA REMOVE AND REFIT		
640201	R + R TAILGATE LOCK	4.0	18.00
G020	R + R REAR SCREEN	28.0	126.00
	INCLUDES: REAR PARCEL SHELF AND REQUIRED		
750474	TRIMS REMOVE AND REFIT		
750171	RENEW BADGE "TOYOTA"	2.0	9.00
B410	R + R REAR BUMPER	4.0	18.00
B420)	RENEW REAR BUMPER	1.0	4.50
NO NUMBER	•	3.0	13.50
NO NUMBER	RENEW R/RR SIDE MEMBER CPL	25.0	112.50
NO NUMBER	RENEW CONDENSER-/COMPRESSOR HOSE	4.0	18.00
NO NUMBER	R + R COMPRESSOR-/EVAPORATOR HOSE	4.0	18.00
NO NUMBER	R + R EVAPORATOR/CONDENSER PIPE	4.0	18.00
B450)	R + R BOTH REAR SEAT RESTS	1.0	4.50
B450) 711511)	R + R COMPLETE REAR SEAT CUSHION	1.0	4.50
/11311)	R + R LEFT REAR SEAT BELT	3.0	13.50
	INCLUDES: REAR PARCEL SHELF AND REQUIRED		
M010	TRIMS REMOVE AND REFIT	4= 5	
M010)	R + R RADIATOR/CONDENSER	15.0	67.50
160101)	RENEW RADIATOR (RADIATOR REMOVED)	2.0	9.00
160101)	R + R UPPER RADIATOR HOSE	2.0	9.00
NO NUMBER	R + R LOWER RADIATOR HOSE R + R AIR FILTER INTAKE HOSE	2.0	9.00
170011)		1.0	4.50
NO NUMBER	R + R INTAKE MANIFOLD	8.0	36.00
280011	R + R UPPER ENGINE COVER	1.0	4.50
NO NUMBER	R + R STARTER R + R REAR PROTECTION PANEL	6.0	27.00
M240)	R + R FRONT EXHAUST PIPE	1.0	4.50
420018)	R + R LEFT REAR WHEEL	2.0	9.00
420018)	R + R RIGHT REAR WHEEL	1.0	4.50
471551)	RENEW L/R BRAKE ANCHOR PLATE	1.0	4.50
-(/ IJJI)	(WHEEL REMOVED)	8.0	36.00
	INCLUDES: R + R BRAKE DRUM, WHEEL HUB		
	AND BRAKE SHOES		
471551)	RENEW R/R BRAKE ANCHOR PLATE	8.0	26.00
.,	MENTER IVIN DIVANT MINORION LEVIE	0.0	36.00

Claim Reference: 3 PARTY CLAIM Full Report - V1
Assessment Number: AH000940 Registration: SJB7411Y
Version: AHLIM001/1 Printed: 29/09/2018 11:55

Date Calculated: 29/09/2018 04:54

	(11)		
	(WHEEL REMOVED)		
	INCLUDES: R + R BRAKE DRUM, WHEEL HUB		
404354)	AND BRAKE SHOES		
481251)	R + R LEFT REAR SHOCK ABSORBER	1.0	4.50
481251)	R + R RIGHT REAR SHOCK ABSORBER	1.0	4.50
NO NUMBER	R + R REAR AXLE CARRIER	16.0	72.00
004466)	BLEED REAR BRAKE SYSTEM	6.0	27.00
NN	REAR SILENCER R&R / NEW PARTS	10.0*	45.00
NN	H LAMP TOP PANAL LH R&R / NEW PARTS	10.0*	45.00
NN	H LMP TOP PANAL RH R&R / NEW PARTS	10.0*	45.00
NN	S TYRE SIDE PAL RH R&R / NEW PARTS	15.0*	67.50
NN	ENGINE MOUNING RH R&R / NEW PARTS	5.0*	22.50
NN	E MOUNING REAR R&R / NEW PARTS	5.0*	22.50
NN	GEAR BOX MOUNING LH R&R / NEW PARTS	5.0*	22.50
0741	REPAIR L/F WING	10.0*	45.00
1117	REPAIR L/F WHEELHOUSE CPL	20.0*	90.00
1118	REPAIR R/F WHEELHOUSE CPL	20.0*	90.00
1201	REPAIR L/F SIDE MEMBER	20.0*	90.00
1202	REPAIR R/F SIDE MEMBER	20.0*	90.00
1481	REPAIR LEFT FRONT DOOR	10.0*	45.00
1482	REPAIR RIGHT FRONT DOOR	10.0*	45.00
2931	REPAIR BOOTLID	10.0*	45.00
3901	REPAIR REAR FLOOR PANEL	20.0*	90.00
4162	REPAIR R/R OUTER WHEELHOUSE	60.0*	270.00
4166	REPAIR R/R INNER WHEELHOUSE	30.0*	135.00
LAB	SOUR COST		
	Total Work Units	604.0	
	Corrosion Protection External Labour	0.0HRS	0.00
	Corrosion Protection Internal Labour	0.0HRS	0.00
	Sub Total	60.4HRS	\$2,718.00
	Paint Labour	23.0HRS	\$1,035.00
	Total Labour	83.4HRS	\$3,753.00

<b>PAINT WORK</b>	Time Basis	10 WU = 1 HR. Price =	= \$45.00/HR
Guide Number		WU	Cost Price (\$)
	- TWO COAT METALLIC		***
	- PREPARE OFF VEHICLE		
340	BUMPER REINFORCEMENTSURFACE PAINT	6.0	
471	BONNET NEW PART PAINTING	12.0	
742	R/F WING NEW PART PAINTING	10.0	
1009	INNER FRT PANEL CPL SURFACE PAINT	6.0	
2711	REAR PANEL NEW PART PAINTING	21.0	
3482	R/R SIDE PANEL NEW PART PAINTING	22.0	
281	FRONT BUMPER NEW PART PAINT K1R	13.0	
293	FRT TOWING EYE COVERNEW PART PAINT K1R	3.0	
2581	REAR BUMPER NEW PART PAINT K1R	10.0	
741	L/F WING REPAIR PAINTING <50%	11.0	
1481	LEFT FRONT DOOR REPAIR PAINTING <50%	16.0	
1482	RIGHT FRONT DOOR REPAIR PAINTING <50%	16.0	
2931	BOOTLID REPAIR PAINTING <50%	16.0	
1117	L/F WHEELHOUSE CPL SURFACE PAINT	6.0	
1118	R/F WHEELHOUSE CPL SURFACE PAINT	6.0	

Claim Reference: 3 PARTY CLAIM Full Report - V1
Assessment Number: AH000940 Registration: SJB7411Y
Version: AHLIM001/1 Printed: 29/09/2018 11:55

Date Calculated: 29/09/2018 04:54

1201	L/F SIDE MEMBER SURFACE PAINT	5.0	
1202	R/F SIDE MEMBER SURFACE PAINT	5.0	
3901	REAR FLOOR PANEL SURFACE PAINT	7.0	
4162	R/R OUTER WHEELHOUSESURFACE PAINT	4.0	
4166	R/R INNER WHEELHOUSESURFACE PAINT	5.0	
	LABOUR COST - PAINT		
	TIME(PAINT)	200.0	
	Preparation Main Work Plastic	5.0	
	Preparation Main Work Metal	25.0	
	Preparation Work Multi Layer Paint	0.0	
	Total Work Units (10WU/HR)	230.0	
	Total Paintwork Labour	23.0HRS	\$1,035.00
	MATERIAL COST - PAINT		Cost Price
	New Part Painting		\$101.34
	New Part Painting - Plastic K1R		\$112.18
	Material-Constant Main Work Metal		\$28.60
	Surface-/Blend Paint		\$86.16
	Repair Painting		\$92.05
	Material-Const Main Work Plastic		\$9.00
	Total Excluding Pearlescent Uplift		\$429.33
	Pearlescent Uplift @ 0.0%		\$0.00
	Total Paint Material Cost		\$429.33

PARTS						<del>* • • • • • • • • • • • • • • • • • • •</del>
					Price Valid	: 01/06/2015
Guide N	o.Qty	Description	Part Number	Supplier	Bet.	Price (\$)
253	1	L/LOWER GRILLE	52128 0D070		0%	45.00*
254	1	R/LOWER GRILLE	52127 0D150		0%	45.00*
281	1	FRONT BUMPER	52119 0D996		0%	155.00*
293	1	FRT TOWING EYE COVER	52721 0D902		0%	20.00*
317	1	L/F BUMPER BRACKET	53165 0D030		0%	38.00*
318	1	R/F BUMPER BRACKET	53164 0D030		0%	38.00*
333	1	FRT BUMPER ABSORBER	52617 0D050		0%	40.00*
340	1	BUMPER REINFORCEMENT	52021 0D090		0%	110.00*
343	1	LOWER FRONT GRILLE	53112 0D120		0%	38.00*
350	1	FRT BUMPER CLAMP KIT	SEE GUIDE NO.		0%	24.00*
			0351			
410	1	GRILLE	53111 0D901		0%	130.00*
431	1	FRONT MANUFACT BADGE	75301 0D010		0%	32.00*
471	1	BONNET	53301 0D100		0%	180.00*
475	1	L/F HINGE	53420 0D170		0%	30.00*
476	1	R/F HINGE	53410 0D170		0%	30.00*
493	1	BONNET LOCK	53510 0D181		0%	45.00*
500	1	BONNET CABLE	53630 0D080		0%	32.00*
527	2	FRONT BONNET SEAL	53381 0D060		0%	30.00*
561	1	LEFT HEADLAMP ASSY	81150 0D700		0%	130.00*
562	1	RIGHT HEADLAMP ASSY	81110 0D700		0%	130.00*
742	1	R/F WING	53811 52240		0%	130.00*
789	7	L/F WING MNTG KIT	91621 40614		0%	20.00*
790	7	R/F WING MNTG KIT	91621 40614		0%	20.00*
811	1	BADGE "VVT-I" L	75443 06151		0%	16.31U
812	1	BADGE "VVT-I" R	75443 06151		0%	16.31U
841	1	L/WHEELHOUSE SHELL	53876 0D080		0%	50.00*
842	1	R/WHEELHOUSE SHELL	53875 0D080		0%	50.00*

Claim Reference: 3 PARTY CLAIM Full Report - V1
Assessment Number: AH000940 Registration: SJB7411Y

Version: AHLIM001/1 Printed: 29/09/2018 11:55

Date Ca	alculated:	29/09/	/2018	04:54

1009	1	INNER FRT PANEL CPL	53201 0D130	0%	200.00*
1391	1	COWL PANEL GRILLE	55708 0D130	0%	205.00*
1436	1	WASHER CONTAINER	85315 0D101	0%	60.00*
2581	1	REAR BUMPER	52159 0D983	0%	160.00*
2619	1	L/R BUMPER BRACKET	52576 0D070	0%	45.00*
2620	1	R/R BUMPER BRACKET	52575 0D070	0%	45.00*
2621	1	L/R OUT BUMPER BRKT	52156 0D030	0%	55.00*
2622	1	R/R OUT BUMPER BRKT	52155 0D030	0%	55.00*
2711	1	REAR PANEL	58307 0D101	0%	210.00*
2944	1	BOOTLID SEAL	64461 0D050	0%	55.00*
2977	1	BOOT/TAILGATE LOCK	64610 0D030	0%	50.00*
3013	1	REAR MANUFACT BADGE	90975 02063	0%	38.00*
3161	1	REAR WINDOW MOULDING	75573 0D040	0%	55.00*
3163	1	REAR SCREEN FIX SET	USE SINGLE PARTS	0%	0.00
3169	1	LWR REAR WINDOW MLDG	64813 52080	0%	0.00
3171	2	CLIP FASTENING	56116 22050	0%	<b>3.96</b> U
3172	2	CLIP FASTENING	56115 30100	0%	<b>4.04</b> U
3282	1	R/R LAMP ASSY	81550 0D220	0%	95.00*
3292	1	R/R REFLECTOR	81910 0D010	0%	45.00*
3482	1	R/R SIDE PANEL	61601 0D160	0%	350.00*
3572	1	R/R LAMP PANEL	61063 0D010	0%	60.00*
3990	1	R/R SIDE MEMBER CPL	57601 0D121	0%	110.00*
4448	1	CONDENSER FIX FRAME	88891 0D080	0%	32.00*
4465	1	CONDENSER	88460 0D130	0%	300.00*
4481	1	COMPRESSOR HOSE	88704 0D050	0%	110.00*
4483	1	COND/EVAPORATOR HOSE	88706 0D240	0%	140.00*
4485	1	PRESSURE HOSE COMPRS	88711 0D150	0%	140.00*
4978	1	LUGG COMPART CARPET	64711 0D060C0	0%	65.00*
4985	1	END PANEL TRIM	58387 0D010	0%	95.00*
4992	1	R/BOOT TRIM COVER	64721 0D040C0	0%	135.00*
7751	1	L/RADIATOR STRUT	16523 0M050	0%	10.00*
7752	1	R/RADIATOR STRUT	16523 0M050	0%	10.00*
7753	1	L/RADIATOR RUBB MNTG	90480 W0005	0%	10.00*
7754	1	R/RADIATOR RUBB MNTG	90480 W0005	0%	10.00*
7761	1	RADIATOR CPL	16400 0M070	0%	330.00*
7765	1	UPP FUEL HOSE FLANGE	16502 21070	0%	32.00*
7767	1	RADIATOR SHROUD	16711 0M030	0%	78.00*
7773	1	UPPER RADIATOR HOSE	16573 0M010	0%	25.00*
7776	1	LWR RADIATOR HOSE	16572 0M040	0%	25.00*
7789	1	FAN MOTOR	16363 0M020	0%	110.00*
7793	1	COOLING FAN	16361 0M050	0%	65.00*
8221	1	INTAKE MANIFOLD	17101 0M030	0%	165.00*
8375	1	AIR INTAKE HOSE	17751 0M020	0%	45.00*
8391	1	AIR FILTER ASSY	17700 0M030	0%	255.00*
8501	1	STARTER MOTOR	28100 0M051	0%	340.00*
8833	1	REAR SILENCER	17430 0M061	0%	200.00*
8846	1	REAR PROTECT PANEL	58327 0D081	0%	0.00
8848	1	R/R EXHAUST RUBBER	17565 0M020	0%	105.00*
9081	1	REAR AXLE SUBFRAME	42110 0D171	0%	700.00*
9182	1	R/R WHEEL HUB/BRG	42410 0D040	0%	230.00*
9646	1	HORN	86520 52170	0%	80.00*
1000	1	F WIPER GAR COVER X2	Renew	0%	60.00*
1000	1	F WIPER GARH RUBBER	Renew	0%	32.00*
1000	1	F BOT INER STOPER X2	Renew	0%	20.00*

Claim Reference: 3 PARTY CLAIM Full Report - V1
Assessment Number: AH000940 Registration: SJB7411Y
Version: AHLIM001/1 Printed: 29/09/2018 11:55

Date Calculated: 29/09/2018 04:54

1000	1	H LAMP TOP PANAL LH	Renew	0%	45.00*
1000	1	H LMP TOP PANAL RH	Renew	0%	45.00*
1000	1	H LAMP CLIPS X4	Renew	0%	8.00*
1000	1	F REINFORMET BRT X2	Renew	0%	170.00*
1000	1	E UNDER COVER RH	Renew	0%	50.00*
1000	1	G BOX LOW COVER LH	Renew	0%	60.00*
1000	1	R INER AIR GUIDE LH	Renew	0%	38.00*
1000	1	R INER AIR GUIDE RH	Renew	0%	38.00*
1000	1	R COOLING PIPE X2	Renew	0%	64.00*
1000	1	R BOT LOGO (VIOS)	Renew	0%	35.00*
1000	1	R BOT LOGO (J)	Renew	0%	35.00*
1000	1	TAIL LAMP CLIP X3 RH	Renew	0%	9.00*
1000	1	R BUMBER CLPS X12	Renew	0%	24.00*
1000	1	TOOL BOX REAR	Renew	0%	110.00*
1000	1	TOL BOX SIDE RH	Renew	0%	115.00*
1000	1	S TYRE SIDE PAL RH	Renew	0%	58.00*
1000	1	R FEN TRIM CLPX12 RH	Renew	0%	24.00*
1000	1	R FEN AIR VENT RH	Renew	0%	58.00*
1000	1	R FEN COWLING RH	Renew	0%	38.00*
1000	1	R EXHAUST CHROME RH	Renew	0%	55.00*
1000	1	ENGINE MOUNING RH	Renew	0%	130.00*
1000	1	E MOUNING REAR	Renew	0%	60.00*
1000	1	GEAR BOX MOUNING LH	Renew	0%	75.00*
f: OEM P			Sub Total		\$8,823.62
g: Origin	al		Mark Up From Cost	(15 %)	\$1,323.54
h: Secon	dhand		Total Parts	-	\$10,147.16
p: Parall	el				

# THIS ASSESSMENT CONTAINS UNPRICED PARTS NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

#### Extras

x: Exchange

Description		Betterment	Price
COOLANT	SPECIALIST	0%	\$35.00
F NUMBER PLATE	SPECIALIST		\$35.00
CEHCK WIRING	SPECIALIST	0%	\$40.00
FRONT			4
REFILL A/C GAS	SPECIALIST		\$50.00
R SPORT RIM RH	SPECIALIST	0%	\$0.00
R TYRE 185/60/15	SPECIALIST		\$0.00
RH			•
REVERSE SENSORX2	SPECIALIST	0%	\$200.00
R WIND SEALANT	SPECIALIST		\$60.00
R WIND INNER SEAL	SPECIALIST	0%	\$40.00
CHECK WIRING REAR	RSPECIALIST		\$40.00
WHEEL ALIGMENT	SPECIALIST	0%	\$80.00
REMOVE R	SPECIALIST		\$100.00
WINDSCREEN			
REPLACE RVER	SPECIALIST	0%	\$80.00
SEOSOR			
ANTI-RUST COATING	SPECIALIST		\$200.00
RESET AL	SPECIALIST	0%	\$250.00
DIAGNOSTIC			
		Total Extras	\$1,210.00

Claim Reference: 3 PARTY CLAIM Assessment Number: AH000940

Version: AHLIM001/1

Date Calculated: 29/09/2018 04:54

Full Report - V1 Registration: SJB7411Y

Printed: 29/09/2018 11:55

\$16,627.25

## **Final Calculation**

Total Parts	\$10,147.1
Labour	• •
Total Panel/Mechanical	\$2,718.00
Total Paintwork	\$1,035.00
Total Labour	\$3,753.0
Additional Costs	
Corr Prot Materials External	\$0.00
Corr Prot Materials Internal	\$0.00
Cost of Specialist	\$1,210.00
Total of Additional Costs	\$1,210.0
Total Paint/Material Costs	\$429.3
Grand Total Excludes GST	\$15,539.4
GST @ 7 %	\$1,087.7

#### **Assessment Notes**

**Grand Total Includes GST** 

**Summary Information** 

Vehicle

Manufacturer & Model:

VIN Number:

TOYOTA Vios

MRO53HY9305046438

Registration:

SJB7411Y YF3 04

Type:

Build Date:

2008

Software

Calculation Date:

29/09/2018

AudaDirect Version:

337

Software Version:

Valid Part Price Date: 01/06/2015

Model Sheet Version:

## Model Specification

A5	FROM 02/2008
G1	BONNET INSULATION
I1	HEADLAMP TRIM COLOUR

I2 FOG LAMPS N3 1.5 LTR 80 KW

P8 4-SPEED AUTOMATIC R1 TYRES 185/60 HR 15

S7 WHEELS 5.5J X 15 ALU X4 EQUIPMENT "J" GRADE

Y4 TWO COAT METALLIC Y7 PREPARE OFF VEHICLE

## **Guide Numbers**

**Invalid Guide Numbers** 

H 471 F: (

Corrosion

# > Back to OneMotoring

# **Enquire PARF/COE Rebate for Registered Vehicle**

# **Vehicle Owner Particulars**

Owner ID Type: Singapore NRIC

Owner ID: 1228D

Vehicle Details

Vehicle No.: SJB7411Y

Vehicle to be Exported: Yes

Intended Deregistration Date: 28 Sep 2018
Vehicle Make: TOYOTA
Vehicle Model: VIOS J AUTO

Primary Colour: Silver
Manufacturing Year: 2007

Engine No.: 1NZX688721

Chassis No.: MR053HY9305046438 Maximum Power Output: 80.0 kW (107 bhp)

Open Market Value:\$12,074.00Original Registration Date:23 Jan 2008First Registration Date:23 Jan 2008

Transfer Count: 1

Actual ARF Paid: \$10,388.00

**Intended PARF Rebate Details** 

PARF Eligibility: Forfeited

PARF Eligibility Expiry Date: -

PARF Rebate Amount: \$0.00

**Intended COE Rebate Details** 

COE Expiry Date: 31 Dec 2022

COE Category: A - Car (1600cc & below)

COE Period(Years): 5

 PQP Paid:
 \$21,349.00

 COE Rebate Amount:
 \$18,181.00


 Total Rebate Amount:
 \$18,181.00

Message

Please note that the 5-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.

The information contained herein is correct as at 28 Sep 2018

OK

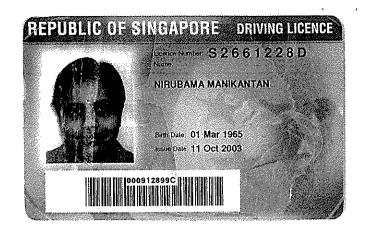

REPUBLIC OF SINGAPORE IDENTITY CARD NO. \$2661228D



NIRUBAMA MANIKANTAN

நிருபமா மணிகண்டன்

INDIAN
Date of birth
01-03-1965
Country/Place of birth

INDIA

Sex

: 15%1226;

5522536

Stp 9666 CSOY 1 90298029 Emerl. Niru\_ sai @gahao.com

Srikudarshan @ gnail.com

YOU ARE LICENSED TO DRIVE VEHICLES IN THE FOLLOWING CLASS(ES)

PASS DATE

Class 2B Class 3 Motorcycles not exceeding 200 cc Motor Cars and Motor Tractors the weight of which unladen does not exceed 2500 kilograms 01 Nov 1996 01 Nov 1996

NP 428A



NRIC No. \$26612

Date of issue 15-08-2015

APT BLK 796 YISHUN RING ROAD #03-3370 SINGAPORE 760796

> Cy. les Neck pair & Whiplash Ca: No



#### Certificate of Insurance

Comprehensive Car Policy Policy Number: P10028040R00

Motor Vehicles (Third-Party Risks And Compensation) Act (Chapter 189) (Republic of Singapore), Motor Vehicles (Third-Party Risks And Compensation) Rules, 1996 Edition (Republic of Singapore), Road Transport Act, 1987 (Malaysia), Motor Vehicles (Third-Party Risks) Rules, 1959 (Malaysia) or any Amendment, Act or Acts passed in substitution thereof.

#### Certificate Number P10028040R00 (Comprehensive / Named Driver Plan)

1) Vehicle Registration Number

SJB7411Y

Chassis Number

:

2) Effective Date / Time of Commencement

18/11/2017 (00:00)

of Insurance for the Purpose of the Act

3) Date / Time of Expiry of Insurance

22/01/2019 (23:59)

4) Excess (i) Policy

S\$ 600.00

(i) Policy (ii) Windscreen

S\$ 100.00

5) Policyholder

Nirubama Manikantan

6) Persons or Classes of Persons Entitled to Drive\*

Drivers named as a Main / Named Driver in this Certificate of Insurance only.

Provided that the person driving is permitted in accordance with the licensing or other laws or regulations to drive the Motor Vehicle or has been so permitted and is not disqualified by order of a Court of Law or by any reason of any enactment or regulation in that behalf from driving the Motor Vehicle. And provided further that the Motor Vehicle is registered under the Road Traffic Act and its registration under the Road Traffic Act has not been cancelled at the time of accident or loss. Please refer to the Product Disclosure Document for full terms and conditions.

Main Driver / Date of Birth

Nirubama Manikantan (01/03/1965)

Named Driver(s) / Date of Birth

None

7) Limitation as to use\*

Use only for social, domestic and pleasure purposes. The Policy does not cover use for hire or reward, tuition or driving tests, racing, pace-making, reliability trials, speed-testing or the carriage of goods other than samples in connection with any trade or business or use for any purpose in connection with the Motor Trade.

\* Limitations rendered inoperative by Section 8 of the Motor Vehicles (Third-Party Risks and Compensation) Act (Chapter 189) and Section 95 of the Road Transport Act, 1987 (Malaysia), are not to be included under these headings.

8) Finance Company

Malayan Banking Berhad

I / We hereby certify that the policy to which this Certificate relates is issued in accordance with the provisions of the Motor Vehicles (Third-Party Risks and Compensation) Act (Chapter 189) and Part IV of the Road Transport Act, 1987 (Malaysia) or any Amendment, Act or Acts passed in substitution thereof.

Issued in Singapore on 19/07/2018

Auto & General Insurance (Singapore) Pte. Limited
Trading as Budget Direct Insurance

Simon Birch