	*	7 - 44	
Serveyor	REF: CS 3	ASM 17020781 /BVb-1	Special Instruction:
. 3	A	SSICNMENT (OF )	L/s: \$ 8100.00
From (Person):	Heng Xinyi of Seah	Ong Date/Time: 03-(0)018	Third Parties:
Estimated Cost	:Bill to:	J	Claimant:
		1	Surveyor: PAR Automotile
	pection / Evaluation		Workshop: TWINCON ALTO MUTILL
To Inspect Veh	icle No: SLA 3818F	Insured: SLB 5	437L
at Workshop m	/s Twm(ar	Tel: 6847.0051	
	2 Kaki Bukit Ave 2 #		
Policy No:		Claim No:18.246	58 PD-0
Sum Insured:_		Excess:	
Make of Veh:		D.O.A. 38,10-20	P
(Client's Record)	· 18	- 10, 14 (10-5 (200) pc. 1	
FG 1 1000			H.O.D. Endorsement/Date:
Date/Time:	Person Contacte	zd: Vehicle IN /	OUT
Date/Time: _	Confirmed with	Final Fig. da	vs (Red S / %: Original 7 daws)
Date/Time: _	8 10 18 Submit Final Fig S	\$ 2000, 4days (Red \$ 610	oo /35 %; Original days)
_	Action/Instruction		
	SLA 3816R - CS3 /A9MIZIONO	211/10/07	Ded - 20 in iz
	S18, 567L - x		294 70 1041
			At the
	- to check v	18th Adrian.	Arrest
			Hiola
	-	Kepair a	ap 4 Torin line
			4/18/18
Para(1) : P	arts found not replaced (	To highlight R or UB	
		gg x 0, 02	, DR, DR
•			
Para(2) : C	comments on consistency of	damages (Parts Not Co	nsistent : NC)
	•	5 (	
	RECEIVE	ED 0 9 OCT 2018	
	. 11202112	25 0 0 00 000	
Dans (2)			
Para(3) : N	ett Value		
	Market Value		Fee Charged: Date:
	Market Value :		Basic & Add 150
	Salvage Value :	Evaluated by:	Transport Photos
			Others
	Nett Value :		Total 15V
1) Date/Time	8 10- typist File Pass to_	2) Date/Time	File Return to
3) Date/Time	File Pass to	4) Date/Time	
5) Date/Time	File Pass to	6) Date/Time	

## Catherine Chong (LKK Auto)

From:

Xin Yi <xinyi@seahong.com.sg>

Sent:

Wednesday, 3 October, 2018 3:31 PM

To:

'Catherine Chong (LKK Auto)'

Cc:

'Chee Kiong'; 'Samson'; amanda@seahong.com.sg

Subject:

SLA 3813R [Our file ref: 18.24658 PD-O]

Attachments:

TP LOD.pdf; SLB5937L INSD GIA.PDF; SLA3818R TP GIA.PDF

Dear Catherine,

CLAIMANT:

INSPIRE SEIKI PTE LTD

**VEHICLE NUMBER:** 

**SLA 3813R** 

ALLEGED ACCIDENT DATE:

28 OCTOBER 2017

AXA VEHICLE NUMBER :

**SLB 5937L** 

We act for AXA Insurance Pte Ltd for the above matter.

We understand that you were engaged to survey the claimant's vehicle. We also note that post repair inspection has already been carried out.

Please find attached the relevant documents for your attention.

Kindly let us have your survey report and invoice for our further action. Thanks!

Thanks & Best Regards Heng Xinvi

(Secretary to Mr Tan Chee Kiong)
Seah Ong & Partners LLP
36 Robinson Road
#12-03 City House
Singapore 068877

Tel: 6536 5369 Fax: 6536 5811

This message is intended for the recipient named above. It may contain confidential or privileged information. If you are not the intended recipient, please notify the sender immediately by replying to this message and then delete it from your system. Do not read, copy, use or circulate this communication. Thank you.

Disclaimer: Internet communications are not secure. While every reasonable effort has been made to ensure that this communication has not been tampered with, Seah Ong & Partners LLP cannot be responsible for alterations made to the contents of this message without its express consent. If you wish to receive a hard copy of this message for comparison or should you require any other form of confirmation of the contents of this message, please contact the sender. Opinions, conclusions and other information in this message that do not relate to the official business of the company shall be understood as neither given nor endorsed by Seah Ong & Partners LLP.

Estimated Cost:	ASSIGNME of	Axa	Da	te/Time: 31-10-2017	1.28pm
To inspect Vehicle No.		3	Insured:	SUB 5937	 L
at Workshop m/sof	Twhear 2 Kaki Bukit A	(1) # G 14	Tel:	1500 CHE	
Policy No:Sum Insured:		Claim No:	00mF2	3KJ	
Make of Veh. (Client's Record)		Excess	D.0	F106-01-8C A.	
CA / REV / REP. / REV. Date/Time: 31-1().7			I:	O.D. Endorsement	
	iction ( x ) Estimate				
SIB 553	11 - 8				
	Part: 03-112017 ir: Ob11209				

15.	SIGNMENT
Estimated Cos:  OD/TP/WS/TP RES/OD RES/EVA/INV/MV	Tyce M.Cap M.Cycle / Bus   Van   Lorry   Taxi / Prime Mover   Truck / Trailer or
o respect vehice to SLA 3 StSR  of Workshop mis Two Car  of 2 tooler Bullet Au 2 # 214  insured  Porcy to	1.1946 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1966 - 1.1
Claims No. Sum insured Excess	Gen Cond Good/ Fair / Poor / Burn: Steering   Inorder / Jammed   Leaked   Burnt
(Clients Record) Make of Van	Brake Inorder   Jammed Leaked Burnt :-  Mod: Nil / SYRIM STD A Rim :-
(Policy Condition)  Remark The veh had commenced its repair at the time of inspection.	Tyre Size F: 225 65 R 17  R: 225 65 R 17  BS / DUN / EXNOVA / GY / FS   LEAT MIC OHTSU / PIR / SUM! TOYO / YOKO S/
Bai or Market Value  IDAC Accident Room: Consistent? Yes or No  GIA PR Seen Consistent? Yes or No	RBa 3 mm RBa 3 mm
GIA PR Seen Consistent? Yes of No Est. Repairs days Res. Yes of No Lum Sum: 3 3 Val. Yes of No	0.0 A 26 (10 (2017 20 3) 110 (2017 5) 5 (10 (2017 5) 6)
CA / REV / REP. / 24 HRS  Date Person Contacted Vehicle: IN/OUT	Des of Damages Fri Reas O/S / N/S / U/C / Rooftop or
Date / Time Action Instruction	The U/C / Chassis frame / Body Structure affected due to collision

FIDCIFC	: Preli. Report	Days Of Repair. Resurvey No. of Trip.	iurva, Paa	100
2		Add Fee: Site Insc. 5	Factors.	24
Report Format	PRS	Tech Inter \$		
		Mesikana S	_	

## LAW LLC3819431051---

Advocates & Solicitors - Notary Public - Commissioner for Oaths Agents for Trade Marks

(Incorporated with limited liability)

61162046

FRIC NG CHING BOON WONG KENG LEONG RAYNEY AUDREY WONG SU-HSIEN PAUL YAP TAI SAN ANJALLI DO MUNIANDY SEGA PARAM ANG KIM NOI DIANE RAVENDRA KRISHNASAMY TAY HAO RAN JANICE HAN JIA LIN TAN YINGXIAN SELWYN

Unique Entity Number: 200721148H

√Head Office: 133 New Bridge Road #18-01/02 Chinatown Point Singapore 059413 Branch: 490 Toa Payoh Lorong 6 #03-11 HDB Hub Singapore 310490

Branch: 133 New Bridge Road #10-03 Chinatown Point Singapore 059413

HEAD OFFICE:

(65) 65342811 (Hunting) TEL FAX (65) 65356802 (General)

E-MAIL: annatan@visionlawllc.com

BRANCH

TEL (65) 63580703 TEL : (65) 65330868

BRANCH

TEL (65) 65342811 (Hunting) : (65) 65330869

WHEN REPLYING PLEASE QUOTE OUR REFERENCE - Please reply to HEAD OFFICE for this

Our Ref

: AKN-atv-Ins-T140-107050-18

Your Ref

: SLB 5937 L

Date:

12 July 2018

AXA INSURANCE SINGAPORE PTE LTD

8 Shenton Way #27-01 AXA Tower Singapore 068811

Motor Claims Department Attn:

BY HAND



CERTIFICATE OF POSTING [For your information only A

LIM GEOK HOON

Apt Blk 613 Bukit Panjang Ring Road #05-850 Singapore 670613

Dear Sir,

CLAIMANT INSPIRE SEIKI PTE LTD

ACCIDENT INVOLVING SLA 3818 R & SLB 5937 L ON 28-OCT-2017-AT MALAYSIA CHECKPOINT AT ABOUT 1550HOURS

We are instructed by the above named to claim damages against you/your insured in connection with a road traffic accident on 28-OCT-2017 AT MALAYSIA CHECKPOINT AT ABOUT 1550HOURS involving our client's vehicle registration number SLA 3818 R and vehicle registration number SLB 5937 L driven by you/your insured at the material time.

We are instructed that the accident was caused by you/your insured's negligent driving and /or management of your your insured vehicle. As a result of the accident, our client's vehicle was damaged and our client has been put to loss and expense, particulars of which are as follows:-

01.	Cost of Repair		\$8,667.00
02.	Rental fees		\$2,000.00
03.	2 days loss of use for pre repair		\$ 300.00
04.	Survey report fees		\$ 772.00
05.	GIA & LTA search / report fees		\$ 41.84
06.	Cost Contribution (at this stage)		\$1,605.00
07.	Disbursements (at this stage)		\$ 50.00
		TOTAL	\$13,435.84

.../2 to be continued next page

CONFIDENTIALITY

THE INFORMATION CONTAINED IN THESE DOCUMENTS MAY BE PRIVILEGED AND CONFIDENTIAL AND IS INTENDED FOR THE EXCLUSIVE USE OF THE ADDRESSEE DESIGNATED ABOVE. If you are not the addressee, any disclosure, reproduction, distribution or other dissemination or use of this communication is strictly prohibited. If you have received this transmission in error please contact us immediately by telephone so that we can arrange for its return.

### VISION LAW LLC

Advocates & Solicitors Page 2

Our Ref

: AKN-atv-Ins-T140-107050-18

Your Ref

: SLB 5937 L

Date:

12 July 2018

#### AXA INSURANCE SINGAPORE PTE LTD

8 Shenton Way #27-01 AXA Tower Singapore 068811

Attn:

Motor Claims Department

#### LIM GEOK HOON

Apt Blk 613 Bukit Panjang Ring Road #05-850 Singapore 670613

We enclose a copy of each of the following documents for your consideration:-

- (a) GIA report lodged by driver of SLA 3818 R;
- (b) Video footage of accident;
- (c) Photographs taken at scene of accident;
- (d) LTANet Search;
- (e) Certificate of Insurance;
- (f) Registration Card:
- (g) Rental agreement, rental invoice & rental receipt;
- (h) Final Repair Bill;
- (i) Surveyor's report & invoice; and
- (j) 97 Coloured photographs depicting the damages to motor vehicle SLA 3818 R.

(P.S:- Original photographs will be sent to insurance co. only)

The demand herein is in respect of our client's claim for damages pertaining to his motor vehicle and any settlement following or subsequent to this demand shall not prejudice our client's claim in respect of damages and consequential loss in relation to his personal injuries.

Please note that if you are insured and you wish to claim under your insurance policy, you should immediately pass this letter and all the enclosed documents to your insurer.

Please note that you or your insurer should send to us an acknowledgement of receipt of this letter within 14 days of your receipt of this letter, failing which our client will have no alternative but to commence proceedings against you without further notice to you or your insurer. Our client's claim herein is quantified based on supporting documents in our file. Until a settlement is reached, all negotiations are conducted on the basis that the damages quantified herein are subject to revision if so instructed by our client.

Please also note that if you have a counterclaim against our client arising out of the accident, you are also required to send to us a letter giving full particulars of the counterclaim together with all relevant supporting documents within 8 weeks of your receipt of this letter.

Yours faithfully

(HEAD OFFICE)

Enc.

cc: client:

Inspire Seiki Pte Ltd

As per your instruction we have submitted your claim as set out above to the third party insurance company. Please do notify us if there is any discrepancy, if any, particularly, the number of days claimed for rental charges and/or loss of use as soon as possible. Thank you.

CONFIDENTIALITY

THE INFORMATION CONTAINED IN THESE DOCUMENTS MAY BE PRIVILEGED AND CONFIDENTIAL AND IS INTENDED FOR THE EXCLUSIVE USE OF THE ADDRESSEE DESIGNATED ABOVE. If you are not the addressee, any disclosure, reproduction, distribution or other dissemination or use of this communication is strictly prohibited. If you have received this transmission in error please contact us immediately by telephone so that we can arrange for its return.

## PAR Automotive Consultancy

Thomson Rd Post Office PO Box 029 Singapore 915701. Tel: 645 31173, Fax: 645 36131.

Regn. No: 52986974L

Report No: 0269-18-TCA

04 June 2018

Inspire Seiki Pte Ltd 10 Admiralty Street #02-83 North Link Bldg Singapore 757695

INVOICE No.

0269-18-TCA

Vehicle No.

**SLA3818R** 

S/NO.	SERVICES RENDERED	Amount due
1	Being accident vehicle appraisal services, transport, photographs and re-inspection (work in progress and post repair inspection).	
	T	\$772.00
	Total amount payable	\$772.00

Kindly cross your cheque in favour of "PAR Automotive Consultancy"

We thank you in anticipation for your prompt payment.

PAR Automotive Consultancy

## R Automotive Consultancy

Thomson Rd Post Office PO Box 029 Singapore 915701. Tel: 645 31173, Fax: 645 36131.

Report No: 0269-18-TCA

04 June 2018

## ACCIDENT VEHICLE SURVEY REPORT

Inspire Seiki Pte Ltd 10 Admiralty Street #02-83 North Link Bldg Singapore 757695

## VEHICLE INFORMATION:

Vehicle Reg No .:

SLA3818R

Odometer:

47298km

Make & Model:

Toyota Harrier 2.0A

Colour:

Silver

Regn. No: 52986974L

Chassis number:

ZSU600076941

Date of accident:

28/10/2017

Year of Regn.:

03/06/2016

Date inspected:

31/10/2017

Repairer at:

Twincar Automotive Pte Ltd Date inspected (After Repair):

06/11/2017

2 Kaki Bukit Ave 2 #01-17 Kaki Bukit Auto Hub

Singapore 417921

## STATIC CHECKS, where applicable:

Steering:

serviceable

Footbrake:

serviceable

Handbrake:

serviceable

Paintwork .

Good

General condition:

Good

#### TIRE CONDITION:

LH / Make

RH / Make

Size

Front:

6mm/Michelin

6mm/Michelin

225/65R17

Rear:

6mm/Michelin

6mm/Michelin

225/65R17

## POINT OF IMPACT AND DAMAGE, where applicable:

Impact on the rear RH portion.

Please see details as described in the Annex for parts and labour.

### REMARKS:

We have inspected the above-mentioned vehicle on a "Without Prejudice" basis.

# PAR Automotive Consultancy

## Parts and Labour Assesment

## PARTS

Description of part	Qty	Condition	Repairer's	
REAR BUMPER 'LOWER'	1	deformed	374.45	1-
REAR BUMPER 'TOP'	1	squashed	1,210.50	
REAR BUMPER INNER SPONGE	1	fractured	174.45	
REAR BUMPER REFLECTOR L/R	2	shorted	364.50	included distance
REAR BUMPER RH INNER SHIELD	1	warped	174.75	0 (
REAR BUMPER RH INNER SHIELD CLIPS	3	necessary	19.50	CONTRACTOR OF THE PROPERTY OF
REAR BUMPER SIDE RETAINER L/R	2	necessary	264.20	
REAR END PANEL INNER TOP GARNISH CLIPS	4	necessary	26.00	
REAR RH FENDER	1	repair	1,218.45	0.0000000000000000000000000000000000000
REAR RH FENDER INNER SHIELD	1	reuse	374.45	(3-22-22-2
REAR RH KNUCKLE ARM	1	distorted	581.90	
REAR RH LOWER ARM	1	bent	591.60	
REAR RH SHOCK ABSORBER	1	bent	374.45	274-45
REAR RH STABILIZER BAR LINK	1	bent	381.90	NNS
REAR RH STAY ARM	1	bent	381.85	
REAR RH TAILLAMP	1	fractured	561.60	561.60
REAR RH TAILLAMP CLIPS	4	necessary	26.00	26.00
REAR RH TAILLAMP INNER PANEL	1	repair	374.85	0.00
REAR RH TAILLAMP LOWER BRACKET	1	bent	132.10	132.10
REAR RH TORSION ARM	1	bent	561.60	561.60
REAR RH WHEEL HUB BEARING	1	dislodged	581.90	581.90
Personal discount 2500 1 2		before discount	S\$ 8,751.00	
Percentage discount 25% and 2	25%	-	S\$ 2,187.75	S\$ 1,695.81
DEAD DID OFFI CLIPS		Sub-total 1	S\$ 6,563.25	S\$ 5,087.44
REAR BUMPER CLIPS - SET	1	necessary	30.00	30.00 NEC
REAR BUMPER REVERSE SENSOR - SET	1	shorted	350.00	200-0350.00 CUT
REAR RH 17" SPORT RIM	1	abrdaed	1,500.00	1,500.00
REAR RH 225/65R17 102H TYRE	1	abraded	580.00	580.00
REAR RH FENDER INNER SHIELD CLIPS - SET	1	necessary	30.00	30.00
REAR RH FENDER INNER UPHOLSTERY TRIM BOARD CLIPS - SET			20.00	>HH;
REAR RH FENDER INSULATOR MAT	1	necessary	30.00	30.00
REAR RH FENDER QUARTER GLASS SEALANT	1	reuse	180.00	0.00
THAT STANK COUNTER GENERALING	5	reuse	80.00	0.00
	Subtotal	before discount_	S\$ 2,780.00	S\$ 2,520.00
		Sub-total 2	S\$ 2,780.00	S\$ 2,520.00
		Parts-total	S\$ 9,343.25	S\$ 7,607.44

## PAR Automotive Consultancy

## LABOUR

Labour Total Parts & Labour Total	00 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0	S\$ 1,980.00 S\$ 9,587.44
To apply anti-rust chemical on repaired and replaced panel.	120.00	30.00
construct and re-align body structure, body alignments and damaged consistent to the accident.	1,500.00	400.00 660.00
To provide labour, workmanship to change the above damaged bodyparts, repair, re-		
To re-spray painting on the change bodyparts, repair portion, and where consistent to the accident.	1,000.00	300.00
To send vehicle for cleaning, shampoo, upholstery and cushion seat.	200.00	0.00
To remove, reinstall roof top trim upholstery, cushion seat, trim garnish, trim liner carpet. (to FR)	140.00	0.00
To road test driving, check and resetting wheel alignments system.	180.00	60.50 180.00 /
To remove, change rear suspension parts, axle carriage, absorber, lower arm, top arm, trailing arm, knuckel arm, wheel bearing, bearing hub and etc.	550.00	450.00 NN X
To remove, reinstall fender glass	150.00	0.00
To remove, reinstall electrical wiring harness, check lighting and rewire for parking sensor.	150.00	60.00

Results of inspection of the accident vehicle are as shown above.

We have taken into consideration the age and condition of the vehicle in our recommendation.

Hence, the recommended cost of repairs based on Lump Sum repairs is: SS 8,100.00 and the recommended number of working days for the repairs is within 7 day(s).

B J Loi (I Eng., MIMI, AIRTE)

Automotive Appraiser

Repair days 4

Talun lim 04/14/18



Land Transport Authority 10 Sin Ming Drive Singapore 575701

GST Registration No.: M4-0006529-2

Print Date/Time:

30 Oct 2017 / 12:49:16

Receipt Date/Time: 30 Oct 2017 / 12:49:16

#### Tax Invoice/Receipt

Receipt No.: ITNET-00000-171030-000856

Previous Receipt No.:

S/N Item Description/ Business Transaction Reference No.		Amount Before GST (S\$)	GST Amount (S\$)	Amount After GST (S\$)
Result of Insurance Enquiry - SLB5937L As at 28 Oct 2017/15:50:00 Insurance Co: AXA INSURANCE PTE LTD Insurance Enquiry - SLB5937L Enquiry Fee		5.00	0.35	5.35
20171030124848470575	Sub-Total	5.00	0.35	E 25
	Total Before Rounding	5.00	1.450.0000	5.35
	Rounding Difference	5.00	0.35	5.35 0.00
	Total Amount Payable			5.35
	Paid By			
	xxxxxxxxxxx2392	Credit Card: Visa/MasterCard	i	5.35
	Total			5.35
	Cash Change			0.00
	Tendered Amount			5.35
	Excess Refundable Amount			0.00

#### THANK YOU AND HAVE A NICE DAY!

Please ensure that all payments to the Authority are good and promptly settled by the payment service provider / financial institution. Otherwise, the transaction and receipt is considered void and late fee may apply.

TWINCAR RENTAL Business Registration Number: 53092815M

Blk 2 Kaki Bukit Avenue 2 #01-17 Kaki Bukit Autohub, Singapore 417921

Tel: 68420051 Fax: 67410510 email: sales@n51.com.sg

Invoice To:

INSPIRE SEIKE PTE LTD 10 ADMIRALTY ST #02-83 NORTH LINK BUILDING SINGAPORE 757695

INVOICE

Invoice No.

13-1992

Date

6/11/2017

Description al from the period of 30/10/2017	SLA3818R 7 to 06/11/2017.	71486 Per Day	CASH Amount (S\$)
al from the period of 30/10/2017	7 to 06/11/2017.	Per Day	Amount (S\$)
al from the period of 30/10/2017 no. SFA2922A	7 to 06/11/2017.		
		250.00	2,000.0
ore Dollars Two Thousand Only			
	ore Dollars Two Thousand Only	ore Dollars Two Thousand Only	ore Dollars Two Thousand Only

TWINCAR RENTAL

Authorised Signature



## TWINCAR RENTAL

Kaki Bukit Autohub @ 2 Kaki Bukit Ave. 2 #01-18 Singapore 417921 Tel: 6744 0510 / 6842 0051

VEHICLE RENTAL AGREEMENT

VHA NO: 71486 SLA 3818 R(TC)

100

OC NO. 53092815M	VEHICLE REI	NTAL AGRE	EEMENT	Г			SLA	38/8	KI
HIBER'S PARTICULAR		Vehicle N	No: SFA	797	ZA	Rep	olace Veh N		
Name: (as in I/C) INSPIRE SE	IKI PIE CID	Mileage	Out:			Mile	eage Out:		
NRIC/PASSPORT No: DCC) CC	3345NI	Make &		_			A	uto / Manua	ai
Address (Res): ICADM/RALTY	S7 #02-83		us ex					roup:	
MORTH LINK BUILD	ING SA57695	OUT: Da	te 30,	10/1	7-		Time: 13	.15	
Name & Address of Employer:		HIRE/PE	RIOD EXP	IRY					
		NON-WA	AIVER EXC	ESS:\$					
Occupation:	Driving Exp:	_							
Driving Licence No: D/L	Type: Local / International			CHAR	GES				T
ssue Date: Date   Tel: (O)	of Birth:	Daily	@\$	250	per	lav	Ω	2000	~
Tel: (O) (R)	HP/PG 7/38 38/3			250	-		8	1000	00
ADDITIONAL DRIVER'S PARTICULAR	IS	Weekly	@\$			veek			+-
Name: (as in I/C) ANG LYE	SHENG	Monthly	@\$		per	nonth			
	3/680H	Hours	@ \$		per h	nour			
Address (Res): 60 PA VILION	V RISE	Others	@\$						
SINGAPORE		CDW	@\$		per	fay/m	onth		1
Driving Licence No: 56/3/680 6/1	Type: Local / International	PAI	@\$		per o	lay/m	onth		1
ssue Date: 24/03/ 2014 Dat		Delivery :	Service		*******	10,500			+
Occupation:	Driving Exp:	Delivery	Oel VICE						+-
VEHICLE CHECKLIST						SUB-	TOTAL \$		1
S		PETROL	LEVEL						
SCRATCHES SCRATCHES		Out	E 1/4	1/2	3/4	F			
£ 10m	19	In i	E 1/4	1/2	3/4	F			
SCHAT		EXTENS	ON						
		Collectio	n Service						
11-1-1		Misc.							
s l	A A A				TOTA	L CH	ARGE \$	2000	OD
ACCIDENTS FRONT FRONT		Rented o	ut by:						
8								(2)	
RIGHT FRONT	TOP LEFT	-				1	$\sim$	1 )	
¥ 4				Cath	a	V	,		
ACCESSORIES CHECK		Hirer's S	Signature	0	_		1	_	
Ashtray Cig Lig	ghter S/Tyre								
STD Tools Jack									
Jack	Hub Caps		Driver's	Signat	ure				
Radio / Cass CD	Cartidges								


that all amounts payable under this agreement and for parking and traffic infringements may be billed to that account and my signature above will be considered to have been made on the charge/credit card voucher. All information I have given TWINCARD RENTAL in connection with this Agreement is true.


- 1. ONLY PERSONS ABOVE 23 YEARS OF AGE WITH MORE TAHN 2 YEARS DRIVING EXPERIENCE, AUTHORISED, LICENSED AND SIGNING THIS AGREEMENT MAY DRIVE THE VEHICLE.
- 2. ALL PARKING AND TRAFFIC VIOLATIONS ARE THE RESPONSIBILITY OF THE HIRER, AN ADMINISTRATIVE CHARGE WILL BE LEVIED ON ANY TRAFFIC VIOLATIONS REDIRECTED.
- 3. THE HIRER SHALL BE LIABLE FOR EXCESS CHARGES FOR ANY LATE RETURN. AT THE RATE SHOWN PER HOUR OR PER DAY, INCLUSIVE OF CDW AND/OR PAI WHERE APPLICABLE.
- 4. IN CASE OF ACCIDENT, THE HIRER SHALL REPORT TO RENTAL OFFICE IMMEDIATELY, IF THERE IS BODILY INJURIES, A POLICE REPORT MUST BE MADE WITHIN 24 HOURS.
- 5. VEHICLE IS STRICTLY FOR SINGAPORE USE ONLY. AND MAY NOT BE DRIVEN OUT OF SINGAPORE WITHOUT PRIOR CONSENT OF THE COMPANY TWINCAR RENTAL

RETURN OF VEHICLE - THE HIRER / DRIVER IS REQUIRED TO SIGN IN THE COLUMN "SIGNATURE OF HIRER / DRIVER" FAILING WHICH THE DAY AND TIME INSERTED BELOW SHALL DEEMED TO BE THE DAY AND TIME THE VEHICLE IS RETURNED TO TWINCAR RENTAL AND THE SAME SHALL BE ACCEPTED AS CONCLUSIVE EVIDENCE OF THE SAME AND SHALL NOT BE CHALLENGED OR QUEST ONED ON ANY ACCOUNT WHATSOEVER.

DATE IN	TIME IN	MILEAGE	CHECKED BY	REMARKS	
06/11/2017	17:30HRS				
1 1 11	1100				SIGNATURE OF HIRER/DRIVER



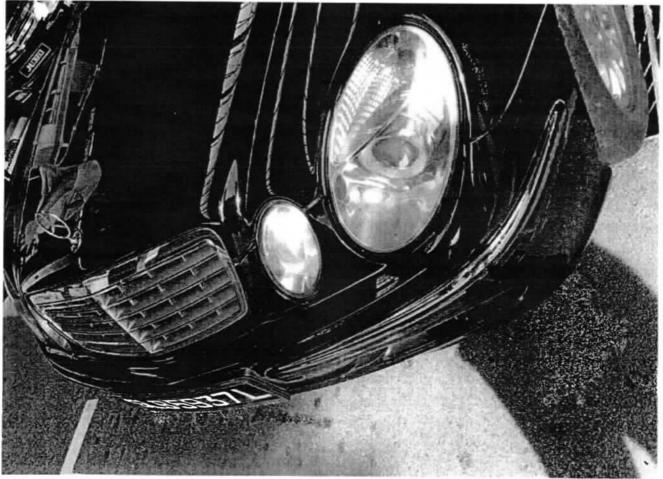

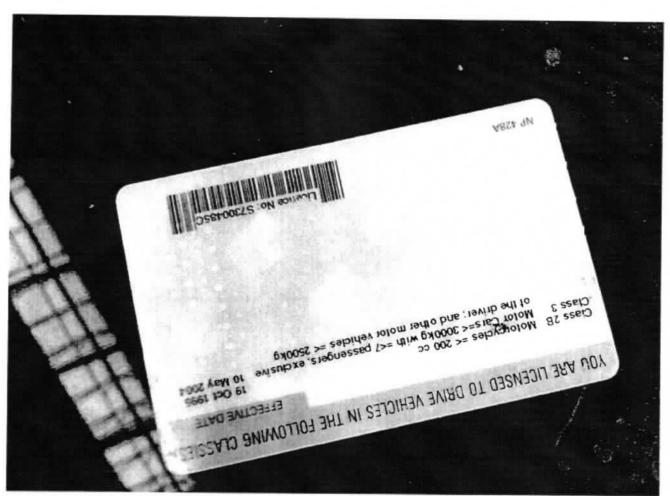



## Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type Company
Owner ID 0345N

Vehicle Details

Vehicle No. SLA3818R

Vehicle to be Exported No

Intended De-registration Date 30 Oct 2017

Vehicle Make TOYOTA

Vehicle Model HARRIER ELEGANCE 2.0 A

Primary Colour Silver
Manufacturing Year 2016

 Engine No.
 3ZRB773155

 Chassis No.
 ZSU600076941

Maximum Power Output 111.0 kW (148 bhp)

 Open Market Value
 \$28,742.00

 Original Registration Date
 03 Jun 2016

 First Registration Date
 03 Jun 2016

Transfer Count 0

Actual ARF Paid \$27,239,00

Intended PARF Rebate Details

PARF Eligibility Yes

PARF Eligibility Expiry Date 02 Jun 2026
PARF Rebate Amount \$20,429.00

Intended COE Rebate Details

COE Expiry Date 02 Jun 2026

COE Category B - Car above 1600cc or 97kW (130bhp)

COE Period(Years) 10

 QP Paid
 \$38,610.00

 COE Rebate Amount
 \$33,172.00

 Total Rebate Amount
 \$53,601.00

The information contained herein is correct as at 30 Oct 2017

## QBE Insurance (Singapore) Pte Ltd

A member of the worldwide QBE Insurance Group - Unique Entity No. 19840136

1 Raffles Quay, #29-10 South Tower, Singapore 048583 Tel: 65-6224 6633 Fax: 65-6533 3270 GST Registration No.: M200644018 www.gbe.com.sg

### 24Hrs Vehicle Accident / Emergency Hotline

6453 4730

9670 5031

Gideon Insurance Agencies Pte Ltd



#### Certificate of Insurance

MOTOR VEHICLES (THIRD-PARTY RISKS AND COMPENSATION) ACT (CHAPTER 189)
MOTOR VEHICLES (THIRD-PARTY RISKS AND COMPENSATION) RULE, 1960
ROAD TRANSPORT ACT, 1987 (MALAYSIA)
MOTOR VEHICLES (THIRD-PARTY RISKS) RULES, 1959 (MALAYSIA)

Certificate No. 8-V0015314-MVA

Account Name GIDEON INSURANCE AGENCIES

MCI Type MX4

PRIVATE LIMITED

1 Index Mark and Registration Number of Vehicle or Chassis No:

**SLA3818R** 

2 Name of Policyholder INSPIRE SEIKI PTE LTD

3 Effective date of Commencement of Insurance for the purpose of the Regulations

03/06/2017

4 Date of Expiry

02/06/2018

5 Person or Classes of Person entitled to drive\*

(a) Any other person who is driving on the Policyholder's order or with their permission.

Provided that the person driving is permitted in accordance with the licensing or other laws or regulations to drive the Motor Vehicle or has been so permitted and is not disqualified by order of a Court of Law or by reason of any enactment or regulation in that behalf from the driving the Motor Vehicle

And provided further that the Motor Vehicle is registered under the Road Traffic Act and its registration under the Road Traffic Act has not been cancelled at the time of the accident loss or damage

6 Limitations as to use\*

Use only for social domestic and pleasure purposes and for the Policyholder's business.

The policy does not cover use for hire or reward, racing, pace-making, reliability trial, speed-testing, the carriage of goods other than samples in connection with any trade or business or use for any purposes in connection with the Motor Trade.

7 Limitations rendered inoperative by Section 8 of the Motor Vehicles (Third Party Risk and Compensation) Act (Chapter 189) and Section 95 of the Road Transport Act 1987 (Malaysia) are not to be included under these headings

I/WE HEREBY CERTIFY that the Policy to which this certificate relates is issued in accordance with the provisions of the Motor Vehicle (Third-Party Risks and Compensation) Act (Chapter 189) and Part IV of the Road Transport Act. 1987 (Malaysia)

QBE Insurance (Singapore) Pte Ltd

Authorized Signature

Date of Issue: 31/05/2017

## TwinCar AUTOMOTIVE PTE LTD

Kaki Bukit AutoHub 2 Kaki Bukit Ave 2

#01-17 / #01-18 /Heavy Vehicle #01-08 / Spray Painting #02-27 Singapore 417921 Tel No. : +65 6842 0051 Fax No. : +65 6741 0510

E-Mail: sales@n51.com.sg Company Reg. No.: 200714616M GST Registration No.: 200714616M

INSPIRE SEIKI PTE LTD 10 ADMIRALTY ST #02-83 NORTH LINK BUILDING SINGAPORE 757695

Contact: 91383818

#### TAX INVOICE

Date: 09/06/2018

Date in: 30/10/2017

Vehicle Num.: SLA3818R

Make/Model: TOYOTA HARRIER ELEGANCE 2.0 A-2016

Chassis/Eng#: ZSU600076941/3ZRB773155

Accident Date: 28/10/2017

Claim No: CLM13901 Reference: OCT-39/2017

Policy No.: 8-V0015314-MVA (02/06/2018)

LUMPSUM REPAIR BILL
AS PER SURVEYOR REPORT

LEF: 0269-18-TCA DATED 04/06/2018
BY PAR AUTOMOTIVE CONSULTANCY

Amount S\$ 8,100.00

E. & O.E.

Sub S\$:

8,100.00

Add GST (7%) S\$:

567.00

Total Amount S\$:

8,667.00



MSME17142968 / SME Motor Pte Ltd - Kaki Bukit NENTRY DATE & TIME: 30/10/2017 12:54

#### SINGAPORE ACCIDENT STATEMENT

#### IMPORTANT NOTICE

- 1. Please report correctly the details of the accident to speed up the claims process.
- 2. This Form must be completed by the Policyholder and/or the Authorised Driver.
- 3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or witholding of material facts may allow insurance companies to repudiate policy ability.
- 4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.

5. Any false reporting may be referred to the Police for investigation.

- 6. This report will be forwarded by the insurers of the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore(GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
- 7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIE	ENT	STAT	ΞV	ENT
-------	-----	------	----	-----

Date Of Report

30/10/2017 12:54

Date Of Accident

28/10/2017 15:50

**Exact Location Of Accident** 

MALAYSIA CHECKPOINT

Country/State of Loss

SINGAPORE

#### **DETAILS OF OWN VEHICLE**

Vehicle Registration Number

SLA3818R

Insured/Policyholder

Name Of Registered Owner INSPIRE SEIKI PTE LTD

Co Reg No

200200345N

NOEMAIL

**Email Address** 

Mobile Phone No Alternative Phone No.

OFFICE-91383818

Vehicle Particulars

Manufacturer

TOYOTA

Model

HARRIER

Exact Purpose for which vehicle was being used at

time of accident

Are you claiming under your own insurance policy

for repair to your vehicle?

If No, Please state action to be taken

THIRD PARTY

Vehicle Category

PRIVATE CAR

Insurance Company

Name of Insurance Company

QBE INSURANCE (SINGAPORE) PTE LTD

Type Of Coverage

COMPREHENSIVE

Fleet Policy

NO

Policy Number

8-V0015314-MVA

Cover Note Number

Driver

Name of Driver

ANG LYE SHENG

NRIC No.

S6931680H

Date Of Birth

12/09/1969

Occupation

INDOOR

Date Of Driving Pass

19/02/1993

**Driving Experience** 

24 YEARS AND 8 MONTHS

Gender

MALE

Mobile Number

(LOCAL) +65-91383818

Fax Number

Contact Number

NOEMAIL

EMail Address

Page 1 of 13

Address

60 PAVILION RISE

Postcode

658413

Was driver an employee of the Insured's Company YES

If No, Relationship of the Driver with the Insured

Vehicle Registration Number of Driver's Own

Vehicle

.

Insurance Company of Driver's Own Vehicle

.

General Information of the Accident

Type Of Accident

COLLISION - CHANGE/CROSS LANE

Weather Conditions

CLEAR

Road Surface

DRY

Other Information

Was any foreign vehicle involved in this accident? NO

...

Was any body injured in the Accident?

NO

Was any other material or property damaged?

YES

I have been approached by unknown person(s) soliciting/offering accident claims assistance.

NO

Number of Brown and Aller British

5

Number of Passengers (Including Driver)

4

**Details of Police Action** 

Was the accident reported to the police?

NO

If Yes, Please state which Police Station

Was notice of intended Prosecution given?

NO

If Yes, against whom?

#### Circumstances of Accident

ON THE ABOVE DATE AND TIME, I WAS DRIVING ALONG MALAYSIA CHECKPOINT ON THE LEFT LANE OF THE 2 LANES ROAD. SOMEWHERE REACHING THE CHECKPOINT, VEHICLE AHEAD OF ME SLOWED DOWN AND STOPPED DUE TO THE HEAVY TRAFFIC FLOW. AS SUCH, I APPLIED BRAKE AND STOPPED ACCORDINGLY. OUT OF THE SUDDEN, VEHICLE B (SLB5937L) CUT FROM THE ROAD DIVIDER AND CAME FROM THE REAR, COLLIDED DIRECTLY ONTO THE REAR PORTION OF MY VEHICLE.

#### Attachment(s)

Are accident photos available for attachment?

YES

Was there any video captured by Car Camera?

NO

Was there any audic recorded?

NO

### **DETAILS OF OTHER VEHICLE PROPERTY 1**

Vehicle Registration Number

SLB5937L

Vehicle Make/Model/Colour

Details Of Properties

VEHICLE B

Name of Driver

NRIC/Passport Number

Contact Number

Address

Postcode

Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)

**Details of Witness** 

Name

Phone Number

**Email Address** 

#### Sketch Plan Pg. 1

#### SKETCH PLAN

#### IMPORTANT NOTICE

- 1. Please report correctly the details of the accident to speed up the claims process.
- 2. This Form must be completed by the Policyholder and/or the Authorised Driver.
- Information provided must be as <u>truthful and accurate as possible</u>. Any wilful misrepresentation or withholding of material facts may allow insurance companies to <u>repudiate policy liability</u>.
- The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
- 5. Any false reporting may be referred to the Police for investigation.
- The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance
  Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by
  Interested parties.
- By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
- 8. Consent under the Personal Data Protection Act (PDPA)

Lunderstand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this (form) and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
  - processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
  - (ii) investigating the accident and/or my claims;
  - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
  - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
  - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims, (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents@ncluding their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
  - to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
  - (ii) for complying with requirements under any regulations, laws or court orders.

Policyholder's Signature Date & Time:

Oriver's Signature (if driver is not the policyholder) Date & Time: Reporting Centre Personnel's Signature Name: NRIC/FIN No.:

#### Sketch Plan #2 Pg. 1

SKETCH PLAN

J1/10 401/ 10E J.IJ LAA

B-SLA 3818 R

UNKANU
Vehicle

#### DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

On the citions darks and time, I was driving along Malaysia check point on the left home on the Clones round. Somewhere reaching the check point; vehicle ahead of my slowed down and stapped doe to the heavy traffic flow. As such I applied brake and stapped according. Out of the sudden vehicle B (SLB 59137 L) cut from the round divider and came from the rear and collided directly unto the rear portion of my vehicle.

A-SLA 3818R

B-SLB 5437 L

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyhol Beneture

Oriver's Signature (If driver is not the policyholder) Date & Time:

Reporting Centre Personnel's Signature Name: NRIC/FIN Yo.:

TWINGSE

7/12/2018 Vehicle Hub

## Enquire Vehicle & Owner Information (Vehicle No. SLB5937L As At 28 Oct 2017 / 15:50:00 )

Law Firm Search Details

Search Reason:

Insurance claim in relation to traffic accident

Law Firm Case No.:

T140-107050-18

Current Owner Details

Owner ID Type:

Singapore NRIC

Owner ID:

S7013758E

Owner Name:

LIM GEOK HOON

Registered Address Type: HDB/HUDC

Registered Block/House No.: 613

Registered Street Name:

**BUKIT PANJANG RING ROAD** 

Registered Unit No.:

#05-850

Registered Building Name: -

670613

Registered Postal Code: Current Vehicle Details

Vehicle No.:

SLB5937L

Make Description/Model: MERCEDES BENZ/E200NGT-PC

Insurance Company Name: AXA INSURANCE PTE LTD



Ng Ching Boon Eric has successfully logged out. Your last login date and time was 12 Jul 2018, 15:41:06. To return to ONE.MOTORING, please click here For security reasons, please CLEAR YOUR CACHE after each session.

### Session Transaction History

-	Asset Type Vehicle	Asset ID SL35937L	Asset Owner ID	Transaction Type 18.19 Enquire Veh Owner Info (Others) by Law Firm	Transaction Amount(S\$)	Log Date/Time 12 Jul 2018 / 15:41:46
---	-----------------------	----------------------	----------------	--------------------------------------------------------------------	-------------------------	-----------------------------------------



51 UBI AVE 1, #01/02-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL: (065) 6256 3561 FAX: (065) 6256 4315

Your Ref: 18.24658 PD-O

Date: 10th Oct 2018

Our Ref: CS3/ASM17020781/Bvbe2-1

#### M/s AXA Insurance Pte Ltd

C/O: Seah Ong & Partners LLP 36 Robinson Road #12-03 City House Singapore 068877 (The Motor Claims Department)

Dear Sir / Madam,

# EVALUATION REPORT (PAPER SURVEY) OF ACCIDENT VEHICLE NO: SLA 3818R INSURED VEHICLE: SLB 5937L ACCIDENT DATE: 28/10/2017

We thank you for your instruction on 03/10/2018.

We acknowledge receipt of the following documents:-

- a) Automobile Inspection Report of SLA 3818R from M/s Par Automotive Consultancy.
- b) Singapore Accident Statement of Vehicles SLA 3818R and SLB 5937L.
- c) Final Repair Bill of SLA 3818R from M/s Twincar Automotive Pte Ltd.
- d) Colour damaged vehicle photographs of SLA 3818R.

Pre-Repair Inspection Date: 31/10/2017 at M/s Twincar Automotive Pte Ltd, 2 Kaki Bukit Ave 2, #01-17 Kaki Bukit Autohub, Singapore 417921.

Based on the documents received from you, we have evaluated the damages of the vehicle and have the following comments:-

1. Information Recorded: -

Registration Number

: SLA 3818R

Make & Model

: Toyota Harrier Elegance 2.0 A

Year of Registration

: 2016

Chassis Number

: ZSU600076941

Engine Capacity

: 1986 cc

- We recommend that the repairs of the entire damage require about <u>4 (Four)</u> working days to complete.
- We hereby provide our recommendations on the cost of repair to the damaged vehicle as stated in the following page.



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

### ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLA 3818R

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	REAR BUMPER 'LOWER'	CUT	374.45	374.45
1	REAR BUMPER 'TOP'	сит	1,210.50	1,210.50
1	REAR BUMPER INNER SPONGE	CRACKED	174.45	174.45
2	REAR BUMPER REFLECTOR L/R	NOT NECESSARY	364.50	1-
1	REAR BUMPER RH INNER SHIELD	CRACKED	174.75	174.75
3	REAR BUMPER RH INNER SHIELD CLIPS	NECESSARY	19.50	19.50
2	REAR BUMPER SIDE RETAINER L/R	NOT NECESSARY	264.20	-
4	REAR END PANEL INNER TOP GARNISH CLIPS	NOT NECESSARY	26.00	1+
1	REAR RH FENDER	NOT NECESSARY	1,218.45	-
1	REAR RH FENDER INNER SHIELD	NOT NECESSARY	374.45	
1	REAR RH KNUCKLE ARM	NOT NECESSARY	581.90	-
1	REAR RH LOWER ARM	NOT NECESSARY	591.60	-
1	REAR RH SHOCK ABSORBER	NOT NECESSARY	374.45	-
1	REAR RH STABILIZER BAR LINK	NOT NECESSARY	381.90	
1	REAR RH STAY ARM	NOT NECESSARY	381.85	-
1	REAR RH TAILLAMP	NOT NECESSARY	561.60	-
4	REAR RH TAILLAMP CLIPS	NOT NECESSARY	26.00	-
1	REAR RH TAILLAMP INNER PANEL	NOT NECESSARY	374.85	
1	REAR RH TAILLAMP LOWER BRACKET	NOT NECESSARY	132.10	-
1	REAR RH TORSION ARM	NOT NECESSARY	561.60	-
1	REAR RH WHEEL HUB BEARING	NOT NECESSARY	581.90	-
	LESS 25% DISCOUNT		-2,187.75	-488.41
			6,563.25	1,465.24
	SPECIAL NETT ITEMS			
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	30.00	30.00
1	SET REAR BUMPER REVERSE SENSOR (SN)	CUT	350.00	200.00
1	REAR RH 17" SPORT RIM (SN)	NOT NECESSARY	1,500.00	-
1	REAR RH 225/65R17 102H TYRE (SN)	NOT NECESSARY	580.00	
1	SET REAR RH FENDER INNER SHIELD CLIPS (SN)	NOT NECESSARY	30.00	-
1	SET REAR RH FENDER INNER UPHOLSTERY TRIM BOARD CLIPS (SN)	NOT NECESSARY	30.00	-
1	REAR RH FENDER INSULATOR MAT (SN)	NOT NECESSARY	180.00	-

Report Ref No. CS3/ASM17020781/Bvbe2-1



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR RH FENDER QUARTER GLASS SEALANT (SN)	NOT NECESSARY	80.00	92
			2,780.00	230.00
	LABOUR			
	TO REMOVE, REINSTALL ELECTRICAL WIRING HARNESS, CHECK LIGHTING AND REWIRE FOR PARKING SENSOR.		150.00	60.00
	TO REMOVE, REINSTALL FENDER GLASS.	NOT NECESSARY	150.00	2.
	TO REMOVE, CHANGE REAR SUSPENSION PARTS, AXLE CARRIAGE, ABSORBER, LOWER ARM, TOP ARM, TRAILING ARM, KNUCKLE ARM, WHEEL BEARING, BEARING HUB AND ETC.	NOT NECESSARY	550.00	,
	TO ROAD TEST DRIVING, CHECK AND RESETTING WHEEL ALIGNMENTS SYSTEM.		180.00	60.00
	TO REMOVE, REINSTALL ROOF TOP TRIM UPHOLSTERY, CUSHION SEAT, TRIM GARNISH, TRIM LINER CARPET(TO FR).	NOT NECESSARY	140.00	
	TO SEND VEHICLE FOR CLEANING, SHAMPOO, UPHOLSTERY AND CUSHION SEAT.	NOT NECESSARY	200.00	
	TO RE-SPRAY PAINTING ON THE CHANGE BODYPARTS, REPAIR PORTION, AND WHERE CONSISTENT TO THE ACCIDENT.		1,000.00	300.00
	TO PROVIDE LABOAR, WORKMANSHIP TO CHANGE THE ABOVE DAMAGED BODYPARTS, REPAIR, RECONSTRUCT AND RE-ALIGN BODY STRUCTURE, BODY ALIGNMENTS AND DAMAGED CONSISTENT TO THE ACCIDENT.		1,500.00	400.00
	TO APPLY ANTI-RUST CHEMICAL ON REPAIRED AND REPLACED PANEL.		120.00	30.00
			3,990.00	850.00
	GRAND TOTAL		13,333.25	2,545.24

RECOMMENDED COST OF LUMP SUM REPAIRS	A PROPERTY OF	2,000.00
(TO ITS PRE-ACCIDENT CONDITION)		

Report Ref No. CS3/ASM17020781/Bvbe2-1

LIM TEOW GUAN

HO LEONG CHUAN

Asst. Automotive Assessor

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contact or tort, is accepted to any third party who may reply on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.