

Signature

Xnd

REF:

CC3/TML18017977/Gthb02

3878 K

ASSIGNMENT

From: Date: 2/10/18

Estimated Cost:

OD ☒ WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No. ~~SHB 9540T~~

at Workshop m/s Trans Cab

of NO. 2 AMK St-63

Insured: SJU 7294T

Policy No. MG001213

Claims No. M1805075

Sum Insured: Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.



Bal. or Market Value:

IDAC Accident Rpt: Consistent?: Yes or No

GIA / PR Seen: Consistent?: Yes or No

Est. Repairs: 2 days Res.: Yes or No

Lum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS (up)

Date: Person Contacted:

Vehicle: IN / OUT

Veh No: SHB9540T Yr Regn: 14 Jan 2014

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Renault lat Hude c.c 1995

Colour: Red A/C: Insured / Std / NI / NA

Sp. Reading: 492240 T/Radio: Insured / Std / NI / NA

Eng. No:

C/No: VF1ABLISAU.C276768

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: N/A / S/Rim / STD A/Rim or

Tyre Size: F: 215/60R16 R: n

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Giti

Front

Rear

R/Bal: 5 mm R/Bal: 5 mm

L/Bal: 5 mm L/Bal: 5 mm

D.O.A. D.O.I. 03-10-18

Survey held at w/s 4:30pm

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

SHB 9540T - C3/TP1201SH16/Kul

SJU 7294T - C3/FC17021803/AB

DM: 01-09-2012

DM: 10/11/2017

9/10- Report via email to the manne.

Lump Sum \$1000 - (Red: 22807.01 : 95%)

RECEIVED 09 NOV 2018

Date/Time: File Pass to?

☐ : Preli. Report

9/11 Typist

☒ : Final Report

Date/Time: File Return to?

2)

Days Of Repair: 2

Resurvey No. of Trip: -

Survey Fee:

Transportation

\$ * RS * SI

Photos

Others

TOTAL

Add Fee: ☐ Site Insp (\$

☐ Interview (\$

☐ Tech. Invs (\$

☐ Weekend (\$

250
10

260

Report Format: TP

Lump Sum / I.B.I. (\$ 1000)

Denise Tay (LKKAuto)

From: Denise Tay (LKKAuto)
Sent: Tuesday, 9 October 2018 11:16 AM
To: 'Motor Claims'
Cc: SUR
Subject: DIRECT SURVEY INSPECTION ON WORKSHOP - TRANS-CAB AUTO SERVICES PTE LTD - DOA: 1/10/2018 SHB 9540T (TP), SJU 7294T(OI)
Attachments: SHB 9540T ESTIMATE.pdf; SHB 9540T GIA.pdf

Dear Sir/Madam,

Please be informed that we had inspected the vehicle **SHB 9540T** at M/s: Trans-Cab Auto Services Pte Ltd (Sungei Kadut).

Enclosed herewith a copy of TP's GIA report & police report.

Meanwhile, kindly create claims in Merimen for our necessary action.

Best Regards,

Denise Tay | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: denisetay@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

This message contains confidential information and is intended only for the addressee named. If you are not the named addressee (or authorised to receive for the addressee) you must not disseminate, distribute or copy this email. Please notify the sender immediately by e-mail if you have received this e-mail by mistake and delete this e-mail from your system.

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Company
Owner ID:	3878K
Vehicle Details	
Vehicle No.:	SHB9540T
Vehicle to be Exported:	No
Intended Deregistration Date:	04 Oct 2018
Vehicle Make:	RENAULT
Vehicle Model:	LATITUDE 2.0L DCI AUTO D/AB 4DR
Primary Colour:	Red
Manufacturing Year:	2013
Engine No.:	M9R8839C000919
Chassis No.:	VF1ABL15AUC276768
Maximum Power Output:	127.0 kW (170 bhp)
Open Market Value:	\$19,998.00
Original Registration Date:	14 Jan 2014
First Registration Date:	14 Jan 2014
Transfer Count:	0
Actual ARF Paid:	\$12,498.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	13 Jan 2022
PARF Rebate Amount:	\$9,373.00
Intended COE Rebate Details	
COE Expiry Date:	13 Jan 2022
COE Category:	A - Car (1600cc & below)
COE Period(Years):	8
PQP Paid:	\$60,888.00
COE Rebate Amount:	\$24,919.00
Total Rebate Amount:	\$34,292.00
Message	
Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.	

The information contained herein is correct as at 04 Oct 2018

OK

[> Back to OneMotoring](#)**Enquire PARF/COE Rebate for Registered Vehicle****Vehicle Owner Particulars**

Owner ID Type:	Company
Owner ID:	3878K

Vehicle Details

Vehicle No.:	SHB9540T
Vehicle to be Exported:	Yes
Intended Deregistration Date:	01 Oct 2018
Vehicle Make:	RENAULT
Vehicle Model:	LATITUDE 2.0L DCI AUTO D/AB 4DR
Primary Colour:	Red
Manufacturing Year:	2013
Engine No.:	M9R8839C000919
Chassis No.:	VF1ABL15AUC276768
Maximum Power Output:	127.0 kW (170 bhp)
Open Market Value:	\$19,998.00
Original Registration Date:	14 Jan 2014
First Registration Date:	14 Jan 2014
Transfer Count:	0
Actual ARF Paid:	\$12,498.00

Intended PARF Rebate Details

PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	13 Jan 2022
PARF Rebate Amount:	\$9,373.00

Intended COE Rebate Details

COE Expiry Date:	13 Jan 2022
COE Category:	A - Car (1600cc & below)
COE Period(Years):	8
PQP Paid:	\$60,888.00
COE Rebate Amount:	\$24,981.00
Total Rebate Amount:	\$34,354.00

Message

Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.

The information contained herein is correct as at 01 Oct 2018

OK

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	01/10/2018 14:35
Date Of Accident	01/10/2018 08:50
Exact Location Of Accident	TOA PAYOH LORONG 2
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SHB9540T
Insured/Policyholder	
Name Of Registered Owner	TRANS-CAB SERVICES PTE LTD
Co Reg No	200303878K
Email Address	CLAIMS@TRANSCAB.COM.SG
Mobile Phone No	
Alternative Phone No	OFFICE-62866666

Vehicle Particulars

Manufacturer	RENAULT
Model	LATITUDE-2.0 L (A)
Exact Purpose for which vehicle was being used at time of accident	HIRE AND REWARD
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	TAXI

Insurance Company

Name of Insurance Company	AXA INSURANCE PTE LTD
Type Of Coverage	THIRD PARTY
Fleet Policy	YES
Policy Number	VPX/P1680520
Cover Note Number	

Driver

Name of Driver	LIM ENG LAI
NRIC No	S0817319B
Date Of Birth	20/06/1949
Occupation	OUTDOOR
Date Of Driving Pass	19/12/1968
Driving Experience	49 YEARS AND 9 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-88588238
Fax Number	
Contact Number	
Email Address	NOEMAIL

Address	BLK 238 WESTWOOD AVENUE #11-41
Postcode	648363
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OTHER - HIRER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	COLLISION - HEAD TO REAR
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles involved in the accident	2
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	2
Passenger 1	NAME: : JULIANA - 96733516 GENDER: : FEMALE

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

On 01.10.2018 at about 0850hours, I was stationary straight on the extreme right lane along Toa Payoh Lorong 2 when the traffic light was red. While stationary, suddenly I felt an impact. Vehicle B (SJU7294T) hit onto my taxi rear portion.

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SJU7294T
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	PRIVATE CAR
Name of Driver	
NRIC/Passport Number	
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	

No. Of Passenger (Including Driver)

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the Insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:


- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of :
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.

Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

SKETCH PLAN

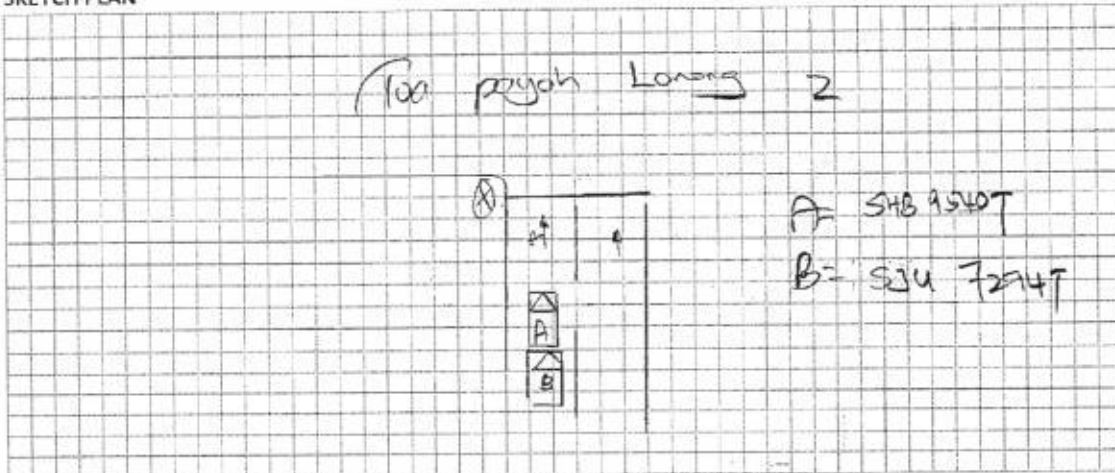

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

pls see attach GVA Report

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

Trans-cab Auto Services Pte Ltd

AAD1810-015

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHB 9540T

Vehicle No.:

Chassis No.:

Vehicle Make:

Vehicle Model:

Date of Accident :

Third Party Insurer :

to Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts price are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

SHB 9540T

VF1ABL15AUC276768

RENAULT

LATITUDE

01.10.18

TOKIO MARINE

PART

LIST

1	1 BUMPER COVER REAR	X Repair.	\$	1,108.46
2	1 BUMPER LOWER REAR	/ SCA	\$	768.84
3	1 BUMPER BRACKET CTR REAR	X	\$	113.47
4	1 BUMPER BRACKET SIDE RH REAR	X	\$	135.97
5	1 BUMPER RETAINER RH REAR	X	\$	44.99
6	1 BUMPER REFLECTOR RH	X	\$	43.61
7	1 BUMPER BRACKET SIDE LH REAR	X	\$	135.97
8	1 BUMPER RETAINER LH REAR	X	\$	44.99
9	1 BUMPER REFLECTOR LH	X	\$	43.61
10	1 BUMPER BEAM REAR	X	\$	777.52
11	1 BUMPER BEAM BRACKET LH REAR	X	\$	225.95
12	1 BUMPER BEAM BRACKET RH REAR	X	\$	225.95
13	1 OUTER PANEL REAR (End Panel)	X	\$	1,471.77
14	1 OUTER PANEL REAR (End Panel)TRIM	X	\$	404.56
15	1 TAILLAMP RH	X	\$	552.55
16	1 TAILLAMP PANEL RH	X	\$	986.70
17	1 TAILLAMP LH	X	\$	552.55
18	1 TAILLAMP PANEL LH	X	\$	986.70
19	1 BOOT REAR	X	\$	2,872.68
20	1 BOOT FINISHER	X	\$	470.06
21	1 BOOT WHEATERSTRIP	X	\$	323.05
22	1 BOOT REFLECTOR LAMP LH	X	\$	493.35
23	1 BOOT REFLECTOR LAMP RH	X	\$	493.35
24	1 BOOT BADGE 'RENAULT'	X	\$	225.36
25	1 BOOT BADGE	X	\$	225.36
26	1 BOOT STRUT LH	X	\$	276.08
27	1 BOOT STRUT RH	X	\$	276.08
28	1 BOOT HINGE LH	X	\$	367.84
29	1 BOOT HINGE RH	X	\$	367.84

Trans-cab Auto Services Pte Ltd

AAD1810-015

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHB 9540T

30	1 BOOT INNER TRIM	X		\$	586.45
31	1 BOOT SWITCH	X		\$	168.13
32	1 BOOT LOCK	X		\$	202.67
33	1 BOOT LOCK CATCH	X		\$	74.40

	\$	16,046.87
10%	\$	1,604.69
	\$	14,442.19

Special Nett

1	1SET PARKING AID	X	NN	\$	700.00
2	1SET REAR BUMPER CLIP		MC	\$	66.00
3	1SET BUMPER BRACKET CTR CLIP	X		\$	33.00
4	1SET BUMPER BRACKET SIDE CLIP RH RR	X	NN	\$	10.00
5	1SET BUMPER RETAINER RH CLIP RR	X		\$	20.00
6	1SET BUMPER BRACKET SIDE CLIP LH RR	X		\$	10.00
7	1SET BUMPER RETAINER CLIP LH RR	X		\$	20.00
8	1SET BUMPER LOWER REAR RIVET	X		\$	22.00
9	1SET BUMPER LOWER REAR CLIP		MC	\$	66.00
10	1 BOOT STICKER "Trans-cab"	X		\$	80.00
11	1 BOOT STICKER "6555-3333"	X		\$	80.00
12	1 EXHAUST MOUNTING REAR	X	NN	\$	17.82
13	2 REAR WINDSCREEN SEALANT	X		\$	80.00
14	1 WINDSCREEN MOULDING	X		\$	100.00
15	1 REAR WINDSCREEN INNER SPONGE SEAL	X		\$	100.00

TOTAL	\$	1,404.82
--------------	-----------	-----------------

TOTAL PARTS	\$	15,847.01
--------------------	-----------	------------------

LABOUR

Putty And Spray Painting Of The Affected Portion.	\$	3,000.00	200
---	----	----------	-----

Panel Beating, Knocking And Straightening The Necessary Portion, Remove And Renewal Of Parts, Adjust And Realign The Same	\$	3,000.00	200
---	----	----------	-----

Trans-cab Auto Services Pte Ltd

AAD1810-015

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHB 9540T

To transfer of tire, rim and on wheel balancing.	\$	170.00	X	} nn
To remove and refit interior fittings, trimings, garnish, fittings and other, to enable repair.	\$	380.00	X	
To Rust-Proofing Of The Affected Areas.	\$	170.00	X	
To reinstall rear bumper parking sensor.	\$	170.00	40	
To transfer of bootlid fittings, attachments and perform water seepage test.	\$	170.00	X	} nn
To repair and realign rear exhaust pipe.	\$	170.00	X	
To drop rear exhaust box, renew the same, to repair and realign centre exhaust pipe.	\$	170.00	X	
To transfer of rear end panel fittings, attachment and perform water seepage test.	\$	170.00	X	
To transfer of rear windscreen fittings and conduct water seepage test.	\$	170.00	X	
To check steering geometry and computer wheel alignment	\$	220.00	X	

TOTAL \$ 7,960.00**Over All Total \$ 23,807.01****LUMP SUM (REPAIR DAY)****10 DAYS**

2 Days.

lumpsum repair

After repair photos.

Emo Q:ap - 8288 0282

23/10/18

LKK Auto Consultants Pte Ltd (Co.Reg.No.199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CC3/TMI18017977/GTBN2

Date: 14/11/2018

REFERENCE

Handling Insurer:	Tokio Marine Insurance Singapore Ltd	Policy No:	MG001213
Claimant	SHB9540T	Insured Vehicle No :	SJU7294T
Vehicle No :		Nature of Claim:	TP
Date of Loss:	01/10/2018	Claim No:	M1805075

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SHB9540T	Engine No:	M9R8839C000919
Make & Model:	RENAULT LATITUDE, 2.0 L (A)	Chassis No:	VF1ABL15AUC276768
Reg. Date:	14/01/2014 (Man. Year: 2013)	Odometer:	492240 km
Colour:	Red		
Engine Capacity:	1995 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	215/60R16	Rear Tyre Size:	215/60R16
Front Left Side:	Giti 5 mm	Rear Left Side:	Giti 5 mm
Front Right Side:	Giti 5 mm	Rear Right Side:	Giti 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	15,846.99	823.96	15,023.03	94.80
Miscellaneous Items	0.00	0.00	0.00	
Labour	7,960.00	440.00	7,520.00	94.47
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	23,806.99	1,263.96	22,543.03	94.69
Approved Total (Overridden) (S\$)		1,000.00		
(S\$)	23,806.99	1,000.00	22,806.99	95.80
+ GST 7.00/7.00% (S\$)	1,666.49	70.00	1,596.49	95.80
Nett Amount (S\$)	25,473.48	1,070.00	24,403.48	95.80

INSPECTION

Date of Assignment: 09/10/2018

Date Inspected: 03/10/2018 Inspected At:

Trans-cab Auto Services Pte Ltd (Ang Mo Kio)
2, Ang Mo Kio Street 63
Singapore 569111

Estimated Period of Repair: 2.0 days

Adjuster: XING GUO QIANG

Manager: DENISE TAY KWEE CHENG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our

knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source: MRM-SG	Version: 1.0 (Last Synchronised: 14 Nov 2018)
Parts: 143	RENAULT LATITUDE 2.0 L (A) (Catalogue:Merimen Singapore 1.0)
Labour: Repairer's	(Price-denominated Standard List)
Print Code: (Unsubmitted, no print-code for SHB9540T)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*BUMPER COVER REAR	Repair	1,108.46 FL	*- FL
2	1		*BUMPER LOWER REAR	Scratched	768.84 FL	*768.84 FL
3	1		*BUMPER BRACKET CTR REAR	Not Necessary	113.47 FL	*- FL
4	1		*BUMPER BRACKET SIDE RH REAR	Not Necessary	135.97 FL	*- FL
5	1		*BUMPER RETAINER RH REAR	Not Necessary	44.99 FL	*- FL
6	1		*BUMPER REFLECTOR RH	Not Necessary	43.61 FL	*- FL
7	1		*BUMPER BRACKET SIDE LH REAR	Not Necessary	135.97 FL	*- FL
8	1		*BUMPER RETAINER LH REAR	Not Necessary	44.99 FL	*- FL
9	1		*BUMPER REFLECTOR LH	Not Necessary	43.61 FL	*- FL
10	1		*BUMPER BEAM REAR	Not Necessary	777.52 FL	*- FL
11	1		*BUMPER BEAM BRACKET LH REAR	Not Necessary	225.95 FL	*- FL
12	1		*BUMPER BEAM BRACKET RH REAR	Not Necessary	225.95 FL	*- FL
13	1		*OUTER PANEL REAR (END PANEL)	Not Necessary	1,471.77 FL	*- FL
14	1		*OUTER PANEL REAR (END PANEL) TRIM	Not Necessary	404.56 FL	*- FL
15	1		*TAILLAMP RH	Not Necessary	552.55 FL	*- FL
16	1		*TAILLAMP PANEL RH	Not Necessary	986.70 FL	*- FL
17	1		*TAILLAMP LH	Not Necessary	552.55 FL	*- FL
18	1		*TAILLAMP PANEL LH	Not Necessary	986.70 FL	*- FL
19	1		*BOOT REAR	Not Necessary	2,872.68 FL	*- FL
20	1		*BOOT FINISHER	Not Necessary	470.06 FL	*- FL
21	1		*BOOT WEATHERSTRIP	Not Necessary	323.05 FL	*- FL
22	1		*BOOT REFLECTOR LAMP LH	Not Necessary	493.35 FL	*- FL
23	1		*BOOT REFLECTOR LAMP RH	Not Necessary	493.35 FL	*- FL
24	1		*BOOT BADGE RENAULT	Not Necessary	225.36 FL	*- FL
25	1		*BOOT BADGE	Not Necessary	225.36 FL	*- FL
26	1		*BOOT STRUT LH	Not Necessary	276.08 FL	*- FL
27	1		*BOOT STRUT RH	Not Necessary	276.08 FL	*- FL
28	1		*BOOT HINGE LH	Not Necessary	367.84 FL	*- FL
29	1		*BOOT HINGE RH	Not Necessary	367.84 FL	*- FL
30	1		*BOOT INNER TRIM	Not Necessary	586.45 FL	*- FL
31	1		*BOOT SWITCH	Not Necessary	168.13 FL	*- FL
32	1		*BOOT LOCK	Not Necessary	202.67 FL	*- FL
33	1		*BOOT LOCK CATCH	Not Necessary	74.40 FL	*- FL
34	1		*SET PARKING AID	Not Necessary	700.00 FS	*- FS
35	1		*SET REAR BUMPER CLIP	Necessary	66.00 FS	*66.00 FS
36	1		*SET BUMPER BRACKET CTR CLIP	Not Necessary	33.00 FS	*- FS
37	1		*SET BUMPER BRACKET SIDE CLIP RH RR	Not Necessary	10.00 FS	*- FS
38	1		*SET BUMPER RETAINER RH CLIP RR	Not Necessary	20.00 FS	*- FS
39	1		*SET BUMPER BRACKET SIDE CLIP LH RR	Not Necessary	10.00 FS	*- FS
40	1		*SET BUMPER RETAINER CLIP LH RR	Not Necessary	20.00 FS	*- FS
41	1		*SET BUMPER LOWER REAR RIVET	Not Necessary	22.00 FS	*- FS
42	1		*SET BUMPER LOWER REAR CLIP	Necessary	66.00 FS	*66.00 FS
43	1		*BOOT STICKER TRANS-CAB	Not Necessary	80.00 FS	*- FS
44	1		*BOOT STICKER 6555-3333	Not Necessary	80.00 FS	*- FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
45	1		*EXHAUST MOUNTING REAR	Not Necessary	17.82 FS	*-FS
46	2		*REAR WINDSCREEN SEALANT	Not Necessary	80.00 FS	*-FS
47	1		*WINDSCREEN MOULDING	Not Necessary	100.00 FS	*-FS
48	1		*REAR WINDSCREEN INNER SPONGE SEAL	Not Necessary	100.00 FS	*-FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$)	17,451.68	900.84
- List Item Discount on L Items 10.00/10.00% (\$\$)	1,604.69	76.88
Total Parts (\$\$)	15,846.99	823.96

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION	New	3,000.00	200.00
2	PANEL BEATING,KNOCKING AND STRAIGHTENING THE NECESSARY PORTION,REMOVE AND RENEWAL OF PARTS,ADJUST AND REALIGN THE SAME	New	3,000.00	200.00
3	TO TRANSFER OF TIRE,RIM AND ON WHEEL BALANCING	New	170.00	-
4	TO REMOVE AND REFIT INTERIOR FITTINGS,TRIMINGS,GARNISH,FITTINGS AND OTHER,TO ENABLE REPAIR	New	380.00	-
5	TO RUST-PROOFING OF THE AFFECTED AREAS	New	170.00	-
6	TO REINSTALL REAR BUMPER PARKING SENSOR	New	170.00	40.00
7	TO TRANSFER OF BOOTLID FITTINGS,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST	New	170.00	-
8	TO REPAIR AND REALIGN REAR EXHAUST PIPE	New	170.00	-
9	TO DROP REAR EXHAUST BOX,RENEW THE SAME,TO REPAIR AND REALIGN CENTRE EXHAUST PIPE	New	170.00	-
10	TO TRANSFER OF REAR END PANEL FITTINGS,ATTACHMENT AND PERFORM WATER SEEPAGE TEST	New	170.00	-
11	TO TRANSFER OF REAR WINDSCREEN FITTINGS AND CONDUCT WATER SEEPAGE TEST	New	170.00	-
12	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT	New	220.00	-
Gross Labour Cost (S\$)			7,960.00	440.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >