

ASS. REC. BY:

REF:

CS/mshi8018197/Urb12

Special Instruction:

SURVEYOR
Maimun

marus

ASSIGNMENT (Office)

From (Person):

Elaine Ng

of

MSU1

Date/Time:

05/10/2018 3:45pm

Estimated Cost:

Bill to:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To inspect Vehicle No:

GY 7344C

Insured:

ABF 7702L

at Workshop m/s

Yew Tee Automobile

Tel:

6762 2081 / 4743 2262 (shawn)

of

Blk 25 Kaki Bukit Rd 4 #01-61

Policy No:

A29091861mke

Claim No:

572096

Sum Insured:

Excess:

Make of Veh:

D.O.A.

25/05/2018

(Client's Record)

CA / REV / REP. / REV 24 HRS 'wpi'

H.O.D. Endorsement:

Date/Time:

08/10/2018 10:45am

Person Contacted:

Shari

Vehicle:

IN / OUT

Date/Time

Action/Instruction (✓) Estimate

GY 7344C - x

6702 3113

ABF 7702L - x

16/10/18

Revert thru maimun

(08/11/13) wef

ASS. REC. BY: *Marcus*

REF:

MSIA

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: *GY 7394C*at Workshop m/s *Yew Lee Koh, Sides*

of _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____

Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S

Bal. or Market Value: *9800 k.*

IDAC Accident Rpt: _____ Consistent?: Yes or No

GIA / PR Seen: _____ Consistent?: Yes or No

Est Repairs: *12* days Res.: Yes or NoLum Sum: *20* % 3 Val.: Yes or NoCA / REV / REP. / 24 HRS *45048*

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: *GY 7394C*Yr Regn: *7.05*

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or *LM*Make: *Nissan**URVAN cc 2953*Colour: *Silver*

A/C: Insured / Std / NI / NA

Sp. Reading: *375758*

T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: *JNIMh 4E 2520713460*

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: *195-215 Journey*

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or *Luxotik.*

Front

Rear

R/Bal. *5* mmR/Bal. *5* mmL/Bal. *5* mmL/Bal. *5* mmD.O.A. *25/9/18*D.O.I. *8/10/18*

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Rear L/R

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

*Cge unpt. 13.11.2019**LTA 3309 10mth. Sel**asking L/S \$7000 or TOTAL LOSS**TP owner, went again back**9/10/18 confirmed L/S \$6500 with Shenn.**(Red \$7702.88, 54%.)*

RECEIVED 1 NOV 2018

Date/Time, File Pass to?

☐

Preli. Report

1) *typist*☒

Final Report

Date/Time, File Return to?

2) _____

Days Of Repair: *12*Resurvey No. of Trip: *1*

Add Fee:

☐

Site Insp (\$

☐

Interview (\$

☐

Tech. Invs (\$

☐

Weekend (\$

Survey Fee:

Transportation:

S + RS, SI

Photos

Others

TOTAL

*200**10**210*Report Format: *TP*

Lump Sum / LBI: (\$

6500)

...CLAIM SUBFOLDER...(New Assignment)

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	02 Oct 2018 20:24 Sendback Est	02 Oct 2018 20:28 S\$14,202.88	05 Oct 2018 15:45 Assign				New Assignment Cancel Case

Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS									
Insured:	CK1 ENGINEERING PTE LTD , Co. Reg. No.: 201117923H								
Main Claimant:	JEEWA LTD , Co. Reg. No.: 1994045042								
Vehicle Reg. No.:	GY7394C	Date of Loss:	25/09/2018 16:00 - :59 [158 Months and 4 Days From LTA Reg Date (Man Yr)]						
Claim Type:	TP / 572096	Policy/Cover Note No.:	A29091861MKC (Comprehensive) Coverage: 24/08/2018 - 23/08/2019						
Vehicle Reg. No. (Insured):	GBF2720L	Policy No. (Claimant):							
		Excess:							
Repairer:	Yew Tee Automobile Tech Pte Ltd (Kaki Bukit) Blk 25 Kaki Bukit Road 4, #01-61 SYNERGY @ KAKI BUKIT, 417800 Kaki Bukit - Tel: 67023113								
Handling Insurer:	MSIG Insurance (Singapore) Pte. Ltd. (HQ) - Tel: +65 6827 7888 ... [Handled by Elaine Ngu Siau Mei - 6594 2540]								
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Imm.Advice due 06/10/2018]								
Driver/Custodian (Insured):	PANNEERSELVAM SIVAKUMAR (65 / Male), NRIC: G7615767M								
Adj Asg. Remarks:	on WP, liability 100%. TP agree with SJE - assign Marcus Chua of LKK Auto Consultants Pte Ltd.								
ASSOCIATED MAIL RECEIVED									
There are no mail for this case.			View All	Compose Case Mail					
ALL ASSOCIATED TASKS									
Due Date	Priority	Type	Task Group	Subject	Handler	View All	Search Tasks	Create New Task	Complete
No results.						Assigned By	Completed On	Created On	Done?

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To: MSIG Insurance (Singapore) Pte. Ltd.
4 Shenton Way
#21-01 SGX Centre 2
Singapore 068807

From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn: Elaine Ngu Siau Mei

Date: 16 Oct 2018

Preliminary Advice

Insured Vehicle No	: GBF2720L	Accident Date	: 25/09/2018
TP Vehicle No	: GY7394C	Assignment Date	: 05/10/2018
Make	: NISSAN URVAN	Est. Duration of Repair	: 12.00
Date of Inspection	: 08/10/2018		
Inspection At	: YEW TEE AUTOMOBILE TECH PTE LTD (KAKI BUKIT) BLK 25 KAKI BUKIT ROAD 4, #01-61 SYNERGY @ KAKI BUKIT SINGAPORE 417800		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages rear and front portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	14,202.88
Revised Amount	:S\$	9,918.24
Check Items (Estimated)	:S\$	2,976.01
Total	:S\$	12,894.25

Lump Sum Repair	:S\$
-----------------	------

Total Loss Consideration

New for Old Value	:S\$
Pre-Accident Value	:S\$
COE / PARF Rebate	:S\$
Salvage Value	:S\$
Margin for Repair	:S\$

Remarks

- () The vehicle is economical/not economical for repair.
- (X) The above survey was conducted on a 'without prejudice' basis.

[> Back to OneMotoring](#)

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:	Company
Owner ID:	4504Z

Vehicle Details

Vehicle No.:	GY7394C
Vehicle to be Exported:	No
Intended Deregistration Date:	26 Sep 2018
Vehicle Make:	NISSAN
Vehicle Model:	URVAN 5DR
Primary Colour:	Silver
Manufacturing Year:	2005
Engine No.:	ZD30007633K
Chassis No.:	JN1MG4E25Z0713460
Maximum Power Output:	-
Open Market Value:	\$22,107.00
Original Registration Date:	21 Jul 2005
First Registration Date:	21 Jul 2005
Transfer Count:	2
Actual ARF Paid:	\$1,106.00

Intended PARF Rebate Details

PARF Eligibility:	No
PARF Eligibility Expiry Date:	-
PARF Rebate Amount:	\$0.00

Intended COE Rebate Details

COE Expiry Date:	31 Jul 2019
COE Category:	C - Goods Vehicle & Bus
COE Period(Years):	5
PQP Paid:	\$20,383.00
COE Rebate Amount:	\$3,451.00
Total Rebate Amount:	\$3,451.00

Message

Please note that all future COE renewals for this vehicle can only be for a 5-year period, subject to the statutory lifespan (if applicable) of the vehicle.

The information contained herein is correct as at 26 Sep 2018

OK

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT	
Date Of Report	26/09/2018 16:38
Date Of Accident	25/09/2018 17:20
Exact Location Of Accident	ALONG CTE TWDS PIE
Country/State of Loss	SINGAPORE
DETAILS OF OWN VEHICLE	
Vehicle Registration Number	GY7394C
Insured/Policyholder	
Name Of Registered Owner	JEEWA LTD
Co Reg No	199404504Z
Email Address	NOEMAIL
Mobile Phone No	(LOCAL) +65-86200774
Alternative Phone No	OFFICE-86200774
Vehicle Particulars	
Manufacturer	NISSAN
Model	URVAN 5DR
Exact Purpose for which vehicle was being used at time of accident	WORK USE
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	COMMERCIAL VEHICLE
Insurance Company	
Name of Insurance Company	NTUC INCOME INSURANCE CO-OPERATIVE LTD
Type Of Coverage	THIRD PARTY FIRE AND/OR THEFT
Fleet Policy	NO
Policy Number	5070073974-03
Cover Note Number	
Driver	
Name of Driver	ABDUL RAZAK BIN ABDUL RAHMAN
NRIC No	S2000090B
Date Of Birth	02/09/1953
Occupation	INDOOR
Date Of Driving Pass	18/03/1982
Driving Experience	36 YEARS AND 6 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-86200774
Fax Number	
Contact Number	
E-Mail Address	NOEMAIL

Address	BLK 549 WOODLAND DRIVE 44 #08-102
Postcode	730549
Was driver an employee of the Insured's Company	YES
If No, Relationship of the Driver with the Insured	
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	CHAIN COLLISION
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles involved in the accident	
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

REFER TO ATTACHED

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	GBF2720L
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	COMMERCIAL VEHICLE
Name of Driver	PANNEERSELVAM SIV AKUMAR
NRIC/Passport Number	033023847
Contact Number	90622300
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

Sketch Plan

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes;
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated; or
 - (ii) for complying with requirements under any regulations, laws or court orders.

JEEWA LIMITED
No. 31 LORONG 12 GEYLANG
SINGAPORE 399006
TEL: 6743 1211 FAX: 6744 3117
Policyholder's Signature: _____
Date & Time: _____


Driver's Signature
(If driver is not the policyholder)
Date & Time: _____


Reporting Centre Personnel's Signature
Name: _____
NRIC/FIN No. _____

SKETCH PLAN

Broadway

Straight

Towards

Pole

Che to city

Che

- YN9108 d

- G17394C

- 76BF272OL

ANCES OF THE ACCIDENT

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

While I am driving on my way back to my office at junction the ~~junction~~ Exit under ~~Swanston~~ Rd toward Pic suddenly small Larry hit my rear so hard that there was slow traffic & also 1 vehicle was big Larry in front of me

And the Lorry Hit me twice
behind me I cannot exert control

Infront veh no Xn 91084 leave the
(Scene)

DECLARATION

JEERA ALIM
 No. 31 LORONG 12 GE
 SINGAPORE 3994
 TEL: 6743 1211 FAX: 67

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name: _____
NRC/RCM No.: _____

[> Back to OneMotoring](#)**Enquire PARF/COE Rebate for Registered Vehicle****Vehicle Owner Particulars**

Owner ID Type:	Company
Owner ID:	4504Z

Vehicle Details

Vehicle No.:	GY7394C
Vehicle to be Exported:	No
Intended Deregistration Date:	08 Oct 2018
Vehicle Make:	NISSAN
Vehicle Model:	URVAN 5DR
Primary Colour:	Silver
Manufacturing Year:	2005
Engine No.:	ZD30007633K
Chassis No.:	JN1MG4E25Z0713460
Maximum Power Output:	-
Open Market Value:	\$22,107.00
Original Registration Date:	21 Jul 2005
First Registration Date:	21 Jul 2005
Transfer Count:	2
Actual ARF Paid:	\$1,106.00

Intended PARF Rebate Details

PARF Eligibility:	No
PARF Eligibility Expiry Date:	-
PARF Rebate Amount:	\$0.00

Intended COE Rebate Details

COE Expiry Date:	31 Jul 2019
COE Category:	C - Goods Vehicle & Bus
COE Period(Years):	5
PQP Paid:	\$20,383.00
COE Rebate Amount:	\$3,309.00
Total Rebate Amount:	\$3,309.00

Message

Please note that all future COE renewals for this vehicle can only be for a 5-year period, subject to the statutory lifespan (if applicable) of the vehicle.

The information contained herein is correct as at 08 Oct 2018

OK

SGCARMART.COM

Login

Sign up

New Cars

Used Cars

Sell My Car

Directory

Products

Insurance

Articles

Forum

Resources



SELL USED CAR PARTS & ACCESSORIES *Online!*



Post an Advertisement

Sell it yourself! Advertise it at just

\$58 until it's SOLD!

Post an Ad

Advertiser Login

Ways of Selling

1 Owner, Feb Benz CLS250 CDI, 89000Km Only!



Full CSC Servicing Records Available. One Of The Best Deal Around!
Auto Zoom Enterprise - StarAd



HIN LUNG AUTO

Ho Bee Group

30 years of car sale

One Stop Car Hub

Finance, Insurance, Workshop

New and Used Cars

Browse by Category

Sort by Date Posted

20 results/page

12 vehicles

Nissan Urvan

Advanced Search

Submit

	Make	Model	Price	Depreciation	Reg Date	Eng Cap	Mileage	Veh Type	Status
Search Selection	Nissan Urvan		Any	Any	> 10 year(s) old	Any	Any	Any	Available
	Nissan Urvan (COE till 05/2020)		\$12,500	\$7,620 /yr	30-May-2005	2,953 cc	-	Van	Available
Fuel Type: Diesel New Brakes. Good Aircon. Reliable And Cheap To Maintain. Loan Available. Slightly Negotiable. Suitable For Immediate Use And Low Depreciation. See Now. Posted: 08-Oct-2018 Tags: 2005 Nissan Urvan, 2005 nissan urvan, Nissan Urvan, nissan urvan, Nissan, Urvan, urvan, Used Nissan									
	Nissan Urvan (COE till 01/2023)		\$29,777	\$6,960 /yr	18-Jan-2008	2,953 cc	-	Van	Available
Fuel Type: Diesel Powerful And Smooth 3.0 Nissan Urvan, 5 Doors Unit. Very Well Taken Care By Previous Owner. Excellent Handling And Driving Conditions. Comes With Reverse Camera And Sensors Already Built In. Buy With ... KSL Automotive Pte Ltd Posted: 05-Oct-2018 Tags: 2008 Nissan Urvan, 2008 nissan urvan, Nissan Urvan, nissan urvan, Nissan, Urvan, urvan, Used Nissan									
	Nissan Urvan (COE till 09/2021)		\$21,888	\$7,400 /yr	23-Sep-2006	2,953 cc	80,632 km	Van	Available
Fuel Type: Diesel Fully Converted Hearse Van Immediately Can Be Use. Specifications All As Required. Save \$30K On Hearse Conversion! Very Affordable And Reasonable Depreciation. Welcome To Test Drive. Call Us Right Now... ABWIN (1994) Pte Ltd Posted: 25-Oct-2018 Tags: 2006 Nissan Urvan, 2006 nissan urvan, Nissan Urvan, nissan urvan, Nissan, Urvan, urvan, Used Nissan									
	Nissan Urvan (COE till 03/2024)		\$37,800	\$5,900 /yr	14-May-2004	2,389 cc	70,000 km	Bus	Available
Fuel Type: Petrol Very Low Mileage Done, One Owner Only, Very Well Maintained, Flexible In-house Loan Packages Available. Prime Motor & Leasing Posted: 04-Oct-2018 Tags: 2004 Nissan Urvan, 2004 nissan urvan, Nissan Urvan, nissan urvan, Nissan, Urvan, urvan, Used Nissan									
 Is your COE expiring? Let us help you renew it! Getting your COE renewed is easy, fast and affordable. We'll help you renew your COE and get a loan for it. Get the cheapest loan in town and an approval in 2 days without effort! Enquire today.									
	Nissan Urvan (COE till 07/2022)		\$22,800	\$5,980 /yr	12-Jan-2008	2,953 cc	-	Van	Available
Fuel Type: Diesel Previous Owner Very Careful And Well Maintained Of This Vehicle! Powerful And Smooth 3.0 Nissan Urvan, 5 Doors Unit. Very Well Taken Care By Previous Owner. Excellent Handling And Driving Conditions. ... KSL Automotive Pte Ltd Posted: 04-Oct-2018 Tags: 2008 Nissan Urvan, 2008 nissan urvan, Nissan Urvan, nissan urvan, Nissan, Urvan, urvan, Used Nissan									

Compare



Toyota Liteace

Price Range ▼

Depreciation ▼

> 10 year(s) ▼

Vehicle Type ▼

Home » Used Cars » COE Auto Trading » Toyota Liteace (COE till 08/2019)

Resources

Car Buying

Car Selling

Car Ownership

Car Aftermarket

On The Move

Lifestyle

Toyota Liteace (COE till 08/2019)

Overview

Financial

Accessories

Similar

Research

Photos

Map

Add to Shortlist

Add to Compare

Add a Note

Report Error

More Actions

Car Details

Price \$9,800

Depreciation \$11,010 /yr

Reg Date 15-Sep-2004
(10mths 21days COE left)

Lifespan 14-Sep-2024

Manufactured 2004

Mileage -

Transmission Auto

Engine Cap 2,184 cc

Curb Weight 1,300 kg

Fuel type Diesel

Features -

Accessories -

Description Rare Auto Gear, Diesel Engine. New 5 Years COE At \$24,800 Only! Gearbox Just Overhauled. Servicing Done And Brake Pads Just Changed. No Further Repairs Needed. You Will Like It When You See It. Contact Us For Viewing!

COE \$21,466

OMV \$23,506

ARF \$1,176

Dereg Value \$3,823 as of today (change)

No. of Owners 4

Type of Veh Van

Category COE Car



Seller Infor

Company

Address

Location

Office No

Compare

Claim Reference: YTKB/TP/1809/013
Assessment Number: MSIG0021
Version: YEWTEEA1/1
Date Calculated: 02/10/2018 13:13

Full Report - V1
Registration: GY7394C
Printed: 02/10/2018 20:13

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	Shaun Toh	Date of Incident:	25/09/2018
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	MSIG Insurance (Singapore) Pte	Repairs Authorised:	TBA
Claim Reference:	YTKB/TP/1809/013	Estimated Repair Time:	
Policy Number:		Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	NISSAN
Model:	Urvan
Sub Model:	BASE MODEL
Model Sheet Number:	Z64 01
Registration:	GY7394C
Registration Month:	
Registration Year:	
VIN Number:	
Odometer:	Not Known
Colour:	
Engine Number:	
Fuel Level:	%

Model Specs

FROM 04/2005	FRONT AIR CON
FRT ELECTRIC WINDOWS	REMOTE CENTRAL LOCK
RADIO WITH CD	FOG LAMPS
REAR WIPER	LOAD COMPARTM CARPET
PAINTED DOOR HANDLES	3.0 LTR 77 KW
5 SPEED GEARBOX	ABS SYSTEM
DRIVER AIRBAG	TYRES 195/70 CR 15
REAR AXLE TYPE H233B	WHEELBASE 2715MM
VAN	TWO COAT METALLIC
PREPARE OFF VEHICLE	

Vehicle Condition

Vehicle Status

Pre-Accident Condition:	Severity of Impact:
Steering:	Vehicle Status on Inspection:
Brakes Pedal Travel:	Date of Inspection:
Place of Inspection:	02/10/2018
Pre-Accident Damage:	

Tyres Condition:

Tread Depth LHF:
Tread Depth LHR:

Damage Areas:

Tread Depth RHF:
Tread Depth RHR:
Direction of Impact:

- Resurvey before/after spray painting
- Parts prices are subject to confirmation
 - Third party survey is on a "Without Prejudice" basis
 - No illegal modification(s) is allowed
 - Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Yew Tee Automobile

Claim Reference: YTKB/TP/1809/013

Assessment Number: MSIG0021



Version: YEWTEEA1/1

Date Calculated: 02/10/2018 13:13

Full Report - V1

Registration: GY7394C

Printed: 02/10/2018 20:13

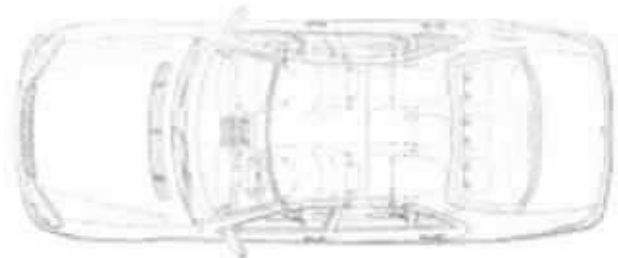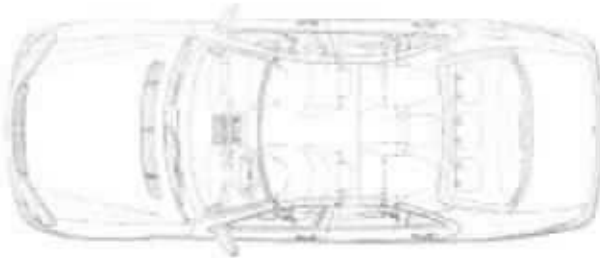

Primary Impact →
Secondary Impact - - - - - →

Addresses

Cost Summary

Total Labour	\$2,780.00
Total Paint/Material	\$434.56
Total Parts	\$10,988.32
Excess:	TBA
Grand Total Exc GST:	\$14,202.88
7 % GST:	\$994.20
Grand Total Inc GST:	\$15,197.08

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$50.00/HR

Price/Dent = \$50.00/HR

Repair /

Guide Number Repair Details

		WU	Cost Price (\$)
NO NUMBER	RENEW FRONT PANEL	14.0	70.00
NO NUMBER	R + R FRONT BUMPER	3.0	15.00
UA10A2 ZAX	RENEW FRONT BUMPER (REMOVED)	3.0	15.00
	INCLUDES: ATTACHED PARTS OF THE BUMPER		
	REMOVE AND REFIT AND RENEW IF NECESSARY		
UU10A2	R + R RADIATOR GRILLE	2.0	10.00
RE20A2)	R + R LEFT HEADLAMP	3.0	15.00
RE20A2)	R + R RIGHT HEADLAMP	3.0	15.00
RG14A2	R + R FRONT WIPER ARMS	2.0	10.00
UG10A2	R + R WINDSCREEN	17.0	85.00
UE24A2	R + R COWL TRIM	2.0	10.00
NO NUMBER	R + R LEFT FRONT DOOR	4.0	20.00
NO NUMBER	R + R RIGHT FRONT DOOR	4.0	20.00
NO NUMBER	R + R TAILGATE	5.0	25.00
UM10A2)	RENEW TAILGATE	21.0	105.00
	(RENEW TAILGATE REM)		
	INCLUDES: ATTACHED PARTS AND WINDOW		
	R+R		
UM18A2	R + R TAILGATE STRIKER PIN	2.0	10.00
UM24A2	R + R TAILGATE SEAL	2.0	10.00
NO NUMBER	R + R REAR BUMPER	3.0	15.00
UC10A2)	RENEW REAR BUMPER (REMOVED)	1.0	5.00
RE24A2	R + R LEFT TAILLAMP	2.0	10.00
RE24A2	R + R RIGHT TAILLAMP	2.0	10.00
NO NUMBER	R + R REAR END MOULDING	3.0	15.00
NO NUMBER	RENEW REAR PANEL CLOSING PANEL	20.0	100.00
NO NUMBER	RENEW REAR CROSSMEMBER CPL	18.0	90.00

Yew Tee Automobile

Claim Reference: YTKB/TP/1809/013

Assessment Number: MSIG0021

Version: YEWTEEA1/1

Date Calculated: 02/10/2018 13:13

Full Report - V1

Registration: GY7394C

Printed: 02/10/2018 20:13

RQ28A2	R + R AIRBAG CONTACT RING	8.0	40.00
VC10A2	R + R INSTRUMENT PANEL	17.0	85.00
TB1012)	R + R HEATING CPL	14.0	70.00
TB1612	R + R BLOWER CPL	16.0	80.00
TD10A2	R + R COMPLETE CONDENSER	7.0	35.00
TB7772	DRAIN AND REFILL AIR CONDITIONING	6.0	30.00
CD10A2)	R + R RADIATOR	8.0	40.00
0925	REPAIR FRT PANEL REINFORCEM	10.0*	50.00 ✓
1481	REPAIR LEFT FRONT DOOR	5.0*	25.00
1482	REPAIR RIGHT FRONT DOOR	5.0*	25.00
3482	REPAIR R/R SIDE PANEL	20.0*	100.00
3577	REPAIR L/R CORNER PILLAR	10.0*	50.00 ✓
3578	REPAIR R/R CORNER PILLAR	10.0*	50.00 ✓
3583	REPAIR L/INN CORNER PILLAR	AA 6.0*	30.00 X
3584	REPAIR R/INN CORNER PILLAR	AA 6.0*	30.00 X
4147	REPAIR CROSSMEMBER 8	7.0*	35.00 ✓

LABOUR COST

Total Work Units	291.0	
Corrosion Protection External Labour	0.0HRS	0.00
Corrosion Protection Internal Labour	0.0HRS	0.00
Sub Total	29.1HRS	\$1,455.00
Paint Labour	26.5HRS	\$1,325.00
Total Labour	55.6HRS	\$2,780.00

PAINT WORK

Guide Number	Description	Time Basis 10 WU = 1 HR. Price = \$50.00/HR	WU	Cost Price (\$)
	- TWO COAT METALLIC			
	- PREPARE OFF VEHICLE			
920	BONNET NEW PART PAINTING		24.0	
933	L/F END PANEL NEW PART PAINTING		7.0	
934	R/F END PANEL NEW PART PAINTING		7.0	
2711	REAR CROSSMEMBER SURFACE PAINT		4.0	
2931	TAILGATE NEW PART PAINTING		22.0	
3931	RR INN CROSSMEMBER SURFACE PAINT		4.0	
1481	LEFT FRONT DOOR REPAIR PAINTING <50%		16.0	
1482	RIGHT FRONT DOOR REPAIR PAINTING <50%		16.0	
3482	R/R SIDE PANEL REPAIR PAINTING <50%		68.0	
3577	L/R CORNER PILLAR REPAIR PAINTING <50%		8.0	
3578	R/R CORNER PILLAR REPAIR PAINTING <50%		8.0	
925	FRT PANEL REINFORCEMSURFACE PAINT		4.0	
2085	L/F DOOR FRAME SURFACE PAINT		5.0* X	
2086	R/F DOOR FRAME SURFACE PAINT		5.0* X	
2115	L/OUTER DOOR SILL SURFACE PAINT		5.0	
2116	R/OUTER DOOR SILL SURFACE PAINT		5.0	
2151	L/OUTER B-PILLAR SURFACE PAINT		5.0	
2152	R/OUTER B-PILLAR SURFACE PAINT		5.0	
2229	LEFT A-PILLAR SURFACE PAINT		4.0	
2230	RIGHT A-PILLAR SURFACE PAINT		4.0	
3583	L/INN CORNER PILLAR SURFACE PAINT		5.0	
3584	R/INN CORNER PILLAR SURFACE PAINT		5.0	
4147	CROSSMEMBER 8 SURFACE PAINT		4.0	

Yew Tee Automobile

Claim Reference: YTKB/TP/1809/013

Assessment Number: MSIG0021

Version: YEWTEEA1/1

Date Calculated: 02/10/2018 13:13

Full Report - V1

Registration: GY7394C

Printed: 02/10/2018 20:13

LABOUR COST - PAINT

TIME(PAINT)

240.0

Preparation Work Multi Layer Paint

0.0

Total Work Units (10WU/HR)

265.0

Total Paintwork Labour

26.5HRS

\$1,325.00

MATERIAL COST - PAINT

Cost Price

New Part Painting

\$112.29

Material-Constant Main Work Metal

\$28.60

Surface-/Blend Paint

\$61.76

Repair Painting

\$231.91

Total Excluding Pearlescent Uplift

\$434.56

Pearlescent Uplift @ 0.0%

\$0.00

Total Paint Material Cost

\$434.56

PARTS

Price Valid: 01/06/2015

Guide No.	Qty	Description	Part Number	Supplier	Bet.	Price (\$)
1000	1	70KM/H	Renew		0%	5.50*
1000	1	8 PAX	Renew		0%	5.50*
1000	1	AIR BAG ECU	Renew		0%	700.00*
7435	1	AIRBAG CONTACT RING	25567 8H325		0%	350.00*
3013	1	BADGE NISSAN	90889 VW000		0%	25.00*
920	1	BONNET	61202 VW030		0%	650.00*
2944	1	BOOT/TAILOUT SEAL	90832 VW000		0%	120.00*
4467	1	CONDENSER CPL	92100 VX200		0%	220.00*
2643	1	CTR REAR BUMPER BRKT	85040 VW000		0%	60.00*
1000	1	DOOR LETTERING	Renew		0%	45.00*
7445	1	DRIVER AIRBAG	Y851M VX200		0%	800.00*
281	1	FRONT BUMPER	62022 VX128		0%	150.00*
410	1	FRONT GRILLE	62310 VW000		0%	85.00*
257	1	FRONT NUMBER PLATE	KNPL3		0%	30.00*
1413	2	FRT SCREEN MNTG KIT	72714 0P005		0%	16.96U
1000	1	FRT WS SEALANT	Renew		0%	24.00*
4348	1	GLOVEBOX Dashboard	68108 VW000		0%	400.00*
431	1	GRILLE BADGE	62889 VW000		0%	40.00*
4415	1	HEATER BLOWER	27210 VX50A		0%	800.00*
4411	1	HEATER CPL	27110 VW010		0%	800.00*
933	1	L/F END PANEL x corner	61261 VW600		0%	90.00*
647	1	L/F FOG LAMP	26159 VW000		0%	80.00*
317	1	L/F INN BUMPER BRKT	62211 VX200		0%	45.00*
321	1	L/F OUT BUMPER BRKT	62201 VW000		0%	45.00*
297	1	L/FOG LAMP COVER	62257 VW010		0%	35.00*
3281	1	L/R LAMP ASSY	26555 VW025		0%	55.00*
571	1	LEFT HEADLAMP ASSY	26065 VW000		0%	100.00*
4344	1	LWR INSTR PANEL CVR	68930 VW600		0%	90.00*
1392	1	LWR WINDSCREEN COVER	66862 VW000		0%	200.00*
3165	1	MOUNTING CLAMP	90314 VW000		0%	0.00
3164	2	MOUNTING CLAMP	90319 68R00		0%	15.46U
3166	1	MOUNTING CLAMP	90315 VW000		0%	0.00
3361	1	NO PLATE LAMP CPL	26510 VW000		0%	40.00*
934	1	R/F END PANEL	61260 VW000		0%	90.00*
648	1	R/F FOG LAMP	26154 VW000		0%	80.00*
318	1	R/F INN BUMPER BRKT	62210 VX200		0%	45.00*

Yew Tee Automobile

Claim Reference: YTKB/TP/1809/013

Assessment Number: MSIG0021

Version: YEWTEEA1/1

Date Calculated: 02/10/2018 13:13

Full Report - V1

Registration: GY7394C

Printed: 02/10/2018 20:13

322	1	R/F OUT BUMPER BRKT	62200 VW000	0%	Ref	45.00	✓
298	1	R/FOG LAMP COVER	62256 VW010	0%	11	35.00	*X
3282	1	R/R LAMP ASSY	26550 VW025	0%	310	55.00	✓
7761	1	RADIATOR	21410 VW300	0%	11	200.00	*X
2581	1	REAR BUMPER	85022 VW025	0%	D-3	300.00	✓
2711	1	REAR CROSSMEMBER	75615 VW000	0%	R.450	220.00	✓
2981	1	REAR LOCK CYL	K0600 VW025	0%	2013m	80.00	✓
2702	1	REAR NUMBER PLATE	KNPL6	0%	Ref	15.00	*14
3151	1	REAR SCREEN	90300 VW011	0%	Shuttl	350.00	✓
3161	1	REAR SCREEN SEAL	G2716 89900	0%	Ref	80.00	*40
3167	1	REAR SCREEN SPACER	90356 VZ00A	0%	2m	15.00	U
3225	1	REAR WIPER ARM	28781 VW010	0%	11	35.00	*X
3221	1	REAR WIPER MOTOR	28710 VW000	0%	11	200.00	*X
1000	1	REVERSE SENSOR	Renew	0%	Shuttl	80.00	✓
572	1	RIGHT HEADLAMP ASSY	26015 VW000	0%	310	100.00	✓
1000	1	RR GLASS SELANT	Renew	0%	2m	24.00	✓
3931	1	RR INN CROSSMEMBER	75614 VW000	0%	Ref	300.00	*X
2931	1	TAILGATE	K010M VX6AA	0%	Shuttl	950.00	✓
2979	1	TAILGATE TRIM	90810 VW11A	0%	D-3	50.00	✓
1421	1	UPP WINDSCREEN MLDG	72750 VX50A	0%	11	60.00	*X
1401	1	WINDSCREEN <i>Ref</i>	72712 VW000	0%	11	400.00	✓
1411	1	WINDSCREEN BOND KIT	KE150 10002	0%	2m	31.21	U
1410	1	WINDSCREEN SEAL	G2716 89901	0%	2m	26.75	U
f: OEM Parts			Sub Total			\$9,989.38	
g: Original			Mark Up From Cost	(10 %)		\$998.94	
h: Secondhand			Total Parts			\$10,988.32	
p: Parallel							
x: Exchange							

THIS ASSESSMENT CONTAINS UNPRICED PARTS
NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Total Extras **\$0.00**

Final Calculation

Total Parts	\$10,988.32
Labour	
Total Panel/Mechanical	\$1,455.00 (270.00) 1185.00
Total Paintwork	\$1,325.00 (250.00) 1075.00
Total Labour	\$2,780.00
Total Paint/Material Costs	\$434.56 (417.13) 267.43
Grand Total Excludes GST	\$14,202.88
GST @ 7 %	\$994.20
Grand Total Includes GST	\$15,197.08

Assessment Notes

7373.92

51 Ubi Avenue 1, #01-25
Paya Ubi Industrial Park
Singapore

408933

Full Report - V1
Registration: GY7394C
Printed: 16/10/2018 12:24

Claim Reference: YTKB/TP/1809/013
Assessment Number: MSIG0021
Version: LKKAUTOC/2
Date Calculated: 16/10/2018 05:23

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	LKK AUTO	Date of Incident:	25/09/2018
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	MSIG Insurance (Singapore) Pte	Repairs Authorised:	TBA
Claim Reference:	YTKB/TP/1809/013	Estimated Repair Time:	
Policy Number:		Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	NISSAN
Model:	Urvan
Sub Model:	BASE MODEL
Model Sheet Number:	Z64 01
Registration:	GY7394C
Registration Month:	
Registration Year:	
VIN Number:	
Odometer:	Not Known
Colour:	
Engine Number:	
Fuel Level:	%



Model Specs

FROM 04/2005	FRONT AIR CON
FRT ELECTRIC WINDOWS	REMOTE CENTRAL LOCK
RADIO WITH CD	FOG LAMPS
REAR WIPER	LOAD COMPARTM CARPET
PAINTED DOOR HANDLES	3.0 LTR 77 KW
5 SPEED GEARBOX	ABS SYSTEM
DRIVER AIRBAG	TYRES 195/70 CR 15
REAR AXLE TYPE H233B	WHEELBASE 2715MM
VAN	TWO COAT METALLIC
PREPARE OFF VEHICLE	

Vehicle Condition

Vehicle Status

Pre-Accident Condition:	Severity of Impact:	
Steering:	Vehicle Status on Inspection:	
Brakes Pedal Travel:	Date of Inspection:	02/10/2018
Place of Inspection:		
Pre-Accident Damage:		
Tyres Condition:		
Tread Depth LHF:	Tread Depth RHF:	
Tread Depth LHR:	Tread Depth RHR:	
Damage Areas:	Direction of Impact:	

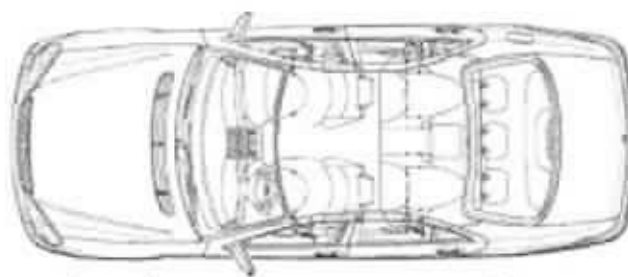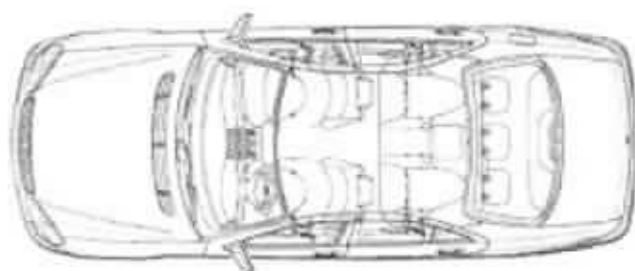

Primary Impact
Secondary Impact



Addresses

Cost Summary

Total Labour	\$2,525.00
Total Paint/Material	\$417.13
Total Parts	\$9,952.12
Excess:	TBA
Grand Total Exc GST:	\$12,894.25
7 % GST:	\$902.60
Grand Total Inc GST:	\$13,796.85

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$50.00/HR
Price/Dent = \$50.00/HR

Repair / Guide Number	Repair Details	WU	Cost Price (\$)
NO NUMBER	RENEW FRONT PANEL	14.0	70.00
NO NUMBER	R + R FRONT BUMPER	3.0	15.00
UA10A2 ZAX	RENEW FRONT BUMPER (REMOVED)	3.0	15.00
	INCLUDES: ATTACHED PARTS OF THE BUMPER REMOVE AND REFIT AND RENEW IF NECESSARY		
UU10A2	R + R RADIATOR GRILLE	2.0	10.00
RE20A2)	R + R LEFT HEADLAMP	3.0	15.00
RE20A2)	R + R RIGHT HEADLAMP	3.0	15.00
RG14A2	R + R FRONT WIPER ARMS	2.0	10.00
UG10A2	R + R WINDSCREEN	17.0	85.00
UE24A2	R + R COWL TRIM	2.0	10.00
NO NUMBER	R + R LEFT FRONT DOOR	4.0	20.00
NO NUMBER	R + R RIGHT FRONT DOOR	4.0	20.00
NO NUMBER	R + R TAILGATE	5.0	25.00
UM10A2)	RENEW TAILGATE	21.0	105.00
	(RENEW TAILGATE REM)		
	INCLUDES: ATTACHED PARTS AND WINDOW R+R		
UM18A2	R + R TAILGATE STRIKER PIN	2.0	10.00
UM24A2	R + R TAILGATE SEAL	2.0	10.00
NO NUMBER	R + R REAR BUMPER	3.0	15.00
UC10A2)	RENEW REAR BUMPER (REMOVED)	1.0	5.00
RE24A2	R + R LEFT TAILLAMP	2.0	10.00
RE24A2	R + R RIGHT TAILLAMP	2.0	10.00
NO NUMBER	R + R REAR END MOULDING	3.0	15.00
NO NUMBER	RENEW REAR PANEL CLOSING PANEL	20.0	100.00
RQ28A2	R + R AIRBAG CONTACT RING	8.0	40.00

VC10A2	R + R INSTRUMENT PANEL	17.0	85.00
TB1012)	R + R HEATING CPL	14.0	70.00
TB1612	R + R BLOWER CPL	16.0	80.00
TB7772	DRAIN AND REFILL AIR CONDITIONING	6.0	30.00
CD10A2)	R + R RADIATOR	8.0	40.00
0925	REPAIR FRT PANEL REINFORCEM	10.0*	50.00
1481	REPAIR LEFT FRONT DOOR	5.0*	25.00
1482	REPAIR RIGHT FRONT DOOR	5.0*	25.00
3482	REPAIR R/R SIDE PANEL	20.0*	100.00
3577	REPAIR L/R CORNER PILLAR	10.0*	50.00
3578	REPAIR R/R CORNER PILLAR	10.0*	50.00
4147	REPAIR CROSSMEMBER 8	7.0*	35.00

LABOUR COST

Total Work Units	254.0	
Corrosion Protection External Labour	0.0HRS	0.00
Corrosion Protection Internal Labour	0.0HRS	0.00
Sub Total	25.4HRS	\$1,270.00
Paint Labour	25.1HRS	\$1,255.00
Total Labour	50.5HRS	\$2,525.00

PAINT WORK

Time Basis 10 WU = 1 HR. Price = \$50.00/HR

Guide Number	Description	WU	Cost Price (\$)
	- TWO COAT METALLIC		
	- PREPARE OFF VEHICLE		
920	BONNET NEW PART PAINTING	24.0	
933	L/F END PANEL NEW PART PAINTING	7.0	
934	R/F END PANEL NEW PART PAINTING	7.0	
2711	REAR CROSSMEMBER SURFACE PAINT	4.0	
2931	TAILGATE NEW PART PAINTING	22.0	
1481	LEFT FRONT DOOR REPAIR PAINTING <50%	16.0	
1482	RIGHT FRONT DOOR REPAIR PAINTING <50%	16.0	
3482	R/R SIDE PANEL REPAIR PAINTING <50%	68.0	
3577	L/R CORNER PILLAR REPAIR PAINTING <50%	8.0	
3578	R/R CORNER PILLAR REPAIR PAINTING <50%	8.0	
925	FRT PANEL REINFORCEMSURFACE PAINT	4.0	
2085	L/F DOOR FRAME SURFACE PAINT	5.0*	
2086	R/F DOOR FRAME SURFACE PAINT	5.0*	
2115	L/OUTER DOOR SILL SURFACE PAINT	5.0	
2116	R/OUTER DOOR SILL SURFACE PAINT	5.0	
2151	L/OUTER B-PILLAR SURFACE PAINT	5.0	
2152	R/OUTER B-PILLAR SURFACE PAINT	5.0	
2229	LEFT A-PILLAR SURFACE PAINT	4.0	
2230	RIGHT A-PILLAR SURFACE PAINT	4.0	
4147	CROSSMEMBER 8 SURFACE PAINT	4.0	

LABOUR COST - PAINT

TIME(PAINT)	226.0	
Preparation Work Multi Layer Paint	0.0	
Total Work Units (10WU/HR)	251.0	
Total Paintwork Labour	25.1HRS	\$1,255.00

MATERIAL COST - PAINT

New Part Painting		\$112.29
-------------------	--	----------

Material-Constant Main Work Metal	\$28.60
Surface-/Blend Paint	\$44.33
Repair Painting	\$231.91
Total Excluding Pearlescent Uplift	\$417.13
Pearlescent Uplift @ 0.0%	\$0.00
Total Paint Material Cost	\$417.13

PARTS

Price Valid: 01/06/2015

Guide No.	Qty	Description	Part Number	Supplier	Bet.	Price (\$)
257	1	FRONT NUMBER PLATE	KNPL3		0%	14.00*
281	1	FRONT BUMPER	62022 VX128		0%	150.00*
317	1	L/F INN BUMPER BRKT	62211 VX200		0%	45.00*
318	1	R/F INN BUMPER BRKT	62210 VX200		0%	45.00*
321	1	L/F OUT BUMPER BRKT	62201 VW000		0%	45.00*
322	1	R/F OUT BUMPER BRKT	62200 VW000		0%	45.00*
410	1	FRONT GRILLE	62310 VW000		0%	85.00*
431	1	GRILLE BADGE	62889 VW000		0%	40.00*
571	1	LEFT HEADLAMP ASSY	26065 VW000		0%	100.00*
572	1	RIGHT HEADLAMP ASSY	26015 VW000		0%	100.00*
920	1	BONNET	61202 VW030		0%	650.00*
933	1	L/F END PANEL	61261 VW600		0%	90.00*
934	1	R/F END PANEL	61260 VW000		0%	90.00*
1392	1	LWR WINDSCREEN COVER	66862 VW000		0%	200.00*
1401	1	WINDSCREEN	72712 VW000		0%	400.00*
1410	1	WINDSCREEN SEAL	G2716 89901		0%	26.75U
1411	1	WINDSCREEN BOND KIT	KE150 10002		0%	31.21U
1413	2	FRT SCREEN MNTG KIT	72714 0P005		0%	16.96U
2581	1	REAR BUMPER	85022 VW025		0%	300.00*
2643	1	CTR REAR BUMPER BRKT	85040 VW000		0%	60.00*
2702	1	REAR NUMBER PLATE	KNPL6		0%	14.00*
2711	1	REAR CROSSMEMBER	75615 VW000		0%	220.00*
2931	1	TAILGATE	K010M VX6AA		0%	950.00*
2944	1	BOOT/TAILGATE SEAL	90832 VW000		0%	120.00*
2979	1	TAILGATE TRIM	90810 VW11A		0%	50.00*
2981	1	REAR LOCK CYL	K0600 VW025		0%	80.00*
3013	1	BADGE NISSAN	90889 VW000		0%	25.00*
3151	1	REAR SCREEN	90300 VW011		0%	350.00*
3161	1	REAR SCREEN SEAL	G2716 89900		0%	40.00*
3164	2	MOUNTING CLAMP	90319 68R00		0%	15.46U
3165	1	MOUNTING CLAMP	90314 VW000		0%	0.00
3166	1	MOUNTING CLAMP	90315 VW000		0%	0.00
3167	1	REAR SCREEN SPACER	90356 VZ00A		0%	15.00U
3221	1	REAR WIPER MOTOR	28710 VW000		0%	200.00*
3281	1	L/R LAMP ASSY	26555 VW025		0%	55.00*
3282	1	R/R LAMP ASSY	26550 VW025		0%	55.00*
4344	1	LWR INSTR PANEL CVR	68930 VW600		0%	90.00*
4348	1	GLOVEBOX	68108 VW000		0%	400.00*
4411	1	HEATER CPL	27110 VW010		0%	800.00*
4415	1	HEATER BLOWER	27210 VX50A		0%	800.00*
7435	1	AIRBAG CONTACT RING	25567 8H325		0%	350.00*
7445	1	DRIVER AIRBAG	Y851M VX200		0%	800.00*
7761	1	RADIATOR	21410 VW300		0%	200.00*

1000	1	FRT WS SEALANT	Renew	0%	24.00*
1000	1	DOOR LETTERING	Renew	0%	45.00*
1000	1	AIR BAG ECU	Renew	0%	700.00*
1000	1	RR GLASS SELANT	Renew	0%	24.00*
1000	1	8 PAX	Renew	0%	5.50*
1000	1	70KM/H	Renew	0%	5.50*
1000	1	REVERSE SENSOR	Renew	0%	80.00*

f: OEM Parts

Sub Total

\$9,047.38

g: Original

Mark Up From Cost (10 %)

\$904.74

h: Secondhand

Total Parts**\$9,952.12**

p: Parallel

x: Exchange

THIS ASSESSMENT CONTAINS UNPRICED PARTS

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Total Extras**\$0.00****Final Calculation****Total Parts** **\$9,952.12****Labour**

Total Panel/Mechanical

\$1,270.00

Total Paintwork

\$1,255.00

Total Labour**\$2,525.00****Total Paint/Material Costs****\$417.13****Grand Total Excludes GST****\$12,894.25**

GST @ 7 %

\$902.60**Grand Total Includes GST****\$13,796.85****Assessment Notes**

Claim Reference: YTKB/TP/1809/013
Assessment Number: MSIG0021
Version: LKKAUTOC/5
Date Calculated: 01/11/2018 06:56

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	LKK AUTO	Date of Incident:	25/09/2018
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	MSIG Insurance (Singapore) Pte	Repairs Authorised:	TBA
Claim Reference:	YTKB/TP/1809/013	Estimated Repair Time:	
Policy Number:		Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	NISSAN
Model:	Urvan
Sub Model:	BASE MODEL
Model Sheet Number:	Z64 01
Registration:	GY7394C
Registration Month:	
Registration Year:	
VIN Number:	
Odometer:	Not Known
Colour:	
Engine Number:	
Fuel Level:	%



Model Specs

FROM 04/2005	FRONT AIR CON
FRT ELECTRIC WINDOWS	REMOTE CENTRAL LOCK
RADIO WITH CD	FOG LAMPS
REAR WIPER	LOAD COMPARTM CARPET
PAINTED DOOR HANDLES	3.0 LTR 77 KW
5 SPEED GEARBOX	ABS SYSTEM
DRIVER AIRBAG	TYRES 195/70 CR 15
REAR AXLE TYPE H233B	WHEELBASE 2715MM
VAN	TWO COAT METALLIC
PREPARE OFF VEHICLE	

Vehicle Condition

Vehicle Status

Pre-Accident Condition:	Severity of Impact:
Steering:	Vehicle Status on Inspection:
Brakes Pedal Travel:	Date of Inspection:
Place of Inspection:	02/10/2018
Pre-Accident Damage:	
Tyres Condition:	Tread Depth RHF:
Tread Depth LHF:	Tread Depth RHR:
Tread Depth LHR:	Direction of Impact:
Damage Areas:	

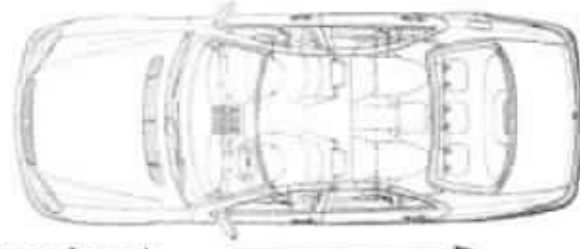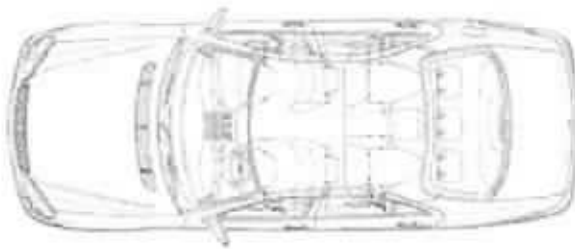

Primary Impact
Secondary Impact



Addresses

Cost Summary

Total Labour	\$2,150.00
Total Paint/Material	\$380.77
Total Parts	\$8,296.11
Excess:	TBA
Grand Total Exc GST:	\$10,826.88
7 % GST:	\$757.88
Grand Total Inc GST:	\$11,584.76

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$50.00/HR
Price/Dent = \$50.00/HR

Repair /

Guide Number	Repair Details	WU	Cost Price (\$)
NO NUMBER	RENEW FRONT PANEL	14.0	70.00
NO NUMBER	R + R FRONT BUMPER	3.0	15.00
UA10A2 ZAX	RENEW FRONT BUMPER (REMOVED) INCLUDES: ATTACHED PARTS OF THE BUMPER REMOVE AND REFIT AND RENEW IF NECESSARY	3.0	15.00
UU10A2	R + R RADIATOR GRILLE	2.0	10.00
RE20A2)	R + R LEFT HEADLAMP	3.0	15.00
RE20A2)	R + R RIGHT HEADLAMP	3.0	15.00
RG14A2	R + R FRONT WIPER ARMS	2.0	10.00
UG10A2	R + R WINDSCREEN	17.0	85.00
UE24A2	R + R COWL TRIM	2.0	10.00
NO NUMBER	R + R LEFT FRONT DOOR	4.0	20.00
NO NUMBER	R + R RIGHT FRONT DOOR	4.0	20.00
NO NUMBER	R + R TAILGATE	5.0	25.00
UM10A2)	RENEW TAILGATE (RENEW TAILGATE REM) INCLUDES: ATTACHED PARTS AND WINDOW	21.0	105.00
UM18A2	R + R TAILGATE STRIKER PIN	2.0	10.00
UM24A2	R + R TAILGATE SEAL	2.0	10.00
NO NUMBER	R + R REAR BUMPER	3.0	15.00
UC10A2)	RENEW REAR BUMPER (REMOVED)	1.0	5.00
RE24A2	R + R LEFT TAILLAMP	2.0	10.00
RE24A2	R + R RIGHT TAILLAMP	2.0	10.00
NO NUMBER	R + R REAR END MOULDING	3.0	15.00
NO NUMBER	RENEW REAR PANEL CLOSING PANEL	20.0	100.00
RQ28A2	R + R AIRBAG CONTACT RING	8.0	40.00

VC24A2	GLOVE BOX REMOVE + REFIT	2.0	10.00
TB1612	R + R BLOWER CPL	16.0	80.00
TB7772	DRAIN AND REFILL AIR CONDITIONING	6.0	30.00
0925	REPAIR FRT PANEL REINFORCEMENT	10.0*	50.00
1481	REPAIR LEFT FRONT DOOR	5.0*	25.00
1482	REPAIR RIGHT FRONT DOOR	5.0*	25.00
3482	REPAIR R/R SIDE PANEL	20.0*	100.00
3577	REPAIR L/R CORNER PILLAR	10.0*	50.00
3578	REPAIR R/R CORNER PILLAR	10.0*	50.00
4147	REPAIR CROSSMEMBER 8	7.0*	35.00

LABOUR COST

Total Work Units	217.0	
Corrosion Protection External Labour	0.0HRS	0.00
Corrosion Protection Internal Labour	0.0HRS	0.00
Sub Total	21.7HRS	\$1,085.00
Paint Labour	21.3HRS	\$1,065.00
Total Labour	43.0HRS	\$2,150.00

PAINT WORK

Time Basis 10 WU = 1 HR. Price = \$50.00/HR

Guide Number	Description	WU	Cost Price (\$)
	- TWO COAT METALLIC		
	- PREPARE OFF VEHICLE		
920	BONNET NEW PART PAINTING	24.0	
933	L/F END PANEL NEW PART PAINTING	7.0	
934	R/F END PANEL NEW PART PAINTING	7.0	
2711	REAR CROSSMEMBER SURFACE PAINT	4.0	
2931	TAILGATE NEW PART PAINTING	22.0	
1481	LEFT FRONT DOOR REPAIR PAINTING <50%	16.0	
1482	RIGHT FRONT DOOR REPAIR PAINTING <50%	16.0	
3482	R/R SIDE PANEL REPAIR PAINTING <50%	68.0	
3577	L/R CORNER PILLAR REPAIR PAINTING <50%	8.0	
3578	R/R CORNER PILLAR REPAIR PAINTING <50%	8.0	
925	FRT PANEL REINFORCEMENT SURFACE PAINT	4.0	
4147	CROSSMEMBER 8 SURFACE PAINT	4.0	

LABOUR COST - PAINT

TIME(PAINT)	188.0	
Preparation Work Multi Layer Paint	0.0	
Total Work Units (10WU/HR)	213.0	
Total Paintwork Labour	21.3HRS	\$1,065.00

MATERIAL COST - PAINT

New Part Painting	\$112.29
Material-Constant Main Work Metal	\$28.60
Surface-/Blend Paint	\$7.97
Repair Painting	\$231.91
Total Excluding Pearlescent Uplift	\$380.77
Pearlescent Uplift @ 0.0%	\$0.00
Total Paint Material Cost	\$380.77

PARTS

Guide No.	Qty	Description	Part Number	Supplier	Price Valid: 01/06/2015	Bet.	Price (\$)
257	1	FRONT NUMBER PLATE	KNPL3		0%		14.00*

281	1	FRONT BUMPER	62022 VX128	0%	150.00*
317	1	L/F INN BUMPER BRKT	62211 VX200	0%	45.00*
318	1	R/F INN BUMPER BRKT	62210 VX200	0%	45.00*
321	1	L/F OUT BUMPER BRKT	62201 VW000	0%	45.00*
322	1	R/F OUT BUMPER BRKT	62200 VW000	0%	45.00*
410	1	FRONT GRILLE	62310 VW000	0%	85.00*
431	1	GRILLE BADGE	62889 VW000	0%	40.00*
571	1	LEFT HEADLAMP ASSY	26065 VW000	0%	100.00*
572	1	RIGHT HEADLAMP ASSY	26015 VW000	0%	100.00*
920	1	BONNET	61202 VW030	0%	650.00*
933	1	L/F END PANEL	61261 VW600	0%	90.00*
934	1	R/F END PANEL	61260 VW000	0%	90.00*
1401	1	WINDSCREEN	72712 VW000	0%	400.00*
1410	1	WINDSCREEN SEAL	G2716 89901	0%	26.75U
1411	1	WINDSCREEN BOND KIT	KE150 10002	0%	31.21U
1413	2	FRT SCREEN MNTG KIT	72714 0P005	0%	16.96U
2581	1	REAR BUMPER	85022 VW025	0%	300.00*
2643	1	CTR REAR BUMPER BRKT	85040 VW000	0%	60.00*
2702	1	REAR NUMBER PLATE	KNPL6	0%	14.00*
2711	1	REAR CROSSMEMBER	75615 VW000	0%	220.00*
2931	1	TAILGATE	K010M VX6AA	0%	950.00*
2944	1	BOOT/TAILGATE SEAL	90832 VW000	0%	120.00*
2979	1	TAILGATE TRIM	90810 VW11A	0%	50.00*
2981	1	REAR LOCK CYL	K0600 VW025	0%	80.00*
3013	1	BADGE NISSAN	90889 VW000	0%	25.00*
3151	1	REAR SCREEN	90300 VW011	0%	350.00*
3161	1	REAR SCREEN SEAL	G2716 89900	0%	40.00*
3164	2	MOUNTING CLAMP	90319 68R00	0%	0.00F
3165	1	MOUNTING CLAMP	90314 VW000	0%	0.00
3166	1	MOUNTING CLAMP	90315 VW000	0%	0.00
3167	1	REAR SCREEN SPACER	90356 VZ00A	0%	15.00U
3281	1	L/R LAMP ASSY	26555 VW025	0%	55.00*
3282	1	R/R LAMP ASSY	26550 VW025	0%	55.00*
4348	1	GLOVEBOX	68108 VW000	0%	400.00*
4415	1	HEATER BLOWER	27210 VX50A	0%	800.00*
7435	1	AIRBAG CONTACT RING	25567 8H325	0%	350.00*
7445	1	DRIVER AIRBAG	Y851M VX200	0%	800.00*
1000	1	FRT WS SEALANT	Renew	0%	24.00*
1000	1	DOOR LETTERING	Renew	0%	45.00*
1000	1	AIR BAG ECU	Renew	0%	700.00*
1000	1	RR GLASS SELANT	Renew	0%	24.00*
1000	1	8 PAX	Renew	0%	5.50*
1000	1	70KM/H	Renew	0%	5.50*
1000	1	REVERSE SENSOR	Renew	0%	80.00*

f: OEM Parts

g: Original

h: Secondhand

p: Parallel

x: Exchange

Saving

Sub Total

Mark Up From Cost (10 %)

Total Parts

\$15.46

\$7,541.92

\$754.19

\$8,296.11

THIS ASSESSMENT CONTAINS UNPRICED PARTS
NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Total Extras

\$0.00

Final Calculation

Total Parts		\$8,296.11
Labour		
Total Panel/Mechanical	\$1,085.00	
Total Paintwork	\$1,065.00	
Total Labour		\$2,150.00
Total Paint/Material Costs		\$380.77
Grand Total Excludes GST		\$10,826.88
GST @ 7 %		\$757.88
Grand Total Includes GST		\$11,584.76

Assessment Notes

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'ed	Status
Main	02 Oct 2018 20:24 Sendback Est	02 Oct 2018 20:28 S\$14,202.88	05 Oct 2018 15:45 Edit Adj Rpt	S\$6,500.00 Edit Estimates	S\$6,500.00 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All
------	-----------	---------------	-----------	----------

CLAIM SUBFOLDER DETAILS

Insured:	CKI ENGINEERING PTE LTD , Co. Reg. No.: 201117923H		
Main Claimant:	JEEWA LTD , Co. Reg. No.: 199404504Z		
Vehicle Reg. No.:	GY7394C	Date of Loss:	25/09/2018 16:00 - :59 [158 Months and 4 Days From LTA Reg Date (Man Yr)]
Claim Type:	TP / 572096	Policy/Cover Note No.:	A29091861MKC (Comprehensive) Coverage: 24/08/2018 - 23/08/2019
Vehicle Reg. No. (Insured):	GBF2720L	Policy No. (Claimant):	
		Excess:	
Reparer:	Yew Tee Automobile Tech Pte Ltd (Kaki Bukit) Bk 25 Kaki Bukit Road 4, #01-61 SYNERGY @ KAKI BUKIT, 417800 Kaki Bukit - Tel: 67023113		
Handling Insurer:	MSIG Insurance (Singapore) Pte. Ltd. (HQ) - Tel: +65 6827 7888 ... [Handled by Elaine Ngu Siau Mei - 6594 2540]		
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by MARCUS CHUA] ... [Final Rpt due 04/11/2018]		
Driver/Custodian (Insured):	PANNEERSELVAM SIVAKUMAR (65 / Male), NRIC: G7615767M		
Adj Asg. Remarks:	on WP, liability 100%. TP agree with SJE - assign Marcus Chua of LKK Auto Consultants Pte Ltd.		

ASSOCIATED MAIL RECEIVED

[View All](#)
[Compose Case Mail](#)

There are no mail for this case.

ALL ASSOCIATED TASKS

[View All](#)
[Search Tasks](#)
[Create New Task](#)
[Complete](#)

Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

GY7394C (572096)
[GBF2720L]
TP
JEEWA LTD
Sep 25 2018 4:00PM
[CK1 ENGINEERING PTE LTD]
Yew Tee Automobile Tech Pte Ltd

Upload Documents Upload Photos Compose New Letter			View View in Browser	
Assessment Reports			1 per page	☒
No	Finalized On	Yew Tee Automobile Tech Pte Ltd (Kaki Bukit)	Thumbnail	Print
1	02/10/18 20:28	Repairer Estimates	 Load HTM	☐
No	Finalized On	MSIG Insurance (Singapore) Pte. Ltd. (HQ)	Thumbnail	Print
1	03/10/18 18:29	Accident Statement From: SC - Reg. No: GBF2720L, Claimant: CK1 ENGINEERING PTE LTD	 Load HTM	☐
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	16/10/18 12:54	Adjuster Immediate Advice	 Load HTM	☐
Photos/Images			3 per page	☒
No	Finalized On	Yew Tee Automobile Tech Pte Ltd (Kaki Bukit)	Thumbnail	Print
1	02/10/18 20:27	Accident Photo	 Load JPG	☒
2	02/10/18 20:27	Accident Photo	 Load JPG	☒
3	02/10/18 20:27	Accident Photo	 Load JPG	☒
4	02/10/18 20:27	Accident Photo	 Load JPG	☒
5	02/10/18 20:27	Accident Photo	 Load JPG	☒
6	02/10/18 20:27	Accident Photo	 Load JPG	☒
7	02/10/18 20:27	Accident Photo	 Load JPG	☒
8	02/10/18 20:27	Accident Photo	 Load JPG	☒
9	02/10/18 20:27	Accident Photo	 Load JPG	☒
10	02/10/18 20:27	Accident Photo	 Load JPG	☒
11	02/10/18 20:27	Accident Photo	 Load JPG	☒
12	02/10/18 20:27	Accident Photo	 Load JPG	☒
13	02/10/18 20:27	Accident Photo	 Load JPG	☒
14	02/10/18 20:27	Accident Photo	 Load JPG	☒
15	02/10/18 20:27	Accident Photo	 Load JPG	☒
16	02/10/18 20:27	Accident Photo	 Load JPG	☒
17	02/10/18 20:27	Accident Photo	 Load JPG	☒
18	02/10/18 20:27	Accident Photo	 Load JPG	☒
19	02/10/18 20:27	Accident Photo	 Load JPG	☒
20	02/10/18 20:27	Accident Photo	 Load JPG	☒
21	02/10/18 20:27	Accident Photo	 Load JPG	☒
22	02/10/18 20:27	Accident Photo	 Load JPG	☒
23	02/10/18 20:27	Accident Photo	 Load JPG	☒
24	02/10/18 20:27	Accident Photo	 Load JPG	☒
25	02/10/18 20:27	Accident Photo	 Load JPG	☒
26	02/10/18 20:27	Accident Photo	 Load JPG	☒
27	02/10/18 20:27	Dismantled Parts	 Load JPG	☒
28	02/10/18 20:27	Accident Photo	 Load JPG	☒
29	02/10/18 20:27	Accident Photo	 Load JPG	☒
30	02/10/18 20:27	Accident Photo	 Load JPG	☒

Assessment Reports			1 per page	☒
No	Finalized On	Yew Tee Automobile Tech Pte Ltd (Kaki Bukit)	Thumbnail	Print
31	02/10/18 20:27	Accident Photo		☒
32	02/10/18 20:27	Accident Photo		☒
33	02/10/18 20:27	Accident Photo		☒
34	02/10/18 20:27	Accident Photo		☒
35	02/10/18 20:27	Accident Photo		☒
36	02/10/18 20:27	Accident Photo		☒
37	02/10/18 20:27	Accident Photo		☒
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	30/10/18 18:02	Reinspection Photo		☒
2	30/10/18 18:02	Reinspection Photo		☒
3	30/10/18 18:02	Reinspection Photo		☒
4	30/10/18 18:02	Reinspection Photo		☒
5	30/10/18 18:02	Reinspection Photo		☒
6	30/10/18 18:02	Reinspection Photo		☒
7	30/10/18 18:02	Reinspection Photo		☒
8	30/10/18 18:02	Reinspection Photo		☒
9	30/10/18 18:02	Reinspection Photo		☒
10	30/10/18 18:02	Reinspection Photo		☒
11	30/10/18 18:02	Reinspection Photo		☒
12	30/10/18 18:02	Reinspection Photo		☒
13	30/10/18 18:02	Reinspection Photo		☒
14	30/10/18 18:02	Reinspection Photo		☒
15	30/10/18 18:02	Reinspection Photo		☒
16	30/10/18 18:02	Reinspection Photo		☒
17	30/10/18 18:02	Reinspection Photo		☒
18	30/10/18 18:02	Reinspection Photo		☒
19	30/10/18 18:02	Reinspection Photo		☒
20	30/10/18 18:02	Reinspection Photo		☒
21	30/10/18 18:02	Reinspection Photo		☒
22	30/10/18 18:02	Reinspection Photo		☒
23	30/10/18 18:02	Reinspection Photo		☒
24	30/10/18 18:02	Reinspection Photo		☒
25	30/10/18 18:02	Reinspection Photo		☒
26	30/10/18 18:02	Reinspection Photo		☒
27	01/11/18 15:17	General View		☒
28	01/11/18 15:17	General View		☒
29	01/11/18 15:17	General View		☒
30	01/11/18 15:17	General View		☒
31	01/11/18 15:17	General View		☒
32	01/11/18 15:17	General View		☒
33	01/11/18 15:17	General View		☒
34	01/11/18 15:17	General View		☒
35	01/11/18 15:17	General View		☒
36	01/11/18 15:17	General View		☒
37	01/11/18 15:17	General View		☒
38	01/11/18 15:17	General View		☒
39	01/11/18 15:17	General View		☒
40	01/11/18 15:17	General View		☒
41	01/11/18 15:17	General View		☒
42	01/11/18 15:17	General View		☒

Assessment Reports			1 per page	☒
No	Finalized On	Yew Tee Automobile Tech Pte Ltd (Kaki Bukit)	Thumbnail	Print
43	01/11/18 15:17	General View	 Load JPG	☒
44	01/11/18 15:17	General View	 Load JPG	☒
45	01/11/18 15:17	General View	 Load JPG	☒
46	01/11/18 15:17	General View	 Load JPG	☒
47	01/11/18 15:17	General View	 Load JPG	☒
48	01/11/18 15:17	General View	 Load JPG	☒
49	01/11/18 15:17	General View	 Load JPG	☒
50	01/11/18 15:17	General View	 Load JPG	☒
51	01/11/18 15:17	General View	 Load JPG	☒
52	01/11/18 15:17	General View	 Load JPG	☒
53	01/11/18 15:17	General View	 Load JPG	☒
54	01/11/18 15:17	General View	 Load JPG	☒
55	01/11/18 15:17	General View	 Load JPG	☒
56	01/11/18 15:17	General View	 Load JPG	☒
57	01/11/18 15:17	General View	 Load JPG	☒
58	01/11/18 15:17	General View	 Load JPG	☒
59	01/11/18 15:17	General View	 Load JPG	☒
60	01/11/18 15:17	General View	 Load JPG	☒
61	01/11/18 15:17	General View	 Load JPG	☒
62	01/11/18 15:17	General View	 Load JPG	☒
63	01/11/18 15:17	General View	 Load JPG	☒
64	01/11/18 15:17	General View	 Load JPG	☒
65	01/11/18 15:17	General View	 Load JPG	☒
66	01/11/18 15:17	General View	 Load JPG	☒
67	01/11/18 15:17	General View	 Load JPG	☒
68	01/11/18 15:17	General View	 Load JPG	☒
69	01/11/18 15:17	General View	 Load JPG	☒
70	01/11/18 15:17	General View	 Load JPG	☒
71	01/11/18 15:17	General View	 Load JPG	☒
72	01/11/18 15:17	General View	 Load JPG	☒
73	01/11/18 15:17	General View	 Load JPG	☒
74	01/11/18 15:17	General View	 Load JPG	☒
75	01/11/18 15:17	General View	 Load JPG	☒
76	01/11/18 15:17	General View	 Load JPG	☒
77	01/11/18 15:17	General View	 Load JPG	☒
78	01/11/18 15:17	General View	 Load JPG	☒
79	01/11/18 15:17	General View	 Load JPG	☒
80	01/11/18 15:17	General View	 Load JPG	☒
81	01/11/18 15:17	General View	 Load JPG	☒
82	01/11/18 15:17	General View	 Load JPG	☒
83	01/11/18 15:17	General View	 Load JPG	☒
84	01/11/18 15:17	General View	 Load JPG	☒
85	01/11/18 15:17	General View	 Load JPG	☒
86	01/11/18 15:17	General View	 Load JPG	☒
87	01/11/18 15:17	General View	 Load JPG	☒
88	01/11/18 15:17	General View	 Load JPG	☒
89	01/11/18 15:17	General View	 Load JPG	☒
90	01/11/18 15:17	General View	 Load JPG	☒
91	01/11/18 15:17	General View	 Load JPG	☒
92	01/11/18 15:17	General View	 Load JPG	☒

Assessment Reports			1 per page	☒
No.	Finalized On	Yew Tee Automobile Tech Pte Ltd (Kaki Bukit)	Thumbnail	Print
93	01/11/18 15:17	General View	 Load JPG	☒
94	01/11/18 15:17	General View	 Load JPG	☒
95	01/11/18 15:17	General View	 Load JPG	☒
96	01/11/18 15:17	General View	 Load JPG	☒
97	01/11/18 15:17	General View	 Load JPG	☒
98	01/11/18 15:17	General View	 Load JPG	☒
99	01/11/18 15:17	General View	 Load JPG	☒
100	01/11/18 15:17	General View	 Load JPG	☒
101	01/11/18 15:17	General View	 Load JPG	☒
102	01/11/18 15:17	General View	 Load JPG	☒
103	01/11/18 15:17	General View	 Load JPG	☒
104	01/11/18 15:17	General View	 Load JPG	☒
105	01/11/18 15:17	General View	 Load JPG	☒
106	01/11/18 15:17	General View	 Load JPG	☒
107	01/11/18 15:17	General View	 Load JPG	☒
108	01/11/18 15:17	General View	 Load JPG	☒
109	01/11/18 15:17	General View	 Load JPG	☒
110	01/11/18 15:17	General View	 Load JPG	☒
111	01/11/18 15:17	General View	 Load JPG	☒
112	01/11/18 15:17	General View	 Load JPG	☒
113	01/11/18 15:17	General View	 Load JPG	☒
114	01/11/18 15:17	General View	 Load JPG	☒
115	01/11/18 15:17	General View	 Load JPG	☒
116	01/11/18 15:17	General View	 Load JPG	☒
117	01/11/18 15:17	General View	 Load JPG	☒
118	01/11/18 15:17	General View	 Load JPG	☒
119	01/11/18 15:17	General View	 Load JPG	☒
120	01/11/18 15:17	General View	 Load JPG	☒
121	01/11/18 15:17	General View	 Load JPG	☒
122	01/11/18 15:17	General View	 Load JPG	☒
123	01/11/18 15:17	General View	 Load JPG	☒
124	01/11/18 15:17	General View	 Load JPG	☒
125	01/11/18 15:17	General View	 Load JPG	☒
126	01/11/18 15:17	General View	 Load JPG	☒
127	01/11/18 15:17	General View	 Load JPG	☒
128	01/11/18 15:17	General View	 Load JPG	☒
129	01/11/18 15:17	General View	 Load JPG	☒
130	01/11/18 15:17	General View	 Load JPG	☒
131	01/11/18 15:17	General View	 Load JPG	☒
132	01/11/18 15:17	General View	 Load JPG	☒
133	01/11/18 15:17	General View	 Load JPG	☒
134	01/11/18 15:17	General View	 Load JPG	☒
135	01/11/18 15:17	General View	 Load JPG	☒
136	01/11/18 15:17	General View	 Load JPG	☒
137	01/11/18 15:17	General View	 Load JPG	☒
138	01/11/18 15:17	General View	 Load JPG	☒
139	01/11/18 15:17	General View	Load JPG	☒
140	01/11/18 15:17	General View	Load JPG	☒
141	01/11/18 15:17	General View	Load JPG	☒
142	01/11/18 15:17	General View	Load JPG	☒

Assessment Reports			1 per page	☒
No	Finalized On	Yew Tee Automobile Tech Pte Ltd (Kaki Bukit)	Thumbnail	Print
143	01/11/18 15:17	General View	 Load JPG	☒
144	01/11/18 15:17	General View	 Load JPG	☒
145	01/11/18 15:17	General View	 Load JPG	☒
146	01/11/18 15:17	General View	 Load JPG	☒
147	01/11/18 15:17	General View	 Load JPG	☒
148	01/11/18 15:17	General View	 Load JPG	☒
149	01/11/18 15:17	General View	 Load JPG	☒
150	01/11/18 15:17	General View	 Load JPG	☒
151	01/11/18 15:17	General View	 Load JPG	☒
152	01/11/18 15:17	General View	 Load JPG	☒
153	01/11/18 15:17	General View	 Load JPG	☒
154	01/11/18 15:17	General View	 Load JPG	☒
155	01/11/18 15:17	General View	 Load JPG	☒
156	01/11/18 15:17	General View	 Load JPG	☒
157	01/11/18 15:17	General View	 Load JPG	☒
158	01/11/18 15:17	General View	 Load JPG	☒
159	01/11/18 15:17	General View	 Load JPG	☒
160	01/11/18 15:17	General View	 Load JPG	☒
161	01/11/18 15:17	General View	 Load JPG	☒
162	01/11/18 15:17	General View	 Load JPG	☒
163	01/11/18 15:17	General View	 Load JPG	☒
164	01/11/18 15:17	General View	 Load JPG	☒
165	01/11/18 15:17	General View	 Load JPG	☒
166	01/11/18 15:17	General View	 Load JPG	☒

Documentation			1 per page	☒
No	Finalized On	Yew Tee Automobile Tech Pte Ltd (Kaki Bukit)	Thumbnail	Print
1	02/10/18 20:26	Singapore Accident Statement	 Load PDF	
2	02/10/18 20:26	Driver's NRIC	 Load PDF	
No	Finalized On	MSIG Insurance (Singapore) Pte. Ltd. (HQ)	Thumbnail	Print
1	03/10/18 18:29	YN910BU E-FILE REPORT From: SC - Reg. No: GBF2720L, Claimant: CK1 ENGINEERING PTE LTD	 Load PDF	
2	05/10/18 08:43	TP agree SJE - assign LKK	 Load PDF	
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	01/11/18 15:16	GY 7394C FINALISE.AudatexMS	 Load PDF	

Documents Checklist

DOCUMENTS CHECKLIST		Reset	Save	Print
There are no document checklists configured.				
Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)				
Show Remarks To: ☐ Repairer ☐ Handling Insurer Note: Remarks are private unless you show it to other parties.				

LKK Auto Consultants Pte Ltd

(Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/MSG18018197/URBE2

Date: 05/11/2018

REFERENCE

Handling Insurer: MSIG Insurance (Singapore) Pte. Ltd.

Policy No:

A29091861MKC

Claimant Vehicle No : GY7394C

Insured Vehicle No :

GBF2720L

Date of Loss: 25/09/2018

Nature of Claim: TP

Claim No: 572096

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: GY7394C

Make & Model: NISSAN URVAN, 2.5 D (M)

Engine No: ZD30007633K

Reg. Date: 21/07/2005 (Man. Year: 2005)

Chassis No: JN1MG4E25Z0713460

Colour: Silver

Odometer: 375758 km

Engine Capacity: 2953 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable):

Yes

Footbrake (Serviceable):

Yes

Handbrake (Serviceable): Yes Engine Modification:

No

Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 195 R15

Rear Tyre Size:

195 R15

Front Left Side: Journey 5 mm

Rear Left Side:

Luxotik 5 mm

Front Right Side: Journey 5 mm

Rear Right Side:

Luxotik 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	10,988.32	8,296.11	2,692.21	24.50
Miscellaneous Items	0.00	0.00	0.00	
Paintwork Materials	434.56	380.77	53.79	12.38
Labour	1,455.00	1,085.00	370.00	25.43
Paintwork Labour	1,325.00	1,065.00	260.00	19.62
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	14,202.88	10,826.88	3,376.00	23.77
Approved Total (Overridden) (S\$)		6,500.00		
(S\$)	14,202.88	6,500.00	7,702.88	54.23
+ GST 7.00/7.00% (S\$)	994.20	455.00	539.20	54.23
Nett Amount (S\$)	15,197.08	6,955.00	8,242.08	54.23

INSPECTION

Date of Assignment: 05/10/2018 Present Location:

Yew Tee Automobile Tech Pte Ltd (Kaki Bukit)

Date Inspected: 08/10/2018 Inspected At:

Yew Tee Automobile Tech Pte Ltd (Kaki Bukit)

Blk 25 Kaki Bukit Road 4, #01-61

SYNERGY @ KAKI BUKIT

Singapore 417800

Estimated Period of Repair: 12.0 days

Adjuster: MARCUS CHUA

Manager: Janice Lee Si Hua

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	(Last Synchronised: 05 Nov 2018)	
Parts:	N/A	NISSAN URVAN 2.5 D (M) (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for GY7394C)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*PARTS (WCP)		9,989.38 F	*7,541.92 F
Sub Total (S\$)					9,989.38	7,541.92
+ Margin on L,N Items 10.00/10.00% (S\$)					998.94	754.19
Total Parts (S\$)					10,988.32	8,296.11

F=Franchise part.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

No	Qty	Particulars	Repairer's	Amount
<u>Materials</u>				
1	1	PAINTWORK MATERIAL	434.56	380.77
Sub Total (S\$)			434.56	380.77

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Paintwork Labour</u>				
1	SPRAY PAINTING	New	1,325.00	1,065.00
<u>Labour Items</u>				
2	LABOUR	New	1,455.00	1,085.00
Gross Labour Cost (S\$)			2,780.00	2,150.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >