

INS CASE OWNER:

CC6 / LPPG160 22818, Aha3/L-1

LKK:

IDAC:

Surveyor:

ADRIAN

DOI:

25-11-16

Date / Time:

29-11-16

Registered in Merit:

Pre-assign / CCU / FTE

SJN 2244H

Claim No:

1611616140001019177

Policy No:

2116140001097496

Make / Model:

TOYOTA RUSH-1.5 x (4)

Place of Accident:

Along PIE Lane / Tanjong Chay Airport



Insured Vehicle No:

TAN SOON HENDI

Name of Insured

Insured Tel No:

HP: 97942298

Excess Sec II : \$5

D.O.A: 25-11-16

Is driver the owner?

(YES / NO)

Nature of Accident:

OI GIA REPORT: YES / NO ; TP GIA REPORT: YES / NO

Insured Liability:

%

Final ? Yes / No

If NO, Driver Name / Age:

Driver Tel No:

(V/L YES / NO)

SJH 3842J

CJN 2244H

WKF 383

S6W 2489G



INSRS:

WSP:

Tel:

Liability:

RMKS:



INSRS:

WSP:

Tel:

Liability:

RMKS:

81



INSRS:

WSP:

Tel:

Liability:

RMKS:



INSRS:

WSP:

Tel:

Liability:

RMKS:

Date / Time	STAGE	DATE / PIC
21/11/16	Non-Reporting ltr (1st)	
	Non-Reporting ltr (2nd)	
	Non-Reporting ltr (Final)	
	Notification ltr (if non-pickup)	
	Call OI:	
	After call ltr to OI:	
21/11/16	Documentation Check List:	
	Notification ltr (if non-pickup)	
	After call ltr to OI:	
	Authorisation To Act:	
	Release Voucher:	
	Final Repair Bill:	
	Car Rental Invoice:	
	Towing Invoice:	
	LTA / GIA:	
	Medical Bill:	
	PIR:	
	Mandate/Reject Instruction:	
	LOD:	
	Payment Breakdown Form:	
	Post-Repair Photos:	
	Others:	
21/11/16	FILE REVIEWED. OI KNOWLEDGE IN A 4 WHEEL C.O.C. W. WHEELS THE 3RD CAR & WHEELS (2ND CAR) WHICH IS A PORTION CAR. NO MORE REPAIRS.	
21/11/16	FINALIZED.	
21/11/16	TO SEND PA IN THE REPORT VALUE PENDING TO LOD.	
21/11/16	REPORT DONE.	
21/11/16	TP LOD IN BY EMAIL.	
21/11/16	ORIGI WARRANTS APPROVAL BY EMAIL.	
21/11/16	ORIGI WARRANTS APPROVAL VIA EMAIL.	
21/11/16	ORIGI WARRANTS TO LPA.	
21/11/16	LPA APPROVED WARRANTS @ 10% ONLY.	
21/11/16	TO CONTINUE OR RESUBMIT CLAIM TO RUC.	
21/11/16	TP PERSUASION. SUBMIT UP REPORT.	
21/11/16	PRELIMINARY ADVICE	
Date/Time	Sent By:	Confirm by:
21/11/16	Adrian	
21/11/16	FINALIZATION	
Date/Time	Confirm with	Email ☐ Call ☐
21/11/16	Repair Cost: \$16,500.00 (11 days) Reduction: 44 %	
21/11/16	FINAL SETTLEMENT	
Date/Time	Confirm with	Email ☐ Call ☐
21/11/16	Final Liability: % (Agreed / Assessed) BOLA S/N No: NIL	
21/11/16	Repair Cost: \$5	
21/11/16	Loss of Rental (LOR): \$5 (days)	
21/11/16	Loss of Use (LOU): \$5 (\$ x days)	
21/11/16	Loss of Income (LOI): \$5 (\$ x days)	
21/11/16	LOR only ☐ LOU only ☐ LOR + LOU ☐ LOR + LOI ☐ [Tick only one]	
21/11/16	GIA/LTA Search: \$5	
21/11/16	Medical: \$5	
21/11/16	Disbursement: \$5 (e.g. Tow/Independent)	
21/11/16	Legal Cost: \$5	
21/11/16	Total: \$5	
21/11/16	Global Sum \$5:	Email ☐ Call ☐
21/11/16	FINAL PAYMENT	
Date/Time	Confirm with	
21/11/16	Payee 1: \$5	
21/11/16	Payee 2: (Strike if N.A.) \$5	
21/11/16	Payee 3: (Strike if N.A.) \$5	
21/11/16	Name 1:	
21/11/16	Name 2:	
21/11/16	Name 3:	
21/11/16	If NO or B 28, Ass. Lia: 0/0	
21/11/16	4.12h Chain Collision	
21/11/16	01 3.1 Vch. CTR WALKWAY-240	
21/11/16	TP PERSUASION	
21/11/16	TP LACRORE PURCHASE REPORT	
21/11/16	REIMBURSE LPA	
21/11/16	1) Claim status: Normal/Reject/Private Settle	
21/11/16	2) Report Format: WSP REPORT	
21/11/16	3) Survey fee: \$250.00	

(1/2)

REFERENCE NUMBER	
CCG/LPC/6022018/ANA3	
DATE / TIME	ACTIONS / REMARKS
08/07/17	SEND THE ORDER TO TP @ 10%.
10/07/17	TP HAS CASH TO LAUNDRY.
11/07/17	EMAIL TO LPC TO INFORM THE FINE IN SUBMIT WP REPORT. NO INTEREST. TO CLOSE.
	REIMBURSE CHARGE FROM TP LAUNDRY TO REIMBURSE LPC IN SUBMIT REPORT TO TP LAUNDRY

ASS. REC. BY:

REF:

ASSIGNMENT

From: _____ Date: _____
Estimated Cost: _____
OD / TP / WS / TP RES / OD RES / EVA / INV / MV
To inspect Vehicle No: _____
at Workshop m/s _____
of _____
Insured: _____
Policy No: _____
Claims No: _____
Sum Insured: _____ Excess: _____
(Client's Record)
Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value: _____

IDAC Accident Rpt: _____

GIA / PR Seen: _____

Est. Repairs: _____

Lum Sum: _____

Consistent? : Yes or No

Consistent? : Yes or No

11 days Res: Yes or No

20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____

Person Contacted: _____

Vehicle: IN / OUT

Veh No: WSK383 Yr Regn: 2006
Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Audi A4

cc 1984

Colour: Black

A/C: Insured / Std / NI / NA

Sp. Reading: 195085

T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: NAU2228E56A26/898

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 235/40R18

R: 235/40R18

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or

Front

Rear

R/Bal: 06 mm

R/Bal: 06 mm

L/Bal: 06 mm

L/Bal: 06 mm

D.O.A.

D.O.I. 29/11/16

Survey held at Hue Mary

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

LOC TP

MANUFACTURE COR L16 @ 16,500.00 WITH 2 DAYS
CREW @ 13,278.45 (44%)

COR @ 16,500.00

LOC @ 1,320.00 (210 x 6 DAYS)

LTH @ 5.00

TOTAL @ 17,825.00

@ 20% @ 3,565.00 10.26 @ 21,390.00

Date/Time. File Pass to?

☐ : Prel. Report

☐ : Final Report

Date/Time. File Return to?

1)

Report Format :

Lump Sum / I.B.I: (\$)

Days Of Repair:

Resurvey No. of Trip:

Add Fee: ☐ : Site Insp (\$

☐ : Interview (\$

☐ : Tech. Invs (\$

☐ : Weekend (\$

Survey Fee:

Transportation

) \$ - RS. \$

) Photos

) Others

TOTAL



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD			Ref : CC6/LPC16022818/Aha3	
100 BEACH ROAD #19-00 SHAW TOWERS SINGAPORE 189702			Date : 30-11-2016	
			Code : LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SJN 2244H	Veh. Inspected	WSK 383	
Policy No.	Z/16/VP00/097496	Coverage (\$)	0.00	
Claim No.	16/16/16/VP00/019477	Excess (\$)	0.00	
Assign From		Assign Date	30/11/2016	
2. Vehicle Particulars & Condition				
Make & Model		c.c	0	
Engine No.	HIDDEN	Year of Reg.		
Chassis No.		Colour		
Odometer	-	Steering		
Brakes		Modification		
General				
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre			mm	
L/H Front Tyre			mm	
R/H Rear Tyre			mm	
L/H Rear Tyre			mm	
4. Description of Damages				
5. General Information				
Accident Date	25/11/2016	Inspection Date	29/11/2016	
Survey held at	HUA MENG SPRAY PAINTING WKSP 1 KAKI BUKIT AVE 6 #01-61 AUTOBAY SINGAPORE 417883			
5a. Remarks				
A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				

Vic (LKKAUTO)

From: Vic (LKKAUTO)
Sent: Monday, 24 September, 2018 3:07 PM
To: ONG LI LI
Cc: MT_Claim_SG; Admin A; Vic (LKKAUTO); Accounts (LKKAUTO)
Subject: RE: <SEEK MANDATE> RE: Direct Settlement - Accident Involving SJN2244H (OI : LPC - 16/16/16/VP00/019477) AND WSK383 (TP : LKK REF - CC6/LPC16022818/Aha3) on 25.11.2016
Attachments: TP LAWYER CHEQUE.pdf

Dear Li Li,

We refer further to our below email.

Please be informed that we had already received the cheque payment from TP lawyer to purchase our Report.

We will now process the refund of the survey fees.

Thank you.

Best Regards,

Vic Alpeh | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6841-2096 | email: vicalpeh@lkkauto.com | fax: 6741-4108

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)



Save the Earth. Print only when necessary.

This e-mail contain confidential and privileged material, and are for the sole use of the intended recipient. Use or distribution by an unintended recipient is prohibited, and may be a violation of law. If you believe that you received this e-mail in error, please do not read this e-mail or any attached items. Please delete the e-mail and all attachments, including any copies thereof, and inform the sender that you have deleted the e-mail, all attachments and any copies thereof. Thank you.

From: ONG LI LI [<mailto:llong@lonpac.com>]
Sent: Monday, 27 August, 2018 12:23 PM
To: Vic (LKKAUTO)
Cc: MT_Claim_SG; Admin A
Subject: RE: <SEEK MANDATE> RE: Direct Settlement - Accident Involving SJN2244H (OI : LPC - 16/16/16/VP00/019477) AND WSK383 (TP : LKK REF - CC6/LPC16022818/Aha3) on 25.11.2016

Dear Vic

As spoken, if TP purchases your report, please refund the survey fees to us.

Thank you.

Regards,

Ong Li Li

Senior Claims Executive | Lonpac Insurance Bhd

300 Beach Road #17-04/07 The Concourse Singapore 199555

Tel : (65) 6250 7388 Ext. 254 Fax: (65) 6296 2706

From: ONG LI LI
Sent: Monday, 27 August, 2018 12:12 PM
To: Vic (LKKAUTO)
Cc: MT_Claim_SG; Admin A
Subject: RE: <SEEK MANDATE> RE: Direct Settlement - Accident Involving SJN2244H (OI : LPC - 16/16/16/VP00/019477) AND WSK383 (TP : LKK REF - CC6/LPC16022818/Aha3) on 25.11.2016

Hi Vic

They will need to purchase it.

Regards,
Ong Li Li
Senior Claims Executive | Lonpac Insurance Bhd
300 Beach Road #17-04/07 The Concourse Singapore 199555
Tel : (65) 6250 7388 Ext. 254 Fax: (65) 6296 2706

From: Vic (LKKAUTO) [<mailto:vicalpeh@lkkauto.com>]
Sent: Monday, 27 August, 2018 12:08 PM
To: ONG LI LI
Cc: MT_Claim_SG; Admin A; Vic (LKKAUTO)
Subject: RE: <SEEK MANDATE> RE: Direct Settlement - Accident Involving SJN2244H (OI : LPC - 16/16/16/VP00/019477) AND WSK383 (TP : LKK REF - CC6/LPC16022818/Aha3) on 25.11.2016

Dear Li Li,

We refer further to our below email.

Please be informed that TP repairer would now like to request a copy of the Survey Report as per their lawyer request.

Kindly advise if we can provide a copy.

Thank you.


Best Regards,

Vic Alpeh | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6841-2096 | email: vicalpeh@lkkauto.com | fax: 6741-4108

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)



Save the Earth. Print only when necessary.

This e-mail contain confidential and privileged material, and are for the sole use of the intended recipient. Use or distribution by an unintended recipient is prohibited, and may be a violation of law. If you believe that you received this e-mail in error, please do not read this e-mail or any attached items. Please delete the e-mail and all attachments, including any copies thereof, and inform the sender that you have deleted the e-mail, all attachments and any copies thereof. Thank you.

From: Vic (LKKAUTO)
Sent: Tuesday, 11 July, 2017 12:09 PM
To: ONG LI LI
Cc: MT_Claim_SG; Admin A; Asher Sng (LKKAUTO); Vic (LKKAUTO)

DEW chambers

ADVOCATES & SOLICITORS

UEN No.: 53319533X

Tel : +65 6908 0300
HP: +65 9422 0011
Fax: +65 6532 3013
Email : dewchambers@gmail.com.sg
Address :
Blk 51 #02-83 Chin Swee Road
Singapore 160051

In Association with T.H. Ho Law Chambers

Your Ref:

Our Ref: DC.RTA(PI).2016.8124

13 September 2018

BY FAX & POST

(Fax No.: 6256 4315)

For the kind attention of Vic

LKK Auto Consultant Pte Ltd

51 Ubi Avenue 1 #01-25

Paya Ubi Industrial Park


Singapore 408933

**ROAD TRAFFIC ACCIDENT INVOLVING WSK383, SGW2489G, SJN2244H AND
SJH3842J ALONG ROAD 1 PAN ISLAND EXPRESSWAY ON 25/11/2016 @
20:40HRS – PURCHASE OF SURVEY REPORT**

Dear Sirs,

1. We refer to the above matter.
2. We act for Mr Yap Sern Shen, the driver of WSK383 who was involved in the above-captioned accident.
3. As per the conversation between your good self and our Ms Cindy on 12 September 2018, we will be obliged if you could let us have a copy of the Survey Report conducted by your company.
4. We enclose herewith the cheque for the sum of S\$374.50 issued in favour of "LKK Auto Consultant Pte Ltd" for your attention.
5. Please do not hesitate to contact us if you have any queries.
6. Thank you.

Yours faithfully,

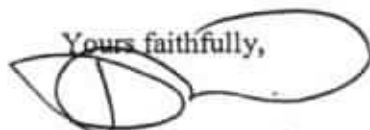

DEW CHAMBERS

(Dew Wong)

Enc.



OCBC PAYA LEBAR SQUARE BRANCH

13 SEP 2018

Date | D | M | Y

Pay LKK Auto Consultant Pte Ltd


SGD 374.50*

Singapore Dollars

or ~~Banker~~

S\$

DEW CHAMBERS

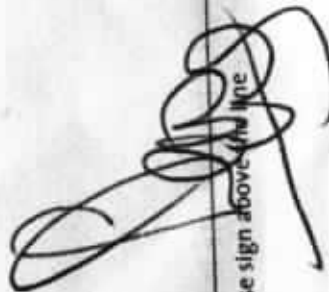
Please sign above the line

| Cheque No. | Bank No. | Account No.

1:611461233117333900525181475200111

**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD
300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC1708694
INV Date 27/07/2017
Reference CC6/LPC16022818/Aha3q2
Code LPC2

**PROFESSIONAL SERVICE FEE**

Vehicle No. WSK 383
Insured Veh. SJN 2244H
Claim No. 16/16/16/VP00/019477
Policy No. Z/16/VP00/097496
Accident Date 25/11/2016
Inspection Date 29/11/2016

Description	Total
Survey Inspection	350.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	350.00
GST (7%)	24.50
Grand Total	374.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd

HYN

DEW chambers

ADVOCATES & SOLICITORS

UEN No.: 53319533X

Tel: +65 6908 0300
HP: +65 9422 0011
Fax: +65 6532 3013
Email: dewchambers@gmail.com.sg
Address:
Blk 51 #02-83 Chin Swee Road
Singapore 160051

In Association with T.H. Ho Law Chambers

Vic

Your Ref:

Our Ref: DC.RTA(PI).2016.8124

23 October 2018

BY FAX & POST

(Fax No.: 6256 4315)

For the kind attention of Vic

LKK Auto Consultant Pte Ltd

51 Ubi Avenue 1 #01-25

Paya Ubi Industrial Park


Singapore 408933

Dear Sirs,

**ROAD TRAFFIC ACCIDENT INVOLVING WSK383, SGW2489G, SJN2244H AND
SJH3842J ALONG ROAD 1 PAN ISLAND EXPRESSWAY ON 25/11/2016 @
20:40HRS – PURCHASE OF SURVEY REPORT**

1. We refer to the above matter and to our letter dated 13 September 2018.
2. To-date, we have not received a copy of the Survey Report for the above matter.
3. As this matter has been outstanding for a long time, we would be grateful if you could revert to us with the said report expeditiously.
4. Thank you.

Yours faithfully,

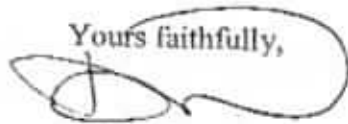

DEW CHAMBERS

(Dew Wong)

DEW chambers

ADVOCATES & SOLICITORS

UEN No.: 53319533X

Tel : +65 6908 0300
HP: +65 9422 0011
Fax: +65 6532 3013
Email : dewchambers@gmail.com.sg ✓
Address :
Blk 51 #02-83 Chin Swee Road
Singapore 160051

In Association with T.H. Ho Law Chambers

Your Ref:

Our Ref: DC.RTA(PI).2016.8124

23 October 2018

BY FAX & POST

(Fax No.: 6256 4315)

For the kind attention of Vic

LKK Auto Consultant Pte Ltd

51 Ubi Avenue 1 #01-25

Paya Ubi Industrial Park

Singapore 408933

Dear Sirs,

**ROAD TRAFFIC ACCIDENT INVOLVING WSK383, SGW2489G, SJN2244H AND
SJH3842J ALONG ROAD 1 PAN ISLAND EXPRESSWAY ON 25/11/2016 @
20:40HRS – PURCHASE OF SURVEY REPORT**

1. We refer to the above matter and to our letter dated 13 September 2018.
2. To-date, we have not received a copy of the Survey Report for the above matter.
3. As this matter has been outstanding for a long time, we would be grateful if you could revert to us with the said report expeditiously.
4. Thank you.

Yours faithfully,

DEW CHAMBERS

(Dew Wong)



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

LONPAC INSURANCE BHD

Ref : CC6/LPC16022818/Aha3q2

300 BEACH ROAD
#17-04/07 THE CONCOURSE SINGAPORE
199555

Date : 27-07-2017



Code : LPC2

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SJN 2244H	Veh. Inspected	WSK 383
Policy No.	Z/16/VP00/097496	Coverage (\$)	0.00
Claim No.	16/16/16/VP00/019477	Excess (\$)	0.00
Assign From		Assign Date	29/11/2016

2. Vehicle Particulars & Condition

Make & Model	AUDI A4	c.c	1984
Engine No.	HIDDEN	Year of Reg.	2006
Chassis No.	WAUZZZ8E56A261898	Colour	BLACK
Odometer	195085	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	235/40 R18	PIRELLI	6 mm
L/H Front Tyre	235/40 R18	PIRELLI	6 mm
R/H Rear Tyre	235/40 R18	PIRELLI	6 mm
L/H Rear Tyre	235/40 R18	PIRELLI	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE FRONT AND REAR PORTION. DAMAGES SEE DETAILS.
--

5. General Information

Accident Date	25/11/2016	Inspection Date	29/11/2016
Survey held at	HUA MENG SPRAY PAINTING WKSP 1 KAKI BUKIT AVE 6 #01-61 AUTOBAY SINGAPORE 417863		

5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	11 Working Days
-------------------------------------	-----------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199507198R GST Reg. No. 19-9607198-R

Page No.: 1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. WSK 383

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	REAR BOOT LID	BUCKLED	2,716.35	2,716.35
2	REAR BOOT LID HINGES @\$157.95	NOT NECESSARY	315.90	-
1	REAR BOOT LID UPPER LOCK	DAMAGED	220.35	220.35
1	REAR BOOT LID LOWER LOCK	NOT NECESSARY	37.05	-
1	REAR BOOT LID CABLE	NOT NECESSARY	37.30	-
1	REAR BOOT LID CENTRE LOGO	NECESSARY	81.90	81.90
2	REAR BOOT LID SHOCK ABSORBER @\$108.00	NOT NECESSARY	216.00	-
1	REAR BOOT LID INSULATION	NOT NECESSARY	165.75	-
2	REAR BOOT LID REFLECTOR @\$60.45	NOT NECESSARY	120.90	-
1	REAR BOOT LID MTM EMBLEM	NECESSARY	64.35	64.35
1	REAR BUMPER	DEFORMED	1,316.25	1,316.25
2	REAR BUMPER SIDE HOLDER @\$97.50	NECESSARY	195.00	195.00
1	REAR BUMPER REINFORCEMENT	BENT	374.40	374.40
1	REAR BUMPER SPONGE	NOT NECESSARY	88.00	-
2	REAR BUMPER BRACKET @\$27.30	BENT	54.60	54.60
1	REAR BUMPER LOWER LIP	DEFORMED	165.75	165.75
4	REAR BUMPER REVERSE SENSOR @\$220.35	DAMAGED (2PCS ONLY)	881.40	440.70
1	SET REAR BUMPER CLIPS	NECESSARY	128.70	30.00
1	REAR BUMPER TOP CENTRE MOULDING	NECESSARY	134.55	134.55
2	REAR LAMP @\$234.00	NOT NECESSARY	468.00	-
2	REAR LAMP HOUSING @\$288.00	NOT NECESSARY	576.00	-
1	REAR EXHAUST PIPE	BENT	1,125.15	1,125.15
1	REAR EXHAUST PIPE CHROME	BENT	183.30	183.30
1	REAR EXHAUST PIPE MOUNTING	NOT NECESSARY	56.55	-
1	REAR BOOT LID WEATHER STRIP	NOT NECESSARY	144.30	-
1	REAR END PANEL	TO REPAIR SEE LABOUR	216.45	-
1	REAR END PANEL TOP GARNISH	CRACKED	80.55	80.55
1	REAR RH FENDER INNER AIR VENT	NOT NECESSARY	526.50	-

Report Ref No. CC6/LPC16022818/Aha3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6266 3561 FAX: 6266 4315

Reg. No: 199607198R GST Reg. No: 19-9607198-R

Page No: 2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR SPARE TYRE TOP BOARD	TORN	489.45	489.45
1	REAR RH FENDER INNER TRIM	NOT NECESSARY	187.20	-
1	FRONT BONNET	DISTORTED	1,181.70	1,181.70
1	FRONT BONNET CABLE	NOT NECESSARY	37.05	-
1	FRONT BONNET INNER LOCK	DAMAGED	115.05	115.05
1	FRONT BONNET INNER LOCK HANDLE	NOT NECESSARY	105.30	-
2	FRONT BONNET HINGES @\$56.55	NOT NECESSARY	113.10	-
1	FRONT BONNET INNER RUBBER	NOT NECESSARY	78.00	-
1	FRONT BONNET INSULATION	NOT NECESSARY	206.70	-
1	FRONT BONNET SHOCK ABSORBER	NOT NECESSARY	87.75	-
1	FRONT SUPPORT PANEL	CRACKED	819.00	819.00
1	FRONT GRILLE)	CRACKED	254.35	254.35
1	FRONT GRILLE LOGO)	NECESSARY	-	-
2	FRONT HEAD LAMP @\$1569.75	CUT	3,139.50	3,139.50
1	FRONT BUMPER	DEFORMED	1,242.15	1,242.15
2	FRONT BUMPER SIDE HOLDER @\$142.35	NECESSARY	142.35	142.35
1	FRONT BUMPER REINFORCEMENT	BENT	536.25	536.25
2	FRONT BUMPER BRACKET @\$27.30	DAMAGED	54.60	54.60
2	FRONT BUMPER SHOCK ABSORBER @\$46.80	NOT NECESSARY	93.60	-
2	FRONT BUMPER FOG LAMP @\$259.35	NOT NECESSARY	518.70	-
2	FRONT BUMPER FOG LAMP GARNISH @\$87.75	NOT NECESSARY	175.50	-
2	FRONT BUMPER INNER SIDE GARNISH @\$101.4	DEFORMED	202.80	202.80
2	SET FRONT BUMPER INNER CLIPS @\$40.00	NECESSARY	80.00	30.00
1	AIR CON CONDENSER	BENT	700.10	700.10
2	AIR CON CONDENSER SIDE GARNISH @\$208.00	NOT NECESSARY	416.00	-
1	RADIATOR	BENT	664.95	664.95
1	RADIATOR FAN ASSY	DAMAGED	1,115.40	1,115.40
1	RADIATOR FAN COWLING	NOT NECESSARY	600.60	-
	LESS 5% DISCOUNT		-	-893.54
			24,048.45	16,977.31
	<u>SPECIAL NETT ITEMS</u>			
1	REAR NUMBER PLATE (SN)	NOT NECESSARY	50.00	-

Report Ref No. CC6/LPC16022818/Aha3q2

**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3661 FAX: 6256 4315

Reg. No: 199507198R GST Reg. No. 19-9607198-R

Page No.: 3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT NUMBER PLATE (SN)	MISSING	50.00	50.00
			100.00	50.00
	LABOUR			
	TO SUPPLY REAR END PANEL INNER SEALANT.	NOT NECESSARY	200.00	-
	REMOVE & REINSTALL AIR CON FILL IN GAS.		150.00	120.00
	REMOVE & REINSTALL REVERSE SENSOR.		150.00	60.00
	REMOVE & REINSTALL EXHAUST PIPE.		250.00	120.00
	REMOVE & REINSTALL BOOT LID INNER GARNISH.		150.00	50.00
	REMOVE, REPLACE & REPAIR CONSISTENT TO THE ACCIDENT INCLUSIVE OF THE REPAIR OF REAR END PANEL.		2,500.00	1,700.00
	RESPRAY PAINTING.		2,000.00	1,400.00
	TUFF KOTE.		150.00	80.00
	TO CHECK WIRING.		80.00	60.00
GRAND TOTAL			29,778.45	20,617.31
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE - ACCIDENT CONDITION)				16,500.00

Report Ref No. CC6/LPC16022818/Aha3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES: This Report is made solely for the use and benefit of the Client named on the front page of this Report.No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD			Ref : CC6/LPC16022818/Aha3q2	
300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555			Date : 27-07-2017	
			Code : LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SJN 2244H	Veh. Inspected	WSK 383	
Policy No.	Z/16/VP00/097496	Coverage (\$)	0.00	
Claim No.	16/16/16/VP00/019477	Excess (\$)	0.00	
Assign From		Assign Date	29/11/2016	
2. Vehicle Particulars & Condition				
Make & Model	AUDI A4	c.c	1984	
Engine No.	HIDDEN	Year of Reg.	2006	
Chassis No.	WAUZZZ8E56A261898	Colour	BLACK	
Odometer	195085	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	235/40 R18	PIRELLI	6 mm	
L/H Front Tyre	235/40 R18	PIRELLI	6 mm	
R/H Rear Tyre	235/40 R18	PIRELLI	6 mm	
L/H Rear Tyre	235/40 R18	PIRELLI	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT AND REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	25/11/2016	Inspection Date	29/11/2016	
Survey held at	HUA MENG SPRAY PAINTING WKSP 1 KAKI BUKIT AVE 6 #01-61 AUTOBAY SINGAPORE 417883			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		11 Working Days		



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. WSK 383

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	REAR BOOT LID	BUCKLED	2,716.35	2,716.35
2	REAR BOOT LID HINGES @\$157.95	NOT NECESSARY	315.90	-
1	REAR BOOT LID UPPER LOCK	DAMAGED	220.35	220.35
1	REAR BOOT LID LOWER LOCK	NOT NECESSARY	37.05	-
1	REAR BOOT LID CABLE	NOT NECESSARY	37.30	-
1	REAR BOOT LID CENTRE LOGO	NECESSARY	81.90	81.90
2	REAR BOOT LID SHOCK ABSORBER @\$108.00	NOT NECESSARY	216.00	-
1	REAR BOOT LID INSULATION	NOT NECESSARY	165.75	-
2	REAR BOOT LID REFLECTOR @\$60.45	NOT NECESSARY	120.90	-
1	REAR BOOT LID MTM EMBLEM	NECESSARY	64.35	64.35
1	REAR BUMPER	DEFORMED	1,316.25	1,316.25
2	REAR BUMPER SIDE HOLDER @\$97.50	NECESSARY	195.00	195.00
1	REAR BUMPER REINFORCEMENT	BENT	374.40	374.40
1	REAR BUMPER SPONGE	NOT NECESSARY	88.00	-
2	REAR BUMPER BRACKET @\$27.30	BENT	54.60	54.60
1	REAR BUMPER LOWER LIP	DEFORMED	165.75	165.75
4	REAR BUMPER REVERSE SENSOR @\$220.35	DAMAGED (2PCS ONLY)	881.40	440.70
1	SET REAR BUMPER CLIPS	NECESSARY	128.70	30.00
1	REAR BUMPER TOP CENTRE MOULDING	NECESSARY	134.55	134.55
2	REAR LAMP @\$234.00	NOT NECESSARY	468.00	-
2	REAR LAMP HOUSING @\$288.00	NOT NECESSARY	576.00	-
1	REAR EXHAUST PIPE	BENT	1,125.15	1,125.15
1	REAR EXHAUST PIPE CHROME	BENT	183.30	183.30
1	REAR EXHAUST PIPE MOUNTING	NOT NECESSARY	56.55	-
1	REAR BOOT LID WEATHER STRIP	NOT NECESSARY	144.30	-
1	REAR END PANEL	TO REPAIR SEE LABOUR	216.45	-
1	REAR END PANEL TOP GARNISH	CRACKED	80.55	80.55
1	REAR RH FENDER INNER AIR VENT	NOT NECESSARY	526.50	-
1	REAR SPARE TYRE TOP BOARD	TORN	489.45	489.45

Report Ref No. CC6/LPC16022818/Aha3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR RH FENDER INNER TRIM	NOT NECESSARY	187.20	-
1	FRONT BONNET	DISTORTED	1,181.70	1,181.70
1	FRONT BONNET CABLE	NOT NECESSARY	37.05	-
1	FRONT BONNET INNER LOCK	DAMAGED	115.05	115.05
1	FRONT BONNET INNER LOCK HANDLE	NOT NECESSARY	105.30	-
2	FRONT BONNET HINGES @\$56.55	NOT NECESSARY	113.10	-
1	FRONT BONNET INNER RUBBER	NOT NECESSARY	78.00	-
1	FRONT BONNET INSULATION	NOT NECESSARY	206.70	-
1	FRONT BONNET SHOCK ABSORBER	NOT NECESSARY	87.75	-
1	FRONT SUPPORT PANEL	CRACKED	819.00	819.00
1	FRONT GRILLE)	CRACKED	254.35	254.35
1	FRONT GRILLE LOGO)	NECESSARY	-	-
2	FRONT HEAD LAMP @\$1569.75	CUT	3,139.50	3,139.50
1	FRONT BUMPER	DEFORMED	1,242.15	1,242.15
2	FRONT BUMPER SIDE HOLDER @\$142.35	NECESSARY	142.35	142.35
1	FRONT BUMPER REINFORCEMENT	BENT	536.25	536.25
2	FRONT BUMPER BRACKET @\$27.30	DAMAGED	54.60	54.60
2	FRONT BUMPER SHOCK ABSORBER @\$46.80	NOT NECESSARY	93.60	-
2	FRONT BUMPER FOG LAMP @\$259.35	NOT NECESSARY	518.70	-
2	FRONT BUMPER FOG LAMP GARNISH @\$87.75	NOT NECESSARY	175.50	-
2	FRONT BUMPER INNER SIDE GARNISH @\$101.4	DEFORMED	202.80	202.80
2	SET FRONT BUMPER INNER CLIPS @\$40.00	NECESSARY	80.00	30.00
1	AIR CON CONDENSER	BENT	700.10	700.10
2	AIR CON CONDENSER SIDE GARNISH @\$208.00	NOT NECESSARY	416.00	-
1	RADIATOR	BENT	664.95	664.95
1	RADIATOR FAN ASSY	DAMAGED	1,115.40	1,115.40
1	RADIATOR FAN COWLING	NOT NECESSARY	600.60	-
	LESS 5% DISCOUNT		-	-893.54
			24,048.45	16,977.31
	SPECIAL NETT ITEMS			
1	REAR NUMBER PLATE (SN)	NOT NECESSARY	50.00	-



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT NUMBER PLATE (SN)	MISSING	50.00	50.00
			100.00	50.00
	LABOUR			
	TO SUPPLY REAR END PANEL INNER SEALANT.	NOT NECESSARY	200.00	-
	REMOVE & REINSTALL AIR CON FILL IN GAS.		150.00	120.00
	REMOVE & REINSTALL REVERSE SENSOR.		150.00	60.00
	REMOVE & REINSTALL EXHAUST PIPE.		250.00	120.00
	REMOVE & REINSTALL BOOT LID INNER GARNISH.		150.00	50.00
	REMOVE, REPLACE & REPAIR CONSISTENT TO THE ACCIDENT.INCLUSIVE OF THE REPAIR OF REAR END PANEL.		2,500.00	1,700.00
	RESPRAY PAINTING.		2,000.00	1,400.00
	TUFF KOTE.		150.00	80.00
	TO CHECK WIRING.		80.00	60.00
			5,630.00	3,590.00
GRAND TOTAL			29,778.45	20,617.31
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE - ACCIDENT CONDITION)				16,500.00

Report Ref No. CC6/LPC16022818/Aha3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.