

ASS. REC. BY:

REF: CS/CTI18018415/Rlv d3/

Special Instruction:

SURVEYOR

MUNIM

ASSIGNMENT (Office)

From (Person): Irene Tay of CTI Date/Time: 10/10/18 @ 4:08pm

Estimated Cost: Bill to:

OD ~~TP~~ WS/TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No: SJN 7799R Insured: GR 7316R

at Workshop m/s: Eng Ah Tee Tel: 6268 6183

of Blk 3, Pioneer Rd North #01-18

Policy No: DMCVSN3055561804 Claim No: 8NM18D04760C02

Sum Insured: Excess:

Make of Veh: D.O.A. 02/10/2018
(Client's Record)

CA / REV / REP. / REV 24 HRS 1up 12-11-2018 @ before 1pm H.O.D. Endorsement:

Date/Time: 5:01pm @ 10/10/18 Person Contacted: Joyce Vehicle: IN ~~OUT~~

Date/Time	Action/Instruction (✓) Estimate
	SJN 7799R - CS/CTI18005853/Grb DOA: 23/3/18
	GR 7316R - NA/CTI18017958/24 DOA: 2/10/18
11/10/18-	VMI YET
2/11/18-	VMI YET (Jmll)
21/12/18	LS \$ 2900 confirmed by email (Recd 1400.17, 33/9)

Merimen

REF: CTL

26426

ASSIGNMENT

From:
 Date: 12.11.2018
 Estimated Cost:
 OD / TP / WS / TP RES / OD RES / EVA / INV / MV
 To inspect Vehicle No: SIN 7799R
 at Workshop m/s: Sng Ah Tee Motor
 of: Blk 3 Pioneer Rd North #01-18
 Insured:
 Policy No:
 Claims No:
 Sum Insured:
 Excess:
 (Client's Record)
 Make of Veh:

before 1pm

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value: 20K
 IDAC Accident Rpt: Consistent? Yes or No
 GIA / PR Seen: Consistent? Yes or No
 Est. Repairs: days Res: Yes or No
 Lump Sum: % 3 Val: Yes or No

CA / REV / REP. / 24 HRS WPI

Date: Person Contacted:

Vehicle: IN / OUT

Veh No: SIN 7799R Yr Regd: 2009 FEB
 Type: ☒ M. Car / ☐ M. Cycle / ☐ Bus / ☐ Van / ☐ Lorry / ☐ Taxi / ☐ Prime Mover /
 Truck / Trailer or
 Make: Peugeot 308 1.6A CC: 1598
 Colour: BLACK A/C: Insured / Std / NI / NA
 Sp Reading: 158254 T/Ratio: Insured / Std / NI / NA
 Eng/No:
 C/No: VF34CFE55386710
 Gen. Cond: Good / ☒ Fair / ☐ Poor / ☐ Burnt
 Steering: ☒ Order / ☐ Jammed / ☐ Leaked / ☐ Burnt or
 Brake: ☒ Order / ☐ Jammed / ☐ Leaked / ☐ Burnt or
 Modi: Nil / ☒ Rrim / ☐ STD A/Rim or
 Tyre Size: F: 225/45 R17
 R: -

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
 TOYO / YOKO or

Continental

Front:
 R/Bal: 6 mm
 L/Bal: 6 mm
 D.O.A: 02/10/18
 Rear:
 R/Bal: 6 mm
 L/Bal: 6 mm
 D.O.A: 12/11/18

Survey held at: SNG AH TEE

Des. of Damages: Frt / ☒ Rear / ☐ O/S / ☐ N/S / ☐ U/C / ☐ Rooftop or

The UIC / Chassis frame / Body Structure affected due to collision

Date / Time Action / Instruction

13/11/18 Inform workshop to give 8mm air rec repair (cost 8k). 8he actual

RECEIVED 24 DEC 2018

Date/Time, File Pass to? ☐ Prell. Report

1) ☐ Final Report

Date/Time, File Return to?

2) 24/12 - typist

Report Format: merimen

Lump Sum / L.B.L: 2900/-

Days Of Repair: 5

Resurvey No. of Trip: 1

Add Fee: ☐ Site Insp \$

☐ Interview \$

☐ Tech. Insp \$

☐ Weekend \$

Survey Fee:

Transportation

1. S + R. \$

2. Photos

3. Draw

10%

700

220

...CLAIM SUBFOLDER...(New Assignment)

CLAIM SUBFOLDER TRACKING

Case	Submitted	Est. Submitted	#3 Assigned	Adj. Rpt	Adj. Submitted	Est. Rpt Due	Status
Main	09 Oct 2018 Sendback Est	09 Oct 2018 11:15 \$4,300.17	10 Oct 2018 16:08 Assign				New Assignment Cancel Case

Main	Reference	Claim Details	Documents	Show All
----------------------	---------------------------	-------------------------------	---------------------------	--------------------------

CLAIM SUBFOLDER DETAILS

Insured:	POLY NDT (PTE) LTD , Co. Reg. No.: 197501046D		
Main Claimant:	TEO YUET SHANG BRIDGET , ID: S76426428		
Vehicle Reg. No.:	SJN7799R	Date of Loss:	02/10/2018 09:00 - :59 [115 Months and 5 Days From LTA Reg Date (Man Yr)]
Claim Type:	TP / SNM18D04760C02	Policy/Cover Note No.:	DMCVSN3055561804
Vehicle Reg. No. (Insured):	GR7316R	Policy No. (Claimant):	DMPCSN3084451700
		Excess:	\$0.00
Repairer:	Sng Ah Tee Motor & Panel Service Pte Ltd (Pioneer) Blk 3 Pioneer Road North, #01-18, 628457 Pioneer - Tel: 6268 6183		
Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd. (HQ) - Tel: 6389 6111 ... [Handled by Irene Tay Hui Ping - 638986192]		
Claimant's Insurer:	China Taiping Insurance (Singapore) Pte. Ltd. (HQ) - Tel: 6389 6111		
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Final Rpt due 19/10/2018]		
Adj. Asg. Remarks:	EST \$4601.18, CASE WITH SJE.		

ASSOCIATED MAIL RECEIVED

[View All](#) [Compose Case Mail](#)

There are no mail for this case.

ALL ASSOCIATED TASKS

[View All](#) [Search Tasks](#) [Create New Task](#) [Complete](#)

Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type: Singapore NRIC
Owner ID: 2642B

Vehicle Details

Vehicle No.: SJN7799R
Vehicle to be Exported: No
Intended Deregistration Date: 03 Nov 2018
Vehicle Make: PEUGEOT
Vehicle Model: 308 1.6 A TURBO GLASS ROOF
Primary Colour: Black
Manufacturing Year: 2008
Engine No.: 10FJAV0438564
Chassis No.: VF34C5FTF55386710
Maximum Power Output: 103.0 kW (138 bhp)
Open Market Value: \$22,107.00
Original Registration Date: 27 Feb 2009
First Registration Date: 27 Feb 2009
Transfer Count: 1
Actual ARF Paid: \$22,107.00

Intended PARF Rebate Details

PARF Eligibility: Yes
PARF Eligibility Expiry Date: 26 Feb 2019
PARF Rebate Amount: \$11,053.00

Intended COE Rebate Details

COE Expiry Date: 26 Feb 2019
COE Category: A - Car (1600cc & below)
COE Period(Years): 10
QP Paid: \$4,460.00
COE Rebate Amount: \$142.00
Total Rebate Amount: \$11,195.00

The information contained herein is correct as at 03 Oct 2018

OK

20,000
11,195

8,805

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	02/10/2018 12:09
Date Of Accident	02/10/2018 09:00
Exact Location Of Accident	JUNCTION OF PIONEER SECTOR 1 & PIONEER RD
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SJN7799R
Insured/Policyholder	
Name Of Registered Owner	TEO YUET SHANG BRIDGET
NRIC No	S7642642B
Email Address	GODISGOOD_BRIDGET@YAHOO.COM
Mobile Phone No	(LOCAL) +65-90705275
Alternative Phone No	OFFICE-NOPHONE

Vehicle Particulars

Manufacturer	PEUGEOT
Model	308 1.6 A TURBO GLASS ROOF
Exact Purpose for which vehicle was being used at time of accident	
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	PRIVATE CAR

Insurance Company

Name of Insurance Company	CHINA TAIPING INSURANCE (SINGAPORE) PTE. LTD.
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	DMPCSN3084451700
Cover Note Number	

Driver

Name of Driver	TEO YUET SHANG BRIDGET
NRIC No	S7642642B
Date Of Birth	29/12/1976
Occupation	INDOOR
Date Of Driving Pass	13/12/1996
Driving Experience	21 YEARS AND 9 MONTHS
Gender	FEMALE
Mobile Number	(LOCAL) +65-90705275
Fax Number	
Contact Number	OFFICE-NOPHONE
Email Address	GODISGOOD_BRIDGET@YAHOO.COM

Address	BLK 3 DELTA AVE #05-20
Postcode	160003
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OWNER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	CHAIN COLLISION
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles involved in the accident	
Was any body injured in the Accident?	YES
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

ON 02/10/2018 AT ABOUT 0900 HRS. WHILE MY VEHICLE IS STATIONARY AT PIONEER SECTOR 1 WAITING FOR THE TRAFFIC LIGHT. SUDDENLY I FEEL AN IMPACT FROM MY REAR. I NOTICED THAT REAR OF MY VEHICLE HAD HIT BY VEHICLE B . VEHICLE C HIT ONTO VEHICLE B AND CAUSED BY THE IMPACT ,VEHICLE B MOVE IN FRONT AND HIT ONTO MY VEHICLE .

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	GR7316R
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	COMMERCIAL VEHICLE
Name of Driver	RAJENDRAN BALAMURUGAN
NRIC/Passport Number	G7822005G
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

DETAILS OF OTHER VEHICLE PROPERTY 2

Vehicle Registration Number	XD9297X
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	COMMERCIAL VEHICLE
Name of Driver	GURSHARAN SINGH S/O KARMJIT SINGH
NRIC/Passport Number	S8838025H
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

DETAILS OF INJURED PERSON 1

Name	TEO YUET SHANG BRIDGET
Approximate Age	
Injuries Sustain	
Injured person in which vehicle?	SJN7799R
Were seat belts worn?	
Was this injured conveyed to hospital by ambulance?	
Address	
Postcode	

SKETCH PLAN**IMPORTANT NOTICE**

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "insurers"), the insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.

Policyholder's Signature

Date & Time: 2/12/18

Driver's Signature

(If driver is not the policyholder)

Date & Time:

Reporting Centre Personnel's Signature

Name:

NRIC/FIN No.:

I AM AWARE THAT MY INSURER MAY HAVE A **14 DAYS TIMEFRAME** FOR ME TO SUBMIT AN OWN DAMAGE CLAIM UNDER MY OWN POLICY. I WILL CHECK MY POLICY FOR MORE DETAILS.

SKETCH PLAN



A-SJN7799R
B-GR7316R
C-XD9297X

Pioneer Sector 1

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

Refer to circumstances

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

☐ Claims own policy
☒ Claim third party
☐ Claim OD / TP at other works hop
☐ For record purpose
Policy No. DMPC SN3084451700
Insurer Chia 9 Veh.No. SJN7799R

**SNG AH TEE MOTOR &
PANEL SERVICE PTE LTD
3 PIONEER ROAD NORTH
#01-18
SINGAPORE 628457**

Claim Reference:
Assessment Number: DS000568
Version: SNGAHTEE/1
Date Calculated: 09/10/2018 04:05

Full Report - V1
Registration: SJN7799R
Printed: 09/10/2018 11:05

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	SNG AH TEE	Date of Incident:	02/10/2018
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	China Taiping Insurance (S) Pt	Repairs Authorised:	TBA
Claim Reference:		Estimated Repair Time:	
Policy Number:	-	Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:	True	Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	PEUGEOT
Model:	308
Sub Model:	BASE MODEL
Model Sheet Number:	B48 01
Registration:	SJN7799R
Registration Month:	
Registration Year:	
VIN Number:	VF34C5FTF55386710
Odometer:	Not Known
Colour:	
Engine Number:	
Fuel Level:	%

Model Specs

FROM 11/2008	AUTO AIR CON
REAR STABILISER 28MM	DR/SEAT LUMBAR SUPP
BOOT PARTITION NET	FRT/RR ELECT WINDOWS
ELEC CHILD LOCKING	ELECT FOLDING MIRROR
ACOUSTICS IMPROVED	RADIO SYSTEM RD4 MP3
S-WHEEL RADIO CONT	RECEPTION IMPROVED
BI-TUNER	FOG LAMPS
PASS SEAT LUMBAR SUP	CLOTH TRIM
HEIGHT ADJ PASS SEAT	TRAY WITH LID
LEATHER STRG WHEEL	RAIN SENSOR
EQUIP LINE BLACK	FRONT CENTRE ARMREST
S/BELT W/WARNING DEV	AIR SUCTION 2 PIECES
OUT FUEL FILTER	REAR CENTRE ARMREST
INNER MIRROR/SENSOR	1.6 LTR 103KW
AUTO GEARBOX AL4	HOUSING PREHEATING
TYRES 225/45 WR 17	WHEELS 7.5J X 17 ALU
ALTERNATOR 150 AMP	SPARE WHEEL ALLOY
STABILITY PROGRAM	EMISSION STD EURO 4
HEAD AIRBAG	FRONT SIDE AIRBAG
PANORAMA SUNROOF	PREPARE OFF VEHICLE

Vehicle Condition

Vehicle Status

Pre-Accident Condition:	Severity of Impact:
Steering:	Vehicle Status on
	Inspection:
Brakes Pedal Travel:	Date of Inspection:
Place of Inspection:	05/10/2018
Pre-Accident Damage:	

Tyres Condition:

SNG AH TEE MOTOR & PANEL SERVICE PTE LTD

Claim Reference:

Assessment Number: DS000568

Version: SNGAHTEE/1

Date Calculated: 09/10/2018 04:05



Full Report - V1

Registration: SJN7799R

Printed: 09/10/2018 11:05

Tread Depth LHF:
Tread Depth LHR:
Damage Areas:

Tread Depth RHF:
Tread Depth RHR:
Direction of Impact:

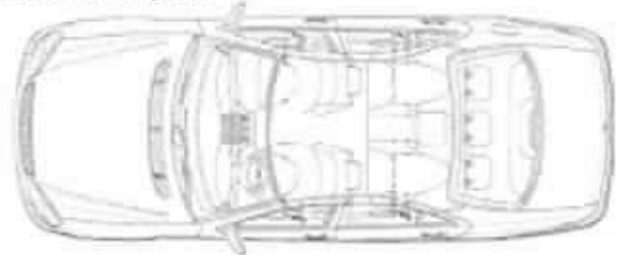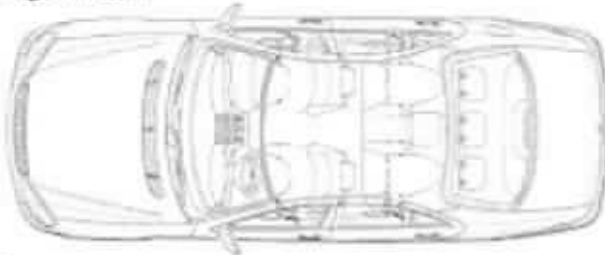

Addresses

Cost Summary

Total Labour	\$810.60
Total Paint/Material	\$181.57
Total Parts	\$3,023.00
Total of Additional Costs	\$285.00
Excess:	TBA
Grand Total Exc GST:	\$4,300.17
7 % GST:	\$301.01
Grand Total Inc GST:	\$4,601.18

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$42.00/HR
Price/Dent = \$0.00/HR

Repair /

Guide Number Repair Details

Guide Number	Repair Details	WU	Cost Price (\$)
72.315A)	RENEW COMPLETE REAR PANEL INCLUDES: R + R REAR BUMPER, TAILLAMPS, REAR STRIKER PIN AND ALL NECESSARY TRIMS	74.0	310.80
74.005A)	RENEW REAR BUMPER	4.0	16.80
74.005J	R + R REAR BUMPER PROTECTIVE MOULDINGS	2.0	8.40
87.001A	R + R TAILGATE	12.0	50.40
87.010A)	RENEW TAILGATE (REMOVED)	7.0	29.40
87.010G	R + R TAILGATE REAR SCREEN	7.0	29.40

LABOUR COST

Total Work Units	106.0	
Corrosion Protection External Labour	0.0HRS	0.00
Corrosion Protection Internal Labour	0.0HRS	0.00
Sub Total	10.6HRS	\$445.20
Paint Labour	8.7HRS	\$365.40
Total Labour	19.3HRS	\$810.60

PAINT WORK

Time Basis 10 WU = 1 HR. Price = \$42.00/HR

Guide Number Description

Guide Number	Description	WU	Cost Price (\$)
	- PREPARE OFF VEHICLE		
2711	REAR PANEL CPL NEW PART PAINTING	22.0	
2931	BOOTLID/TAILGATE NEW PART PAINTING	15.0	
2581	REAR BUMPER NEW PART PAINT K1R	14.0	
2613	L/R BUMPER MOULDING NEW PART PAINT K1R	3.0	
2614	R/R BUMPER MOULDING NEW PART PAINT K1R	3.0	

SNG AH TEE MOTOR & PANEL SERVICE PTE LTD

Claim Reference:

Assessment Number: DS000568

Version: SNGAHTEE/1

Date Calculated: 09/10/2018 04:05

Full Report - V1

Registration: SJN7799R

Printed: 09/10/2018 11:05

LABOUR COST - PAINT

TIME(PAINT)

57.0

Preparation Main Work Plastic

5.0

Preparation Main Work Metal

25.0

Preparation Work Multi Layer Paint

0.0

Total Work Units (10WU/HR)

87.0

Total Paintwork Labour

8.7HRS

\$365.40

MATERIAL COST - PAINT

Cost Price

New Part Painting

\$68.20

New Part Painting - Plastic K1R

\$75.77

Material-Constant Main Work Metal

\$28.60

Material-Const Main Work Plastic

\$9.00

Total Excluding Pearlescent Uplift

\$181.57

Pearlescent Uplift @ 0.0%

\$0.00

Total Paint Material Cost

\$181.57

PARTS

Price Valid: 01/01/2001

Guide No.	Qty	Description	Part Number	Supplier	Bet.	Price (\$)
2581	1	REAR BUMPER <i>Turn</i>	7410 EL		0%	400.00*
2613	1	L/R BUMPER MOULDING <i>X Repair</i>	7452 PQ	<i>X Svc</i>	0%	80.00*
2614	1	R/R BUMPER MOULDING <i>X</i>	7452 PR	<i>X Svc</i>	0%	80.00*
2640	1	REAR BUMPER C-MEMBER <i>TA</i>	7252 EH		0%	220.00*
2650	1	RR BUMPER CLAMP KIT <i>Free</i>	6999 HF		0%	0.00F
2702	1	REAR NUMBER PLATE <i>BT</i>	KNPL6		0%	0.00F
2711	1	REAR PANEL CPL <i>Repair</i>	16 105 800 80		0%	650.00*
2931	1	BOOTLID/TAILGATE <i>TA</i>	8701 Y3		0%	800.00*
2944	1	BOOT/TAILGATE SEAL <i>ne</i>	8707 G7		0%	120.00*
2977	1	BOOT/TAILGATE LOCK <i>X Svc</i>	8719 G7		0%	65.00*
3011	1	REAR BADGE <i>ne</i>	7810 S3		0%	30.00*
3013	1	BADGE PEUGEOT <i>ne</i>	8665 VF		0%	28.00*
3017	1	BADGE "308" <i>ne</i>	8665 VG		0%	30.00*
3160	1	REAR SCREEN BOND KIT <i>ne</i>	16 188 585 80		0%	0.00F
3281	1	L/R LAMP <i>inconsistent CR</i>	6350 CW	<i>X</i>	0%	150.00*
3282	1	R/R LAMP <i>X</i>	6351 CW		0%	150.00*
4986	1	REAR PANEL COVERING <i>X Svc</i>	7467 AB	<i>X</i>	0%	120.00*

f: OEM Parts

g: Original

h: Secondhand

p: Parallel

x: Exchange

Saving

Sub Total

Mark Up From Cost

(0 %)

Sundry Parts

(Fixed)

Total Parts

\$63.23

\$2,923.00

\$0.00

\$100.00

\$3,023.00

THIS ASSESSMENT CONTAINS UNPRICED PARTS

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description	Betterment	Price
REAR NUMBER PLATE SPECIALIST <i>TA</i>	0%	\$35.00
REVERSE SENSOR SPECIALIST <i>ne</i>		\$180.00
REAR SCREEN GUM SPECIALIST <i>ne</i>	0%	\$40.00
CHECK WIRING SPECIALIST <i>ne</i>		\$30.00
Total Extras		\$285.00

Final Calculation

Total Parts

\$3,023.00

Labour

SNG AH TEE MOTOR & PANEL SERVICE PTE LTD

Claim Reference:

Assessment Number: DS000568

Version: SNGAHTEE/1

Date Calculated: 09/10/2018 04:05

Full Report - V1

Registration: SJN7799R

Printed: 09/10/2018 11:05

Total Panel/Mechanical	\$445.20	
Total Paintwork	\$365.40	340.30
Total Labour		\$810.60
Additional Costs		
Corr Prot Materials External	\$0.00	
Corr Prot Materials Internal	\$0.00	
Cost of Specialist	\$285.00	
Total of Additional Costs		\$285.00
Total Paint/Material Costs		\$181.57
Grand Total Excludes GST		\$4,300.17
GST @ 7 %		\$301.01
Grand Total Includes GST		\$4,601.18

Assessment Notes

Panel
Hp 200000
5 days
4/5
12/11/18 @ 1350
Re my after print

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

**SNG AH TEE MOTOR &
PANEL SERVICE PTE LTD
3 PIONEER ROAD NORTH
#01-18
SINGAPORE 628457**

Repairer

Claim Reference:
Assessment Number: DS000568
Version: SNGAHTEE/4
Date Calculated: 19/12/2018 10:24

Full Report - V1
Registration: SJN7799R
Printed: 19/12/2018 18:26

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	SNG AH TEE	Date of Incident:	02/10/2018
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	China Taiping Insurance (S) Pt	Repairs Authorised:	TBA
Claim Reference:		Estimated Repair Time:	
Policy Number:	-	Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:	True	Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	PEUGEOT
Model:	308
Sub Model:	BASE MODEL
Model Sheet Number:	B48 01
Registration:	SJN7799R
Registration Month:	
Registration Year:	
VIN Number:	VF34C5FTF55386710
Odometer:	Not Known
Colour:	
Engine Number:	
Fuel Level:	%

Model Specs

FROM 11/2008	AUTO AIR CON
REAR STABILISER 28MM	DR/SEAT LUMBAR SUPP
BOOT PARTITION NET	FRT/RR ELECT WINDOWS
ELEC CHILD LOCKING	ELECT FOLDING MIRROR
ACOUSTICS IMPROVED	RADIO SYSTEM RD4 MP3
S-WHEEL RADIO CONT	RECEPTION IMPROVED
BI-TUNER	FOG LAMPS
PASS SEAT LUMBAR SUP	CLOTH TRIM
HEIGHT ADJ PASS SEAT	TRAY WITH LID
LEATHER STRG WHEEL	RAIN SENSOR
EQUIP LINE BLACK	FRONT CENTRE ARMREST
S/BELT W/WARNING DEV	AIR SUCTION 2 PIECES
OUT FUEL FILTER	REAR CENTRE ARMREST
INNER MIRROR/SENSOR	1.6 LTR 103KW
AUTO GEARBOX AL4	HOUSING PREHEATING
TYRES 225/45 WR 17	WHEELS 7.5J X 17 ALU
ALTERNATOR 150 AMP	SPARE WHEEL ALLOY
STABILITY PROGRAM	EMISSION STD EURO 4
HEAD AIRBAG	FRONT SIDE AIRBAG
PANORAMA SUNROOF	PREPARE OFF VEHICLE

Vehicle Condition

Vehicle Status

Pre-Accident Condition:	Severity of Impact:
Steering:	Vehicle Status on
	Inspection:
Brakes Pedal Travel:	Date of Inspection:
Place of Inspection:	05/10/2018
Pre-Accident Damage:	

SNG AH TEE MOTOR & PANEL SERVICE PTE LTD**Claim Reference:****Assessment Number: DS000568****Version: SNGAHTEE/4****Date Calculated: 19/12/2018 10:24****Full Report - V1****Registration: SJN7799R****Printed: 19/12/2018 18:26****Tyres Condition:**

Tread Depth LHF:



Tread Depth LHR:

Damage Areas:

Tread Depth RHF:

Tread Depth RHR:

Direction of Impact:

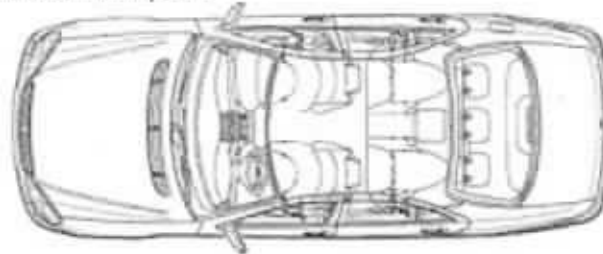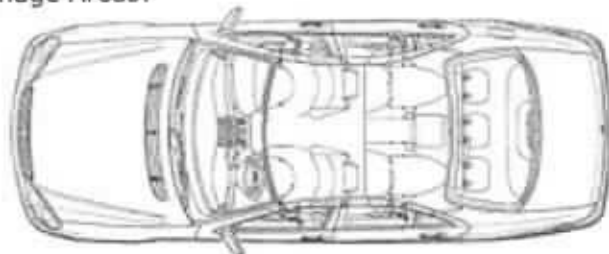**Addresses****Cost Summary**

Total Labour	\$919.80
Total Paint/Material	\$195.49
Total Parts	\$2,378.00
Total of Additional Costs	\$285.00
Repair Cost Exc GST:	\$3,778.29
Overall Discount (20%):	-\$755.66
Excess:	TBA
After Deduction -	
Grand Total Exc GST:	\$3,022.63
7 % GST:	\$211.58
Grand Total Inc GST:	\$3,234.21

Repair Information**LABOUR**

Time Basis 10 WU = 1 HR. Price/CL 1 = \$42.00/HR
Price/Dent = \$0.00/HR

Repair /**Guide Number Repair Details**

		WU	Cost Price (\$)
NO NUMBER	R + R LEFT REAR WHEELHOUSE SHELL	2.0	8.40
NO NUMBER	R + R RIGHT REAR WHEELHOUSE SHELL	2.0	8.40
72.315A)	RENEW COMPLETE REAR PANEL	74.0	310.80
	INCLUDES: R + R REAR BUMPER, TAILLAMPS, REAR STRIKER PIN AND ALL NECESSARY TRIMS		
74.005A)	RENEW REAR BUMPER	4.0	16.80
74.005J	R + R REAR BUMPER PROTECTIVE MOULDINGS	2.0	8.40
87.001A	R + R TAILGATE	12.0	50.40
87.010A)	RENEW TAILGATE (REMOVED)	7.0	29.40
87.010G	R + R TAILGATE REAR SCREEN	7.0	29.40
3489	REPAIR L/R WING	10.0*	42.00

LABOUR COST**Total Work Units****Corrosion Protection External Labour****Corrosion Protection Internal Labour****Sub Total****Paint Labour****Total Labour**

120.0

0.0HRS

0.00

0.0HRS

0.00

12.0HRS

\$504.00

9.9HRS

\$415.80

21.9HRS

\$919.80

SNG AH TEE MOTOR & PANEL SERVICE PTE LTD

Claim Reference:

Assessment Number: DS000568

Version: SNGAHTEE/4

Date Calculated: 19/12/2018 10:24

Full Report - V1

Registration: SJN7799R

Printed: 19/12/2018 18:26

PAINT WORK		Time Basis 10 WU = 1 HR. Price = \$42.00/HR	
Guide Number	Description	WU	Cost Price (\$)
	- PREPARE OFF VEHICLE		
2711	REAR PANEL CPL NEW PART PAINTING	22.0	
2931	BOOTLID/TAILGATE NEW PART PAINTING	15.0	
2581	REAR BUMPER NEW PART PAINT K1R	14.0	
3489	L/R WING REPAIR PAINTING <50%	12.0	
2613	L/R BUMPER MOULDING SURFACE PAINT PLAST.	3.0	
2614	R/R BUMPER MOULDING SURFACE PAINT PLAST.	3.0	
LABOUR COST - PAINT			
	TIME(PAINT)	69.0	
	Preparation Main Work Plastic	5.0	
	Preparation Main Work Metal	25.0	
	Preparation Work Multi Layer Paint	0.0	
	Total Work Units (10WU/HR)	99.0	
	Total Paintwork Labour	9.9HRS	\$415.80
MATERIAL COST - PAINT			
	Cost Price		
	New Part Painting		\$68.20
	New Part Painting - Plastic K1R		\$70.85
	Material-Constant Main Work Metal		\$28.60
	Surface Paint Plastic		\$3.66
	Repair Painting		\$15.18
	Material-Const Main Work Plastic		\$9.00
	Total Excluding Pearlescent Uplift		\$195.49
	Pearlescent Uplift @ 0.0%		\$0.00
	Total Paint Material Cost		\$195.49

PARTS

				Price Valid: 01/01/2001	
Guide No.	Qty	Description	Part Number	Supplier	Bet. Price (\$)
2581	1	REAR BUMPER	7410 EL		0% 400.00*
2640	1	REAR BUMPER C-MEMBER	7252 EH		0% 220.00*
2650	1	RR BUMPER CLAMP KIT	6999 HF		0% 0.00F
2702	1	REAR NUMBER PLATE	KNPL6		0% 0.00F
2711	1	REAR PANEL CPL	16 105 800 80		0% 650.00*
2931	1	BOOTLID/TAILGATE	8701 Y3		0% 800.00*
2944	1	BOOT/TAILGATE SEAL	8707 G7		0% 120.00*
3011	1	REAR BADGE	7810 S3		0% 30.00*
3013	1	BADGE PEUGEOT	8665 VF		0% 28.00*
3017	1	BADGE "308"	8665 VG		0% 30.00*
3160	1	REAR SCREEN BOND KIT	16 188 585 80		0% 0.00F
f: OEM Parts		Saving			\$63.23
g: Original		Sub Total			\$2,278.00
h: Secondhand		Mark Up From Cost		(0 %)	\$0.00
p: Parallel		Sundry Parts		(Fixed)	\$100.00
x: Exchange		Total Parts			\$2,378.00

THIS ASSESSMENT CONTAINS UNPRICED PARTS

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description	Betterment	Price
REAR NUMBER PLATE SPECIALIST	0%	\$35.00
REVERSE SENSOR SPECIALIST		\$180.00
REAR SCREEN GUM SPECIALIST	0%	\$40.00

SNG AH TEE MOTOR & PANEL SERVICE PTE LTD**Claim Reference:****Assessment Number: DS000568****Version: SNGAHTEE/4****Date Calculated: 19/12/2018 10:24****Full Report - Y1****Registration: SJN7799R****Printed: 19/12/2018 18:26**

CHECK WIRING

SPECIALIST

\$30.00

Total Extras**\$285.00****Final Calculation****Total Parts** **\$2,378.00****Labour**

Total Panel/Mechanical

\$504.00

Total Paintwork

\$415.80

Total Labour**\$919.80****Additional Costs**

Corr Prot Materials External

\$0.00

Corr Prot Materials Internal

\$0.00

Cost of Specialist

\$285.00

Total of Additional Costs**\$285.00****Total Paint/Material Costs****\$195.49****Repair Costs Excludes GST****\$3,778.29****Deductions**

Deduction (20.00 %) Before GST

-\$755.66

Deduction for Excess

TBA

Total Deductions**-\$755.66****Grand Total Excludes GST (After Deduction)****\$3,022.63**

GST @ 7 %

\$211.58**Grand Total Includes GST (After Deduction)****\$3,234.21****Assessment Notes**

51 Ubi Avenue 1, #01-25
Paya Ubi Industrial Park
Singapore
408933

Final/Seal

Claim Reference: SNM18D04760C02
Assessment Number: DS000568
Version: CHINATAI/2
Date Calculated: 21/12/2018 09:12

Full Report - V1
Registration: SJN7799R
Printed: 21/12/2018 17:12

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	LKK AUTO	Date of Incident:	02/10/2018
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	China Taiping Insurance (S) Pt	Repairs Authorised:	TBA
Claim Reference:	SNM18D04760C02	Estimated Repair Time:	
Policy Number:	-	Quote Due Date:	
Other Reference:	TPP CLAIM	Actual Repair Days:	
Third Party:	True	Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	PEUGEOT
Model:	308
Sub Model:	BASE MODEL
Model Sheet Number:	B48 01
Registration:	SJN7799R
Registration Month:	
Registration Year:	
VIN Number:	VF34C5FTF55386710
Odometer:	Not Known
Colour:	
Engine Number:	
Fuel Level:	%

Model Specs


FROM 11/2008	AUTO AIR CON
REAR STABILISER 28MM	DR/SEAT LUMBAR SUPP
BOOT PARTITION NET	FRT/RR ELECT WINDOWS
ELEC CHILD LOCKING	ELECT FOLDING MIRROR
ACOUSTICS IMPROVED	RADIO SYSTEM RD4 MP3
S-WHEEL RADIO CONT	RECEPTION IMPROVED
BI-TUNER	FOG LAMPS
PASS SEAT LUMBAR SUP	CLOTH TRIM
HEIGHT ADJ PASS SEAT	TRAY WITH LID
LEATHER STRG WHEEL	RAIN SENSOR
EQUIP LINE BLACK	FRONT CENTRE ARMREST
S/BELT W/WARNING DEV	AIR SUCTION 2 PIECES
OUT FUEL FILTER	REAR CENTRE ARMREST
INNER MIRROR/SENSOR	1.6 LTR 103KW
AUTO GEARBOX AL4	HOUSING PREHEATING
TYRES 225/45 WR 17	WHEELS 7.5J X 17 ALU
ALTERNATOR 150 AMP	SPARE WHEEL ALLOY
STABILITY PROGRAM	EMISSION STD EURO 4
HEAD AIRBAG	FRONT SIDE AIRBAG
PANORAMA SUNROOF	PREPARE OFF VEHICLE

Vehicle Condition


Vehicle Status

Pre-Accident Condition:	Severity of Impact:
Steering:	Vehicle Status on Inspection:
Brakes Pedal Travel:	Date of Inspection:
Place of Inspection:	05/10/2018
Pre-Accident Damage:	
Tyres Condition:	
Tread Depth LHF:	Tread Depth RHF:

Tread Depth LHR:
Damage Areas:

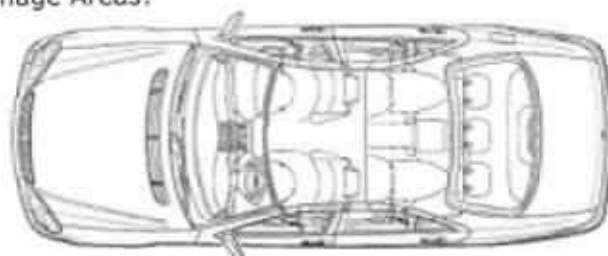

Tread Depth RHR:
Direction of Impact:

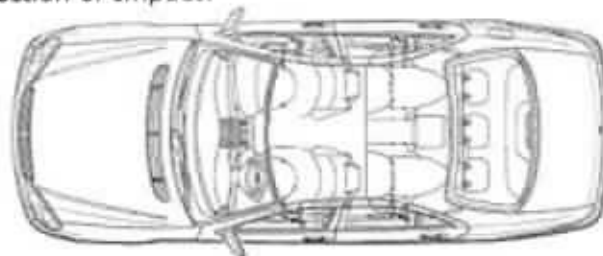

Addresses

Cost Summary

Total Labour	\$785.40
Total Paint/Material	\$176.65
Total Parts	\$2,378.00
Total of Additional Costs	\$285.00
Excess:	TBA
Grand Total Exc GST:	\$3,625.05
7 % GST:	\$253.75
Grand Total Inc GST:	\$3,878.80

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$42.00/HR
Price/Dent = \$0.00/HR

Repair / Guide Number	Repair Details	WU	Cost Price (\$)
72.315A)	RENEW COMPLETE REAR PANEL INCLUDES: R + R REAR BUMPER, TAILLAMPS, REAR STRIKER PIN AND ALL NECESSARY TRIMS	74.0	310.80
74.005A)	RENEW REAR BUMPER	4.0	16.80
74.005J	R + R REAR BUMPER PROTECTIVE MOULDINGS	2.0	8.40
87.001A	R + R TAILGATE	12.0	50.40
87.010A)	RENEW TAILGATE (REMOVED)	7.0	29.40
87.010G	R + R TAILGATE REAR SCREEN	7.0	29.40

LABOUR COST

Total Work Units	106.0	
Corrosion Protection External Labour	0.0HRS	0.00
Corrosion Protection Internal Labour	0.0HRS	0.00
Sub Total	10.6HRS	\$445.20
Paint Labour	8.1HRS	\$340.20
Total Labour	18.7HRS	\$785.40

PAINT WORK

Time Basis 10 WU = 1 HR. Price = \$42.00/HR

Guide Number	Description	WU	Cost Price (\$)
	- PREPARE OFF VEHICLE		
2711	REAR PANEL CPL NEW PART PAINTING	22.0	
2931	BOOTLID/TAILGATE NEW PART PAINTING	15.0	
2581	REAR BUMPER NEW PART PAINT K1R	14.0	
LABOUR COST - PAINT			
TIME(PAINT)		51.0	
Preparation Main Work Plastic		5.0	

Preparation Main Work Metal	25.0	
Preparation Work Multi Layer Paint	0.0	
Total Work Units (10WU/HR)	81.0	
Total Paintwork Labour	8.1HRS	\$340.20
MATERIAL COST - PAINT		Cost Price
New Part Painting		\$68.20
New Part Painting - Plastic K1R		\$70.85
Material-Constant Main Work Metal		\$28.60
Material-Const Main Work Plastic		\$9.00
Total Excluding Pearlescent Uplift		\$176.65
Pearlescent Uplift @ 0.0%		\$0.00
Total Paint Material Cost		\$176.65

PARTS

Price Valid: 01/01/2001

Guide No.	Qty	Description	Part Number	Supplier	Bet.	Price (\$)
3017	1	BADGE "308"	8665 VG		0%	30.00*
3013	1	BADGE PEUGEOT	8665 VF		0%	28.00*
2944	1	BOOT/TAILGATE SEAL	8707 G7		0%	120.00*
2931	1	BOOTLID/TAILGATE	8701 Y3		0%	800.00*
3011	1	REAR BADGE	7810 S3		0%	30.00*
2581	1	REAR BUMPER	7410 EL		0%	400.00*
2640	1	REAR BUMPER C-MEMBER	7252 EH		0%	220.00*
2702	1	REAR NUMBER PLATE	KNPL6		0%	0.00F
2711	1	REAR PANEL CPL	16 105 800 80		0%	650.00*
3160	1	REAR SCREEN BOND KIT	16 188 585 80		0%	0.00F
2650	1	RR BUMPER CLAMP KIT	6999 HF		0%	0.00F
f: OEM Parts			Saving			\$63.23
g: Original			Sub Total			\$2,278.00
h: Secondhand			Mark Up From Cost	(0 %)		\$0.00
p: Parallel			Sundry Parts	(Fixed)		\$100.00
x: Exchange			Total Parts			\$2,378.00

THIS ASSESSMENT CONTAINS UNPRICED PARTS

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description	Betterment	Price
REAR NUMBER PLATE SPECIALIST	0%	\$35.00
REVERSE SENSOR SPECIALIST		\$180.00
REAR SCREEN GUM SPECIALIST	0%	\$40.00
CHECK WIRING SPECIALIST		\$30.00
Total Extras		\$285.00

Final Calculation

Total Parts		\$2,378.00
Labour		
Total Panel/Mechanical	\$445.20	
Total Paintwork	\$340.20	
Total Labour		\$785.40
Additional Costs		
Corr Prot Materials External	\$0.00	
Corr Prot Materials Internal	\$0.00	
Cost of Specialist	\$285.00	
Total of Additional Costs		\$285.00

51 Ubi Avenue 1, #01-25 Paya Ubi Industrial Park Singapore

Claim Reference: SNM18D04760C02

Full Report - V1

Assessment Number: DS000568

Registration: SJN7799R

Version: CHINATAI/2

Printed: 21/12/2018 17:12

Date Calculated: 21/12/2018 09:12

Total Paint/Material Costs

\$176.65

Grand Total Excludes GST

\$3,625.05

GST @ 7 %

\$253.75

Grand Total Includes GST

\$3,878.80

Assessment Notes

Veron Chen (LKKAUTO)

From: Veron Chen (LKKAUTO)
Sent: Monday, 24 December 2018 7:44 AM
To: 'Sharon Sng'; SUR
Subject: RE: ASSIST TO FINALISE-SJN 7799R

Dear Sharon,

Noted with thanks.

Kindly send Final invoice and all supporting documents to CHINA TAIPING.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Sharon Sng <sharon@sngahtee.com>
Sent: Friday, 21 December 2018 6:21 PM
To: Veron Chen (LKKAUTO) <veronchen@lkkauto.com>
Subject: RE: ASSIST TO FINALISE-SJN 7799R

Hi Veron

We confirm \$2900 5 days.
thanks.

Best Regards

Sharon Sng

SNG AH TEE MOTOR & PANEL SERVICE PTE LTD | BLK 3 PIONEER ROAD NORTH #01-18 SINGAPORE 628457
TEL: 62686183 (4LINES) | FAX: 62681429 | Find us at <http://www.sngahtee.com>



-Please note that all offer/acceptance is made without prejudice.-

From: Veron Chen (LKKAUTO) <veronchen@lkkauto.com>
Sent: Friday, December 21, 2018 5:22 PM
To: Sharon Sng <sharon@sngahtee.com>; Rasul (LKKAUTO) <Rasul@lkkauto.com>
Cc: SUR <sur@lkkauto.com>
Subject: RE: ASSIST TO FINALISE-SJN 7799R

Dear Sharon,

WITHOUT PREJUDICE

Offer Lump Sum \$2900/- @ 5 working days.

Please check and confirm.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Sharon Sng <sharon@sngahtee.com>

Sent: Wednesday, 19 December 2018 6:28 PM

To: Veron Chen (LKKAuto) <veronchen@lkkauto.com>; Rasul (LKKAuto) <Rasul@lkkauto.com>

Subject: FW: ASSIST TO FINALISE-SJN 7799R

Hi Rasul

LS \$3000. thanks.

Best Regards

Sharon Sng

SNG AH TEE MOTOR & PANEL SERVICE PTE LTD | BLK 3 PIONEER ROAD NORTH #01-18 SINGAPORE 628457
TEL: 62686183 (4LINES) | FAX: 62681429 | Find us at <http://www.sngahtee.com>



-Please note that all offer/acceptance is made without prejudice.-

From: Sharon Sng <sharon@sngahtee.com>

Sent: Wednesday, December 19, 2018 5:25 PM

To: 'Veron Chen (LKKAuto)' <veronchen@lkkauto.com>

Subject: RE: ASSIST TO FINALISE-SJN 7799R

Hi Veron

Refer to the audatex report.
LS\$3150

Best Regards

Sharon Sng

SNG AH TEE MOTOR & PANEL SERVICE PTE LTD | BLK 3 PIONEER ROAD NORTH #01-18 SINGAPORE 628457
TEL: 62686183 (4LINES) | FAX: 62681429 | Find us at <http://www.sngahtee.com>



-Please note that all offer/acceptance is made without prejudice.-

From: Veron Chen (LKKAuto) <veronchen@lkkauto.com>
Sent: Wednesday, December 19, 2018 4:12 PM
To: Sharon Sng <sharon@sngahtee.com>
Cc: SUR <sur@lkkauto.com>
Subject: RE: ASSIST TO FINALISE-SJN 7799R

Dear Sharon,

WITHOUT PREJUDICE

Offer Lump Sum \$1900/- @ 5 working days.

Please check and confirm.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Veron Chen (LKKAuto)
Sent: Thursday, 6 December 2018 5:46 PM
To: Sharon Sng <sharon@sngahtee.com>
Cc: SUR <sur@lkkauto.com>
Subject: ASSIST TO FINALISE

Dear Sharon,

Kindly advise vehicle status.

If vehicle has been repaired, please finalize with us.

- 1) SJN 7799R-DOA: 2/10/18 (CHINA TAIPING TP)
- 2) SGH 1948J-DOA: 9/11/18 (EQI OD)

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	09 Oct 2018 Sendback Est	09 Oct 2018 11:15 \$4,300.17	10 Oct 2018 16:08 Edit Adj Rpt	\$2,900.00 Edit Estimates	\$2,900.00 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS									
Insured: POLY NDT (PTE) LTD , Co. Reg. No.: 197501046D									
Main Claimant: TED YUET SHANG BRIDGET , ID: 57642642B									
Vehicle Reg. No.: SJN7799R		Date of Loss: 02/10/2018 09:00 - :59 [115 Months and 5 Days From LTA Reg Date (Man Yr)]							
Claim Type: TP / SNM18D04760C02		Policy/Cover Note No.: DMCVSN3055561804							
Vehicle Reg. No. (Insured): GR7316R		Policy No. (Claimant): DMPCSN3084451700							
		Excess: \$0.00							
Repairer: Sng Ah Tee Motor & Panel Service Pte Ltd (Pioneer) Blk 3 Pioneer Road North, #01-18, 628457 Pioneer - Tel: 6268 6183									
Handling Insurer: China Taiping Insurance (Singapore) Pte. Ltd. (HQ) - Tel: 6389 6111 ... [Handled by Irene Tay Hui Ping - 638986192]									
Claimant's Insurer: China Taiping Insurance (Singapore) Pte. Ltd. (HQ) - Tel: 6389 6111									
Adjuster: LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by MOHD RASUL] ... [Final Rpt due 19/10/2018]									
Adj Asg. Remarks: EST \$4601.18, CASE WITH SJE.									
ASSOCIATED MAIL RECEIVED View All Compose Case Mail									
There are no mail for this case.									
ALL ASSOCIATED TASKS View All Search Tasks Create New Task Complete									
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

**SJN7799R (SNM18D04760C02)
[GR7316R]**

TP

TEO YUET SHANG BRIDGET

Oct 2 2018 9:00AM













[POLY NDT (PTE) LTD]

Sng Ah Tee Motor & Panel Service Pte Ltd

Upload Documents		Upload Photos	Compose New Letter	View View in Browser	
Assessment Reports				1 per page	<input checked="" type="checkbox"/>
No	Finalized On	Sng Ah Tee Motor & Panel Service Pte Ltd (Pioneer)		Thumbnail	Print
1	02/10/18 14:48	Accident Statement		Load HTM	
2	09/10/18 11:15	Repairer Estimates		Load HTM	
Photos/Images				3 per page	<input checked="" type="checkbox"/>
No	Finalized On	Sng Ah Tee Motor & Panel Service Pte Ltd (Pioneer)		Thumbnail	Print
1	02/10/18 14:38	Accident Photo [Linked Accident Report Documents]		Load JPG	<input checked="" type="checkbox"/>
2	02/10/18 14:38	Accident Photo [Linked Accident Report Documents]		Load JPG	<input checked="" type="checkbox"/>
3	02/10/18 14:38	Accident Photo [Linked Accident Report Documents]		Load JPG	<input checked="" type="checkbox"/>
4	02/10/18 14:38	Accident Photo [Linked Accident Report Documents]		Load JPG	<input checked="" type="checkbox"/>
5	02/10/18 14:38	Accident Photo [Linked Accident Report Documents]		Load JPG	<input checked="" type="checkbox"/>
6	02/10/18 14:38	Accident Photo [Linked Accident Report Documents]		Load JPG	<input checked="" type="checkbox"/>
7	02/10/18 14:38	Accident Photo [Linked Accident Report Documents]		Load JPG	<input checked="" type="checkbox"/>
8	02/10/18 14:38	Accident Photo [Linked Accident Report Documents]		Load JPG	<input checked="" type="checkbox"/>
9	02/10/18 14:38	Accident Photo [Linked Accident Report Documents]		Load JPG	<input checked="" type="checkbox"/>
10	02/10/18 14:38	Accident Photo [Linked Accident Report Documents]		Load JPG	<input checked="" type="checkbox"/>
Relabel/Reorder					
1	21/12/18 16:53	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print
1	21/12/18 16:53	General View		Load PDF	
2	21/12/18 16:54	Reinspection Photo		Load PDF	
Documentation				1 per page	<input checked="" type="checkbox"/>
No	Finalized On	Sng Ah Tee Motor & Panel Service Pte Ltd (Pioneer)		Thumbnail	Print
1	02/10/18 14:38	Sketch Plan [Linked Accident Report Documents]		Load TIF	
2	02/10/18 14:44	IC,CI,DL [Linked Accident Report Documents]		Load TIF	
3	09/10/18 11:15	E-filed GIA report		Load PDF	
4	09/10/18 11:15	IC,DL,CI		Load TIF	
China Taiping Insurance (Singapore) Pte. Ltd. (HQ)				Thumbnail	Print
1	10/10/18 16:06	OI GIA		Load PDF	

Linked Accident Report Documents

Assessment Reports		View View in Browser	
		1 per page	<input checked="" type="checkbox"/>
No	Finalized On	Sng Ah Tee Motor & Panel Service Pte Ltd (Pioneer)	Thumbnail
1	02/10/18 14:48	Accident Statement	Load HTM
Photos/Images		3 per page	<input checked="" type="checkbox"/>

Assessment Reports				1 per page	<input checked="" type="checkbox"/>
No	Finalized On			Thumbnail	Print
No	Finalized On	Sng Ah Tee Motor & Panel Service Pte Ltd (Pioneer)		Thumbnail	Print
1	02/10/18 14:38	Accident Photo		Load JPG	<input checked="" type="checkbox"/>
2	02/10/18 14:38	Accident Photo		Load JPG	<input checked="" type="checkbox"/>
3	02/10/18 14:38	Accident Photo		Load JPG	<input checked="" type="checkbox"/>
4	02/10/18 14:38	Accident Photo		Load JPG	<input checked="" type="checkbox"/>
5	02/10/18 14:38	Accident Photo		Load JPG	<input checked="" type="checkbox"/>
6	02/10/18 14:38	Accident Photo		Load JPG	<input checked="" type="checkbox"/>
7	02/10/18 14:38	Accident Photo		Load JPG	<input checked="" type="checkbox"/>
8	02/10/18 14:38	Accident Photo		Load JPG	<input checked="" type="checkbox"/>
9	02/10/18 14:38	Accident Photo		Load JPG	<input checked="" type="checkbox"/>
10	02/10/18 14:38	Accident Photo		Load JPG	<input checked="" type="checkbox"/>
Documentation				1 per page	<input checked="" type="checkbox"/>
No	Finalized On			Thumbnail	Print
1	02/10/18 14:38	Sketch Plan		Load TIF	
2	02/10/18 14:44	IC,CI,DL		Load TIF	

Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			
Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ) <div style="border: 1px solid black; height: 40px; margin-top: 5px;"></div>			
Show Remarks To: <input type="checkbox"/> Repairer <input type="checkbox"/> Handling Insurer <small>Note: Remarks are private unless you show it to other parties.</small>			

LKK Auto Consultants Pte Ltd (Co. Reg. No: 199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/CT18018415/R1VD3E2

Date: 26/12/2018

REFERENCE

Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd.	Policy No:	DMCVSN3055561804
Claimant Vehicle No :	SJN7799R	Insured Vehicle No :	GR7316R
Date of Loss:	02/10/2018	Nature of Claim:	TP
		Claim No:	SNM18D04760C02

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SJN7799R		
Make & Model:	PEUGEOT 308, 1.6 Turbo Glass Roof (A)	Engine No:	10FJAVD438564
Reg. Date:	27/02/2009 (Man. Year: 2008)	Chassis No:	VF34C5FTF55386710
Colour:	Black	Odometer:	158294 km
Engine Capacity:	1598 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	225/45 R17	Rear Tyre Size:	225/45 R17
Front Left Side:	Continental 6 mm	Rear Left Side:	Continental 6 mm
Front Right Side:	Continental 6 mm	Rear Right Side:	Continental 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	3,308.00	2,663.00	645.00	19.50
Miscellaneous Items	0.00	0.00	0.00	
Labour	992.17	962.05	30.12	3.04
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	4,300.17	3,625.05	675.12	15.70
Approved Total (Overridden) (S\$)		2,900.00		
(S\$)	4,300.17	2,900.00	1,400.17	32.56
+ GST 7.00/7.00% (S\$)	301.01	203.00	98.01	32.56
Nett Amount (S\$)	4,601.18	3,103.00	1,498.18	32.56

INSPECTION

Date of Assignment:	10/10/2018 Present Location:	Sng Ah Tee Motor & Panel Service Pte Ltd (Pioneer)
Date Inspected:	12/11/2018 Inspected At:	Sng Ah Tee Motor & Panel Service Pte Ltd (Pioneer) Blk 3 Pioneer Road North, #01-18 Singapore 628457

Estimated Period of Repair: 5.0 days

Adjuster: MOHD RASUL

Manager: VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 26 Dec 2018)
Parts:	144	PEUGEOT 308 1.6 Turbo Glass Roof (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SJN7799R)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1	NA	*BADGE "308"	Necessary	30.00 F	*30.00 F
2	1	NA	*BADGE PEUGEOT	Necessary	28.00 F	*28.00 F
3	1	NA	*BOOT/TAILGATE LOCK	Serviceable	65.00 F	*- F
4	1	NA	*BOOT/TAILGATE SEAL	Necessary	120.00 F	*120.00 F
5	1	NA	*BOOTLID/TAILGATE	Bent	800.00 F	*800.00 F
6	1	NA	*L/R BUMPER MOULDING	Repair	80.00 F	*- F
7	1	NA	*L/R LAMP (CRACKED)	Not Consistent With The Impact	150.00 F	*- F
8	1	NA	*R/R BUMPER MOULDING	Serviceable	80.00 F	*- F
9	1	NA	*R/R LAMP	Not Necessary	150.00 F	*- F
10	1	NA	*REAR BADGE	Necessary	30.00 F	*30.00 F
11	1	NA	*REAR BUMPER	Torn	400.00 F	*400.00 F
12	1	NA	*REAR BUMPER C-MEMBER	Bent	220.00 F	*220.00 F
13	1	NA	*REAR NUMBER PLATE	Bent	0.00 F	*- F
14	1	NA	*REAR PANEL COVERING	Serviceable	120.00 F	*- F
15	1	NA	*REAR PANEL CPL	Bent	650.00 F	*650.00 F
16	1	NA	*REAR SCREEN BOND KIT	Necessary	0.00 F	*- F
17	1	NA	*RR BUMPER CLAMP KIT	Necessary	0.00 F	*- F
18	1	NA	*SPECIALIST CHECK WIRING	Necessary	30.00 FS	*30.00 FS
19	1	NA	*SPECIALIST REAR NUMBER PLATE	Bent	35.00 FS	*35.00 FS
20	1	NA	*SPECIALIST REAR SCREEN GUM	Necessary	40.00 FS	*40.00 FS
21	1	NA	*SPECIALIST REVERSE SENSOR	Not Working	180.00 FS	*180.00 FS
22	1	NA	*SUNDRY PARTS	Necessary	100.00 FS	*100.00 FS

F=Franchise part. S=SpcNett.

Total Parts (S\$)	3,308.00	2,663.00
--------------------------	-----------------	-----------------

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	Total Paint Labour	New	365.40	340.20
2	Total Paint Materials	New	181.57	176.65
3	Total Panel/Mechanical Labour	New	445.20	445.20
Gross Labour Cost (S\$)			992.17	962.05

Report was unsubmitted during this print-out.

< END OF ESTIMATES >