



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD
3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV No. AC2006716
INV Date 29/09/2020
Reference CC6/CTI18018444/Dka3s2
Code CTI



PROFESSIONAL SERVICE FEE

Vehicle No. SJM 5750Z
Insured Veh. SDW 5055R
Claim No. SNM18D04799C02
Policy No. DMPCSN1125051807
Accident Date 04/10/2018
Inspection Date 08/10/2018

Description	Total
Survey Inspection	350.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	350.00
GST (7%)	24.50
Grand Total	374.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

CHINA TAIPING INSURANCE (S) PTE LTD	Ref : CC6/CTI18018444/Dka3s2
3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909	Date : 29-09-2020
	Code : CTI



1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SDW 5055R	Veh. Inspected	SJM 5750Z
Policy No.	DMPCSN1125051807	Coverage (\$)	0.00
Claim No.	SNM18D04799C02	Excess (\$)	0.00
Assign From		Assign Date	08/10/2018

2. Vehicle Particulars & Condition

Make & Model	HONDA CIVIC	c.c	1799
Engine No.	HIDDEN	Year of Reg.	2009
Chassis No.	JHMFD16309S201672	Colour	GREY
Odometer	183217	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	205/55 R16	YOKOHAMA	5 mm
L/H Front Tyre	205/55 R16	YOKOHAMA	5 mm
R/H Rear Tyre	205/55 R16	YOKOHAMA	5 mm
L/H Rear Tyre	205/55 R16	YOKOHAMA	5 mm

4. Description of Damages

	THE VEHICLE SUSTAINED DAMAGES AT THE N/S FRONT PORTION AND N/S BODY. DAMAGES SEE DETAILS.
--	--

5. General Information

Accident Date	04/10/2018	Inspection Date	08/10/2018
Survey held at	WEI LEE MOTOR WORKS BLOCK 9 SIN MING INDUSTRIAL ESTATE #01-32 SINGAPORE 575644.		

5a. Remarks

	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
--	--

5b. Estimate Days of Repair

	ESTIMATED NORMAL PERIOD FOR REPAIR: 6 Working Days
--	---



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 1

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJM 5750Z

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	FRONT BUMPER	CUT	576.00	576.00
2	FRONT BUMPER RETAINER @ \$42.00	SERVICEABLE	84.00	-
1	HEADLAMP, LH	NOT NECESSARY	242.00	-
1	FRONT FENDER, LH	DENTED	537.80	537.80
1	FENDER COWLING	DEFORMED	90.10	90.10
1	COWLING CLIP	NECESSARY	38.00	38.00
1	FRONT DOOR	DENTED	842.20	842.20
1	FRONT DOOR PROTECTOR N CHROME	BROKEN	90.40	90.40
1	ROCKER PANEL, LH	DENTED	243.10	243.10
1	SIDE SKIRT, LH	DENTED	566.60	566.60
	LESS 20% DISCOUNT		-662.04	-596.84
			2,648.16	2,387.36
LABOUR				
	TO TRANSFER DOOR BOARD, POWER WINDOW MECHANISMS, GLASS TO NEW DOOR.		160.00	60.00
	TO REMOVE DAMAGED PARTS AND ATTACHMENTS. CUT AND WELD DAMAGED PANEL. REPAIR / RESHAPE DAMAGED / DENTED AREAS. STRAIGHTEN FRONT PILLAR. REPLACE ABOVE PARTS.		1,100.00	800.00
	TO SPRAY PAINT.		1,200.00	800.00
			2,460.00	1,660.00
GRAND TOTAL			5,108.16	4,047.36
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				2,600.00

Report Ref No. CC6/CT118018444/Dka3s2

ANG BRYAN TANI

Automotive Assessor / Investigator

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJM 5750Z

INSPECTION

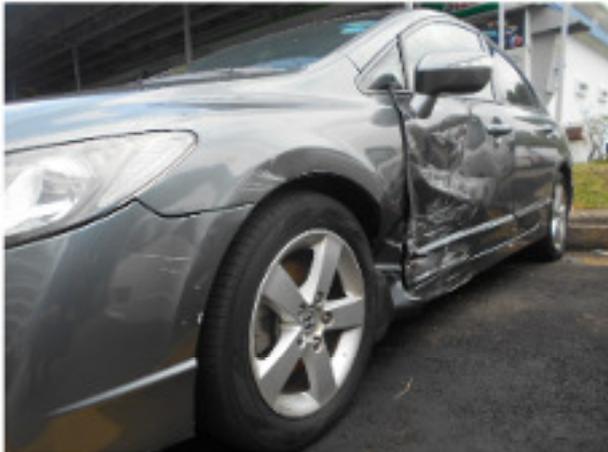




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

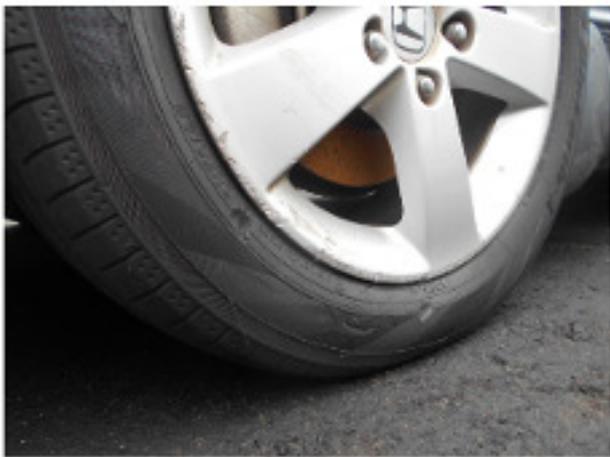



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

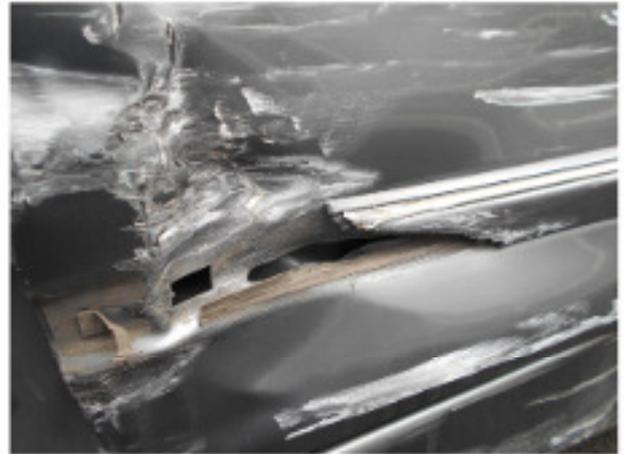



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJM 5750Z

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

