

ASSIGNMENT

Adrian

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____


Excess: \$1,600/-

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

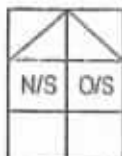

Bal. or Market Value: 150K

IDAC Accident Rpt: _____

Consistent? : Yes or No

GIA / PR Seen: _____

Consistent? : Yes or No

Est. Repairs: 29 8/10 days

Res.: Yes or No

Lum Sum: _____

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____

Person Contacted: _____

Vehicle: IN / OUT

Veh No: SKT3113C

Yr Regn: 2018 / July

Type: ☒ M/Car / M/Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Audi A4

c.c 1984.

Colour: Black

A/C: Insured / Std / NI / NA

Sp. Reading 6143

T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: WAU222F40JNO15000

Gen. Cond: ☒ Good / Fair / Poor / BurntSteering: ☒ In order / Jammed / Leaked / Burnt orBrake: ☒ In order / Jammed / Leaked / Burnt orModi: Nil / ☒ S/Rim / STD A/Rim or

Tyre Size: F: 205/60R16

R: 205/60R16

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU ☒ PIR / SUMI / TOYO / YOKO or

Front

Rear

R/Bal. 06 mm

R/Bal. 06 mm

L/Bal. 06 mm

L/Bal. 06 mm

D.O.A. _____

D.O.A. 29/10/18

Survey held at Premium

Des. of Damages: Frt / Rear ☒ O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

RECEIVED 11 DEC 2019

Date / Time

Action / Instruction

ODALG.

SKT 3113C - A

30/10/18 @ 13:12 p.m. revised IA to Tong shing via mermer

30/10/18 @ 13:17 p.m. mandate requested authorize repair to Tong shing via mermer.

08/11/18 @ 13:46 p.m. mandate approved by Victor Koh via mermer

08/11/18 @ 14:28 p.m. revert authorised repair to Tong (repairer) via mermer.

18/11/19 Adrian Gubman p/p \$ 47,270.16 @ 24 days with Boss (\$ 25,380.84 Red - 35%.)

Date/Time, File Part to?

Date/Time, File Return to?

1) 11/12/19

2)

3) Typ: 54

4)

5)

6)

Prel. Report:

Final Report:

\$ 47,270.16 p/p

Part Prices Check:

IN

OUT

Survey Fee:

Date:

Basic & Add.

S + RS, SI

Photos

Others

TOTAL

200

11

211

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	3295J
Vehicle Details	
Vehicle No.:	SKT3113C
Vehicle to be Exported:	No
Intended Deregistration Date:	30 Oct 2018
Vehicle Make:	AUDI
Vehicle Model:	A4 SEDAN 2.0 TFSI S TRONIC (NAV)
Primary Colour:	Black
Manufacturing Year:	2018
Engine No.:	CVK064044
Chassis No.:	WAUZZZF40JN015000
Maximum Power Output:	140.0 kW (187 bhp)
Open Market Value:	\$33,421.00
Original Registration Date:	28 Jul 2018
First Registration Date:	28 Jul 2018
Transfer Count:	0
Actual ARF Paid:	\$38,790.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	27 Jul 2028
PARF Rebate Amount:	\$29,092.00
Intended COE Rebate Details	
COE Expiry Date:	27 Jul 2028
COE Category:	B - Car above 1600cc or 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$31,000.00
COE Rebate Amount:	\$30,191.00
Total Rebate Amount:	\$59,283.00

The information contained herein is correct as at 30 Oct 2018

OK

Shirley Hiew (LKK Auto)

From: Shirley Hiew (LKK Auto)
Sent: Wednesday, 4 December 2019 2:52 pm
To: Carrine Leong
Cc: jiajee.yap@premiumauto.com.sg; 'Chang Chee Sing'; Adrian Ling (LKKAuto); SUR
Subject: RE: FINAL REVISION - SKT3113C - OD AIG - SURVEYED 29 OCT 18

Dear Carrine,

Confirmed final fig \$47,270.16 @ 24 days of repairs before excess \$ 1,600/- & GST.

Kindly expedite the discharge voucher and tax invoice to us for close case.

Thank you.

Best Regards,

Shirley Hiew | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: Sur@lkkauto.com | fax: 6256-4315
Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Carrine Leong <carrine.leong@premiumauto.com.sg>
Sent: Monday, 15 July 2019 3:45 pm
To: Adrian Ling (LKKAuto) <adrianling@lkkauto.com>; Shirley Hiew (LKK Auto) <ShirleyHiew@lkkauto.com>; SUR <sur@lkkauto.com>
Cc: jiajee.yap@premiumauto.com.sg; 'Chang Chee Sing' <claims@premiumauto.com.sg>
Subject: RE: FINAL REVISION - SKT3113C - OD AIG - SURVEYED 29 OCT 18

Dear Adrian and all,

Reminder

We have yet receive your confirmation of repair cost and days of repair for above vehicle.

Revised estimate was mailed to you on 13 Mar 2019.

We sincerely appreciate your early closure.

Thanks & Best Regard
Carrine Leong
Claims Administrator

Premium Automobiles Pte Ltd (Reg No 199902271W)
55 Ubi Road 1 Road Singapore 408699
p. +65 6388 2323 d. +65 6768 9925 f. +65 6841 1183
e. carrine.leong@premiumauto.com.sg w. www.audi.com.sg
Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223

Shirley Hiew (LKK Auto)

From: Shirley Hiew (LKK Auto) <ShirleyHiew@lkkauto.com>
Sent: Thursday, 8 November 2018 2:28 PM
To: claims@premiumauto.com.sg
Cc: SUR
Subject: RE: OD claim for SKT 3113 C

Dear Tony,

As instructed by our client, please proceed to repair the insured vehicle **SKT 3113C (Excess \$ 1,600/-)**.

If there are any check items or supplementary items please inform our office's Assignment Team at Tel: 6741 8434 to arrange our surveyor for inspection.

All supplementary items and unconfirm items are subjected to further approval from insurance company before completion of the repair.

*Our client reserve their right not to pay if there is no valid approval obtained before repair.

Thank you.

Best Regards,

Shirley Hiew | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: Sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Shirley Hiew (LKK Auto) [mailto:ShirleyHiew@lkkauto.com]
Sent: Thursday, 8 November 2018 9:53 AM
To: 'Loo, Tong Shing' <TongShing.Loo@aig.com>
Cc: SUR <sur@lkkauto.com>; 'Koh, Victor-CK' <Victor-CK.Koh@aig.com>; 'Fong, Andy-SY' <Andy-SY.Fong@aig.com>; claims@premiumauto.com.sg
Subject: RE: OD claim for SKT 3113 C

Hi Tong Shing,

We noted that the excess coverage is confirmed. But based on merimen, we are still pending mandate approval.

Kindly advise.

Thank you.

Best Regards,

Shirley Hiew | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: Sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Loo, Tong Shing [<mailto:TongShing.Loo@aig.com>]

Sent: Thursday, 8 November 2018 9:05 AM

To: Claims <claims@premiumauto.com.sg>; 'Shirley Hiew (LKK Auto)' <ShirleyHiew@lkkauto.com>

Cc: 'SUR' <sur@lkkauto.com>

Subject: RE: OD claim for SKT 3113 C

Importance: High

Hi Tony,

Coverage already confirmed , for replacement car may need LKK to adv for the authorization of repair.

Thank you.

Loo Tong Shing
AIG

Express Claims Adjuster
Claims Operations | AIG Shared Services

TongShing.Loo@aig.com | www.aig.com

From: Claims [<mailto:claims@premiumauto.com.sg>]

Sent: Wednesday, November 07, 2018 2:53 PM

To: 'Shirley Hiew (LKK Auto)'; Loo, Tong Shing

Cc: 'SUR'; claims@premiumauto.com.sg

Subject: RE: OD claim for SKT 3113 C

Dear Tong Shing,

Refer to this OD claim. Kindly assist follow up repair approval.

Owner is chasing for replacement car.

Thank you.

Best Regards,
Tony Foong
Claims Advisor

Premium Automobiles Pte Ltd (Reg No 199902271W)

55 Ubi Road 1 Road Singapore 408699

p. +65 6388 2323 d. +65 6768 9828 f. +65 6841 1183

e. claims@premiumauto.com.sg w. www.audi.com.sg

Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223



http://www.audi.com.sg/sea/brand/sg/audi_promotions/promotions/car_promotions/new-audi-q2-2017.html

Email Disclaimer

This email, including any attachment, is confidential and may also be privileged. If you have received it in error, please notify us immediately by reply email and then delete this message from your system. Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you

From: Shirley Hiew (LKK Auto) [<mailto:ShirleyHiew@lkkauto.com>]
Sent: Wednesday, 7 November, 2018 1:32 PM
To: 'Claims' <claims@premiumauto.com.sg>
Cc: SUR <sur@lkkauto.com>; Admin-D (LKKAuto) <admin-d@lkkauto.com>
Subject: RE: OD claim for SKT 3113 C

Hi Tony,

We are still pending approval from insurance.

Thank you.

Best Regards,

Shirley Hiew | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Claims [<mailto:claims@premiumauto.com.sg>]
Sent: Wednesday, 7 November 2018 9:49 AM
To: 'Shirley Hiew (LKK Auto)' <ShirleyHiew@lkkauto.com>
Cc: 'SUR' <sur@lkkauto.com>; 'Admin-D (LKKAuto)' <admin-d@lkkauto.com>; claims@premiumauto.com.sg
Subject: RE: OD claim for SKT 3113 C

Dear all,

Any update on repair approval?

Thank you.

Best Regards,

Tony Foong
Claims Advisor

Premium Automobiles Pte Ltd (Reg No 199902271W)
55 Ubi Road 1 Road Singapore 408699
p. +65 6388 2323 d. +65 6768 9828 f. +65 6841 1183



http://www.audi.com.sg/sea/brand/sg/audi_promotions/promotions/car_promotions/new-audi-q2-2017.html

Email Disclaimer

This email, including any attachment, is confidential and may also be privileged.
If you have received it in error, please notify us immediately by reply email and then delete this message from your system.
Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you

From: Claims [<mailto:claims@premiumauto.com.sg>]

Sent: Friday, 2 November, 2018 6:59 PM

To: 'Shirley Hiew (LKK Auto)' <ShirleyHiew@lkkauto.com>

Cc: 'SUR' <sur@lkkauto.com>; 'Admin-D (LKKAuto)' <admin-d@lkkauto.com>; claims@premiumauto.com.sg

Subject: RE: OD claim for SKT 3113 C

Dear Shirley,

FYNA.

Thank you.

Best Regards,
Tony Foong
Claims Advisor

Premium Automobiles Pte Ltd (Reg No 199902271W)

55 Ubi Road 1 Road Singapore 408699

p. +65 6388 2323 d. +65 6768 9828 f. +65 6841 1183

e. claims@premiumauto.com.sg w. www.audi.com.sg

Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223



http://www.audi.com.sg/sea/brand/sg/audi_promotions/promotions/car_promotions/new-audi-q2-2017.html

Email Disclaimer

This email, including any attachment, is confidential and may also be privileged.
If you have received it in error, please notify us immediately by reply email and then delete this message from your system.
Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you

From: Shirley Hiew (LKK Auto) [mailto:ShirleyHiew@lkkauto.com]
Sent: Thursday, 1 November, 2018 2:29 PM
To: 'Claims Dept' <claims@premiumauto.com.sg>
Cc: SUR <sur@lkkauto.com>; Admin-D (LKKAuto) <admin-d@lkkauto.com>
Subject: RE: OD claim for SKT 3113 C

Hi Jeffrey,

Kindly provide us Undertaking Letter and Interview Form due to single accident.

Thank you.

Best Regards,

Shirley Hiew | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: Sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Claims Dept [mailto:claims@premiumauto.com.sg]
Sent: Wednesday, 31 October 2018 8:14 AM
To: 'Shirley Hiew (LKK Auto)' <ShirleyHiew@lkkauto.com>
Cc: 'SUR' <sur@lkkauto.com>; 'Admin-D (LKKAuto)' <admin-d@lkkauto.com>; 'Claims Dept' <claims@premiumauto.com.sg>
Subject: RE: OD claim for SKT 3113 C

Dear Shirley,

Kindly follow up with AIG and update us accordingly on this.

Many thanks!

Best regards,

Jeffery Tan

Premium Automobiles Pte Ltd (Reg No 199902271W)
55 Ubi Road 1 Road Singapore 408699
p. +65 6388 2323 d. +65 6768 9911 f. +65 6841 1183
e. claims@premiumauto.com.sg w. www.audi.com.sg
Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223



Email Disclaimer

This email, including any attachment, is confidential and may also be privileged.
If you have received it in error, please notify us immediately by reply email and then delete this message from your system.
Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you

From: Shirley Hiew (LKK Auto) [mailto:ShirleyHiew@lkkauto.com]
Sent: Tuesday, 30 October, 2018 1:50 PM
To: 'Claims Dept' <claims@premiumauto.com.sg>
Cc: SUR <sur@lkkauto.com>; Admin-D (LKKAuto) <admin-d@lkkauto.com>
Subject: RE: OD claim for SKT 3113 C

Hi Jeffrey,

We are still pending approval from insurance.

Enclosed Estimate marked by Adrian for your requested.

Thank you.

Best Regards,

Shirley Hiew | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: Sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Claims Dept [mailto:claims@premiumauto.com.sg]
Sent: Tuesday, 30 October 2018 12:49 PM
To: SUR <sur@lkkauto.com>; Admin-D (LKKAuto) <admin-d@lkkauto.com>
Cc: 'Claims Dept' <claims@premiumauto.com.sg>
Subject: RE: OD claim for SKT 3113 C

Dear all,

Kindly revert us back the marked estimate.

And also advise on the approval from AIG on this.

Many thanks!

Best regards,
Jeffery Tan

Premium Automobiles Pte Ltd (Reg No 199902271W)
55 Ubi Road 1 Road Singapore 408699
p. +65 6388 2323 d. +65 6768 9911 f. +65 6841 1183
e. claims@premiumauto.com.sg w. www.audi.com.sg
Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223



Email Disclaimer

This email, including any attachment, is confidential and may also be privileged.
If you have received it in error, please notify us immediately by reply email and then delete this message from your system.
Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you

From: Claims Dept [<mailto:claims@premiumauto.com.sg>]
Sent: Monday, 29 October, 2018 5:50 PM
To: 'SUR' <sur@lkkauto.com>; 'Admin-D (LKKAuto)' <admin-d@lkkauto.com>
Cc: 'Claims Dept' <claims@premiumauto.com.sg>
Subject: RE: OD claim for SKT 3113 C

Dear Catherine,

Kindly forward the estimate to Adrian for kind reference.

Many thanks!

Best regards,
Jeffery Tan

Premium Automobiles Pte Ltd (Reg No 199902271W)
55 Ubi Road 1 Road Singapore 408699
p. +65 6388 2323 d. +65 6768 9911 f. +65 6841 1183
e. claims@premiumauto.com.sg w. www.audi.com.sg
Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223



Email Disclaimer

This email, including any attachment, is confidential and may also be privileged.
If you have received it in error, please notify us immediately by reply email and then delete this message from your system.
Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you

From: Claims Dept [<mailto:claims@premiumauto.com.sg>]
Sent: Friday, 26 October, 2018 4:46 PM
To: 'SUR' <sur@lkkauto.com>; 'Admin A' <admin-a@lkkauto.com>
Cc: 'Claims Dept' <claims@premiumauto.com.sg>
Subject: RE : OD claim for SKT 3113 C

Good afternoon all ,

Here is the attached estimate and GIA report for your kind reference .

Thank you .

Best Regards,
Phua
Claims Advisor

Premium Automobiles Pte Ltd (Reg No 199902271W)

55 Ubi Road 1 Road Singapore 408699

p. +65 6388 2323 d. +65 6768 9911 f. +65 6841 1183

e. claims@premiumauto.com.sg w. www.audi.com.sg

Audi Showroom, Audi Centre 281 Alexandra Road Singapore 159938 p. +65 6836 2223



Email Disclaimer

This email, including any attachment, is confidential and may also be privileged.

If you have received it in error, please notify us immediately by reply email and then delete this message from your system.

Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you.

IMPORTANT NOTICE:

The information in this email (and any attachments) is confidential. If you are not the intended recipient, you must not use or disseminate the information. If you have received this email in error, please immediately notify me by "Reply" command and permanently delete the original and any copies or printouts thereof. Although this email and any attachments are believed to be free of any virus or other defect that might affect any computer system into which it is received and opened, it is the responsibility of the recipient to ensure that it is virus free and no responsibility is accepted by American International Group, Inc. or its subsidiaries or affiliates either jointly or severally, for any loss or damage arising in any way from its use.

View Received Message

This mail is associated with :

***SKT3113C (7903640717SG)**

OD

Oct 22 2018 3:35PM

[ONG LAY GUAT JESSIE MRS JESSIE KAM]

Premium Automobiles Pte Ltd

[Reply](#)[Reply All](#)[Mark as Unread](#)[Print Message](#)[Delete Message](#)[Forward](#)

From AIG Asia Pacific Insurance Pte. Ltd. (AIG_SG), sent on 02/12/2019 10:34 AM.

To LKK_HQ

Subject Alert - Adj Mandate Approved (S\$47270.16) - SKT3113C - Claim Handler: Loo, Tong Shing

Approved:47270.16.

DOCUMENTS SUMMARY

There are no documents.

Shirley Hiew (LKK Auto)

From: Shirley Hiew (LKK Auto)
Sent: Tuesday, 26 November 2019 5:06 pm
To: Koh, Victor-CK
Cc: SUR; Fong, Andy-SY
Subject: RE: Re: Alert - Adj Mandate Maintained - SKT3113C - Claim Handler: Loo, Tong Shing

Dear Victor,

We will check & revert.

Thank you.

Best Regards,

Shirley Hiew | Case Handler

LKK Auto Consultants Pte Ltd


Phone: 6256-3561 | email: Sur@lkkauto.com | fax: 6256-4315
Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Koh, Victor-CK <Victor-CK.Koh@aig.com>
Sent: Tuesday, 26 November 2019 4:42 pm
To: Shirley Hiew (LKK Auto) <ShirleyHiew@lkkauto.com>
Cc: SUR <sur@lkkauto.com>; Fong, Andy-SY <Andy-SY.Fong@aig.com>
Subject: RE: Re: Alert - Adj Mandate Maintained - SKT3113C - Claim Handler: Loo, Tong Shing

Hi Shirley,

I refer to the alignment reading below. Kindly enlighten why the left side (circle in blue) which is not damage has no reading as well.

The one circle in red is after adjustment reading right and not after replacement reading. Which means the undercarriage should be ok?

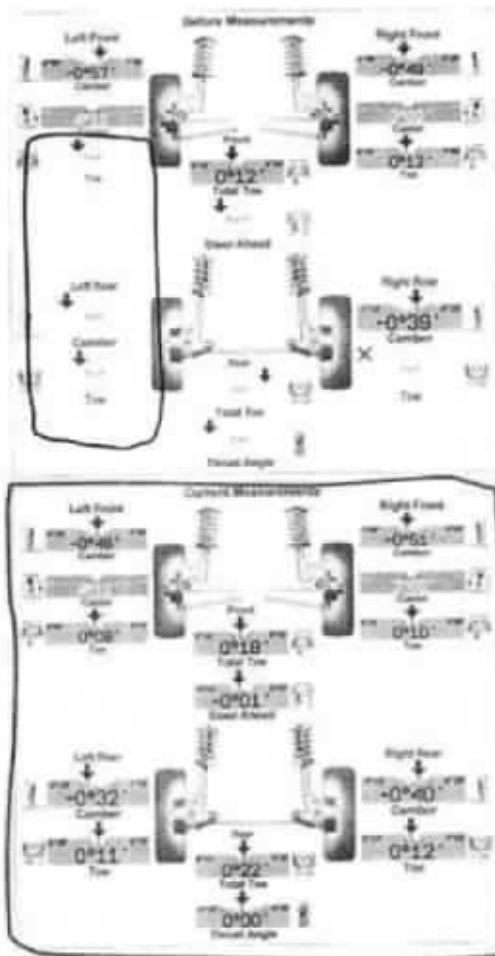

Thanks & Regards

Victor Koh
AIG
Claims Technical Controller
Claims | AIG Asia Pacific Insurance Pte. Ltd

78 Shenton Way #08-16 Singapore 079120
Tel +65 6419 1785 | Fax +65 68357416
Victor-ck.koh@aig.com | www.aig.com

From: Shirley Hiew (LKK Auto) [<mailto:ShirleyHiew@lkkauto.com>]
Sent: Monday, November 18, 2019 6:09 PM
To: Koh, Victor-CK
Cc: SUR; Fong, Andy-SY
Subject: [EXTERNAL] RE: Re: Alert - Adj Mandate Maintained - SKT3113C - Claim Handler: Loo, Tong Shing

This message is from an external sender; be cautious with links and attachments.

Hi Victor,

Shirley Hiew (LKK Auto)

From: Shirley Hiew (LKK Auto)
Sent: Monday, 18 November 2019 6:09 pm
To: Koh, Victor-CK
Cc: SUR; Fong, Andy-SY
Subject: RE: Re: Alert - Adj Mandate Maintained - SKT3113C - Claim Handler: Loo, Tong Shing

Hi Victor,

According to our surveyor, please note that in the alignment report, the toe angle is mark with a "X", which means that the toe angle is completely out of alignment and a reading was not registered.

Kindly let us have your mandate approval.

Thank you.

Best Regards,

Shirley Hiew | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: sur@lkkauto.com | fax: 6256-4315
Blk S1, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Koh, Victor-CK <Victor-CK.Koh@aig.com>
Sent: Thursday, 4 April 2019 2:18 pm
To: SUR <sur@lkkauto.com>
Subject: RE: Re: Alert - Adj Mandate Maintained - SKT3113C - Claim Handler: Loo, Tong Shing

Hi Shirley,

Alignment report show that rear undercarriage is still within the specification?
Why does it need to be replaced?

Thanks & Regards

Victor Koh
AIG
Claims Technical Controller
Claims | AIG Asia Pacific Insurance Pte. Ltd

78 Shenton Way #08-16 Singapore 079120
Tel +65 6419 1785 | Fax +65 68357416
Victor-ck.koh@aig.com | www.aig.com

Hi Victor,

Please note that in the alignment report, the toe angle is marked with an "X", which means that the toe angle is completely out of alignment and a reading was not registered.

Shirley Hiew (LKK Auto)

From: Koh, Victor-CK <Victor-CK.Koh@aig.com>
Sent: Thursday, 4 April 2019 2:18 PM
To: SUR
Subject: RE: Re: Alert - Adj Mandate Maintained - SKT3113C - Claim Handler: Loo, Tong Shing

Hi Shirley,

Alignment report show that rear undercarriage is still within the specification?
Why does it need to be replaced?

Thanks & Regards

Victor Koh
AIG
Claims Technical Controller
Claims | AIG Asia Pacific Insurance Pte. Ltd

78 Shenton Way #08-16 Singapore 079120
Tel +65 6419 1785 | Fax +65 68357416
Victor-ck.koh@aig.com | www.aig.com

From: Do-Not-Reply [mailto:do-not-reply@merimen.com]
Sent: Thursday, April 04, 2019 2:00 PM
To: Koh, Victor-CK
Cc: Loo, Tong Shing; sur@lkkauto.com
Subject: [EXTERNAL] Re: Alert - Adj Mandate Maintained - SKT3113C - Claim Handler: Loo, Tong Shing

Caution: External Email

This mail is associated with :
***SKT3113C (7903640717SG)**
OD
Oct 22 2018 3:35PM
[ONG LAY GUAT JESSIE MRS JESSIE KAM]
Premium Automobiles Pte Ltd

Hi Victor,

Kindly inform documents uploaded in merimen.

According to our surveyor Adrian, please note that the supplementary list of undercarriage items are for the rear right portion.

Please let us have your approval.

Thank you.
Best Regards,
Shirley Hiew | Case Handler

View Sent Message

This mail is associated with :

***SKT3113C (7903640717SG)**
OD
Oct 22 2018 3:35PM
[ONG LAY GUAT JESSIE MRS JESSIE KAM]
Premium Automobiles Pte Ltd

[Resend](#)[View Recipients](#)[Print Message](#)[Delete Message](#)[Forward](#)

From LKK Auto Consultants Pte Ltd (LKK_HQ), sent on 04/04/2019 13:40 PM.
To Victor-CK.Koh@aig.com
CC TongShing.Loo@aig.com; sur@lkkauto.com
Subject Re: Alert - Adj Mandate Maintained - SKT3113C - Claim Handler: Loo, Tong Shing

Hi Victor,

Kindly inform documents uploaded in merimen.

According to our surveyor Adrian, please note that the supplementary list of undercarriage items are for the rear right portion.

Please let us have your approval.

Thank you,
Best Regards,
Shirley Hiew | Case Handler
LKK Auto Consultants Pte Ltd
Phone: 6256-3561 | email: Sur@lkkauto.com | fax: 6256-4315
Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

<-- Original Message -->

From: AIG_SG
To: LKK_HQ
Sent On: 27/03/2019 08:15 AM
Subject: Alert - Adj Mandate Maintained - SKT3113C - Claim Handler: Loo, Tong Shing

Maintained:Supplementary undercarriage is for left or right side? If right side why left side undercarriage taken? Wheel alignment report? Parts requisition form required. Finalise marking estimate?

DOCUMENTS SUMMARY

There are no documents.

View Received Message

This mail is associated with :

***SKT3113C (79036407175G)**

OD

Oct 22 2018 3:35PM

[ONG LAY GUAT JESSIE MRS JESSIE KAM]

Premium Automobiles Pte Ltd

[Reply](#) [Reply All](#) [Mark as Unread](#) [Print Message](#) [Delete Message](#) [Forward](#)

From AIG Asia Pacific Insurance Pte. Ltd. (AIG_SG), sent on 27/03/2019 08:15 AM.

To LKK_HQ

Subject Alert - Adj Mandate Maintained - SKT3113C - Claim Handler: Loo, Tong Shing

Maintained: Supplementary undercarriage is for left or right side? If right side why left side undercarriage taken? Wheel alignment report? Parts requisition form required. Finalise marking estimate?

DOCUMENTS SUMMARY

There are no documents.

Please note that the ^{Supplementary} ~~supplementary~~ list of undercarriage items are for the rear right portion.

View Received Message

This mail is associated with :

***SKT3113C (7903640717SG)**

OD

Oct 22 2018 3:35PM

[ONG LAY GUAT JESSIE MRS JESSIE KAM]

Premium Automobiles Pte Ltd

[Reply](#) [Reply All](#) [Mark as Unread](#) [Print Message](#) [Delete Message](#) [Forward](#)

From AIG Asia Pacific Insurance Pte. Ltd. (AIG_SG), sent on 08/11/2018 13:46 PM.

To LKK_HQ

Subject Alert - Adj Mandate Approved (S\$45917.00) - SKT3113C - Claim Handler: Loo, Tong Shing

Approved:45917.00;Re-inspection to be done for damage check and supplementary items / labour.

DOCUMENTS SUMMARY

There are no documents.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To: AIG Asia Pacific Insurance Pte. Ltd.
AIG Building
78 Shenton Way #08-16
Singapore 079120

From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn: Loo, Tong Shing

Date: 04 Apr 2019

Preliminary Advice

Vehicle No	: SKT3113C	Accident Date	: 22/10/2018
Make	: AUDI A4	Policy No.	: 1800084149
Assignment Date	: 29/10/2018	Excess	: S\$1,600.00
Date of Inspection	: 29/10/2018	Est. Duration of Repair	: 24 days
Inspection At	: Premium Automobiles Pte Ltd (UBI) 55 Ubi Road 1 Singapore 408699		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages o/s body and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	72,651.00 (INCLUSIVE SUPPLEMENTARY)
Revised Amount	:S\$	47,270.16 (INCLUSIVE SUPPLEMENTARY)
Check Items (Estimated)	:S\$	0.00
Total	:S\$	47,270.16
Lump Sum Repair	:S\$	

Total Loss Consideration

New for Old Value	:S\$	
Pre-Accident Value	:S\$	150,000.00
COE / PARF Rebate	:S\$	59,283.00
Salvage Value	:S\$	
Margin for Repair	:S\$	90,717.00

Remarks

- (X) The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.
- () The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.
- (X) Other comments : Supplementary amount is \$ 4,850.40

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To: AIG Asia Pacific Insurance Pte. Ltd.
AIG Building
78 Shenton Way #08-16
Singapore 079120

From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn: Loo, Tong Shing

Date: 13 Mar 2019

Preliminary Advice

Vehicle No	: SKT3113C	Accident Date	: 22/10/2018
Make	: AUDI A4	Policy No.	: 1800084149
Assignment Date	: 29/10/2018	Excess	: S\$1,600.00
Date of Inspection	: 29/10/2018	Est. Duration of Repair	: 24 days
Inspection At	: Premium Automobiles Pte Ltd (UBI) 55 Ubi Road 1 Singapore 408699		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages o/s body and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	72,651.00 (INCLUSIVE SUPPLEMENTARY)
Revised Amount	:S\$	50,767.40 (INCLUSIVE SUPPLEMENTARY)
Check Items (Estimated)	:S\$	2,914.00
Total	:S\$	53,681.40
Lump Sum Repair	:S\$	

Total Loss Consideration

New for Old Value	:S\$	
Pre-Accident Value	:S\$	150,000.00
COE / PARF Rebate	:S\$	59,283.00
Salvage Value	:S\$	
Margin for Repair	:S\$	90,717.00

Remarks

- (X) The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.
- () The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.
- (X) Other comments : Kindly approve of supplementary amount is \$ 4,850.40

Note: This document has not been finalised.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To: AIG Asia Pacific Insurance Pte. Ltd.
AIG Building
78 Shenton Way #07-16
Singapore 079120

From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn: Mohd Zawaye, Norsazani

Date: 30 Oct 2018

Preliminary Advice

Vehicle No	: SKT3113C	Accident Date	: 22/10/2018
Make	: AUDI A4	Policy No.	: 1800084149
Assignment Date	: 29/10/2018	Excess	: S\$0.00
Date of Inspection	: 29/10/2018	Est. Duration of Repair	: 24 days
Inspection At	: Premium Automobiles Pte Ltd (UBI) 55 Ubi Road 1 Singapore 408699		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages o/s body and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	67,121.00
Revised Amount	:S\$	45,917.00
Check Items (Estimated)	:S\$	2,914.00
Total	:S\$	48,831.00

Lump Sum Repair	:S\$	
-----------------	------	--

Total Loss Consideration

New for Old Value	:S\$	
Pre-Accident Value	:S\$	150,000.00
COE / PARF Rebate	:S\$	59,283.00
Salvage Value	:S\$	
Margin for Repair	:S\$	90,717.00

Remarks

- (X) The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.
- () The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.
- () Other comments :

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	23/10/2018 15:53
Date Of Accident	22/10/2018 15:35
Exact Location Of Accident	ALONG MCE TOWARDS CHANGI
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SKT3113C
Insured/Policyholder	
Name Of Registered Owner	ONG LAY GUAT JESSIE MRS JESSIE KAM
NRIC No	S1613295J
Email Address	NOEMAIL
Mobile Phone No	(LOCAL) +65-96669533
Alternative Phone No	OFFICE-96669533

Vehicle Particulars

Manufacturer	AUDI
Model	A4 SEDAN 2.0 TFSI 8W
Exact Purpose for which vehicle was being used at time of accident	PRIVATE USE
Are you claiming under your own insurance policy for repair to your vehicle?	YES
If No, Please state action to be taken	
Vehicle Category	PRIVATE CAR

Insurance Company

Name of Insurance Company	AIG ASIA PACIFIC INSURANCE PTE. LTD.
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	1800084149
Cover Note Number	

Driver

Name of Driver	KAM YEOW BENG BOBBY
NRIC No	S1105131F
Date Of Birth	31/03/1955
Occupation	INDOOR
Date Of Driving Pass	28/01/1977
Driving Experience	41 YEARS AND 8 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-90288855
Fax Number	
Contact Number	
EMail Address	NOEMAIL

Address	74 HAZEL PARK TERRACE
Postcode	678907
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	SPOUSE
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	COLLIDED INTO PROPERTY
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles involved in the accident	
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

I WAS DRIVING STRAIGHT AT MCE TOWARDS CHANGI, ON THE MOST RIGHT LANE. SUDDENLY A CAR ON MY LEFT HAND SIDE CHANGED LANE TO MY LANE. I TRIED TO AVOID AN ACCIDENT, AND SO SWERVE TO THE RIGHT AND THEN ACCIDENTALLY HIT THE WALL OF THE TUNNEL

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	
Vehicle Make/Model/Colour	WALL
Details Of Properties	
Vehicle Category	NA/UNKNOWN
Name of Driver	
NRIC/Passport Number	
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

Sketch Plan

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.

Policyholder's Signature

Date & Time: 23/10/2018
11:45 am

Driver's Signature

(If driver is not the policyholder)
Date & Time: 23/10/2018
11:45 am


Reporting Centre Personnel's Signature

Name: Tan Keng
NRIC/FIN No.: G2090127A



Sketch Plan #2

SKETCH PLAN

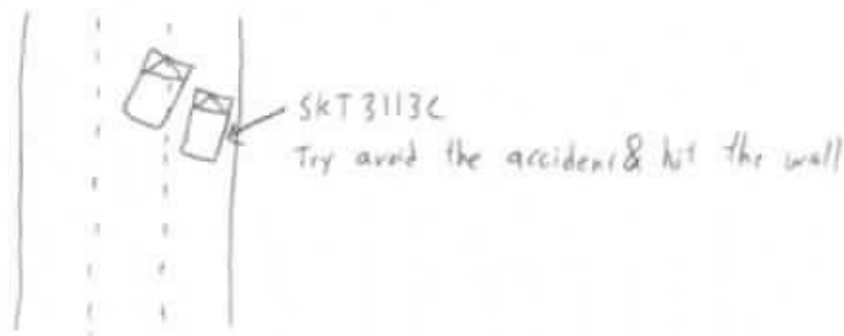

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

I was driving straight at MCE towards Chang, on the most right lane. Suddenly, a car on my left hand side changed lane to my lane. I tried to avoid an accident, and so swerve to the right and then accidentally hit the wall of the tunnel.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature

Date & Time: 23/10/2018
11:45am

Driver's Signature

(If driver is not the policyholder)

Date & Time: 23/10/2018
11:45am



Reporting Centre Personnel's Signature

Name: Terry Fung
NRIC/FIN No.: G2040672

Accident Photo



AUDI AUTO PROTECTOR PRIVATE VEHICLE

Name of Policyholder : ONG LAY GUAT JESSIE MRS JESSIE KAM
Period of Insurance : 28 Jul 2018 To 27 Jul 2020
Engine No. : CVK064044
Chassis No. : WAUZZZF40JN015000

Vehicle No. : SKT3113C
Policy No. : 1800084149
Endorsement No. :
Issued Date : 30 Jul 2018

ABOUT THE COVER

Make/Model : AUDI
Engine Capacity/Tonnage : 1,984.00 CC
Driver Restriction : NA
Sum Insured : Market Value
Off Peak Car : No
First Year of Registration : 2018
Insuring with COE/PARF : Yes

Person or Classes of Persons Entitled to Drive* :

- a) The Policyholder
 b) Any other person who is driving on the Policyholder's order or with his/her permission.
 This Policy will indemnify the Policyholder or any authorised driver only if he/she meets the specified age condition.

You have to pay an additional sum of \$3,000 as "Young and/or Inexperienced Driver Excess" ("YIDR") if You are or Your Authorised Driver (named or unnamed) is under the age of 23 and/or has less than 2 years' driving experience.

Age Condition : All Age Condition

Limitation as to use* :

Use only for social, domestic and pleasure purposes and for the Policyholder's business.

This Policy does not cover use for hire or reward, driving tuition, driving test, racing, pace-making, reliability trial or speed-testing, the carriage of goods other than samples in connection with any trade or business or use for any purpose in connection with Motor Trade.

Loss of Use 1800cc - 2000cc Optional

* Limitations rendered inoperative by Section 8 of the Motor Vehicles (Third-Party Risks and Compensation) Act (Cap. 189) and Section 95 of the Road Transport Act, 1967 (Malaysia), are not to be included under these headings.

EXCESS

Section 1

Fire - \$0 Own Damage - \$1600 Theft - \$0 Flood Cover - \$0

Section 2

Property Damage - \$0

Windscreen : \$100

Named Driver and Excess (where applicable)

ONG LAY GUAT JESSIE MRS JESSIE KAM - \$1600 (Own Damage)

APPROVED REPORTING CENTRES/AUTHORISED REPAIRERS (FOR CLAIMS RELATED REPAIRS)

1. Audi Customer Service Center Add: 55 Ubi Road 1 Singapore 408699 63662323

For other Approved Reporting Centres/AIG Authorised Repairers, please contact our 24-hour accident emergency hotline at +65 6338 6200. Alternatively, you may refer to AIG website www.aig.com.sg or AIG SG Mobile App. Simply search and download "AIG SG" from iTunes or Google Play.

IMPORTANT NOTES

Hire Purchase Company/Employer's Loan: OVERSEA-CHINESE BANKING CORPN LTD

We hereby certify that the policy to which this Certificate of Insurance relates is issued in accordance with the provisions of the Motor Vehicles (Third Party Risks and Compensation) Act (Cap. 189), Part IV of the Road Transport Act, 1967 (Malaysia) and Motor Vehicles (Third Party Risks) Rules, 1959 (Malaysia).

0504125256

PREMIUM LEASING -LSYA

281 ALEXANDRA ROAD AUDI CUSTOMER SERVICE CENTRE

SINGAPORE 159938

Underwritten by AIG Asia Pacific Insurance Pte. Ltd.

AIG Asia Pacific Insurance Pte. Ltd.

AUTHORISED REPRESENTATIVE

Cheng Chang Chee

IMPORTANT: KEEP THIS DOCUMENT IN YOUR CAR AT ALL TIMES.

What can the 24-hour AIG Auto Emergency Hotline provide for you?

- Immediate assistance after an accident
- Emergency breakdown service
- Towing service (accident or non-accident related)
- Advice on Motor Claims procedures
- Medical Referral Assistance

If no one is injured in the accident:

- You are not required to make any police report.
- Record vehicle number, name and address, insurance company and policy number of the other driver(s) and vehicle(s).
- Collect details (name, address and contact number) of witnesses and/or try to take photographs of the scene of the accident.
- Report the accident to us with your accident vehicle (whether damaged or not) via our approved reporting centres or authorised repairers within 24 hours or the next working day of the accident.

If the accident involves injuries or damage to government property & vehicles, foreign registered vehicles or non-injury hit & run case:

- Report the accident to the police, providing full details of the circumstances of the accident.
- Record vehicle number, name and address, insurance company and policy number of the other driver(s) and vehicle(s), if applicable.
- Collect details (name, address and contact number) of witnesses and/or try to take photographs of the scene of the accident.
- Report the accident to us with your accident vehicle (whether damaged or not) via our approved reporting centres or authorised repairers within 24 hours or the next working day of the accident.

What should I do in the event of an accident?

- Keep calm and move your car to a safe place.
- Do not admit or discuss fault or blame with the other party(ies).
- Report the accident to us with your accident vehicle (whether damaged or not) via our approved reporting centres or authorised repairers within 24 hours or the next working day of the accident.
- Submit Writ/Summons/Correspondences from third party(ies) to AIG immediately.

LOSS OF USE CAR REPLACEMENT BENEFIT

Applicable only if this benefit is included in your motor insurance. Please refer to your Policy Schedule for details. Policy terms and conditions apply. Please call our customer service hotline number (65) 6419-3000 for assistance.

The Certificate of Insurance (CI) should be produced without demand when collecting the Rental Car and the Rental Car Company reserves the right to verify the identity of the holder. The CI is the property of AIG and its use is subject to the terms and conditions contained in the Loss of Use Endorsement under the policy issued to the policyholder.

Steps to activate Loss of Use Car Replacement Benefit and Important Information

1. To activate your loss of use car replacement, please contact the Rental Car Company (listed below) after filing/reporting your accident claim.
2. Your rental car will be made available within **5** working hours of activation with the Rental Car Company.
3. At the time of collection of the Rental Car, the **original** insurance policy and schedule issued by AIG, a copy of the Accident Report from **Audi Customer Service Centre** must be produced.
4. The number of days is based on the period your vehicle is in the repair workshop unless the number of days of loss of use entitlement is stated in the Policy.
5. Rental cars are strictly for use in Singapore only.
6. Extension of rental beyond repair period approved by AIG surveyor will be chargeable by the Rental Car Company on per day basis.
7. Upgrade of Rental Car is available upon request subject to additional charges by the Rental Car Company.

Rental Car Company: Popular Rent A Car Pte. Ltd.

Activation Hotline: 67428888

501 Guillemard Road Singapore 399840

Operation Hours: Monday to Friday: 9am to 6pm Saturday (Half Day): 9am to 4pm

*The Rental Car Company's Terms & Conditions apply (i.e., refundable security deposit, excess liability for the Rental Car, Collision Damage Waiver, etc).

IMPORTANT NOTICE

If you sell your motor vehicle, this Notice is **IMPORTANT** and **MUST** be complied with. Policyholders are hereby warned that under the Motor Vehicles (Third Party Risks and Compensation) Act (Cap.99), it shall be unlawful for any person to use or cause or permit any other person to use a motor vehicle without a valid policy of insurance under the Act.

The Policyholder is further warned that on the sale of a motor vehicle, they must surrender the Certificate of Insurance and the Policy to the insurance company. If the Certificate of Insurance has been lost or destroyed, a Statutory Declaration to that effect must be made. Failure to comply with this obligation is an offence under the Motor Vehicles (Third Party Risks and Compensation) Act (Cap.88).

This Policy will cease to be valid once the motor vehicle has been sold to another person unless the transfer of interest has been duly notified to and agreed to by the insurance company concerned. If the insurance company agrees to cover the new owner, they will issue a new Certificate of Insurance in the new owner's name. The premium chargeable may vary according to the new owner's profile.



AIG Asia Pacific Insurance Pte. Ltd
AIG Building
78 Shenton Way
#07-16

MOTOR ACCIDENT INTERVIEW FORM

NAME : KAM YEOW BEN BOBBY
VEHICLE NUMBER : SKT3113 C
DATE/ TIME OF ACCIDENT : OCT 22, 2018 Around 3:30pm
PLACE OF ACCIDENT : MCE, towards Changi
THIRD PARTY VEHICLE (IF ANY) : NA

.....
WHERE DID YOU START YOUR JOURNEY AND WHERE WAS THE INTENDED DESTINATION BEFORE THE ACCIDENT?

PASIR PANJANG ROAD TO KALLANG LEISURE PARK

DID YOU DRINK ANY ALCOHOLIC DRINKS BEFORE YOU DRIVE ON THE DAY OF THE ACCIDENT? IF YES, DID THE TRAFFIC POLICE CONDUCT ANY BREATHE-ANALYSER TEST ON YOU? IF YES, WHAT WAS THE RESULTS?

NO

WHAT IS THE TYPE OF COLLISION AND THE EXTENSIVENESS OF THE DAMAGES TO ALL VEHICLES INVOLVED?

WITH THE WALL IN THE TUNNEL
NO OTHER VEHICLE INVOLVED

WERE YOU OR YOUR PASSENGER/S INJURED? IF INJURED, WHICH HOSPITAL? WERE YOU TAKEN TO THE TRAFFIC POLICE FOR INVESTIGATION?

NO PASSENGER

KAM YEOW BEN BOBBY

1 NOV 2018

NAME:

I AFFIRMED THE ABOVE INFORMATION IS GIVEN TO MY BEST KNOWLEDGE

1 NOV 2018

UNDERTAKING

I, KAM YEOW BENI BOBBY, (NRIC No. S1105131/F), hereby confirm that the Singapore Accident Statement lodged by me on 01/11/2018 at 11:45am hours pertaining to the accident involving motor car Reg. No: 8KT3113Z, in which I was the driver are true and accurate to the best of my knowledge, information and belief.

I acknowledge that my insurers are not liable under the contract of insurance if there is a breach of policy terms and conditions.

In the event that an unrelated/unreported third party property or injury claim arises or there is evidence emerges that there is a breach of policy terms and conditions, I irrevocably undertake to absolve my insurer from all liability under the contract of insurance and I undertake to re-pay any sums paid by my insurers pursuant to the contract of insurance upon receipt of written demand by my insurers.

Signature

:



Name of Insured / Driver

:

KAM YEOW BENI BOBBY

Nric No.

:

S1105131/F

Date

:

1 NOV 2018

Signature

:



Name of Policyholder

:

ONG LAY GUAN JESSIE

Nric No.

:

S1613295/J

Date

:

1 NOV 2018

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Telefax

Estimate	:	Accident Repairs
Workshop	:	Ubi Road 1
Contact No	:	6366 2323
Fax No	:	6841 1183
Reference	:	PA/OD/1221/2018/GW
Date	:	25-Oct-18

Vehicle IN workshop. Kindly arrange for survey.

Your insured vehicle no. **SKT 3113 C**

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 - Fax: 6256 4315

Owner's Name	:	Mrs. Ong Lay Guat Jessie Mrs Jessie Kam
Address	:	74Hazeal Park Terrance Singapore 678907
Telephone	:	(HP) 96669533
Type of Claim	:	Own Damage Claims
Policy No.	:	1800084149
Vehicle No	:	SKT 3113 C
Model Code	:	Audi A 4 Sedan 2.0 TFSI
Model / Year	:	Jul-18
Engine No	:	CVK 064044
Chassis No	:	WAUZZZF40JN015000
Mileage	:	6143 KM
Date In	:	23-Oct-18
Liability	:	-
Excess Cost	:	-
Estimated By	:	Johnny Boo / Allan Wu
Accident Date	:	22-Oct-18
Place of Accident	:	Along MCE Towards Changi

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel: 6366 2323 Fax: 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SKT 3113 C

S/N	Nature of Jobs	Estimated Charges
1	To remove and transfer front wire harness for headlights, horns, outside temperature sensor, headlight washer assy and front parking aid.	S/N \$ 480.00 ✓
2	To remove and transfer rhs front and rear door's multi-lock system and power window devices. Inspect for damages.	S/N \$ 560.00 ✓
3	To remove and reinstall center console. Renew both front seat belts and control unit, pillar trims, roof lining and both curtain air bags.	S/N \$ 2,800.00 ✓
4	To renew rhs front seat back rest, bench's leather covers and rhs side airbag.	S/n \$ 600.00 ✓
5	To dismantle and renew front bumper, rhs front fender, rhs headlight, rhs front door and rhs rear door. Re-organise crash management components. Reinstall all parts removed.	\$ 3,300.00 2000 1500
6	To respray front bumper, rhs front fender, rhs front door, door handles and rhs rear door.	\$ 3,100.00 2200
TOTAL LABOUR CHARGES - FRONT		: \$ 10,840.00

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SKT 3113 C

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
1	FRONT BUMPER <i>Deformed</i>	\$ 1,902.00	✓ 1521.60
2	FRONT BUMPER FIXING PARTS	\$ 245.00	X
3	FRONT BUMPER SECURING STRIP <i>2 Not New</i>	2 \$ 30.00	X
3	FRONT BUMPER CLOSING ELEMENT	\$ 180.00	X
4	FRONT BUMPER AIR GUIDE-RH <i>2 Not New</i>	\$ 73.00	X
5	FRONT BUMPER AIR GUID GRILLE-RH	\$ 118.00	X
6	FRONT BUMPER GUIDE SECTIO-RH <i>Damaged</i>	\$ 32.00	✓ 27.12
7	FRONT SENSOR <i>Not New</i>	\$ 211.00	X
8	FRONT SENSOR SEAL RING <i>Not New</i>	4 \$ 14.00	X
9	FRONT FENDER-RH <i>Dented</i>	\$ 665.00	✓ 532
10	FRONT FENDER ATTACHMENT PARTS-RH <i>New</i>	\$ 45.00	✓ 38
11	FRONT FENDER CLOSING ELEMENT-RH <i>Damaged</i>	\$ 44.00	? 34.56
12	FRONT FENDER BRACKET-RH <i>Bent</i>	\$ 31.00	✓ 25.20
13	FRONT FENDER BRACKET DEFORMATION-RH <i>New</i>	\$ 43.00	✓ 35.60
14	FRONT FENDER UPPER BRACKET-RH <i>Bent</i>	\$ 27.00	✓ 22.64
15	FRONT FENDER BRACE-RH <i>Bent</i>	\$ 103.00	✓ 82.40
16	WHEEL HOUSING LINER-RH <i>Deformed</i>	\$ 209.00	✓ 167.20
17	WHEEL HOUSING LINER ATTACHMENT PARTS <i>2 Not New</i>	\$ 78.00	? X
18	FRONT WHEEL SPOILER-RH <i>Crushed</i>	\$ 63.00	✓ 52.32
19	FRONT WHEEL SPOILER END PLATE-RH <i>Not New</i>	\$ 31.00	? X
20	FRONT STONE CHIP GUARD-RH <i>New</i>	\$ 44.00	✓ 36.64
SUB-TOTAL SPARE PARTS CHARGES - FRONT :		\$ 4,188.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SKT 3113 C

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
21	FRONT DOOR-RH <i>Dented</i>	\$ 2,048.00	✓ 1633.40
22	FRONT OUTER DOOR SEAL-RH <i>new</i>	\$ 176.00	✓ 140.40
23	BONDING AGENT <i>2 lit new</i>	\$ 43.00	? X
24	CLEANING SOLUTION <i>2 lit new</i>	\$ 64.00	? X
25	APPLICATOR <i>2 lit new</i>	\$ 7.00	? X
26	FRONT DOOR ATTACHMENT PARTS-RH <i>2 lit new</i>	\$ 462.00	? X
27	FRONT DOOR CATCH-RH <i>{ not new</i>	\$ 92.00	X
28	FRONT DOOR CATCH COVER-RH <i>{ new</i>	\$ 13.00	X
29	FRONT FENDER LEDGE COVER-RH <i>{ new</i>	\$ 27.00	✓ 22.24
30	FRONT FENDER LEDGE TOP COVER-RH <i>{ new</i>	\$ 20.00	✓ 16.16
31	LED HEADLIGHT-RH <i>not new</i>	\$ 6,973.00	X.
TOTAL SPARE PARTS CHARGES - FRONT :		\$ 14,113.00	
TOTAL LABOUR CHARGES - FRONT		\$ 10,840.00	
GRAND TOTAL - FRONT		\$ 24,953.00	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SKT 3113 C

S/N	Nature of Jobs	Estimated Charges
1	To remove and transfer rear parking aid and rear kick sensor. Check function.	S/N \$ 360.00 ✓
2	To renew rear windscreen and rhs 1/4 glass for fender renewal.	S/N \$ 600.00 ✓
3	To dislodge and reinstall rear wire harness for tail lights, battery manager, fuse and relay trays, electrical and audio components.	S/N \$ 1,400.00 ✓
4	To remove and reinstall rear seat assy, back rest.	S/N \$ 900.00 ✓
5	To dismantle rear bumper and rear lid. Cut out and reweld rhs rear fender and rhs wheel housing liner. Renew rear bumper. Re-organize crash management components. Reinstall all parts removed.	\$ 5,400.00 3000 3560
6	To respray rear bumper, RHS inner wheel housing, RHS rear fender, RHS sill panel, door entrances, roof channel, drain channel and end panelling. To carry out joint sealer work and stone chip treatment.	\$ 4,500.00 2200.
7	To renew rhs front rim and rhs rear rim. To carry out wheel alignment.	S/N \$ 320.00 ✓
8	To carry out diagnostic check.	S/N \$ 384.00 ✓
SUB-TOTAL LABOUR CHARGES - (REAR)		: \$ 13,864.00

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SKT 3113 C.

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
1	REAR DOOR-RH <i>Dented.</i>	\$ 1,928.00	✓ 1542.40
2	REAR OUTER DOOR SEA-RH <i>NEE</i>	\$ 176.00	✓ 147.60
3	BONDNG AGENT <i>NEE</i>	\$ 43.00	? X
4	CLEANING SOLUTION <i>NEE</i>	\$ 64.00	? X
5	APPLICATOR <i>NEE</i>	\$ 7.00	? X
6	SEALING STRIP <i>NEE</i>	\$ 14.00	? X
7	REAR DOOR ATTACHMENT PARTS-RH <i>NEE</i>	\$ 488.00	? X
8	REAR DOOR CATCH-RH	\$ 105.00	X
9	REAR DOOR CATCH COVER	\$ 12.00	X
10	REAR WINDOW REGULATOR-RH	\$ 242.00	X
11	SECTIONAL PART- SIDE PANEL-RH <i>Dented</i>	\$ 2,347.00	✓ 1872.60
12	REAR WINDOW <i>NEE</i>	\$ 1,014.00	✓ 811.20
13	PRIMER <i>NEE</i>	2 \$ 37.00	✓ 29.76
14	REAR SIDE WINDOW-RH <i>NEE</i>	\$ 541.00	✓ 432.40
15	REAR SIDE WINDOW TRIM STRI-RH <i>NEE</i>	\$ 426.00	X
16	REAR BUMPER <i>Deformed.</i>	\$ 1,907.00	✓ 1525.60
17	REAR BUMPER FIXING PARTS <i>NEE</i>	\$ 63.00	X
18	REAR BUMPER SECURING PLATE	4 \$ 56.00	X
19	REAR BUMPER SECURING STRIP	\$ 191.00	X
20	REAR BUMPER GUIDE SECTION-RH <i>Damaged</i>	\$ 38.00	X ✓ 30.40
SUB -SPARE PARTS		\$ 9,699.00	

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SKT 3113 C.

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
21	REAR WHEEL HOUSING LINER-RH <i>Rehnd</i>	S	215.00 ? <i>171.60</i>
22	REAR WHEEL HOUSING LINER ATTACHMENT PARTS-RH <i>not new</i>	S	78.00 X
23	REAR WHEEL HOUSING-RH <i>Repair</i>	S	545.00 +
24	ALUMINIUM RIM- RH FRONT/REAR <i>cut</i>	S	1,290.00 ✓ <i>1032.00</i>
25	RUBBER VALVE <i>not new</i>	8 S	23.00 X
26	DATA PLATE FOR TYRE PRESSURE <i>new</i>	S	33.00 ✓ <i>29.36</i>
27	ACRYLIC SEALANT	S/N S	180.00 ✓
28	CAVITY WAX	S/N S	140.00 ✓
29	STONE CHIP	S/N S	180.00 ✓
30	METAL FILLER POWDER	S/N S	280.00 ✓
31	REAR W/S SEALANT	S/N S	200.00 ✓
32	1/4 GALSS SEALANT	S/N S	100.00 ✓
33	SIDE AIRBAG UNIT-RH <i>Activated</i>	S	1,378.00 ✓ <i>1102.40</i>
34	SIDE AIRBAG WIRING HARNESS <i>{ Activated</i>	S	184.00 ✓ <i>147.20</i>
35	HEAD AIR BAG UNIT-RH/LH	2 S	3,384.00 ✓ <i>2707.20</i>
36	AIR BAG GUIDE-LH/RH <i>not new</i>	2 S	84.00 ? X
37	REAR CRASH SENSOR FOR AIR BAG <i>{ Activated</i>	S	273.00 ✓ <i>218.00</i>
38	AIR BAG CONTROL UNIT	S	1,870.00 ✓ <i>1496.00</i>
39	FUSE CONTROL MOUDULE <i>Damaged.</i>	S	470.00 ? <i>376</i>
40	THREE POINT AUTOMATIC SEAT BELT -LH/RH <i>Activated</i>	2 S	1,912.00 ✓ <i>1529.60</i>
SUB-SPARE PARTS		:	<u>\$ 12,819.00</u>

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SKT 3113 C.

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
41	SEAT BELT HEIGHT ADJUSTER <i>NP new</i>	2 S	306.00 *
42	MOULDED HEADLINING <i>sampled</i>	S	1,682.00 ✓ 1345.60
43	FRONT GRAB HANDLE, FOLDING	S	248.00 *
44	REAR GRAB HANDLE, FOLDING-LH/RH <i>NP new</i>	2 S	248.00 *
45	A PILLAR TRIM-LH/RH <i>schd</i>	2 S	360.00 * ✓ 287.20
46	DRIVER SEAT COVER - RHS <i>torn</i>	S	2,142.00 ✓ 1713.60
48	SUNDRIES <i>New -</i>	S	800.00 ? ✓ 925.6
TOTAL SPARE PARTS - frt/rear		:	\$ 42,417.00
TOTAL LABOUR CHARGES - frt/rear		:	\$ 24,704.00
TOTAL		:	<u>\$ 67,121.00</u>

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

2192140

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Name : Adrian Lim
Surveyed Date : 29/10/18
Authorised Date :
Excess Cost :
Liability :
Remarks : Not Authorised, 24 Days.

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Please Note : This estimate is based on visual inspection of the affected vehicle. Should we require further labour charges and spare parts in the progress of repair, we shall inform you accordingly. For inspection of vehicle, please refer to Ms Norah Khai at Tel:6768 9828 for appointment.

Yours faithfully,
Premium Automobiles Pte Ltd

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant

Premium Automobiles Pte Ltd

55 Ubi Road 1, Singapore 408699

Tel : (65) 6366 2323 Fax : (65) 6841 1183

Supplementary Estimate 1

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way
#07-16 AIG Building
Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept
Tel: 6841 0055 - Fax: 6256 4315

Estimate No.

Date

Service Advisor

Pages

Regn No

Model No

PA/OD/1221/2018/GW

16/11/2018

Kee Siang

1 of 1

SKT 3113 C

Audi A 4 Sedan 2.0 TFSI

Quantity	Description	Unit Price	Amount
Parts			
1	Wishbone link <i>Best</i>	\$ 762.00	\$ 609.20 ✓
2	Track Rod <i>Best</i>	\$ 149.00	\$ 119.20 ✓
3	Wheel bearing Housing <i>and</i>	\$ 868.00	\$ 694.40 ✓
4	Wheel bearing assembly <i>or</i>	\$ 394.00	\$ 314.80 ✓
5	Door seal Inner <i>per</i>	\$ 192.00	\$ 153.20 ✓
6	B PILLAR TRIM - LOWER RHS <i>Behind Arline</i>	\$ 135.00	\$ 107.60 ✓
7	SIDE AIR BAG - CONNECTOR HARNESS - EXTENSION	\$ 233.00	\$ 186.40 ✓
8	WHEELBUB - RHS FRONT <i>Dayd.</i>	\$ 657.00	\$ 525.60 ✓
		\$ 3,390.00	\$ 2,710.40
labour			
1	To remove and reinstall RHS <i>Real</i> front suspension, inspect for damages and renew according to damages. S/N	\$ 1,800.00	\$ 1,800.00 A ✓
TOTAL		\$ 5,190.00	\$ 4,510.40

For Premium Automobiles Pte Ltd

Adrian Ling

LKK Auto Consultants hereby notify the Repairer of the following:

- To resurvey before/during spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature: _____
Date: _____

Authorised Signature

Premium Automobiles Pte Ltd

55 Ubi Road 1, Singapore 408699

Tel : (65) 6366 2323 Fax : (65) 6841 1183

Supplementary Estimate 1

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd 78 Shenton Way #07-16 AIG Building Singapore 079120 Attn: Mr. Adrian Ling - Motor Claims Dept Tel: 6841 0055 - Fax: 6256 4315	Estimate No. PA/OD/1221/2018/GW Date 12-Feb-19 Service Advisor Tony Foong Pages 1 of 1 Regn No SKT 3113 C Model No Audi A 4 Sedan 2.0 TFSI
--	---

Quantity	Description	Unit Price	Amount
1	To reinstall rear windscreen and 1/4 glass solar film <i>Nec</i>	\$ 340.00	✓
		\$ 340.00	
TOTAL		\$ 340.00	

For Premium Automobiles Pte Ltd

Adrian Ling
HL



Authorised Signature

LXX Auto Components hence notify the Repairer of the followings:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No legal modification is allowed
- Supplementary items must be resurveyed and is subject to final approval from Insurance Company



Acknowledged by Repairer

Signature:

Date:


rk Order: 29407-1
: WAUZZZF40JN15000
hnician: BENG
onse: SKT 3113 C
age: 6143
e 22.11.18 10:06

Audi 2015- A4 (B9) 4X2 1BA

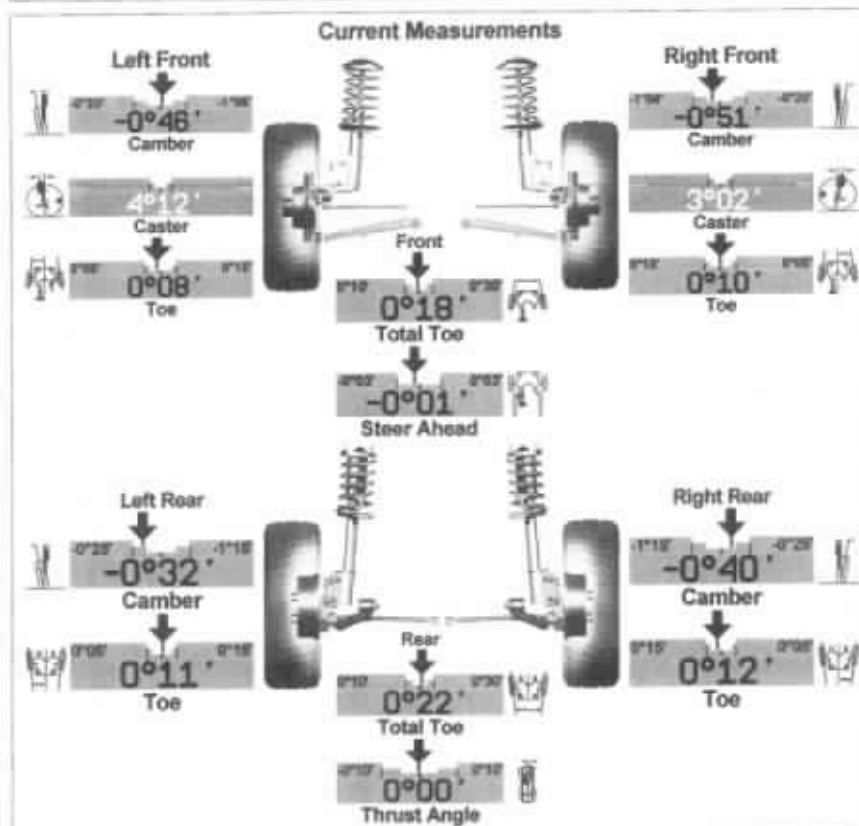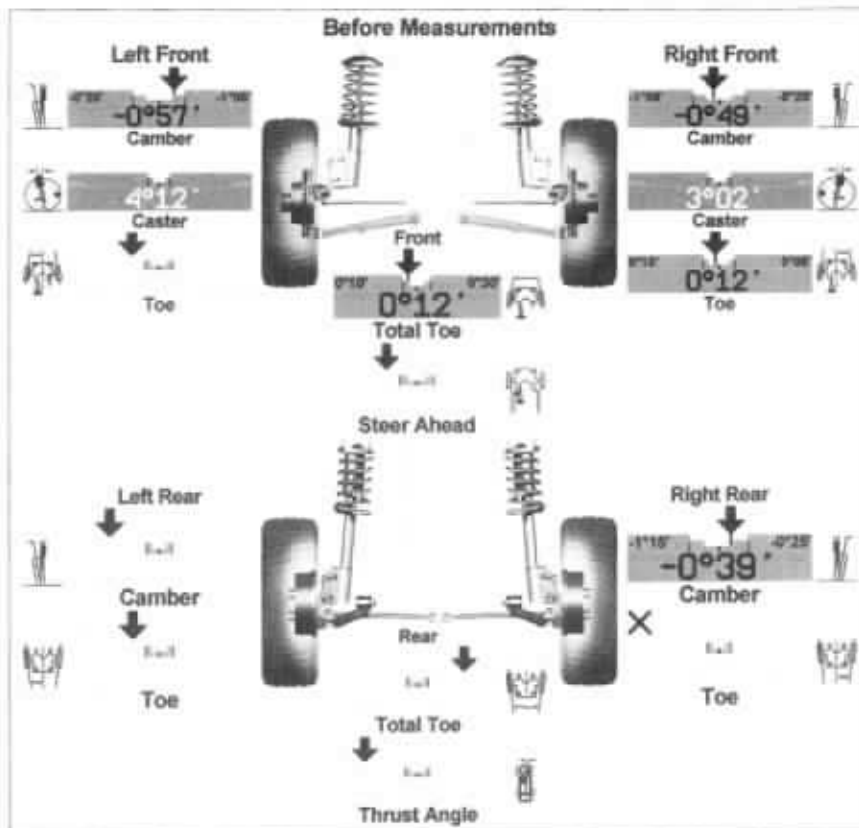


Work Order: 29407
VIN: WAUZZZF40JN15000
Technician: BENG
License: SKT 3113 C
Mileage: 6143
Date: 12.11.18 16:39

Audi : A4 : 2015- (B9 - 8W) : Standard Suspension (1BA)

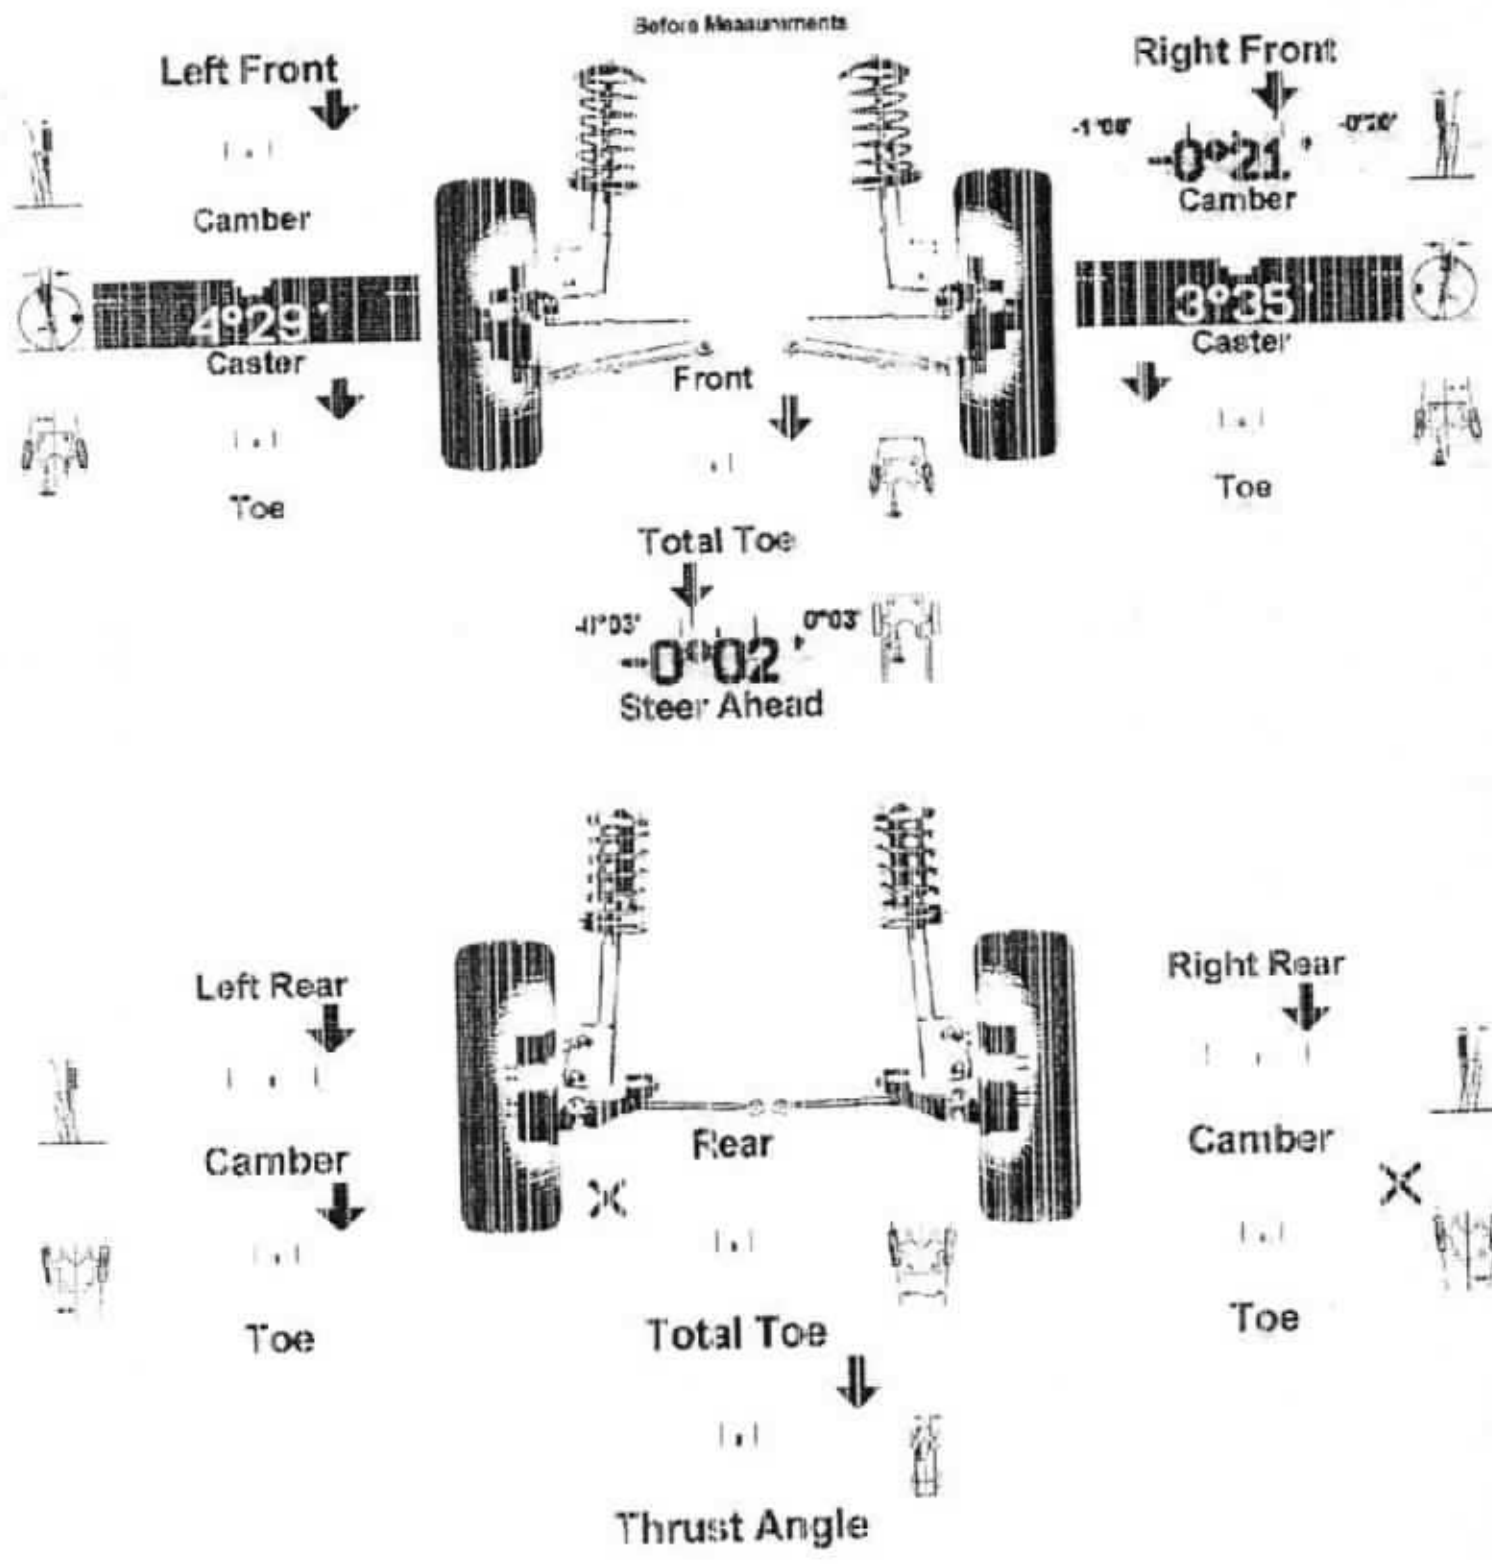

Work Order: 29407-1
IN: WAUZZZF40JN15000
Technician: BENG
License: SKT 3113 C
Image: 0143
Date: 22.11.18 10:06

Audi 2015- A4 (B9) 4X2 1BA

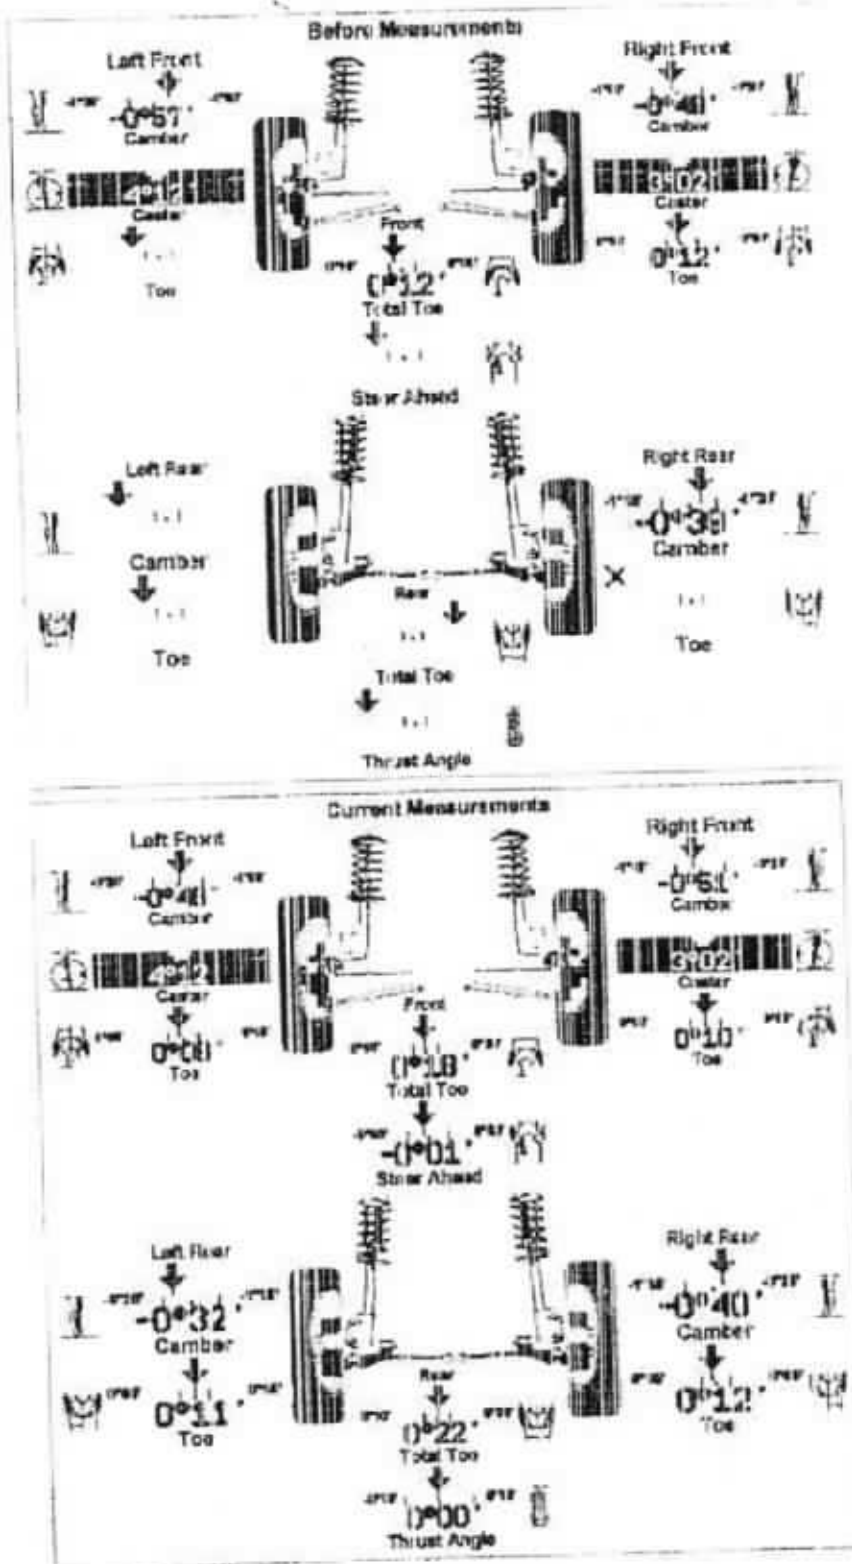

Premium Automobiles Pte Ltd

281 Alexandra Road Singapore 159938
RCB No. 199902271W
Telephone 6836 2223 Sales 6838 2223 Fax 6471 0523



Audi
87212

SALES AGREEMENT

Particulars of Customer

Full name as in NRIC/PASSPORT (Underline Surname)

Name: ONG LAY GUAT JESSIE MRS JESSIE KAM

Date: 21 Jun 2018

Address: 74 HAZEL PARK TERRACE

NRIC / Passport No.: S1613295J

13/12/93

Telephone No.: 96669533

Postal Code: 678907

Email: _____

Vehicle Details

Year of Manufacture: 2018

Chassis No.: WAUZZZF40JN015000

Make / Model: A4 SEDAN 2.0 TFSI 8W2ADG

Engine No.: CVK 064044

Registration Type: Private

Vehicle Regn: SKT 3113 C

Colour: MYTHOS BLACK, METALLIC

Trim: NOUGAT BROWN

Purchase Details

Basic Price with Std specifications, Imp Duty, ARF, Regn, COE and 1 year Road Tax

Accessories: VES Rebate/Surcharge

\$ 0

WF7+1XW+WPV - MM] nav w virtual cockpit,

\$ 00.00

Reverse Camera and Parking system plus

\$ 00.00

\$ _____

\$ _____

\$ _____

\$ _____

\$ _____

\$ _____

\$ _____

\$ _____

Discount Price:

\$ 981.00

Insurance Subsidy:

\$ _____

Total Purchase Price:

\$ _____

Deposit Paid:

\$ 000.00

(Non-Refundable)

☐ Visa:

☐ Cash:

☐ Cheque No.:

Receipt No. / Date:

Important:

1. The above prices and specifications are subject to change without notice.
2. Full car booking deposit must be made on the date of this Sales Agreement, failing which this Sales Agreement shall be deemed cancelled by both parties and any deposit received by the Company shall be forfeited by the Company henceforth.
3. The purchaser must register the vehicle if available within the month of obtaining the COE and full payment must be made before registration.
4. The company's Official Receipt will acknowledge and evidence any payment made by the purchaser for the vehicle.
5. Cheques must be crossed and made payable to the company.
6. The Company is not responsible for any payments made for the purchase of motor accessories unless the purchases are stated in this Agreement and substantiated by the Company's Official Receipt.
7. This Agreement is not transferable and not assignable and only the name stated herein is recognised for registration of the vehicle. The Company reserves the right to refuse to register the vehicle in any name other than that given in this Agreement.
8. In the event the purchaser does not proceed with the purchase of the motor vehicle, the deposit paid by the purchaser to the Company, any advance payment and any other payment shall not be refunded to the purchaser.
9. In the event the purchase of the motor vehicle is not completed, by reason of the failure of the Company to obtain a COE the deposit paid by the purchaser to the Company, any advance payment and any other payment shall be refunded to the purchaser.
10. This Agreement is subject to the Conditions of Sale overleaf.
11. Car performance data eg. fuel consumption figures, power and torque, acceleration, etc can only be treated as indicative figures provided by test bodies under test conditions which cannot be interpreted as a guarantee to the performance during actual usage.
12. Engine oil consumption up to 1 litre per 1,000km is an accepted characteristics depending on the type of engine Oil used.
13. The contract will be void if full documentations for COE bidding and deposit is not submitted prior to the COE Bidding Exercise.

I hereby accept the above mentioned terms and conditions detailed above and on the overleaf, and confirm there is no other oral and unwritten warranty in this agreement

Purchaser's Signature

Date 21 Jun 2018

Witnessed by

Sales Executive Lee Sum Yee Adriana

Date 21 Jun 2018

Signature

Agreed on behalf of Premium Automobiles Pte Ltd

Management

Signature

Date 21 Jun 2018

Original copy for Finance/ Photostated copy for customer

Premium Automobiles Pte Ltd

Audi Centre Singapore

281 Alexandra Road, Singapore 159938, Tel 6836 2223 Fax 6471 0523

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel: 6366 2323 Fax: 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SKT 3113 C

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
1	FRONT BUMPER <i>Deformed</i>	\$ 1,902.00	✓
2	FRONT BUMPER FIXING PARTS	\$ 245.00	X
3	FRONT BUMPER SECURING STRIP <i>Not New</i>	2 \$ 30.00	X
3	FRONT BUMPER CLOSING ELEMENT	\$ 180.00	X
4	FRONT BUMPER AIR GUIDE-RH <i>Not New</i>	\$ 73.00	X
5	FRONT BUMPER AIR GUID GRILLE-RH <i>Not New</i>	\$ 118.00	X
6	FRONT BUMPER GUIDE SECTIO-RH <i>Damaged</i>	\$ 32.00	✓
7	FRONT SENSOR <i>Not New</i>	\$ 211.00	X
8	FRONT SENSOR SEAL RING <i>Not New</i>	4 \$ 14.00	X
9	FRONT FENDER-RH <i>Dented</i>	\$ 665.00	✓
10	FRONT FENDER ATTACHMENT PARTS-RH <i>New</i>	\$ 45.00	✓
11	FRONT FENDER CLOSING ELEMENT-RH ?	\$ 44.00	?
12	FRONT FENDER BRACKET-RH <i>Bent</i>	\$ 31.00	✓
13	FRONT FENDER BRACKET DEFORMATION-RH <i>New</i>	\$ 43.00	✓
14	FRONT FENDER UPPER BRACKET-RH <i>Bent</i>	\$ 27.00	✓
15	FRONT FENDER BRACE-RH <i>Bent</i>	\$ 103.00	✓
16	WHEEL HOUSING LINER-RH <i>Deformed</i>	\$ 209.00	✓
17	WHEEL HOUSING LINER ATTACHMENT PARTS ?	\$ 78.00	?
18	FRONT WHEEL SPOILER-RH <i>Cracked</i>	\$ 63.00	✓
19	FRONT WHEEL SPOILER END PLATE-RH ?	\$ 31.00	?
20	FRONT STONE CHIP GUARD-RH <i>New</i>	\$ 44.00	✓
SUB-TOTAL SPARE PARTS CHARGES - FRONT :		<u>\$ 4,188.00</u>	

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nelli.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel: 6366 2323 Fax: 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SKT 3113 C

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
21	FRONT DOOR-RH <i>Dented</i>	\$ 2,048.00	✓
22	FRONT OUTER DOOR SEAL-RH <i>nee</i>	\$ 176.00	✓
23	BONDING AGENT ?	\$ 43.00	?
24	CLEANING SOLUTION ?	\$ 64.00	?
25	APPLICATOR ?	\$ 7.00	?
26	FRONT DOOR ATTACHMENT PARTS-RH ?	\$ 462.00	?
27	FRONT DOOR CATCH-RH <i>{ not</i>	\$ 92.00	x
28	FRONT DOOR CATCH COVER-RH <i>nee</i>	\$ 13.00	x
29	FRONT FENDER LEDGE COVER-RH <i>{ nee</i>	\$ 27.00	✓
30	FRONT FENDER LEDGE TOP COVER-RH	\$ 20.00	✓
31	LED HEADLIGHT-RH <i>not nee</i>	\$ 6,973.00	x
TOTAL SPARE PARTS CHARGES - FRONT		\$ 14,113.00	:
TOTAL LABOUR CHARGES - FRONT		\$ 10,840.00	
GRAND TOTAL - FRONT		\$ 24,953.00	

All charges are not inclusive of GST.

Legend: Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special NetL.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SKT 3113 C.

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
1	REAR DOOR-RH <i>Dented.</i>	\$ 1,928.00	✓
2	REAR OUTER DOOR SEA-RH <i>nee</i>	\$ 176.00	✓
3	BONDNG AGENT ?	\$ 43.00	?
4	CLEANING SOLUTION ?	\$ 64.00	?
5	APPLICATOR ?	\$ 7.00	?
6	SEALING STRIP ?	\$ 14.00	?
7	REAR DOOR ATTACHMENT PARTS-RH ?	\$ 488.00	?
8	REAR DOOR CATCH-RH	\$ 105.00	✓
9	REAR DOOR CATCH COVER	\$ 12.00	✓
10	REAR WINDOW REGULATOR-RH	\$ 242.00	✓
11	SECTIONAL PART- SIDE PANEL-RH <i>Dented.</i>	\$ 2,347.00	✓
12	REAR WINDOW <i>nee</i>	\$ 1,014.00	✓
13	PRIMER <i>nee</i>	2 \$ 37.00	✓
14	REAR SIDE WINDOW-RH <i>nee</i>	\$ 541.00	✓
15	REAR SIDE WINDOW TRIM STRI-RH <i>not nee</i>	\$ 426.00	✓
16	REAR BUMPER <i>Deformed.</i>	\$ 1,907.00	✓
17	REAR BUMPER FIXING PARTS <i>not nee</i>	\$ 63.00	✓
18	REAR BUMPER SECURING PLATE	4 \$ 56.00	✓
19	REAR BUMPER SECURING STRIP	\$ 191.00	✓
20	REAR BUMPER GUIDE SECTION-RH	\$ 38.00	✓
SUB -SPARE PARTS		\$ 9,699.00	

Legend: Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel: 6366 2323 Fax: 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SKT 3113 C.

		Damage Parts & Prices	
S/N	Parts Description	S/NETT	REMARKS
21	REAR WHEEL HOUSING LINER-RH ? <i>de</i> ✓	\$	215.00 ?
22	REAR WHEEL HOUSING LINER ATTACHMENT PARTS-RH <i>not new</i>	\$	78.00 X
23	REAR WHEEL HOUSING-RH <i>Regir</i>	\$	545.00 +
24	ALUMINIUM RIM- RH FRONT/REAR <i>cut</i>	\$	1,290.00 ✓
25	RUBBER VALVE <i>not new</i>	8 \$	23.00 X
26	DATA PLATE FOR TYRE PRESSURE <i>new</i>	\$	33.00 ✓
27	ACRYLIC SEALANT	S/N \$	180.00 ✓
28	CAVITY WAX	S/N \$	140.00 ✓
29	STONE CHIP	S/N \$	180.00 ✓
30	METAL FILLER POWDER	S/N \$	280.00 ✓
31	REAR W/S SEALANT	S/N \$	200.00 ✓
32	1/4 GALLS SEALANT	S/N \$	100.00 ✓
33	SIDE AIRBAG UNIT-RH <i>Activated</i>	\$	1,378.00 ✓
34	SIDE AIRBAG WIRING HARNESS } <i>Activated</i>	\$	184.00 ✓
35	HEAD AIR BAG UNIT-RH/LH	2 \$	3,384.00 ✓
36	AIR BAG GUIDE-LH/RH ?	2 \$	84.00 ?
37	REAR CRASH SENSOR FOR AIR BAG } <i>Activated</i>	\$	273.00 ✓
38	AIR BAG CONTROL UNIT	\$	1,870.00 ✓
39	FUSE CONTROL MOUDULE ?	\$	470.00 ?
40	THREE POINT AUTOMATIC SEAT BELT -LH/RH <i>Activated</i>	\$	1,912.00 ✓
SUB-SPARE PARTS		\$ 12,819.00	

Legend: Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

16/11/13

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SKT 3113 C.

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
41	SEAT BELT HEIGHT ADJUSTER <i>Not new</i>	2 \$ 306.00	X
42	MOULDED HEADLINING <i>crumpled</i>	\$ 1,682.00	✓
43	FRONT GRAB HANDLE, FOLDING	\$ 248.00	X
44	REAR GRAB HANDLE, FOLDING-LH/RH <i>Not new</i>	2 \$ 248.00	X
45	A PILLAR TRIM-LH/RH	2 \$ 360.00	X
46	DRIVER SEAT COVER - RHS <i>torn</i>	\$ 2,142.00	✓
48	SUNDRIES	\$ 800.00	?
TOTAL SPARE PARTS - frt/rear		: \$ 42,417.00	
TOTAL LABOUR CHARGES - frt/rear		: \$ 24,704.00	
TOTAL		: <u>\$ 67,121.00</u>	

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Telefax

Estimate	:	Accident Repairs
Workshop	:	Ubi Road 1
Contact No	:	6366 2323
Fax No	:	6841 1183
Reference	:	PA/OD/1221/2018/GW
Date	:	25-Oct-18

Vehicle IN workshop. Kindly arrange for survey.

Your insured vehicle no. **SKT 3113 C**

AIG Asia Pacific Insurance Pte Ltd
78 Shenton Way
#07-16 AIG Building
Singapore 079120

*Hi Adrian
24 days exclude 4 Sundays -
ok- j b 13 Mar 19*

Attn: Mr. Adrian Ling - Motor Claims Dept
Tel: 6841 0055 - Fax: 6256 4315

Owner's Name	:	Mrs. Ong Lay Guat Jessie Mrs Jessie Kam
Address	:	74Hazeal Park Terrance Singapore 678907
Telephone	:	(HP) 96669533
Type of Claim	:	Own Damage Claims
Policy No.	:	1800084149
Vehicle No	:	SKT 3113 C
Model Code	:	Audi A 4 Sedan 2.0 TFSI
Model / Year	:	Jul-18
Engine No	:	CVK 064044
Chassis No	:	WAUZZZF40JN015000
Mileage	:	6143 KM
Date In	:	23-Oct-18
Liability	:	-
Excess Cost	:	-
Estimated By	:	Johnny Boo / Allan Wu
Accident Date	:	22-Oct-18
Place of Accident	:	Along MCE Towards Changi

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SKT 3113 C

S/N	Nature of Jobs	Estimated Charges			
1	To remove and transfer front wire harness for headlights, horns, outside temperature sensor, headlight washer assy and front parking aid.	S/N	\$ 480.00	\$	480.00
2	To remove and transfer rhs front and rear door's multi-lock system and power window devices. Inspect for damages.	S/N	\$ 560.00	\$	560.00
3	To remove and reinstall center console. Renew both front seat belts and control unit, pillar trims, roof lining and both curtain air bags.	S/N	\$ 2,800.00	\$	2,800.00
4	To renew rhs front seat back rest, bench's leather covers and rhs side airbag.	S/n	\$ 600.00	\$	600.00
5	To dismantle and renew front bumper, rhs front fender, rhs headlight, rhs front door and rhs rear door. Re-organise crash management components. Reinstall all parts removed. (Include rear door \$500/-)		\$ 3,300.00	\$	2,000.00
6	To respray front bumper, rhs front fender, rhs front door, door handles and rhs rear door.		\$ 3,100.00	\$	2,200.00
TOTAL LABOUR CHARGES - FRONT		:	\$ 10,840.00	\$	8,640.00

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SKT 3113 C

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
1	FRONT BUMPER	\$ 1,902.00	\$ 1,521.60
2	FRONT BUMPER FIXING PARTS	\$ 245.00	
3	FRONT BUMPER SECURING STRIP	2 \$ 30.00	
3	FRONT BUMPER CLOSING ELEMENT	\$ 180.00	
4	FRONT BUMPER AIR GUIDE-RH	\$ 73.00	
5	FRONT BUMPER AIR GUID GRILLE-RH	\$ 118.00	
6	FRONT BUMPER GUIDE SECTIO-RH	\$ 32.00	\$ 27.12
7	FRONT SENSOR	\$ 211.00	
8	FRONT SENSOR SEAL RING	4 \$ 14.00	
9	FRONT FENDER-RH	\$ 665.00	\$ 532.00
10	FRONT FENDER ATTACHMENT PARTS-RH	\$ 45.00	\$ 38.00
11	FRONT FENDER CLOSING ELEMENT-RH	\$ 44.00	\$ 34.56
12	FRONT FENDER BRACKET-RH	\$ 31.00	\$ 25.20
13	FRONT FENDER BRACKET DEFORMATION-RH	\$ 43.00	\$ 35.60
14	FRONT FENDER UPPER BRACKET-RH	\$ 27.00	\$ 22.64
15	FRONT FENDER BRACE-RH	\$ 103.00	\$ 82.40
16	WHEEL HOUSING LINER-RH	\$ 209.00	\$ 167.20
17	WHEEL HOUSING LINER ATTACHMENT PARTS	\$ 78.00	
18	FRONT WHEEL SPOILER-RH	\$ 63.00	\$ 52.32
19	FRONT WHEEL SPOILER END PLATE-RH	\$ 31.00	
20	FRONT STONE CHIP GUARD-RH	\$ 44.00	\$ 36.64
SUB-TOTAL SPARE PARTS CHARGES - FRONT :		\$ 4,188.00	\$ 2,575.28

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SKT 3113 C

S/N	Parts Description	<u>Damage Parts & Prices</u>	
		S/NETT	REMARKS
			\$ 2,575.28
21	FRONT DOOR-RH	\$ 2,048.00	\$ 1,638.40
22	FRONT OUTER DOOR SEAL-RH	\$ 176.00	\$ 140.40
23	BONDING AGENT	\$ 43.00	
24	CLEANING SOLUTION	\$ 64.00	
25	APPLICATOR	\$ 7.00	
26	FRONT DOOR ATTACHMENT PARTS-RH	\$ 462.00	
27	FRONT DOOR CATCH-RH	\$ 92.00	
28	FRONT DOOR CATCH COVER-RH	\$ 13.00	
29	FRONT FENDER LEDGE COVER-RH	\$ 27.00	\$ 22.24
30	FRONT FENDER LEDGE TOP COVER-RH	\$ 20.00	\$ 16.16
31	LED HEADLIGHT-RH	\$ 6,973.00	
TOTAL SPARE PARTS CHARGES - FRONT		\$ 14,113.00	\$ 4,392.48
TOTAL LABOUR CHARGES - FRONT		\$ 10,840.00	\$ 8,640.00
GRAND TOTAL - FRONT		\$ 24,953.00	\$ 13,032.48

All charges are not inclusive of GST.

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Estimated Labour Charges for Accident Vehicle SKT 3113 C

S/N	Nature of Jobs		Estimated Charges		
	c/f front		\$ 8,640.00	\$	8,640.00
1	To remove and transfer rear parking aid and rear kick sensor. Check function.	S/N	\$ 360.00	\$	360.00
2	To renew rear windscreen and rhs 1/4 glass for fender renewal.	S/N	\$ 600.00	\$	600.00
3	To dislodge and reinstall rear wire harness for tail lights, battery manager, fuse and relay trays, electrical and audio components.	S/N	\$ 1,400.00	\$	1,400.00
4	To remove and reinstall rear seat assy, back rest.	S/N	\$ 900.00	\$	900.00
5	To dismantle rear bumper and rear lid. Cut out and reweld rhs rear fender and rhs wheel housing liner. Renew rear bumper. Re-organize crash management components. Reinstall all parts removed. (Added \$500/- repair wheelhouse)		\$ 5,400.00	\$	3,500.00
6	To respray rear bumper, RHS inner wheel housing, RHS rear fender, RHS sill panel, door entrances, roof channel, drain channel and end panelling. To carry out joint sealer work and stone chip treatment.		\$ 4,500.00	\$	2,200.00
7	To renew rhs front rim and rhs rear rim. To carry out wheel alignment.	S/N	\$ 320.00	\$	320.00
8	Supplementary (Solar Film)		\$ 340.00	\$	340.00
8A	Added labour charges - see attached - 16 Nov 18	S/N	\$ 1,800.00	\$	1,800.00
9	To carry out diagnostic check.	S/N	\$ 384.00	\$	384.00
SUB-TOTAL LABOUR CHARGES - (REAR)			\$ 24,644.00	\$	20,444.00

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SKT 3113 C.

S/N	Parts Description	Damage Parts & Prices	
		S/NETT	REMARKS
	<i>Front materials - c/f</i>	\$ 14,113.00	\$ 4,392.48
1	REAR DOOR-RH	\$ 1,928.00	\$ 1,542.40
2	REAR OUTER DOOR SEA-RH	\$ 176.00	\$ 147.60
3	BONDNG AGENT	\$ 43.00	
4	CLEANING SOLUTION	\$ 64.00	
5	APPLICATOR	\$ 7.00	
6	SEALING STRIP	\$ 14.00	
7	REAR DOOR ATTACHMENT PARTS-RH	\$ 488.00	
8	REAR DOOR CATCH-RH	\$ 105.00	
9	REAR DOOR CATCH COVER	\$ 12.00	
10	REAR WINDOW REGULATOR-RH	\$ 242.00	
11	SECTIONAL PART- SIDE PANEL-RH	\$ 2,347.00	\$ 1,877.60
12	REAR WINDOW	\$ 1,014.00	\$ 811.20
13	PRIMER	2 \$ 37.00	\$ 29.76
14	REAR SIDE WINDOW-RH	\$ 541.00	\$ 432.40
15	REAR SIDE WINDOW TRIM STRI-RH	\$ 426.00	
16	REAR BUMPER	\$ 1,907.00	\$ 1,525.60
17	REAR BUMPER FIXING PARTS	\$ 63.00	
18	REAR BUMPER SECURING PLATE	4 \$ 56.00	
19	REAR BUMPER SECURING STRIP	\$ 191.00	
20	REAR BUMPER GUIDE SECTION-RH	\$ 38.00	\$ 30.40
	SUB -SPARE PARTS	\$ 23,812.00	\$ 10,789.44

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved

Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SKT 3113 C.

S/N	Parts Description	Damage Parts & Prices			
			S/NETT	REMARKS	
		<i>c/f</i>	\$	23,812.00	\$ 10,789.44
21	REAR WHEEL HOUSING LINER-RH		\$	215.00	\$ 171.60
22	REAR WHEEL HOUSING LINER ATTACHMENT PARTS-RH		\$	78.00	
23	REAR WHEEL HOUSING-RH		\$	545.00	
24	ALUMINIUM RIM- RH FRONT/REAR		\$	1,290.00	\$ 1,032.00
25	RUBBER VALVE	8	\$	23.00	
26	DATA PLATE FOR TYRE PRESSURE		\$	33.00	\$ 27.36
27	ACRYLIC SEALANT	S/N	\$	180.00	\$ 180.00
28	CAVITY WAX	S/N	\$	140.00	\$ 140.00
29	STONE CHIP	S/N	\$	180.00	\$ 180.00
30	METAL FILLER POWDER	S/N	\$	280.00	\$ 280.00
31	REAR W/S SEALANT	S/N	\$	200.00	\$ 200.00
32	1/4 GALSS SEALANT	S/N	\$	100.00	\$ 100.00
33	SIDE AIRBAG UNIT-RH		\$	1,378.00	\$ 1,102.40
34	SIDE AIRBAG WIRING HARNESS		\$	184.00	\$ 147.20
35	HEAD AIR BAG UNIT-RH/LH	2	\$	3,384.00	\$ 2,707.20
36	AIR BAG GUIDE-LH/RH	2	\$	84.00	
37	REAR CRASH SENSOR FOR AIR BAG		\$	273.00	\$ 218.00
38	AIR BAG CONTROL UNIT		\$	1,870.00	\$ 1,496.00
39	FUSE CONTROL MOUDULE		\$	470.00	\$ 376.00
40	THREE POINT AUTOMATIC SEAT BELT -LH/RH	2	\$	1,912.00	\$ 1,529.60
SUB-SPARE PARTS			\$	36,631.00	\$ 20,676.80

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles

55 Ubi Road 1, Singapore 408699
Tel : 6366 2323 Fax : 6841 1183

Telefax

Material List for Accident Vehicle Regn No. SKT 3113 C.

S/N	Parts Description	c/f	Damage Parts & Prices	
			S/NETT	REMARKS
			\$ 36,631.00	\$ 20,676.80
41	SEAT BELT HEIGHT ADJUSTER	2	\$ 306.00	
42	MOULDED HEADLINING		\$ 1,682.00	\$ 1,345.60
43	FRONT GRAB HANDLE, FOLDING		\$ 248.00	
44	REAR GRAB HANDLE, FOLDING-LH/RH	2	\$ 248.00	
45	A PILLAR TRIM-LH/RH	2	\$ 360.00	\$ 287.20
46	DRIVER SEAT COVER - RHS		\$ 2,142.00	\$ 1,713.60
47	Added parts - see attached		\$ 3,390.00	\$ 2,710.40
49	SUNDRIES		\$ 800.00	\$ 92.56
	TOTAL SPARE PARTS - frt/rear	:	\$ 45,807.00	\$ 26,826.16
	TOTAL LABOUR CHARGES - frt/rear	:	\$ 24,644.00	\$ 20,444.00
	TOTAL	:	\$ 70,451.00	\$ 47,270.16

Legend : Remarks (OK) = Approved, Remarks (X) = Not approved
Spare parts are Special Nett.

Premium Automobiles Pte Ltd

55 Ubi Road 1, Singapore 408699

Tel : (65) 6366 2323 Fax : (65) 6841 1183

Supplementary Estimate 1

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd 78 Shenton Way #07-16 AIG Building Singapore 079120 Attn: Mr. Adrian Ling - Motor Claims Dept Tel: 6841 0055 - Fax: 6256 4315		Estimate No. Date Service Advisor Pages Regn No Model No	PA/OD/1221/2018/GW 12-Feb-19 Tony Foong 1 of 1 SKT 3113 C Audi A 4 Sedan 2.0 TFSI
Quantity	Description	Unit Price	Amount
1	To reinstall rear windscreen and 1/4 glass solar film	\$ 340.00	\$ 340.00
		\$ 340.00	\$ 340.00
	TOTAL	\$ 340.00	\$ 340.00

For Premium Automobiles Pte Ltd

Authorised Signature

Premium Automobiles

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Telefax

Name :
Surveyed Date :
Authorised Date :
Excess Cost :
Liability :
Remarks :

Please Note : This estimate is based on visual inspection of the affected vehicle.
Should we require further labour charges and spare parts in the progress of repair, we shall inform you accordingly.
For inspection of vehicle, please refer to Ms Norah Khai at
Tel:6768 9828 for appointment.

Yours faithfully,
Premium Automobiles Pte Ltd

Johnny Boo
Body Repair Manager

Allan Wu
Claims Consultant

Premium Automobiles

AIG Asia Pacific Insurance Pte Ltd
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Attn: Motor Claims Dept
Yr Ref: SKT 3113 C

Norah Khai
6768 9911
6841 1183
Nora.khai@premiumauto.com.sg
Body & Paint Dept
PA/OD/1221/2018/NH

5TH DEC 2019

from
Telephone +65-
Telefax +65-
EMail
Our department
Our Ref
Your Ref
Date

Dear Sir,

total pages

RE: INSURANCE CLAIM FOR SKT 3113 C, Audi A4 SEDAN 2.0 TFSI.

Premium Automobiles Pte Ltd
Showroom
9 Leng Kee Road
Singapore 159090
Telephone (65) 6566 1111
Telefax (65) 6471 3733

With reference to the above-mentioned vehicle, no. **SKT 3113 C**, claimant, **Ms. Ong Lay Guat Jessie**, please find the related document per attached.

1. A copy of the Original invoice no. 85014545 – S\$ 48,867.07
2. A copy of the Discharge Voucher duly signed by client.

Service & Parts Centres
55 Ubi Rd 1
Singapore 408699
Telephone (65) 6336 2323
Telefax (65) 684 11183

Based on the above document, we would appreciate you could expedite the payment soonest possible.

If you require any further clarification, please do not hesitate to contact me at 6768 9911.

Regards

This is a computer-generated document. No signature is required.

Norah Khai
Claims Dept

Encl
AIG – SKT 3113 C

Premium Automobiles Pte Ltd



Audi Centre Singapore
261 Alexandra Road
Singapore 159938
Main Telephone 6386 2223
Main Telefax 6471 3733

Alexandra Service Centre
261 Alexandra Road
Singapore 159938
Main Telephone 6386 2223
Main Telefax 6475 1023

Ubi Service Centre
55 Ubi Road 1
Singapore 408699
Main Telephone 6386 2323
Main Telefax 6641 1163

Customer Service
Service Appointment 6366 2323
24-hour Breakdown Service 9828 1233
Email customer.care@premiumauto.com.sg

INS TAX INVOICE

Page 1 16:48

Company Reg. No. 199902271W
GST Reg. No. 199902271W

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120	Invoice No: 85014545 Date : 04/12/2019 Order : SKT3113C Term : 30	Account: A0006 (T 0) AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
---	--	--

Regn No: SKT3113C (V 38920)	Regn Date: 28/07/2018	Mileage: 30663	WIP No.: 29407
Model: A4 SEDAN 2.0 TFSI 8W2ADG (NAV,	Chassis: WAUZZZF40JND15000	Engine: CVK 064044	Dept: U
You have been assisted by :- UB-Tony Foong (33)			

		Details	Qty	Unit Price	Amount
S	SUBLET	M: TO RE-WORK DRIVER SEAT COVER	600.00	1.00	600.00
Q	EXC	M: 8888 Insurance Excess/Liability	-1600.00	1.00	-1,600.00
S	SUBLET	M: TO REINSTALL REAR WINDSCREEN AND 1/4 RH SOLAR FILM	340.00	1.00	340.00
S	BODYWORK	M: TO REMOVE AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS, OUTSIDE TEMPERATURE SENSOR, HEADLIGHT WASHER ASSY AND FRONT PARKING AID	480.00	1.00	480.00
S	BODYWORK	M: TO REMOVE AND TRANSFER RHS FRONT AND REAR DOOR'S MULTI LOCK SYSTEM AND POWER WINDOW DEVICES. INSPECT FOR DAMAGE	560.00	1.00	560.00
S	BODYWORK	M: TO REMOVE AND REINSTALL CENTER CONSOLE. RENEW BOTH FRONT SEAT BELTS AND CONTROL UNIT, PILLAR TRIMS, ROOF LINING AND BOTH CURTAIN AIRBAG	2800.00	1.00	2,800.00
S	BODYWORK	M: TO DISMANTLE AND RENEW FRONT BUMPER, RHS FRONT FENDER, RHS FRONT DOOR AND REAR DOOR. REORGANISE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED	2000.00	1.00	2,000.00
S	BODYWORK	M: TO RESPRAY FRONT BUMPER, RHS FRONT FENDER, RHS FRONT DOOR AND RHS REAR DOOR	2200.00	1.00	2,200.00
S	BODYWORK	M: TO REMOVE AND TRANSFER REAR PARKING AID AND REAR LID KICK SENSOR. CHECK FUNCTION	360.00	1.00	360.00
S	BODYWORK	M: TO RENEW REAR WINDSCREEN AND RHS 1/4 GLASS FOR FENDER RENEWAL	600.00	1.00	600.00

Premium Automobiles Pte Ltd



Audi Centre Singapore
281 Alexandra Road
Singapore 159938
Main Telephone 6836 2223
Main Telefax 6471 3733

Alexandra Service Centre
281 Alexandra Road
Singapore 159938
Main Telephone 6388 2223
Main Telefax 6475 1023

Ubi Service Centre
55 Ubi Road 1
Singapore 408699
Main Telephone 6386 2323
Main Telefax 6841 1183

Customer Service
Service Appointment 6366 2323
24-hour Breakdown Service 9828 1233
Email customer.care@premiumauts.com.sg

INS TAX INVOICE

Page 2 16:48

Company Reg. No. 199902271W
GST Reg. No. 199902271W

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120		Invoice No: 85014545 Date : 04/12/2019 Order : SKT3113C Term : 30	Account: A0006 (T 0) AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120		
Regn No: SKT3113C (V 38920)		Regn Date: 28/07/2018	Mileage: 30663	WIP No.: 29407	
Model: A4 SEDAN 2.0 TFSI 8W2ADG (NAV,		Chassis: WAUZZZF40JN015000	Engine: CVR 064044	Dept: U	
You have been assisted by :- UB-Tony Feang (33)					
		Details	Qty	Unit Price	Amount
S	BODYWORK	M: TO DISLodge AND REINSTALL REAR WIRE HARNESS FOR TAIL LIGHTS,BATTERY MANAGER,FUSE AND RELAY TRAYS,ELECTRICAL AND AUDIO COMPONENTS.	1400.00	1.00	1,400.00
S	BODYWORK	M: TO REMOVE AND REINSTALL REAR SEAT ASSY, BACK REST	900.00	1.00	900.00
S	BODYWORK	M: TO DISMANTLE REAR BUMPER AND REAR LID. CUT OUT AND REWELD RHS REAR FENDER AND RHS WHEEL HOUSING LINER.RENEW REAR BUMPER. REORGANISE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED	3500.00	1.00	3,500.00
S	BODYWORK	M: TO RESPRAY REAR BUMPER,RHS REAR FENDER, RHS SILL PANEL AND END PANELLING.TO CARRY OUT JOINT SEALER WORK AND STONE CHIP TREATMENT	2200.00	1.00	2,200.00
S	BODYWORK	M: TO RENEW RHS FRONT RIM AND RHS RREAR RIM. TO CARRY OUT WHEEL ALIGNMENT	320.00	1.00	320.00
S	BODYWORK	M: TO CARRY OUT DIAGNOSTIC CHECK	384.00	1.00	384.00
S	BODYWORK	M: TO SUPPLY ACRYLIC SEALANT,CAVITY WAX,STONE CHIP,METAL FILLER POWDER,REAR WINDSCREEN SEALANT AND 1/4 GLASS SEALANT	1080.00	1.00	1,080.00
S	BODYWORK	M: TO REMOVE AND REINSTALL RHS FRONT SUSPENSION, INSPECT FOR DAMAGES AND RENEW ACCORDING TO DAMAGES	1800.00	1.00	1,800.00
X	A8W5880242K	(A) (G) SIDEAIRBAG (TEC	Less 020%	1.00	1378.00
X	A8W0971553	(A) (G) HARNESS (TECH)	Less 020%	1.00	184.00
X	A8W5880741G	(A) (G) AIRBAG (TECH)	Less 020%	1.00	1692.00
					1,102.40
					147.20
					1,353.60

Premium Automobiles Pte Ltd



Audi Centre Singapore
281 Alexandra Road
Singapore 159938
Main Telephone 6386 2223
Main Telefax 6471 3733

Alexandra Service Centre
281 Alexandra Road
Singapore 159938
Main Telephone 6386 2223
Main Telefax 6475 1023

Ubi Service Centre
55 Ubi Road 1
Singapore 408699
Main Telephone 6386 2323
Main Telefax 6841 1183

Customer Service
Service Appointment 6366 2323
24-hour Breakdown Service 9828 1233
Email customer.care@premiumauto.com.sg

INS TAX INVOICE

Page 3 16:48

Company Reg. No. 199902271W
GST Reg. No. 199902271W

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120	Invoice No: 85014545 Date : 04/12/2019 Order : SKT3113C Term : 30	Account: A0006 (T 0) AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
---	--	--

Regn No: SKT3113C (V 38920)	Regn Date: 28/07/2018	Mileage: 30663	WIP No.: 29407
Model: A4 SEDAN 2.0 TFSI 8W2ADG (NAV,	Chassis: WAUZZZF40JN015000	Engine: CVK 064044	Dept: U
You have been assisted by :- UB-Tony Foong (33)			

		Details	Qty	Unit Price	Amount
X	A8W5880742G	(A) (SK) AIRBAG	Less 020%	1.00	1692.00
X	A4M0959643	(A) (SK) SENSOR	Less 020%	1.00	272.50
X	A8W0857705 V04	(A) (SK) SEAT BELT (TEC	Less 020%	1.00	956.00
X	A8W0857706 V04	(A) (SK) SEAT BELT (TEC	Less 020%	1.00	956.00
X	A8W5867505AH1RO	(A) (G) ROOFLINING (TEC	Less 020%	1.00	1682.00
X	A8W0881806B KGN	(A) (G) COVER (TECH)	Less 020%	1.00	2142.00
X	A8W0501530D	(A) (SK) TIE ROD	Less 020%	1.00	149.00
X	A8W0867233D 1RO	(A) (SK) LINING	Less 020%	1.00	179.50
X	A8W0867234D 1RO	(V) (GER) LINING	Less 020%	1.00	179.50
X	AWHT008016	(V) (GER) SCREW	Less 020%	1.00	13.10
X	A8W0505432P	(A) (SK) (TECH) HOUSING	Less 020%	1.00	868.00
X	A8W0867240A 4PK	(V) (G) LINING	Less 020%	1.00	134.50
X	A8X0971259	(V) (G) HOUSING	Less 020%	1.00	233.00
X	A8W5809838	SUBPART	Less 020%	1.00	2347.00
X	A8W5845298D NVB	SIDE WINDO	Less 020%	1.00	540.50
X	A8W0821172A	WHEEL HOUS	Less 020%	1.00	209.00
X	A8W5833721C	DOOR SEAL	Less 020%	1.00	191.50
X	A8W0810172F	WHEEL HOUS	Less 020%	1.00	214.50
X	A8W0853888A	SPOILER	Less 020%	1.00	65.40
X	A8W0821106A	FENDER	Less 020%	1.00	665.00
X	A8W5833052C	DOOR	Less 020%	1.00	1928.00
X	A8W0831052D	DOOR	Less 020%	1.00	2048.00
X	A8W5845501B NVB	REARWINDOW	Less 020%	1.00	1014.00
X	A8W0807065D GRU	COVER	Less 020%	1.00	1902.00
X	A8W5807067A GRU	COVER	Less 020%	1.00	1907.00
X	A8W0601025EF	(V) (G) RIM 16" CX1	Less 020%	2.00	645.00
X	A8W0098625	MOUNT KIT	Less 020%	1.00	47.50
X	A8W0010502D	LABEL	Less 020%	1.00	34.20
X	A8W0821471	BRACKET	Less 020%	1.00	28.30
X	A8W0821468	BRACKET	Less 020%	1.00	31.50
X	A8W0807284	GUIDE	Less 020%	1.00	33.90
X	A8W0821092	PLATE	Less 020%	1.00	43.20
X	A8W0821136C	SUPPORT	Less 020%	1.00	103.00
X	A8W0823746	COVER	Less 020%	1.00	20.20

Premium Automobiles Pte Ltd



Audi Centre Singapore
281 Alexandra Road
Singapore 159938
Main Telephone 6386 2223
Main Telefax 6471 3733

Alexandra Service Centre
281 Alexandra Road
Singapore 159938
Main Telephone 6386 2223
Main Telefax 6475 1023

Ubi Service Centre
55 Ubi Road 1
Singapore 408999
Main Telephone 6386 2323
Main Telefax 6841 1183

Customer Service
Service Appointment 6366 2323
24-hour Breakdown Service 9828 1233
Email customer.care@premiumauto.com.sg

INS TAX INVOICE

Page 4 16:48

Company Reg. No. 199902271W
GST Reg. No. 199902271W

AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120 079120	Invoice No: 85014545 Date : 04/12/2019 Order : SKT3113C Term : 30	Account: A0006 (T 0) AIG ASIA PACIFIC INSURANCE PTE LTD MOTOR CLAIM DEPT AIG BUILDING 78 SHENTON WAY #07-16 SINGAPORE 079120
---	--	--

Regn No: SKT3113C (V 38920)	Regn Date: 28/07/2018	Mileage: 30663	WIP No.: 29407
Model: A4 SEDAN 2.0 TFSI 8W2ADG (NAV,	Chassis: WAUZZZP40JN015000	Engine: CVK 064044	Dept: U
You have been assisted by :- UB-Tony Foong (33)			

		Details		Qty	Unit Price	Amount
X	A8W0821470	BRACKET	Less 020%	1.00	44.50	35.60
X	A8W0837912A	SEAL	Less 020%	1.00	175.50	140.40
X	A8K9805673C	SPEED NUT	Less 020%	2.00	1.20	1.92
X	A8W0820582C	COVER	Less 020%	1.00	27.80	22.24
X	A8W5839912A	SEAL	Less 020%	1.00	184.50	147.60
X	A8W0853824B 9B9	STONEGUARD	Less 020%	1.00	45.80	36.64
X	A8W0598611A	BEARING	Less 020%	1.00	393.50	314.80
X	A8W0505311H	CONTR ARM	Less 020%	1.00	761.50	609.20
X	A8W0407607A	WHEEL HUB	Less 020%	1.00	657.00	525.60
X	A8W5807454	GUIDE	Less 020%	1.00	36.00	30.40
X	AD 00920002	PRIMER (DG)	Less 020%	2.00	18.60	29.76
X	A8W0959655F	MODULE (TECH)	Less 020%	1.00	1870.00	1,496.00
X	A8W0915459E	FUSE UNIT	Less 020%	1.00	470.00	376.00
X	AWHT005271	BOLT	Less 020%	6.00	1.00	4.80
X	AWHT007041	WASHER	Less 020%	1.00	3.30	2.64
X	AN 0161857	POP-RIVET	Less 020%	6.00	3.00	14.40
X	AWHT007610	NUT	Less 020%	1.00	5.10	4.08
X	AN 91244001	STUD	Less 020%	3.00	3.60	8.64
X	AWHT007043A	WASHER	Less 020%	1.00	5.10	4.08
X	AN 10621301	NUT	Less 020%	6.00	1.80	8.64
X	AN 10106402	NUT	Less 020%	1.00	2.80	2.24
X	AWHT007828	FLANGE NUT	Less 020%	1.00	3.60	2.88
X	AN 91186901	BOLT	Less 020%	1.00	1.00	0.80
X	AWHT007090A	SCREW	Less 020%	1.00	14.20	11.36
X	AWHT007096	BOLT	Less 020%	1.00	11.00	8.80
X	AN 91236401	BOLT	Less 020%	1.00	8.50	6.80

Parts 25,746.16
Labour 0.00
Sublet 21,524.00
Menus 0.00
Lubricant 0.00

Sub-Total 45,670.16

7% GST 3,196.91

Grand Total 48,867.07



4/12

Received by

For & on behalf of
Premium Automobiles Pte Ltd

Premium Automobiles

Telefax

to **AIG Asia Pacific Insurance Pte Ltd**
78 Shenton Way
#07-16 AIG Building
Singapore 079120
Motor Claims Dept
Yr Ref: SKT 3113 C

Norah Khai
6768 9828
6841 1183

Body Repair

PA/OD/1221/2018/PH
7th December 2018

from
Telephone +65-
Telefax +65-
Mobile +65-
Our department
Your Claim Ref
Our Ref
Date

total pages

RE : CLAIM – OWNER’S SATISFACTION/DISCHARGE VOUCHER

Make & Model : Audi A4 Sedan 2.0 TFSI S
Vehicle Chassis No. : WAUZZZF40JN015000
Vehicle Regn No. : **SKT 3113 C**
Vehicle Mileage : 6143 km
Vehicle Owner : Ms. Ong Lay Guat Jessie Mrs Jessie Kam
Certificate No : 1800084149
Own Damage Excess : S\$ 1712.00 (inclusive of 7% GST)
Accident Date : 22/10/2018
Place : Along MCE towards Changi
Repair Cost : \$ 48,867.07
WIP No. : 29407
Repairer's Name : Premium Automobiles Pte Ltd

Premium Automobiles Pte Ltd
Showroom
9 Leng Kee Road
Singapore 159090
Telephone (65) 6566 1111
Telefax (65) 6471 3733

Service & Parts Centres
55 Ubi Road 1
Singapore 408699
Telephone (65) 6366 2323
Telefax (65) 6841 1183

I/We certify that the vehicle has been fully repaired to my entire satisfaction and that payment of the repairer's charges that are claimable under the policy will be deemed in full and final settlement of my claim.

Owner / Insured Signature : 
Time :
Date : 10/12/18

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	28 Oct 2018		29 Oct 2018 19:28 Edit Adj Rpt	S\$47,270.16 Edit Estimates	S\$47,270.16 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS [Created by insurer]									
Insured:	ONG LAY GUAT JESSIE MRS JESSIE KAM, ID: S1613295J								
Vehicle Reg. No.:	SKT3113C	Date of Loss:	22/10/2018 15:00 - :59 [2 Months and 24 Days From LTA Reg Date (Man Yr)]						
Claim Type:	OD / 7903640717SG	Policy/Cover Note No.:	1800084149 (Comprehensive)						
		Excess:	S\$1,600.00						
Repairer:	Premium Automobiles Pte Ltd (UBI) 55 Ubi Road 1, 408599 Ubi - Tel: 67689828/9827/9911								
Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd. (SG) - Tel: 65-6419-3000 ... [Handled by Loo, Tong Shing] TongShing.Loo@aig.com								
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by ADRIAN LING] ... [Final Rpt due 08/11/2018]								
Driver/Custodian:	KAM YEOW BENG BOBBY (63 / Male) , NRIC: S1105131F, Tel: +6590288855 Email: NOEMAIL								
ASSOCIATED MAIL RECEIVED View All Compose Case Mail									
- AIG_SG (02/12/2019): Alert - Adj Mandate Approved (S\$47270.16) - SKT3113C - Claim Handler: Loo, Tong ... - AIG_SG (08/04/2019): Alert - Adj Mandate Maintained - SKT3113C - Claim Handler: Loo, Tong Shing - AIG_SG (27/03/2019): Alert - Adj Mandate Maintained - SKT3113C - Claim Handler: Loo, Tong Shing - AIG_SG (08/11/2018): Alert - Adj Mandate Approved (S\$45917.00) - SKT3113C - Claim Handler: Loo, Tong ... - AIG_SG (07/11/2018): SKT3113C / OD / 22/10/2018 / Coverage & Excess update									
ALL ASSOCIATED TASKS View All Search Tasks Create New Task Complete									
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

*SKT3113C (79036407175G)
 OD
 Oct 22 2018 3:35PM
 [ONG LAY GUAT JESSIE MRS JESSIE KAM]
 Premium Automobiles Pte Ltd

[Upload Documents](#)
[Upload Photos](#)
[Compose New Letter](#)
[Upload Video](#)
[Upload Audio](#)
[View](#)
[View in Browser](#)

Assessment Reports

1 per page

No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	30/10/18 13:12	Adjuster Immediate Advice	 Load HTM	☐
2	13/03/19 17:43	Adjuster Immediate Advice	 Load HTM	☐
3	04/04/19 13:30	Adjuster Immediate Advice	 Load HTM	☐

Photos/Images

3 per page

No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	30/10/18 13:15	General View	 Load JPG	☒
2	30/10/18 13:15	Chassis Number	 Load JPG	☒
3	30/10/18 13:15	Odometer Reading	 Load JPG	☒
4	30/10/18 13:15	General View	 Load JPG	☒
5	30/10/18 13:15	General View	 Load JPG	☒
6	30/10/18 13:15	General View	 Load JPG	☒
7	30/10/18 13:15	General View	 Load JPG	☒
8	30/10/18 13:15	General View	 Load JPG	☒
9	30/10/18 13:15	General View	 Load JPG	☒
10	30/10/18 13:15	General View	 Load JPG	☒
11	30/10/18 13:15	General View	 Load JPG	☒
12	30/10/18 13:15	General View	 Load JPG	☒
13	30/10/18 13:15	General View	 Load JPG	☒
14	30/10/18 13:15	General View	 Load JPG	☒
15	30/10/18 13:15	General View	 Load JPG	☒
16	30/10/18 13:15	General View	 Load JPG	☒
17	30/10/18 13:15	General View	 Load JPG	☒
18	30/10/18 13:15	General View	 Load JPG	☒
19	30/10/18 13:15	General View	 Load JPG	☒
20	30/10/18 13:15	General View	 Load JPG	☒
21	30/10/18 13:15	General View	 Load JPG	☒
22	30/10/18 13:15	General View	 Load JPG	☒
23	30/10/18 13:15	General View	 Load JPG	☒
24	30/10/18 13:15	General View	 Load JPG	☒
25	30/10/18 13:15	General View	 Load JPG	☒
26	30/10/18 13:15	General View	 Load JPG	☒
27	30/10/18 13:15	General View	 Load JPG	☒
28	30/10/18 13:15	General View	 Load JPG	☒
29	30/10/18 13:15	General View	 Load JPG	☒
30	30/10/18 13:15	General View	 Load JPG	☒
31	30/10/18 13:15	General View	 Load JPG	☒
32	30/10/18 13:15	General View	 Load JPG	☒
33	30/10/18 13:15	General View	 Load JPG	☒
34	30/10/18 13:15	General View	 Load JPG	☒
35	30/10/18 13:15	General View	 Load JPG	☒
36	30/10/18 13:15	General View	 Load JPG	☒
37	30/10/18 13:15	General View	 Load JPG	☒
38	30/10/18 13:15	General View	 Load JPG	☒
39	30/10/18 13:15	General View	 Load JPG	☒

Assessment Reports			1 per page	☒
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
40	30/10/18 13:15	General View		☒
41	30/10/18 13:15	General View		☒
42	30/10/18 13:15	General View		☒
43	30/10/18 13:15	General View		☒
44	30/10/18 13:15	General View		☒
45	30/10/18 13:15	General View		☒
46	13/03/19 17:46	Reinspection Photo		☒
47	13/03/19 17:46	Reinspection Photo		☒
48	13/03/19 17:46	Reinspection Photo		☒
49	13/03/19 17:46	Reinspection Photo		☒
50	13/03/19 17:46	Reinspection Photo		☒
51	13/03/19 17:46	Reinspection Photo		☒
52	13/03/19 17:46	Reinspection Photo		☒
53	13/03/19 17:46	Reinspection Photo		☒
54	13/03/19 17:46	Reinspection Photo		☒
55	13/03/19 17:46	Reinspection Photo		☒
56	13/03/19 17:46	Reinspection Photo		☒
57	13/03/19 17:46	Reinspection Photo		☒
58	13/03/19 17:46	Reinspection Photo		☒
59	13/03/19 17:46	Reinspection Photo		☒
60	13/03/19 17:46	Reinspection Photo		☒
61	13/03/19 17:46	Reinspection Photo		☒
62	13/03/19 17:46	Reinspection Photo		☒
63	13/03/19 17:46	Reinspection Photo		☒
64	13/03/19 17:46	Reinspection Photo		☒
65	13/03/19 17:46	Reinspection Photo		☒
66	13/03/19 17:46	Reinspection Photo		☒
67	13/03/19 17:46	Reinspection Photo		☒
68	13/03/19 17:46	Reinspection Photo		☒
69	13/03/19 17:46	Reinspection Photo		☒
70	13/03/19 17:46	Reinspection Photo		☒
71	13/03/19 17:46	Reinspection Photo		☒
72	13/03/19 17:46	Reinspection Photo		☒
73	13/03/19 17:46	Reinspection Photo		☒
74	13/03/19 17:46	Reinspection Photo		☒
75	13/03/19 17:46	Reinspection Photo		☒
76	13/03/19 17:46	Reinspection Photo		☒
77	13/03/19 17:46	Reinspection Photo		☒
78	13/03/19 17:46	Reinspection Photo		☒
79	13/03/19 17:46	Reinspection Photo		☒
80	13/03/19 17:46	Reinspection Photo		☒
81	13/03/19 17:46	Reinspection Photo		☒
82	13/03/19 17:46	Reinspection Photo		☒
83	13/03/19 17:46	Reinspection Photo		☒
84	13/03/19 17:46	Reinspection Photo		☒
85	13/03/19 17:46	Reinspection Photo		☒
86	13/03/19 17:46	Reinspection Photo		☒
87	13/03/19 17:46	Reinspection Photo		☒
88	13/03/19 17:46	Reinspection Photo		☒
89	13/03/19 17:46	Reinspection Photo		☒
90	13/03/19 17:46	Reinspection Photo		☒
91	13/03/19 17:46	Reinspection Photo		☒
92	13/03/19 17:46	Reinspection Photo		☒
93	13/03/19 17:46	Reinspection Photo		☒
94	13/03/19 17:46	Reinspection Photo		☒
95	13/03/19 17:46	Reinspection Photo		☒

Assessment Reports				1 per page	☒
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print
96	13/03/19 17:46	Reinspection Photo		Load JPG	☒
97	13/03/19 17:46	Reinspection Photo		Load JPG	☒
98	13/03/19 17:46	Reinspection Photo		Load JPG	☒
99	13/03/19 17:46	Reinspection Photo		Load JPG	☒
100	13/03/19 17:46	Reinspection Photo		Load JPG	☒
101	13/03/19 17:46	Reinspection Photo		Load JPG	☒
102	13/03/19 17:46	Reinspection Photo		Load JPG	☒
103	13/03/19 17:46	Reinspection Photo		Load JPG	☒
104	13/03/19 17:46	Reinspection Photo		Load JPG	☒
105	13/03/19 17:46	Reinspection Photo		Load JPG	☒
106	13/03/19 17:46	Reinspection Photo		Load JPG	☒
107	13/03/19 17:46	Reinspection Photo		Load JPG	☒
Documentation				1 per page	☒
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print
1	30/10/18 11:18	DRIVING & CERT.pdf		Load PDF	
2	30/10/18 11:18	ESTIMATE.pdf		Load PDF	
3	05/11/18 08:42	AIG Interview & Undertaking-SKT3113C.PDF		Load PDF	
4	13/03/19 17:43	SUPPLEMENTARY.pdf		Load PDF	
5	13/03/19 17:43	SALES AGREEMENT.pdf		Load PDF	
6	04/04/19 13:31	ALIGNMENT REPORT.pdf		Load PDF	
7	18/11/19 09:54	ALIGNMENT REPORT 1.pdf		Load PDF	
8	18/11/19 18:03	ESTIMATE & SUPP MARKED.pdf		Load PDF	
9	11/12/19 14:46	Workshop Invoice		Load PDF	
10	11/12/19 14:46	Discharge Voucher		Load PDF	

Linked Accident Report Documents

Assessment Reports				1 per page	☒
No	Finalized On	Premium Automobiles Pte Ltd (UBI)		Thumbnail	Print
1	23/10/18 16:29	Accident Statement		Load HTML	
Photos/Images				1 per page	☒
No	Finalized On	Premium Automobiles Pte Ltd (UBI)		Thumbnail	Print
1	23/10/18 16:26	Accident Photo		Load JPG	☒
2	23/10/18 16:26	Accident Photo		Load JPG	☒
3	23/10/18 16:26	Accident Photo		Load JPG	☒
4	23/10/18 16:26	Accident Photo		Load JPG	☒
5	23/10/18 16:26	Accident Photo		Load JPG	☒
6	23/10/18 16:26	Accident Photo		Load JPG	☒
7	23/10/18 16:26	Accident Photo		Load JPG	☒
8	23/10/18 16:26	Accident Photo		Load JPG	☒
9	23/10/18 16:26	Accident Photo		Load JPG	☒
10	23/10/18 16:26	Accident Photo		Load JPG	☒
11	23/10/18 16:26	Accident Photo		Load JPG	☒
12	23/10/18 16:26	Accident Photo		Load JPG	☒
13	23/10/18 16:26	Accident Photo		Load JPG	☒
14	23/10/18 16:26	Accident Photo		Load JPG	☒
15	23/10/18 16:26	Accident Photo		Load JPG	☒
16	23/10/18 16:26	Accident Photo		Load JPG	☒
17	23/10/18 16:26	Accident Photo		Load JPG	☒
18	23/10/18 16:26	Accident Photo		Load JPG	☒
19	23/10/18 16:26	Accident Photo		Load JPG	☒
Documentation				1 per page	☒
No	Finalized On	Premium Automobiles Pte Ltd (UBI)		Thumbnail	Print
1	23/10/18 16:09	Sketch Plan		Load JPG	☒
2	23/10/18 16:09	Sketch Plan #2		Load JPG	☒

Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			
Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)			
Show Remarks To: ☐ Handling Insurer			
Note: Remarks are private unless you show it to other parties.			

LKK Auto Consultants Pte Ltd (Co. Reg. No: 199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way #08-16
Singapore 079120

Our File No: CC3/AIG18019684/ASBE2

Date: 11/12/2019

REFERENCE

Insured/Claimant: ONG LAY GUAT JESSIE MRS JESSIE KAM Policy No: 1800084149
Date of Loss: 22/10/2018 Nature of Claim: OD Claim No: 7903640717SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SKT3113C**
Make & Model: AUDI A4, 2.0 (A) Engine No: CVK064044
Reg. Date: 28/07/2018 (Man. Year: 2018) Chassis No: WAUZZZF40JN015000
Colour: Black Odometer: 6143 km
Engine Capacity: 1984 cc
Market Value/New Car Price: S\$150,000.00
Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 205/60 R16 Rear Tyre Size: 205/60 R16
Front Left Side: Pirelli 6 mm Rear Left Side: Pirelli 6 mm
Front Right Side: Pirelli 6 mm Rear Right Side: Pirelli 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	45,127.40	26,826.16	18,301.24	40.55
Miscellaneous Items	0.00	0.00	0.00	
Labour	26,844.00	20,444.00	6,400.00	23.84
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	71,971.40	47,270.16	24,701.24	34.32
- Excess (S\$)	1,600.00	1,600.00	0.00	0.00
(S\$)	70,371.40	45,670.16	24,701.24	35.10
+ GST 7.00/7.00% (S\$)	4,926.00	3,196.91	1,729.09	35.10
Nett Amount (S\$)	75,297.40	48,867.07	26,430.33	35.10

INSPECTION

Date of Assignment: 29/10/2018
Date Inspected: 29/10/2018 Inspected At: Premium Automobiles Pte Ltd (UBI)
55 Ubi Road 1
Singapore 408699
Estimated Period of Repair: 24.0 days

Adjuster: ADRIAN LING

Manager: Hiew May Fung

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Deformed	1,902.00 FS	*1,521.60 FS
2	1		*FRONT BUMPER FIXING PARTS	Not Necessary	245.00 FS	*- FS
3	2		*FRONT BUMPER SECURING STRIP	Not Necessary	30.00 FS	*- FS
4	1		*FRONT BUMPER CLOSING ELEMENT	Not Necessary	180.00 FS	*- FS
5	1		*FRONT BUMPER AIR GUIDE - RH	Not Necessary	73.00 FS	*- FS
6	1		*FRONT BUMPER AIR GUID GRILLE - RH	Not Necessary	118.00 FS	*- FS
7	1		*FRONT BUMPER GUIDE SECTIO - RH	Damaged	32.00 FS	*27.12 FS
8	1		*FRONT SENSOR	Not Necessary	211.00 FS	*- FS
9	4		*FRONT SENSOR SEAL RING	Not Necessary	14.00 FS	*- FS
10	1		*FRONT FENDER - RH	Dented	665.00 FS	*532.00 FS
11	1		*FRONT FENDER ATTACHMENT PARTS - RH	Necessary	45.00 FS	*38.00 FS
12	1		*FRONT FENDER CLOSING ELEMENT - RH	Damaged	44.00 FS	*34.56 FS
13	1		*FRONT FENDER BRACKET - RH	Bent	31.00 FS	*25.20 FS
14	1		*FRONT FENDER BRACKET DEFORMATION - RH	Necessary	43.00 FS	*35.60 FS
15	1		*FRONT FENDER UPPER BRACKET - RH	Bent	27.00 FS	*22.64 FS
16	1		*FRONT FENDER BRACE - RH	Bent	103.00 FS	*82.40 FS
17	1		*WHEEL HOUSING LINER - RH	Deformed	209.00 FS	*167.20 FS
18	1		*WHEEL HOUSING LINER ATTACHMENT PARTS	Not Necessary	78.00 FS	*- FS
19	1		*FRONT WHEEL SPOILER - RH	Cracked	63.00 FS	*52.32 FS
20	1		*FRONT WHEEL SPOILER END PLATE - RH	Not Necessary	31.00 FS	*- FS
21	1		*FRONT STONE CHIP GUARD - RH	Necessary	44.00 FS	*36.64 FS
22	1		*FRONT DOOR - RH	Dented	2,048.00 FS	*1,638.40 FS
23	1		*FRONT OUTER DOOR SEAL - RH	Necessary	176.00 FS	*140.40 FS
24	1		*BONDING AGENT	Not Necessary	43.00 FS	*- FS
25	1		*CLEANING SOLUTION	Not Necessary	64.00 FS	*- FS
26	1		*APPLICATOR	Not Necessary	7.00 FS	*- FS
27	1		*FRONT DOOR ATTACHMENT PARTS - RH	Not Necessary	462.00 FS	*- FS
28	1		*FRONT DOOR CATCH - RH	Not Necessary	92.00 FS	*- FS
29	1		*FRONT DOOR CATCH COVER - RH	Not Necessary	13.00 FS	*- FS
30	1		*FRONT FENDER LEDGE COVER - RH	Necessary	27.00 FS	*22.24 FS
31	1		*FRONT FENDER LEDGE TOP COVER - RH	Necessary	20.00 FS	*16.16 FS
32	1		*LED HEADLIGHT - RH	Not Necessary	6,973.00 FS	*- FS
33	1		*REAR DOOR - RH	Dented	1,928.00 FS	*1,542.40 FS
34	1		*REAR OUTER DOOR SEA - RH	Necessary	176.00 FS	*147.60 FS
35	1		*BONDING AGENT	Not Necessary	43.00 FS	*- FS
36	1		*CLEANING SOLUTION	Not Necessary	64.00 FS	*- FS
37	1		*APPLICATOR		7.00 FS	*- FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
38	1		*SEALING STRIP	Not Necessary	14.00 FS	*- FS
39	1		*REAR DOOR ATTACHMENT PARTS - RH	Not Necessary	488.00 FS	*- FS
40	1		*REAR DOOR CATCH - RH	Not Necessary	105.00 FS	*- FS
41	1		*REAR DOOR CATCH COVER	Not Necessary	12.00 FS	*- FS
42	1		*REAR WINDOW REGULATOR - RH	Not Necessary	242.00 FS	*- FS
43	1		*SECTIONAL PART - SIDE PANEL - RH	Dented	2,347.00 FS	*1,877.60 FS
44	1		*REAR WINDOW	Necessary	1,014.00 FS	*811.20 FS
45	2		*PRIMER	Necessary	37.00 FS	*29.76 FS
46	1		*REAR SIDE WINDOW - RH	Necessary	541.00 FS	*432.40 FS
47	1		*REAR SIDE WINDOW TRIM STRIP - RH	Not Necessary	426.00 FS	*- FS
48	1		*REAR BUMPER	Deformed	1,907.00 FS	*1,525.60 FS
49	1		*REAR BUMPER FIXING PARTS	Not Necessary	63.00 FS	*- FS
50	4		*REAR BUMPER SECURING PLATE	Not Necessary	56.00 FS	*- FS
51	1		*REAR BUMPER SECURING STRIP	Not Necessary	191.00 FS	*- FS
52	1		*REAR BUMPER GUIDE SECTION - RH	Damaged	38.00 FS	*30.40 FS
53	1		*REAR WHEEL HOUSING LINER - RH	Deformed	215.00 FS	*171.60 FS
54	1		*REAR WHEEL HOUSING LINER ATTACHMENT PARTS - RH	Not Necessary	78.00 FS	*- FS
55	1		*REAR WHEEL HOUSING - RH	Repair	545.00 FS	*- FS
56	1		*ALUMINIUM RIM - RH FRONT / REAR	Cut	1,290.00 FS	*1,032.00 FS
57	8		*RUBBER VALVE	Not Necessary	23.00 FS	*- FS
58	1		*DATA PLATE FOR TYRE PRESSURE	Necessary	33.00 FS	*27.36 FS
59	1		*ACRYLIC SEALANT	Necessary	180.00 FS	*180.00 FS
60	1		*CAVITY WAX	Necessary	140.00 FS	*140.00 FS
61	1		*STONE CHIP	Necessary	180.00 FS	*180.00 FS
62	1		*METAL FILLER POWDER	Necessary	280.00 FS	*280.00 FS
63	1		*REAR W/S SEALANT	Necessary	200.00 FS	*200.00 FS
64	1		*1/4 GLASS SEALANT	Necessary	100.00 FS	*100.00 FS
65	1		*SIDE AIRBAG UNIT - RH	Activated	1,378.00 FS	*1,102.40 FS
66	1		*SIDE AIRBAG WIRING HARNESS	Activated	184.00 FS	*147.20 FS
67	2		*HEAD AIR BAG UNIT - RH / LH	Activated	3,384.00 FS	*2,707.20 FS
68	2		*AIR BAG GUIDE - LH / RH	Not Necessary	84.00 FS	*- FS
69	1		*REAR CRASH SENSOR FOR AIR BAG	Activated	273.00 FS	*218.00 FS
70	1		*AIR BAG CONTROL UNIT	Activated	1,870.00 FS	*1,496.00 FS
71	1		*FUSE CONTROL MODULE	Damaged	470.00 FS	*376.00 FS
72	2		*THREE POINT AUTOMATIC SEAT BELT - LH / RH	Activated	1,912.00 FS	*1,529.60 FS
73	2		*SEAT BELT HEIGHT ADJUSTER	Not Necessary	306.00 FS	*- FS
74	1		*MOULDED HEADLINING	Crumpled	1,682.00 FS	*1,345.60 FS
75	1		*FRONT GRAB HANDLE, FOLDING	Not Necessary	248.00 FS	*- FS
76	2		*REAR GRAB HANDLE, FOLDING - LH / RH	Not Necessary	248.00 FS	*- FS
77	2		*A PILLAR TRIM - LH / RH	Deformed	360.00 FS	*287.20 FS
78	1		*DRIVER SEAT COVER - RHS	Torn	2,142.00 FS	*1,713.60 FS
79	1		*SUNDRIES	Necessary	800.00 FS	*92.56 FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
80	1		*WISHBONE LINK	Bent	609.20 FS	*609.20 FS
81	1		*TRACK ROD	Bent	119.20 FS	*119.20 FS
82	1		*WHEEL BEARING HOUSING	Damaged	694.40 FS	*694.40 FS
83	1		*WHEEL BEARING ASSEMBLY	Necessary	314.80 FS	*314.80 FS
84	1		*DOOR SEAL INNER	Necessary	153.20 FS	*153.20 FS
85	1		*B PILLAR TRIM - LOWER RHS	Deformed	107.60 FS	*107.60 FS
86	1		*SIDE AIR BAG - CONNECTOR HARNESS - EXTENSION	Activated	186.40 FS	*186.40 FS
87	1		*WHEELHUB - RHS FRONT	Damaged	525.60 FS	*525.60 FS
F=Franchise part. S=SpcNetl.						
				Total Parts (S\$)	45,127.40	26,826.16

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS, OUTSIDE TEMPERATURE SENSOR, HEADLIGHT WASHER ASSY AND FRONT PARKING AID	New	480.00	480.00
2	TO REMOVE AND TRANSFER RHS FRONT AND REAR DOORS MULTI-LOCK SYSTEM AND POWER WINDOW DEVICES. INSPECT FOR DAMAGES	New	560.00	560.00
3	TO REMOVE AND REINSTALL CENTER CONSOLE. RENEW BOTH FRONT SEAT BELTS AND CONTROL UNIT, PILLAR TRIMS, ROOF LINING AND BOTH CURTAIN AIR BAGS	New	2,800.00	2,800.00
4	TO RENEW RHS FRONT SEAT BACK REST, BENCHS LEATHER COVERS AND RHS SIDE AIRBAG	New	600.00	600.00
5	TO DISMANTLE AND RENEW FRONT BUMPER, RHS FRONT FENDER, RHS HEADLIGHT, RHS FRONT DOOR AND RHS REAR DOOR. RE-ORGANISE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED	New	3,300.00	2,000.00
6	TO RESPRAY FRONT BUMPER, RHS FRONT FENDER, RHS FRONT DOOR, DOOR HANDLES AND RHS REAR DOOR	New	3,100.00	2,200.00
7	TO REMOVE AND TRANSFER REAR PARKING AID AND REAR KICK SENSOR. CHECK FUNCTION	New	360.00	360.00
8	TO RENEW REAR WINDSCREEN AND RHS 1/4 GLASS FOR FENDER RENEWAL	New	600.00	600.00
9	TO DISLODGE AND REINSTALL REAR WIRE HARNESS FOR TAIL LIGHTS, BATTERY MANAGER, FUSE AND RELAY TRAYS, ELECTRICAL AND AUDIO COMPONENTS	New	1,400.00	1,400.00
10	TO REMOVE AND REINSTALL REAR SEAT ASSY, BACK REST	New	900.00	900.00
11	TO DISMANTLE REAR BUMPER AND REAR LID. CUT OUT AND REWELD RHS REAR FENDER AND RHS WHEEL HOUSING LINER. RENEW REAR BUMPER. RE-ORGANIZE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED	New	5,400.00	3,500.00
12	TO RESPRAY REAR BUMPER, RHS INNER WHEEL HOUSING, RHS REAR FENDER, RHS SILL PANEL, DOOR ENTRANCES, ROOF CHANNEL, DRAIN CHANNEL AND END PANELLING. TO CARRY OUT JOINT SEALER WORK AND STONE CHIP TREATMENT	New	4,500.00	2,200.00
13	TO RENEW RHS FRONT RIM AND RHS REAR RIM. TO CARRY OUT WHEEL ALIGNMENT	New	320.00	320.00
14	TO CARRY OUT DIAGNOSTIC CHECK	New	384.00	384.00
15	TO REMOVE AND REINSTALL RHS REAR SUSPENSION, INSPECT FOR DAMAGES AND RENEW ACCORDING TO DAMAGES	New	1,800.00	1,800.00
16	TO REINSTALL REAR WINDSCREEN AND 1/4 GLASS SOLAR FILM	New	340.00	340.00
Gross Labour Cost (\$\$)			26,844.00	20,444.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >