

**PROGRESSIVE CAR CARE
PTE LTD
BLK 3022A UBI ROAD 1
#01-45/46
SINGAPORE 408716**

Email:
claims@procarcare.com.sg

Claim Reference: OD 1118 - 6757
Assessment Number: PA001715
Version: PROGRESS/2
Date Calculated: 12/11/2018 09:47

Full Report - V1
Registration: SJN4297S
Printed: 12/11/2018 17:47

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	Wayne Lim	Date of Incident:	27/10/2018
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	AXA Insurance S'pore Pte Ltd	Repairs Authorised:	TBA
Claim Reference:	OD 1118 - 6757	Estimated Repair Time:	
Policy Number:	GA018429	Quote Due Date:	
Other Reference:	TP 1018 - 5280	Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	HONDA
Model:	Jazz/Fitt
Sub Model:	BASE MODEL
Model Sheet Number:	HAL 01
Registration:	SJN4297S
Registration Month:	February
Registration Year:	2009
VIN Number:	GE61150567
Manufacture Year:	2008
Odometer:	Not Known
Colour:	Red
Engine Number:	L13A4164900
Fuel Level:	%

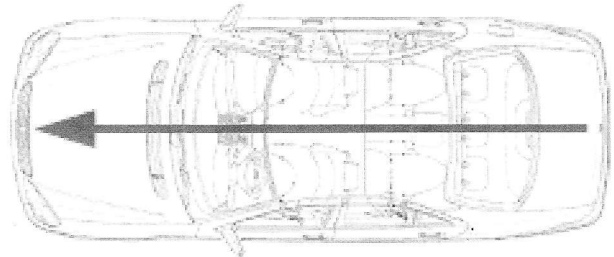
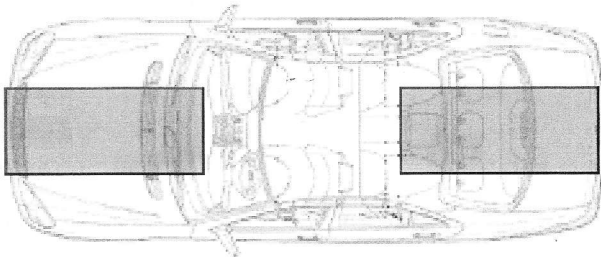
Model Specs

FROM MODEL 2009	AUTO AIR CON
XENON HEADLAMPS	1.4 LTR 73KW
AUTO GEARBOX 5 SPEED	TYRES 175/65 TR 15
WHEELS 5.5J X 15	WHEEL COVER 15"
PRODUCTION IN JAPAN	TWO PACK STRT COLOUR
PREPARE OFF VEHICLE	

Vehicle Condition

Vehicle Status

Pre-Accident Condition:	Severity of Impact:	
Steering:	Vehicle Status on Inspection:	
Brakes Pedal Travel:	Date of Inspection:	27/10/2018
Place of Inspection:		
Pre-Accident Damage:		
Tyres Condition:		
Tread Depth LHF:	Tread Depth RHF:	
Tread Depth LHR:	Tread Depth RHR:	
Damage Areas:	Direction of Impact:	

PROGRESSIVE CAR CARE PTE LTD**Claim Reference: OD 1118 - 6757****Assessment Number: PA001715****Version: PROGRESS/2****Date Calculated: 12/11/2018 09:47****Full Report - V1****Registration: SJN4297S****Printed: 12/11/2018 17:47****Addresses****Repairer**

Name : PROGRESSIVE

Address :

Post Code :

Cost Summary

Total Labour	\$3,046.50
Total Paint/Material	\$356.05
Total Parts	\$6,510.82
Total of Additional Costs	\$652.00
Excess:	TBA
Grand Total Exc GST:	\$10,565.37
7 % GST:	\$739.58
Grand Total Inc GST:	\$11,304.95

Repair Information**LABOUR****Time Basis 10 WU = 1 HR. Price/CL 1 = \$45.00/HR****Price/Dent = \$45.00/HR****Repair /****Guide Number Repair Details**

		WU	Cost Price (\$)
NO NUMBER	RUST PROOFING BODY SHELL PART	2.0	9.00
NO NUMBER	ANTIRUST TREATMENT FOR BONNET	1.0	4.50
NO NUMBER	RIGHT FRONT WING RUST PROOFING	1.0	4.50
NO NUMBER	BOOTLID RUST PROOFING	1.0	4.50
NO NUMBER	LEFT REAR WING CPL RUST PROOFING	7.0	31.50
NO NUMBER	REAR PANEL RUST PROOFING	1.0	4.50
4161A0)	R + R SUBFRAME	13.0	58.50
8101C1)	R + R LEFT FRONT BUMPER BRACKET	1.0	4.50
8101C2)	R + R RIGHT FRONT BUMPER BRACKET	1.0	4.50
8101A2	RENEW FRONT BUMPER	6.0	27.00
8101B1)	R + R FRONT BUMPER SUPPORT	2.0	9.00
8251A1	R + R R/F SKIRT - BODYSHELL	3.0	13.50
712103)	R + R LEFT HEADLAMP	4.0	18.00
712102)	R + R R/HEADLAMP	3.0	13.50
	(L/HEADLAMP REMOVED)		
812100	RENEW BONNET	6.0	27.00
8121B6	R + R L/BONNET HINGE	3.0	13.50
8121B7	R + R R/BONNET HINGE	3.0	13.50
8481A0	R + R LEFT FRONT WING MOULDING REAR	1.0	4.50
7421B0)	R + R WASHER TANK	4.0	18.00
NO NUMBER	R + R RIGHT FRONT WING	7.0	31.50
	INCLUDES: R + R RIGHT FRONT INNER WING COVER		
NO NUMBER	RENEW FRONT PANEL CPL	15.0	67.50

PROGRESSIVE CAR CARE PTE LTD**Claim Reference: OD 1118 - 6757****Assessment Number: PA001715****Version: PROGRESS/2****Date Calculated: 12/11/2018 09:47****Full Report - V1****Registration: SJN4297S****Printed: 12/11/2018 17:47**

4161D8)	R + R BATTERY CONSOLE	2.0	9.00
812105	R + R WINDOW FRAME GRILLE	3.0	13.50
8121B2)	R + R L/-AND R/W-SCREEN FRAME AIR GRILLE	1.0	4.50
844100	R + R RIGHT FRONT DOOR TRIM	3.0	13.50
819110)	R + R OUTER RIGHT FRONT DOOR HANDLE (DOOR TRIM REMOVED)	2.0	9.00
8241C9	R + R R/F DOOR CHANNEL MOULDING	2.0	9.00
845100	R + R LEFT REAR DOOR TRIM	3.0	13.50
821130)	R + R LEFT OUTER REAR DOOR HANDLE (DOOR TRIM REMOVED)	1.0	4.50
8241F0	R + R L/R DOOR CHANNEL MOULDING	2.0	9.00
8111A5	RENEW REAR BUMPER	3.0	13.50
7141A0	R + R L/TAILLAMP	2.0	9.00
7141A5	R + R R/TAILLAMP	2.0	9.00
8331A0)	R + R LEFT REAR SIDE WINDOW GLASS	10.0	45.00
8131A8	R + R L/R WHEELARCH SHELL	1.0	4.50
849100	R + R FUEL FLAP	2.0	9.00
310105)	R + R FUEL FILLER NECK	5.0	22.50
823100)	R + R TAILGATE	9.0	40.50
823100)	RENEW TAILGATE (REMOVED)	8.0	36.00
	INCLUDES: R + R REAR WIPER, REAR WIPER MOTOR, LOCK, NUMBER PLATE LAMPS AND TAILGATE TRIMS		
832120	R + R REAR SCREEN	23.0	103.50
8391A0	R + R TAILGATE SEAL	3.0	13.50
8231A9)	R + R TAILGATE LOCK STRIKER	2.0	9.00
NO NUMBER	RENEW L/TAILLAMP PANEL	7.0	31.50
NO NUMBER	RENEW REAR END PANEL CPL	38.0	171.00
NO NUMBER	RENEW L/RR WING	73.0	328.50
NO NUMBER	RENEW REAR FLOOR CPL	28.0	126.00
8371A0	R + R L/R DOOR FRAME SEAL	2.0	9.00
8491A8)	R + R L/UPPER C-PILLAR TRIM	1.0	4.50
848140	R + R REAR END PANEL TRIM	1.0	4.50
NO NUMBER	R + R BOOT STORAGE BOX	2.0	9.00
NO NUMBER	R + R REAR PARCEL SHELF TRIM	1.0	4.50
8571C8)	R + R L/R LOWER SIDE PANEL TRIM	2.0	9.00
8571C9)	R + R R/R LOWER SIDE PANEL TRIM	2.0	9.00
865100)	R + R LEFT REAR SEAT BELT	1.0	4.50
710100	R + R BATTERY	2.0	9.00
311130	R + R REAR SILENCER	4.0	18.00
1151A2)	R + R FAN MOTOR	1.0	4.50
1111C0	R + R LOWER INTAKE MANIFOLD	7.0	31.50
114100)	R + R RADIATOR CPL WITH ATTACHED PARTS	4.0	18.00
114100 A	R + R OIL COOLER ADD	3.0	13.50
1211D5	R + R AIR FILTER HOUSING	4.0	18.00
118100)	R + R ALTERNATOR	4.0	18.00
421104)	R + R LEFT REAR WHEEL	2.0	9.00
616100)	R + R AIR CONDITIONING CONDENSER	8.0	36.00
114100)	R + R AIR CONDITIONING BLOWER MOTOR	5.0	22.50
NO NUMBER	REFILL + VENT AIR CONDITIONING	10.0	45.00
1202	REPAIR R/F SIDE MEMBER	20.0*	90.00

PROGRESSIVE CAR CARE PTE LTD

Claim Reference: OD 1118 - 6757

Assessment Number: PA001715

Version: PROGRESS/2

Date Calculated: 12/11/2018 09:47

Full Report - V1

Registration: SJN4297S

Printed: 12/11/2018 17:47

2953	REPAIR L/TAILGATE HINGE	5.0*	22.50
3991	REPAIR L/R SIDE MEMBER	20.0*	90.00
4101	REPAIR L/INN SIDE PANEL CPL	20.0*	90.00

LABOUR COST

Total Work Units	451.0	
Corrosion Protection		
Corrosion Protection External Labour	0.0HRS	0.00
Corrosion Protection Internal Labour	1.3HRS	58.50
Sub Total	45.1HRS	\$2,029.50
Paint Labour	22.6HRS	\$1,017.00
Total Labour	67.7HRS	\$3,046.50

PAINT WORK

Time Basis 10 WU = 1 HR. Price = \$45.00/HR

Guide Number	Description	WU	Cost Price (\$)
	- TWO PACK STRT COLOUR		
	- PREPARE OFF VEHICLE		
471	BONNET NEW PART PAINTING	12.0	
742	R/F WING NEW PART PAINTING	9.0	
1009	FRONT PANEL CPL SURFACE PAINT	6.0	
2711	REAR PANEL CPL NEW PART PAINTING	18.0	
2931	BOOTLID/TAILGATE NEW PART PAINTING	14.0	
3481	L/R SIDE PANEL NEW PART PAINTING	22.0	
3571	L/R LAMP PANEL SURFACE PAINT	4.0	
3900	BOOTFLOOR SURFACE PAINT	8.0	
283	FRONT BUMPER NEW PART PAINT K1R	12.0	
2583	REAR BUMPER NEW PART PAINT K1R	9.0	
741	L/F WING REPAIR PAINTING <50%	10.0	
1482	RIGHT FRONT DOOR REPAIR PAINTING <50%	15.0	
1781	L/R DOOR REPAIR PAINTING <50%	14.0	
3482	R/R SIDE PANEL REPAIR PAINTING <50%	12.0	
1201	L/F SIDE MEMBER SURFACE PAINT	4.0	
1202	R/F SIDE MEMBER SURFACE PAINT	4.0	
2112	R/F SILL PANEL SURFACE PAINT	5.0	
2230	RIGHT A-PILLAR SURFACE PAINT	4.0	
2292	RIGHT B-PILLAR SURFACE PAINT	5.0	
3572	R/R LAMP PANEL SURFACE PAINT	4.0	
3991	L/R SIDE MEMBER SURFACE PAINT	4.0	
3992	R/R SIDE MEMBER SURFACE PAINT	4.0	
4101	L/INN SIDE PANEL CPLSURFACE PAINT	5.0	

LABOUR COST - PAINT

TIME(PAINT)	204.0	
Preparation Main Work Plastic	3.0	
Preparation Main Work Metal	19.0	
Preparation Work Multi Layer Paint	0.0	
Total Work Units (10WU/HR)	226.0	
Total Paintwork Labour	22.6HRS	\$1,017.00

MATERIAL COST - PAINT

New Part Painting	\$110.83
New Part Painting - Plastic K1R	\$91.09
Material-Constant Main Work Metal	\$28.60
Surface-/Blend Paint	\$55.78

PROGRESSIVE CAR CARE PTE LTD

Claim Reference: OD 1118 - 6757

Assessment Number: PA001715

Version: PROGRESS/2

Date Calculated: 12/11/2018 09:47

Full Report - V1

Registration: SJN4297S

Printed: 12/11/2018 17:47

Repair Painting	\$60.75
Material-Const Main Work Plastic	\$9.00
Total Excluding Pearlescent Uplift	\$356.05
Pearlescent Uplift @ 0.0%	\$0.00
Total Paint Material Cost	\$356.05

PARTS

Price Valid: 01/06/2015

Guide No.	Qty	Description	Part Number	Supplier	Bet.	Price (\$)	
283	1	FRONT BUMPER <i>dist</i>	04711TF0G00ZZ		0%	150.00*	
293	1	FRT TOWING EYE COVER <i>def</i>	71104TF0000ZH		0%	11.00*	
317	1	L/F OUT BUMPER BRKT <i>nec</i>	71198TF0003		0%	10.00*	
318	1	R/F OUT BUMPER BRKT <i>nec</i>	71193TF0003		0%	10.00*	
319	1	L/F UPP BUMPER BRKT ?	71190TF0000		0%	15.00*	
320	1	R/F UPP BUMPER BRKT ?	71140TF0000		0%	15.00*	
340	1	FRT BUMPER SUPPORT <i>bt</i>	71130TF0000ZZ		0%	75.00*	
350	1	FRT BUMPER CLAMP KIT <i>nec</i>	USE SINGLE PARTS		0%	10.00*	
351	1	FRT LWR BUMP GRILLE <i>def</i>	71103TF0003		0%	55.00*	
410	1	GRILLE <i>cra</i>	71121TF0003		0%	65.00*	
431	1	GRILLE BADGE <i>nec</i>	75700TF0000		0%	15.00*	
471	1	BONNET <i>buc</i>	60100TF0306ZZ		0%	210.00*	
475	1	L/BONNET HINGE <i>bt</i>	60170TF0000ZZ		0%	18.00*	
476	1	R/BONNET HINGE <i>bt</i>	60120TF0000ZZ		0%	18.00*	
492	1	BONNET LOCK <i>dm</i>	74120TF0G11		0%	65.00*	
561	1	L/F HEADLAMP <i>cra</i>	33151TF0N51		0%	315.00*	
562	1	R/F HEADLAMP <i>cra</i>	33101TF0N51		0%	315.00*	
742	1	R/F WING <i>R</i>	60211TF0G00ZZ		0%	145.00*	X
790	1	R/F WING CLAMP KIT <i>nn</i>	USE SINGLE PARTS		0%	20.00*	X
842	1	R/WHEELHOUSE SHELL <i>nn</i>	74101TF0000		0%	25.00*	X
1009	1	FRONT PANEL CPL <i>buc</i>	60400TF0G01ZZ		0%	145.00*	
1331	1	BATTERY CARRIER <i>nn</i>	60630TF0000ZZ		0%	15.00*	X
1393	1	L/COWL PANEL GRILLE <i>nn</i>	74222TF0000		0%	20.00*	
1394	1	R/COWL PANEL GRILLE <i>nn</i>	74212TF0000		0%	20.00*	
1395	1	COWL TRIM GRILLE <i>nn</i>	74218TF0E00		0%	145.00*	X
1435	1	FILLER NECK <i>nn</i>	76805TF0003		0%	12.00*	
1436	1	WASHER RESERVOIR <i>nn</i>	76841TF0G01		0%	25.00*	
1437	1	W-SCREEN WASHER PUMP <i>nn</i>	76846TF0013		0%	35.00*	
2583	1	REAR BUMPER <i>dist</i>	04715TF0G00ZZ		0%	145.00*	
2619	1	L/R BUMPER BRACKET <i>nec</i>	71598TF0003		0%	9.00*	
2620	1	R/R BUMPER BRACKET <i>nec</i>	71593TF0003		0%	9.00*	
2650	1	RR BUMPER CLAMP KIT <i>nec</i>	USE SINGLE PARTS		0%	10.00*	
2711	1	REAR PANEL CPL <i>dist</i>	66100TF0306ZZ		0%	140.00*	
2931	1	BOOTLID/TAILGATE <i>dd</i>	68100TF0Q91ZZ		0%	240.00*	
2944	1	BOOT/TAILGATE SEAL <i>cut</i>	74440TF0003		0%	40.00*	
2973	1	REAR LOCK STRIKER <i>nn</i>	74813SEY003		0%	17.00*	X
2977	1	BOOT/TAILGATE LOCK <i>dm</i>	74801TF0902		0%	60.00*	
2979	1	REAR MOULDING <i>nec</i>	74890TG0Q00		0%	60.00*	
2980	1	BOOT/TAILGATE HANDLE <i>cra</i>	74810S6A003		0%	95.00*	
3017	1	BADGE JAZZ <i>nec</i>	75722TF0E02		0%	20.00*	
3160	1	REAR SCREEN BOND KIT <i>nn</i>	08CRCX016N0	NOT NECC	0%	0.00F	X
3161	1	UPP REAR SCREEN SEAL <i>nec</i>	73225TF0000		0%	25.00*	
3162	1	LWR REAR SCREEN SEAL <i>nec</i>	73226TF0000		0%	25.00*	
3163	1	REAR SCREEN FIX SET <i>nn</i>	USE SINGLE PARTS NOT NECC		0%	0.00F	X

PROGRESSIVE CAR CARE PTE LTD

Claim Reference: OD 1118 - 6757

Assessment Number: PA001715

Version: PROGRESS/2

Date Calculated: 12/11/2018 09:47

Full Report - V1

Registration: SJN4297S

Printed: 12/11/2018 17:47

3170	4	REAR SCREEN CLAMPS	91501S70003	NOT NECC	0%	0.00F	} X
3171	2	REAR SCREEN CLAMPS	91536SS0J01	NOT NECC	0%	0.00F	
3172	2	REAR SCREEN CLAMPS	91502S70003	NOT NECC	0%	0.00F	
3173	2	REAR SCREEN SPACER	73228TG0000	NOT NECC	0%	0.00F	
3281	1	L/R LAMP <i>CRG</i>	33550TF0003		0%	95.00*	X
3282	1	R/R LAMP <i>NN</i>	33500TF0003		0%	95.00*	
3481	1	L/R SIDE PANEL <i>Buc</i>	04646TF0300ZZ		0%	145.00*	X
3571	1	L/R LAMP PANEL <i>DD</i>	63720TF0305ZZ		0%	70.00*	
3677	1	L/R WHEELHOUSE COVER <i>Def</i>	74591TF0000		0%	25.00*	X
3783	1	L/R AIR VENT GRILLE ?	75450SAA013		0%	20.00*	
3819	1	L/R CORNER WDW SEAL	73526TG0000		0%	10.00*	} X
3821	1	L/R SIDE WINDOW SEAL	73525TF0000		0%	10.00*	
3861	1	L/S WINDOW BOND KIT	08CRCX016N0	NOT NECC	0%	0.00F	} X
3863	1	L/SIDE WDW MNTG KIT	USE SINGLE PARTS	NOT NECC	0%	0.00F	
3867	1	L/SIDE WINDOW CLIPS	91503TF0000	NOT NECC	0%	0.00F	
3871	1	L/SIDE WINDOW SPACER	91501S2R003		0%	3.57U	
3875	1	L/SIDE WINDOW CLIPS	91506S47003		0%	2.36U	} X
3900	1	BOOTFLOOR <i>R</i>	04655TF0300ZZ		0%	290.00*	
4465	1	CONDENSER <i>DD</i>	80110TF0013		0%	240.00*	X
4907	1	LOWER TAILGATE TRIM <i>NN</i>	84440TF0003ZA		0%	60.00*	
4971	1	L/UPP C-PILLAR TRIM <i>NN</i>	84181TF0003ZA		0%	60.00*	X
4985	1	END PANEL TRIM <i>Def</i>	84640TF0003ZA		0%	40.00*	
4988	1	BOOT FLOOR TRAY <i>NN</i>	84521TF0013ZA		0%	125.00*	X
4991	1	L/R SIDE PANEL TRIM <i>Def</i>	84651TF0E22ZA		0%	110.00*	
7761	1	RADIATOR <i>DD</i>	19010RB7Z51		0%	250.00*	} X
7767	1	L/FAN SHROUD ?	19015RB0004		0%	45.00*	
7768	1	R/FAN SHROUD ?	38615RB1J51		0%	45.00*	
7769	1	L/RADIATOR BRACKET	74171TF0000		0%	11.00*	
7770	1	R/RADIATOR BRACKET	74171SNAA00		0%	11.00*	} X
7773	1	LWR RADIATOR HOSE	19502RB0000		0%	16.00*	
7776	1	UPPER RADIATOR HOSE	19501RB0000		0%	16.00*	
7787	1	EXPANSION TANK	19101RB0000		0%	24.00*	
7789	1	L/FAN MOTOR	19030RB0004		0%	150.00*	} X
7790	1	R/FAN MOTOR	38616RB0003		0%	150.00*	
7793	1	L/RADIATOR FAN	19020RB0004		0%	40.00*	
7794	1	R/RADIATOR FAN	38611RBB003		0%	40.00*	
8411	1	ALTERNATOR	31100RB0004		0%	360.00*	} X
8433	1	V-BELT	38920RB0004		0%	30.00*	
8781	1	L/WHEELHOUSE COVER <i>torn</i>	74165TF0000		0%	20.00*	} X
8782	1	R/WHEELHOUSE COVER <i>NN</i>	74115TF0000		0%	20.00*	
8827	1	RR EXHAUST SILENCER <i>NN</i>	18307TG0T51		0%	240.00*	} X
9645	1	LOW TONE HORN ?	38100SWAA02		0%	30.00*	
9646	1	HIGH TONE HORN ?	38150SNAX02		0%	30.00*	} X
1000	1	UNDERCOVER CLIP <i>NEL</i>	Renew		0%	20.00*	
1000	1	BONNET RUBBER R	Renew		0%	20.00*	} X
1000	1	BONNET RUBBER L	Renew		0%	20.00*	
1000	1	BONNET AIR INTAKE <i>NN</i>	Renew		0%	18.00*	} X
1000	1	BATTERY BRKT <i>B+</i>	Renew		0%	18.00*	
1000	1	R/L FENDER COWL CLIP <i>NN</i>	Renew		0%	20.00*	X

f: OEM Parts
g: Original
h: Secondhand

Saving
Sub Total
Mark Up From Cost (10 %)

\$109.45
\$5,918.93
\$591.89

PROGRESSIVE CAR CARE PTE LTD

Claim Reference: OD 1118 - 6757
 Assessment Number: PA001715
 Version: PROGRESS/2
 Date Calculated: 12/11/2018 09:47

Full Report - V1
 Registration: SJN4297S
 Printed: 12/11/2018 17:47

p: Parallel
 x: Exchange

Sundry Parts (Fixed) \$0.00
Total Parts \$6,510.82

THIS ASSESSMENT CONTAINS UNPRICED PARTS
 NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description		Betterment	Price
BATTERY	SPECIALIST NN	0%	\$180.00 X
AIRCON COOLANT	SPECIALIST NPL		\$50.00
RADIATOR COOLANT	SPECIALIST NPL	0%	\$20.00
F/BUMPER NO PLATE	SPECIALIST BT		\$35.00
R/BUMPER NO PLATE	SPECIALIST NN	0%	\$35.00 X
R/WS SEALANT	SPECIALIST NPL		\$60.00
R/FENDER SEALANT	SPECIALIST NPL	0%	\$30.00
R/BUMPER SENSOR	SPECIALIST DM		\$200.00
AUDATEX FEE	SPECIALIST NPL	0%	\$42.00
Total Extras			\$652.00

Final Calculation

Total Parts	\$6,510.82
Labour	
Total Panel/Mechanical	\$1,971.00
Total Paintwork	\$1,017.00
Corr Prot Internal 13 WU	\$58.50
Total Labour	\$3,046.50
Additional Costs	
Corr Prot Materials External	\$0.00
Cost of Specialist	\$652.00
Total of Additional Costs	\$652.00
Total Paint/Material Costs	\$356.05
Grand Total Excludes GST	\$10,565.37
GST @ 7 %	\$739.58
Grand Total Includes GST	\$11,304.95

Assessment Notes

LKK Auto Consultants hence notify
 the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and
 is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: