SS AEC BY:	REF CS	\$118008b	53/Atb-	Specie	A luctruction	
	Marian A	SSIGNMEN	T (Office)			
Milmin	. of	Tr		D	ste/Time	810C11-10
		13	all to:			
V	TP RES / OD RES / EVA / II			Insured: _	SHD	Mcab
	JD Motors	ants		Tel:	9237	3644
of	25 Kaki Bul		# 06-38			
Policy No:			Claim No:	MCT 18	305024	1
Sum busured;			Excess:			
Make of Veh				D	LA.0.0	0051018
(Client's Record)		11	15/2018			
	REP. / REV 24 HRS 10091	Contacted.	Ronnie	. Ve	H.O.D. En	0
Date/Figure	Action/festruction (X)	Estimate				•
	THERE YEE		(lybs)		Oth	0370-14.
	SHO. LIBITM - X					
15/5/18	Dismantled					
	Submit lump Sum \$ 5	300 ,6	Days C	led. F	750',	52%)

13/11 - File pass to typist

RECEIVED 1 3 NOV 2018.

,	ASSI	GNMENT
	Date:	Veh No: SJY 8317 J Yr Regn: 2010, Oct
From: Estimated Cost:	Date.	Type: M.Cary M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
	RES / OD RES / EVA / INV / MV	Truck / Trailer or
		Make: Toyota Camry co 1998
o Inspect Vehicle		Make: Toyota Camry c.c 1988 Colour Silves. A/C: Insured/Std/NI/NA
at Workshop m/s		Sp.Reading 217223 T/Radio: Insured / Std / NI / NA
nt .		Eng/No:
nsured:		200(28 K41070 L031).
Policy No.		Gen. Cond: Good / Fair / Poor / Burnt
Claims No.		Steering: Inorder / Jammed / Leaked / Burnt or
Sum Insured:	Excess:	O
(Client's Recon	ď)	
Make of Veh:		Modi: Nil /S/Rim / STD A/Rim or
	**	Tyre Size: F: 225/45R18
(Policy Conditi	ion)	R: 225/45R18
	eh had commenced its N/S O/S	BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
repair	r at the time of inspection.	TOYOTYOKO or Achilles.
Bal. or Market V	/alue	Front Rear
- Sally Seeds Malandine	a delecta Ven or No	R/Bal. 06 mm R/Bal. 06 mm
IDAC Accident	Canalatant2 : Van ar No	L/Bal. 06 mm L/Bal. 06 mm
GIA / PR See	No. Was at No.	D.O.A. D.O.J. 14 05/18
Est. Repairs:		Survey held at JD Motar sport.
Lum Sam:	% 3 Val.: Yes or No	Des. of Damages : Frt / Rear / O/S / N/S / U/C / Rooftop or
CA / REV	/ REP. / 24 HRS	
Date:	Person Contacted:	The U/C / Chassis frame / Body Structure affected due to collision.
	Action / Instruction	
Date / Time	TP (11 PRS	
	11	
	MV: 42K	
	9V:26K	
	Ne#: 161C.	
		DEWED 4.7 MAY 2010
16/2/18	Submid Phs Report RE	CEIVED 1 7 MAY 2018
Date/Time, File F	Pass 10? : Preli. Report	Days Of Repair:
Caleranie, rad r	: Final Report	Resurvey No. of Trip: Survey Fee: 80
I)		Transportation: 80
Date/Time, File		Fee: Site Insp (\$) _s+Rssi
2)		Interview (\$) Photos
		Tech Invs (\$) Others 70
Report Fo		Weekend (\$.)
Lump Sur	m / I.B.I: (\$	TOTAL 120

Catherine Chong (LKK Auto)

From:

Olivia Lau (LKKAuto) <olivialau@lkkauto.com>

Sent:

Tuesday, 9 October, 2018 9:04 AM

To:

Hsiao Tong (LKKAuto); assignments; Admin A

Subject:

FW: Our Ref: MCT 18050242

From: Mekavathanan Sarangapani

Sent: Tuesday, 9 October 2018 9:03:43 AM (UTC+08:00) Kuala Lumpur, Singapore

To: Olivia Lau (LKKAuto)

Cc: Joel Nah Shern Ern; Sherini Pillai Subject: Our Ref : MCT 18050242

Olivia and team - paper survey please

TPPD claim thru Hin Tat .

Joel - once complete LOD comes in- provide rights to LKK to conduct paper survey please

Meka

Date:

EFERENCE

andling Insurer:

India International Insurance Pte Ltd

laimant Vehicle No: SJY8317J ate of Loss:

10/05/2018

Policy No

Insured Vehicle No:

Nature of Claim:

ESCRIPTION & IDENTIFICATION OF VEHICLE

eg No:

SJY8317J

lake & Model:

TOYOTA CAMRY, 2.0 (A)

eg. Date:

05/10/2010 (Man. Year 2010)

olour

Silver

ngine Capacity:

1998 cc N/A

larket Value/New Car Price: um Insured (SS):

Market Value/New Car Price

ONDITION OF VEHICLE AT THE TIME OF SURVEY

ieneral Condition:

Steering (Serviceable):

Yes

andbrake (Serviceable):

Yes

Engine Modification:

Footbri No Pre-ac

Er

CI

0

ONDITION OF TYRES

ront Tyre Size:

225/45 R18

Rear Tyre Size:

ront Left Side:

Achilles 6 mm

Rear Left Side:

ront Right Side:

Achilles 6 mm

Rear Right Side:

he above values represent the remaining tyre treads depth

OST OF CLAIMS		Repairer's	Adjuster's
arts		0.00	0.00
tiscellaneous Items		0.00	0.00
abour		0.00	0.00
aintwork Labour		0.00	0.00
owing		0.00	0.00
	Nett Amount (S\$)	0.00	0.00

ISPECTION

dinatari

ate of Assignment

11/05/2018

ate inspected:

14/05/2018

Inspected At:

Jd Motorsports Pte Ltd (HQ)

25 KAKI BUKIT ROAD 4, #06-38 SYNERGY

Singapore 417800

stimated Period of Repair:

0.0 days

Managari

Un 7han Tian

ADDIANTINO

Case	Notified	Est Submitted	Adj Assigned	Adj Submitted
Main	16 May 2018		11 May 2018 00:00	21 May 2018 10:16 S\$0.00
				(S\$181.90)

Main		Offer Processing	Claim Details	Adjı	uster's Details
CLAIM SUBFOL	DER DETAIL	LS			[Created by a
Insured:	-, Co. Reg.	No.: -			
Main Claimant:	HANZ MAN	TORA SERVICES, Co. Reg. N	o.: 53333682A		
Vehicle Reg. No.:	SJY8317J			Date of Loss:	10/05/2018 12: [91 Months and
Claim Type:	TP / MCT18050242			Policy/Cover Note No.:	MCOM0015 (This
Vehicle Reg. No. (Insured):	SHD6652M			Policy No. (Claimant):	
				Excess:	
Repairer:	Jd Motorspe	orts Pte Ltd (HQ) PROFILE	25 KAKI BUKIT ROAD 4, #0	6-38 SYNERGY@	KB, 417800 Kaki B
Handling Insurer:		national Insurance Pte Ltd (I			
Adjuster:	LKK Auto Co	onsultants Pte Ltd (HQ) - Tel	: 6256-3561 [Handled by	ADRIAN LING] [Final Rpt o
CLAIM REGIST	TERED				
Clm. No (Clm Re	g Date)	MCT18050242 (25/06/20	018)	Intimation (Not	ify Date)
		Fac 11 17			

Best Regards,

Mekavathanan

HOD

Motor Claims Department

India International Insurance Pte Ltd

64 Cecil Street, #04/#05 IOB Building, Singapore 049711

DID: 6347 6105 Fax: 6224 4174



Kindly note that by submitting this claim to us, you are deemed to have agreed to us collecting, using, disclosing and processing your personal data, sharing your personal data with our service providers (located both inside and outside Singapore) and/or with other insurers in the general insurance industry, including the General Insurance Association of Singapore. This enables us to ensure proper processing, handling and/or dealing with your claim, which includes investigating the said claim, and complying with applicable laws. If you do not agree to the same, kindly let us know immediately.

DISCLAIMER:

This email is intended solely for the person to whom it has been addressed.

It may contain confidential and/or legally privileged information.

If you are not the person for whom this e-mail was intended, or if this e-mail has reached you by mistake, please delete it immediately and inform us of the error and also be hereby notified that any use, distribution, transmission, printing, copying or dissemination of this information in any way or in any manner is strictly prohibited and may be unlawful. Internet communications may not be entirely secure or accurate as information could be intercepted, corrupted, lost, delayed or contain viruses.

Therefore, we do not accept liability for any errors or omissions in the content of this message or any delay in delivery which may arise as a result of Internet transmission

or any modification.

Print this email only if it is absolutely necessary and help in preservation of environment.

India International Insurance Pte Ltd.

Registration No. 198703792-K

• E

	No	Subject Matter	Current	Revised	Remarks
	1	Reserves			
		TPPD	PRESERVE	(DIC	
		TPPI	PRESERVE		
		UNINSURED LOSS	PRESERVE		
		SUBRO	PRESERVE		
		LPPN			
		Investigation Fees			
		Survey Fees			
		Legal Fees			
		Others			
2		Fraud Check			
3	Upl	oad to merimen			
4		Grant Rights			
5		ga/ment			

FAX TX REPORT ***

TRANSMISSION OK

JOB NO. 3394 DESTINATION ADDRESS 965330313

SUBADDRESS DESTINATION ID

ST. TIME TX/RX TIME PCS. RESULT

10/10 16:56

00'19 1 OK



UGUSTINE & PARTNERS UEN NO. 53130863D Notaries Public

WEBSITE: www.htapartners.com.sg

EMAIL: anil@htapartners.com.si

Advocates of Solicitors

20 UPPER CIRCULAR ROAD #02-10/12 THE RIVERWALK SINGAPORE 058416 TEL: (65) 6533 0212 FAX: (65) 6533 0313

(65) 6338 3536 Service By Fax Not Accepted

Our Ref:

TCL.GCN.an.50162.18.jdm

Oaths

Your Ref:

SHD6652M

8TH October 2018

COMFORT PRANSPORTATION PTE LTD

383 Sin-Ming Drive Gas Building Singapore 575717

INDIA INTERNATIONAL INSURANCE P

Motor Claims Department 64 Cecil Street #05 IOB Building Singapore 049711

Dear Sirs,

By Post (w/o encl)

In Association with:

Strohal Legal Group Pte Ltd

International Legal Consultants

We are in receipt of your letter, which is receiving our allegely By We shall revert aboutly, trimitly note that By Hand By Fax (w/o encl) E ETD which a medical re-man Our Re

Name Date

9 OCT 2010

India International Insurance

ACCIDENT INVOLVING SJY8317J & SHD6652M ALONG TERMINAL 2 MULTI STOREY CARPARK ON 10TH MAY 2018 @ 12:20 HRS

We act for Hanz Mantora Services, the owner of motor vehicle no. SJY8317J, in relation to the abovecaptioned road traffic accident.

We are instructed that you were the owner and/or the insurers of motor vehicle no. SHD6652M at the material time. We are further instructed that the accident was caused by your authorized driver and/or your insured driver's negligence in the driving, control and/or management of your insured vehicle. As a result of the accident, our client's vehicle was damaged and our client has been put to loss and expense, particulars of which are as follows:

HIN TAT AUGUSTINE & PARTNERS UEN NO. 53130863D

WEBSITE: www.htapartners.com.sg

EMAIL: anil@htapartners.com.sg

Advocates & Solicitors Commissioners For C

20 UPPER CIRCULAR ROAD #02-10/12 THE RIVERWALK

SINGAPORE 058416 TEL: (65) 6533 0212 FAX: (65) 6533 0313 (65) 6338 3536

Service By Fax Not Accepted

Our Ref:

TCL.GCN.an.50162.18.jdm

Your Ref:

SHD6652M

8TH October 2018

COMFORT TRANSPORTATION PTE LTD

383 Sin Ming Drive Gas Building

Singapore 575717

By Post (w/o encl)

By Hand & By Fax (w/o encl)

In Association with:

Strohal Legal Group Pte Ltd

International Legal Consultants

INDIA INTERNATIONAL INSURANCE PTE LTD

Motor Claims Department 64 Cecil Street #05 IOB Building Singapore 049711

Dear Sirs.

10/10/2

ACCIDENT INVOLVING SJY8317J & SHD6652M ALONG TERMINAL 2 MULTI STOREY CARPARK ON 10^{TH} MAY 2018 @ 12:20 HRS

We act for Hanz Mantora Services, the owner of motor vehicle no. SJY8317J, in relation to the above-captioned road traffic accident.

We are instructed that you were the owner and/or the insurers of motor vehicle no. SHD6652M at the material time. We are further instructed that the accident was caused by your authorized driver and/or your insured driver's negligence in the driving, control and/or management of your insured vehicle. As a result of the accident, our client's vehicle was damaged and our client has been put to loss and expense, particulars of which are as follows:

1.	Cost of Repairs		\$11,050.00
2.	Loss of Use (13 days x \$150.00 per day)		\$ 1,950.00
	Survey Fess		\$ 876.00
4.	LTA Search Fee		\$ 7.49
5.	Costs (inclusive of GST)		\$ 1,070.00
6.	Incidentals		\$ 100.00
		Total	\$15,053.49

TAN HIN TAT AUGUSTINE SOH KHENG YEOW SEAN LIM THIAN SIONG TANG CHI LOONG

WOO FOONG LIN TAN E-FANG CLAIRE THAM LI MEI

LEONG LAI SIM
CAROLYN LIM MAY LEAN
HO KIM FOONG
SERENA GOH MAE LI
GONG CHIN NAM
MOHD ZIKRI B MOHD MUZAMMIL
MARILYN HO SU FEN
ANDREW PATRICK HILL

CONSULTANTS:

LIM KIA TONG JANET WEE-TAN



HIN TAT AUGUSTINE & PARTNERS

Page No. 2

Our Ref:

TCL.GCN.an.50162.18.jdm

Your Ref:

SHD6652M

.../Page 2

The following supporting documents are enclosed herewith: -

- Copy of Singapore Accident Statement and Police Report of SJY8317J;
- 2. Copy of Repair Invoice;
- 3. Copy of the Survey report with invoice and damage photographs of SJY8317J;
- 4. Copy of LTA Search Result

Please note that you and/or your insured driver should send to us an acknowledgement of receipt of this letter within **fourteen (14)** days of receipt of this letter, failing which our client will have no alternative but to commence proceedings against you and/or your insured driver without further notice to you and/or your insured driver.

Please note that if you and/or insured driver have a counterclaim against our client arising out of the accident, you and/or your insured driver are also required to send us a letter giving full particulars of the counterclaim together with all relevant supporting documents within eight (8) weeks of your receipt of this letter.

Please note that our client's claim is in respect of his property damage claim, and is strictly without prejudice to the uninsured losses and/or injury claim (if any).

Yours faithfully,

TANG CHI LOONG / GONG CHIN NAM

MSME18061402 / SME Motor Pts Ltd - Kiski Buikit ENTRY DATE & TIME: 11/05/2018 12:35 SUBMITTED BY: Chia Pei Ying

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

- 1. Please report correctly the details of the accident to speed up the claims process.
- 2. This Form must be completed by the Policyholder and/or the Authorised Driver.
- 3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or witholding of material facts may allow insurance companies to repudiate policy ability.
- 4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
- 5. Any false reporting may be referred to the Police for investigation.
- 6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
- 7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesald

			 45 3 16 16
ACCIL	2) =EKIL	SIA	- (0.1

Date Of Report

11/05/2018 12:35

Date Of Accident

10/05/2018 12:20

Exact Location Of Accident

ALONG TERMINAL 2 MULTI STOREY CARPARK

Country/State of Loss

SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number

SJYB317J

Insured/Policyholder

Name Of Registered Owner

HANZ MANTORA SERVICES

Co Reg No

53333682A

Email Address

NOEMAIL

Mobile Phone No

Alternative Phone No.

OFFICE-88621246

Vehicle Particulars

Manufacturer

Model

TOYOTA

CAMRY

Exact Purpose for which vehicle was being used at

time of accident

Are you claiming under your own insurance policy

for repair to your vehicle?

If No, Please state action to be taken

THIRD PARTY

Vehicle Category

PRIVATE CAR

Insurance Company

Name of Insurance Company

NTUC INCOME INSURANCE CO-OPERATIVE LTD

Type Of Coverage

COMPREHENSIVE

Fleet Policy

NO

Policy Number

5098935860

Cover Note Number

Driver

Name of Driver

NAZLY BIN ZAINI

NRIC No

S7735565J

Date Of Birth

07/12/1977

Occupation

INDOOR

Date Of Driving Pass

31/03/2004

Driving Experience

14 YEARS AND 1 MONTH

Gender

MALE

Mobile Number

(LOCAL) +65-91894316

Fax Number

Contact Number

EMail Address

NOEMAIL

BLK 735 WOODLANDS CIRCLE #02-491 Address 730735 Postcode Was driver an employee of the Insured's Company YES If No, Relationship of the Driver with the Insured Vehicle Registration Number of Driver's Own Vehicle Insurance Company of Driver's Own Vehicle General Information of the Accident Type Of Accident COLLISION - HEAD TO REAR Weather Conditions CLEAR Road Surface DRY Other Information Was any foreign vehicle involved in this accident? NO Number of vehicles involved in the accident Was any body injured in the Accident? NO Was any injured conveyed to hospital by NO ambulance? Was any other material or property damaged? YES I have been approached by unknown person(s) NO soliciting/offering accident claims assistance. Number of Passengers (Including Driver) **Details of Police Action** Was the accident reported to the police? NO If Yes, Please state which Police Station Was notice of intended Prosecution give NO If Yes, against whom?

Circumstances of Accident

I WAS DRIVING ALONG CHANGI AIRPORT TERMINAL 2 MULTI STOREY CARPARK GOING AT 20KM/H. SUDDENLY, I FELT A HUGE IMPACT FROM THE RIGHT SIDE OF MY VEHICLE. I QUICKLY STOPPED TO CHECK AND REALISED VEHICLE B DID NOT SAW MY VEHICLE CROSSING AND DASHED OUT. THUS, HITTING THE RIGHT SIDE OF MY VEHICLE. (HEAD TO SIDE)

Attachment(s)

Are accident photos available for attachment? YES
Was there any video captured by Car Camera? NO
Was there any audio recorded? NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number

SHD6652M

Vehicle Make/Model/Colour

VEHICLE B

Details Of Properties

TAXI

Vehicle Category

Name of Driver

NRIC/Passport Number

Contact Number

Address

Postcode

Insurance Company Name

Nature Of Damage

No, Of Passenger (Including Driver)

Sketch Plan Pg. 1

SKETCH PLAN

IMPORTANT NOTICE

- 1. Please report correctly the details of the accident to speed up the claims process
- 2. This Form must be completed by the Policyholder and/or the Authorised Driver
- 3 Information provided must be as <u>truthful and accurate as possible</u>. Any wilful misrepresentation or withholding of material facts may allow insurance companies to <u>repudiate policy liability</u>.
- 4 The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
- 5 Any false reporting may be referred to the Police for investigation.
- 6 The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties
- 7 By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
- 8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer [collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of
 - processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me
 - (iv) administering my claims (including the mailing of correspondence, statements: invoices reports or notices to me
 which could involve disclosure of certain personal data about me to bring about delivery of the same as well as or the
 external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the insurers, awyers/law firms, may/are permitted to coffect, use, disclose and/or process my Personal information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes
- (d) my Personal information will also be collected and used to compile claims history for the purpose of fraud detection investigation and management in present and all future claims
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.

Policyholder's Signature Date & Time Oriver's Signature (If driver is not the policy) Date & Time:

Reporting Centre Personner's Signature Name


NRIC/FIN NO

JD MOTORGODIS

Sketch Plan #2 Pg. 1

SKETCH PLAN

Von 3-7 SHD 6652 M

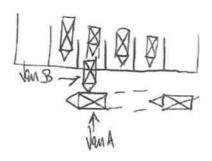

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT	
I was driving along Change Awport Terminal 2 multi	Stoney Campark going at
20 km/n, Suddenly I felt & huge impact from the right of	de of my veh. I quitly
stopped to check, and realise veh 3 did not sow my ve	h Crossing and dashed aut.
Thus hitling the right side of my vehicle.	
You had been advised by workshop that in the event that you wish to claim	Reporting Only
against your own policy (OD claim), there is a Fourteen (14) days clause	am 20
whereby the claim must be made within the stipulated timeframe from the day of occurance.	Ciairi To
	Glaim OD: 19 at other workshop
OECLARATION We declare the foregoing particulars are true in every respect	11 5/18 f 11.20 AM
oficyholder's Signature Driver's Signature	enoruse Centre Parsonnal's Course

Date & Time:

(If driver is not the policyholder).
Date & Time:

NRIC/FIN No





T/20180511/2103

1 of 3

Report No. T/20180511/2103

Police Station Of Origin: Sembawang N.P.C 4 Sembawang Crescent SINGAPORE 757633

Tel No: 1800-5549999

REPORT OF A TRAFFIC ACCIDENT

Date/Time Report Made: 11/05/2018 17:36			Vide Report No.:	Station Diary No.	
Informa	nt's Partic	ulars	The second secon	01	
Name of NAZLY	f Informant BIN ZAINI		Address: APT BLK 735 WOODLANDS CIRCLE #02-491 SINGAPORE 730735		
ID Type / ID No.: NRIC NO / S7735565J			Contact No.: Home/Office:	Maria	
National SINGAP	ity: ORE CITIZ	EN	Email: Mobile: 88621246		
Sex: Age: Date of Birth:			Type of Informant:		
Race: Malay			Language:	Institution / School Name:	
Occupation: GRAB DRIVER			Driving Licence Information: Class:	Date of Expiry:	

General Infor	mation of the Acc	ident	A CONTRACTOR OF THE PARTY OF TH	
Type of Accident:	Injury Others	Drink Drive: No	Date/Time of Accident: 10/05/2018 12:30	Type of Locatio Car Park
Location: Along Road 1 AIRPORT BO T2 MSCP		, , , ,	10/05/2016 12:30	
Weather: Clear		Road Surface: Dry	F	Road Speed Limit:
Traffic Flow:		Traffic Control:	T	raffic Volume:
Type of Collis Between Movi	ion: ing Vehicles - Head	I To Side	а	nyone conveyed by mbulance:

Vehicle No.	Type	Make	Model	10.	B. 71 - 27 Sept.	1000
SHD6652M		Marc	Model	Color	Condition	No of Passenger
01100032101	Car				Slightly	0
SJY8317J	Car				Damaged	
00100170	Car				Slightly	0
					Damaged	

Details of Person Involved	A A A A A A A A A A A A A A A A A A A
Any Pedestrian Involved: No	A STATE OF THE STA
No. of Pedestrians Injured: NIL	Use of Pedestrian Crossing: NA
	T 555 OF F CACSTRAIT CHOSSING, IVA





2 of 3

Report No. T/20180511/2103

Police Station Of Origin: Sembawang N.P.C 4 Sembawang Crescent SINGAPORE 757633

Tel No: 1800-5549999

CONTINUATION OF REPORT

Name	NAZLY BIN ZAINI		Sparing and the second	
		ID No.	S7735565J	
Related Vehicle	SJY8317J (Car)			
	(out)	Contact No.	88621246	
Hospital/Clinic	MOUNT ALVERNIA HOSPITAL			
	ALVERNIA HOSPITAL		Class: NIL Date of Expiry: NIL	
Date Treatment	10/05/2018	Licence & Expiry Date		
No. of Days grante	ed Medical Leave Los Date D	Discharge 10/05	/2018	
rief Details.	Degree	e of Injury Slight		

On the stated date time and place. I was travelling straight when the taxi fail to stop at the stop line turning right and hit onto the both my right door (driver and passenger side door). We did not exchange particulars. No traffic attended to the incident. I had seek treatment at Mt A and was given 5 days MC. I have already informed my insurance with regard to the accident.





Police Station Of Origin: Sembawang N.P.C 4 Sembawang Crescent SINGAPORE 757633 Tel No: 1800-5549999

3 of 3 Report No. T/20180511/2103

CONTINUATION OF REPORT

Sketch Plan

Informant is not able to provide sketch plan

IMPORTANT: Please attach a copy of your vehicle's Insurance Certificate to this report. If you don't have the certificate with you now, please fax a copy to 65474885 stating the **report number** as reference.

Signature Of Officer Recording The Report: F / Staff Sgt TEO BOON PIEW	Signature Of Informant:
Signature Of Interpreter: Not applicable Singapore Police Force	Date/Time: 11/05/2018 17:36
Officer In Charge Of Case: TP / AEIT / Staff Sgt TANG SIEW PING Contact No.: 65476430	Classification Of Case:
uthentication Stamp	

HANZ MANTORA SERVICES c/o 25 Kaki Bukit Road 4 #06-38 Synergy @KB Singapore 417800

Vehicle Num.: SJY8317J Make/Model: Toyota Camry Accident Date: 10/05/18

Qty Particular

Unit Price

Amount S\$

Lump sum for total repair cost inclusive of spare parts and labour charges

\$11,050.00

MOTORSPORTS

Total S\$: \$1

\$11,050.00



6 tampines st 73, #01-03, singapore 528825 tel: 6746 2118 fax: 6746 1148 reg no: 53058468m Date

Our Reference : KAAS/TA/5094/8317/TP/05.18

Invoice No.

: 5094

: 31 July 2018

To: Hanz Mantora Services c/o 25 Kaki Bukit Road 4

#06-38, Synergy @ Kaki Bukit

Singapore 417800

INV	DICE	
PARTICULARS		AMOUNT
Vehicle No. : SJY 8317J		
Make/Model : Toyota Camry 2.0A		
Inspection of Vehicle)	
✓ Appraisal Report)	
106 Colored Photographs)	SGD 876.00
✓ Transport charges)	
Re-inspection fee)	
Disbursements		
Others (Specify)		
	Total	SGD 876.00

Dollars: Eight Hundred and Seventy-Six Only

(Cheque should be crossed and make payable to "Kelvin Automotive Appraising Services")

Kelvin Automotive Appraising Services



6 tampines st 73, #01-03, singapore 528825

tel: 6746 2118 fax: 6746 1148

reg no: 53058468m

Insured Policy No. Sum Insured Excess

Our Reference : KAAS/TA/5094/8317/TP/05.18

Date : 31 July 2018

To: Hanz Mantora Services c/o 25 Kaki Bukit Road 4

#06-38, Synergy @ Kaki Bukit

Singapore 417800

VEHICLE APPRAISAL REPORT

Name of Workshop

: JD Motorsports Pte Ltd

Place of inspection

: 25 Kaki Bukit Road 4 #06-38, Synergy@ Kak/ Bukit , Singapore 417800

Date of Assignment

: 14 May 2018

Date of Accident Date of Inspection : 10 May 2018 : 14 May 2018

PARTICULARS OF INSPECTED VEHICLE

Registration No.

: SJY 8317J

Make/Model

: Toyota Camry 2.0A

Year of Manufacture/Reg

Class/Type

: 2010

: Saloon

Engine No.

: Hidden From View

Chassis Frame No.

: MR053BK4107060311

Colour

: Silver

Odometer Reading

: 217,223 KM

CONDITION OF VEHICLE DURING SURVEY (Visual & Static Check Only)

General Condition

: Good

Paintwork Footbrakes

Steering

: Good

Serviceable : Serviceable

Undercarriage (Front) Undercarriage (Rear)

: Serviceable : Serviceable

Market Value

Scrap Value (PARF/OMV) : -

CONDITION OF TYRES ON VEHICLE

Make/Size

Thread Balance

Front Left Rear Left YOKOHAMA 215 / 55 R17

YOKOHAMA 215 / 55 R17

7mm 7mm

Front Right

YOKOHAMA 215 / 55 R17

7mm

Rear Right

YOKOHAMA 215 / 55 R17

7mm

*The above is an estimate of the remaining life of the tyre thread in millimeters

The information contained in these documents may be privileged and confidential, and is intended for the exclusive use of the addressee designation. If you are not the addressee, any enclosure, reproduction, distribution or other dissemination or use of this communication is strictly prohibited. If you have received this survey report in error, please contact us immediately by phone so that we can arrange for its return.



6 tampines st 73, #01-03, singapore 528825 tel: 6746 2118 fax: 6746 1148

reg no: 53058468m

Our Reference Vehicle Number

: KAAS/TA/5094/8317/TP/05.18

SJY 8317J ~

APPRAISEMENT SCHEDULE

LIST ITEMS:- RH side mirror RH front fender RH front door RH front door inner lock RH front door outer handle RH front door outer handle RH front door window regulator RH front door window regulator RH front door window regulator RH front door inner trim board RH side skirt RH rear door RH rear door inner lock RH rear door weatherstrip RH rear door weatherstrip RH rear door window regulator RH rear door inner trim board	Damaged Buckled Buckled Jammed Deformed Jammed Deformed Bent Not Working Deformed Deformed Deformed Deformed Deformed Buckled Shifted Deformed Deformed Deformed	\$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$	500.00 732.00 1,045.00 458.00 112.00 192.00 158.00 299.00 399.00 550.00 621.00 997.00 468.00 97.00	* ********	500.00 Repair 1,045.00 458.00 112.00 192.00 158.00 299.00 399.00 550.00 621.00 997.00
RH side mirror RH front fender RH front door RH front door inner lock RH front door protector RH front door outer handle RH front door weatherstrip RH front door window regulator RH front door window regulator RH front door inner trim board RH side skirt RH rear door RH rear door inner lock RH rear door protector RH rear door window regulator RH rear door inner trim board	Buckled Buckled Jammed Deformed Jammed Deformed Bent Not Working Deformed Deformed Buckled Shifted Deformed Deformed Deformed	\$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$	732.00 1,045.00 458.00 112.00 192.00 158.00 299.00 399.00 550.00 621.00 997.00 468.00	5555555555	Repair 1,045.00 458.00 112.00 192.00 158.00 299.00 399.00 550.00 621.00
RH front fender RH front door RH front door inner lock RH front door protector RH front door outer handle RH front door weatherstrip RH front door window regulator RH front door window regulator RH front door inner trim board RH side skirt RH rear door RH rear door inner lock RH rear door weatherstrip RH rear door weatherstrip RH rear door window regulator RH rear door window regulator RH rear door window regulator RH rear door inner trim board	Buckled Buckled Jammed Deformed Jammed Deformed Bent Not Working Deformed Deformed Buckled Shifted Deformed Deformed Deformed	\$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$	732.00 1,045.00 458.00 112.00 192.00 158.00 299.00 399.00 550.00 621.00 997.00 468.00	5555555555	Repair 1,045.00 458.00 112.00 192.00 158.00 299.00 399.00 550.00 621.00
RH front fender RH front door RH front door inner lock RH front door protector RH front door outer handle RH front door weatherstrip RH front door window regulator RH front door window regulator RH front door inner trim board RH side skirt RH rear door RH rear door inner lock RH rear door weatherstrip RH rear door weatherstrip RH rear door window regulator RH rear door window regulator RH rear door window regulator RH rear door inner trim board	Buckled Jammed Deformed Jammed Deformed Bent Not Working Deformed Deformed Buckled Shifted Deformed Deformed Deformed	\$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$	1,045.00 458.00 112.00 192.00 158.00 299.00 399.00 550.00 621.00 997.00 468.00	5555555555	Repair 1,045.00 458.00 112.00 192.00 158.00 299.00 399.00 550.00 621.00
RH front door inner lock RH front door protector RH front door outer handle RH front door weatherstrip RH front door window regulator RH front door window regulator motor RH front door inner trim board RH side skirt RH rear door RH rear door inner lock RH rear door weatherstrip RH rear door window regulator RH rear door window regulator RH rear door window regulator RH rear door inner trim board	Jammed Deformed Jammed Deformed Bent Not Working Deformed Deformed Buckled Shifted Deformed Deformed Deformed	* * * * * * * * * * * * * * * * * * * *	458.00 112.00 192.00 158.00 299.00 399.00 550.00 621.00 997.00 468.00	555555555	1,045.00 458.00 112.00 192.00 158.00 299.00 399.00 550.00 621.00
RH front door protector RH front door outer handle RH front door weatherstrip RH front door window regulator RH front door window regulator motor RH front door inner trim board RH side skirt RH rear door RH rear door inner lock RH rear door protector RH rear door weatherstrip RH rear door window regulator RH rear door window regulator RH rear door window regulator RH rear door inner trim board	Deformed Jammed Deformed Bent Not Working Deformed Deformed Buckled Shifted Deformed Deformed Deformed	\$ \$ \$ \$ \$ \$ \$ \$ \$ \$	112.00 192.00 158.00 299.00 399.00 550.00 621.00 997.00 468.00	\$ \$ \$ \$ \$ \$ \$ \$ \$	458.00 112.00 192.00 158.00 299.00 399.00 550.00 621.00
RH front door protector RH front door outer handle RH front door weatherstrip RH front door window regulator RH front door window regulator motor RH front door inner trim board RH side skirt RH rear door RH rear door inner lock RH rear door protector RH rear door weatherstrip RH rear door window regulator RH rear door window regulator RH rear door window regulator RH rear door inner trim board	Jammed Deformed Bent Not Working Deformed Deformed Buckled Shifted Deformed Deformed Deformed	\$ \$ \$ \$ \$ \$ \$ \$ \$ \$	192.00 158.00 299.00 399.00 550.00 621.00 997.00 468.00	555555	112.00 192.00 158.00 299.00 399.00 550.00 621.00
RH front door weatherstrip RH front door window regulator RH front door window regulator motor RH front door inner trim board RH side skirt RH rear door RH rear door inner lock RH rear door protector RH rear door weatherstrip RH rear door window regulator RH rear door window regulator RH rear door inner trim board	Deformed Bent Not Working Deformed Deformed Buckled Shifted Deformed Deformed Deformed Bent	\$ \$ \$ \$ \$ \$ \$ \$ \$	158.00 299.00 399.00 550.00 621.00 997.00 468.00	555555	192.00 158.00 299.00 399.00 550.00 621.00
RH front door window regulator RH front door window regulator motor RH front door inner trim board RH side skirt RH rear door RH rear door inner lock RH rear door protector RH rear door weatherstrip RH rear door window regulator RH rear door window regulator RH rear door inner trim board	Bent Not Working Deformed Deformed Buckled Shifted Deformed Deformed Bent	\$ \$ \$ \$ \$ \$ \$ \$	299.00 399.00 550.00 621.00 997.00 468.00	\$ \$ \$ \$ \$ \$	158.00 299.00 399.00 550.00 621.00
RH front door window regulator motor Me MARH front door inner trim board RH side skirt RH rear door RH rear door inner lock RH rear door protector RH rear door weatherstrip RH rear door window regulator RH rear door window regulator RH rear door inner trim board	Not Working Deformed Deformed Buckled Shifted Deformed Deformed Bent	\$ \$ \$ \$ \$	399.00 550.00 621.00 997.00 468.00	5555	299.00 399.00 550.00 621.00
RH front door inner trim board RH side skirt RH rear door RH rear door inner lock RH rear door protector RH rear door weatherstrip RH rear door window regulator RH rear door window regulator RH rear door inner trim board	Deformed Deformed Buckled Shifted Deformed Deformed Bent	\$ \$ \$	550.00 621.00 997.00 468.00	\$ \$	399.00 550.00 621.00
RH side skirt RH rear door RH rear door inner lock RH rear door protector RH rear door weatherstrip RH rear door window regulator RH rear door window regulator RH rear door inner trim board	Deformed Deformed Buckled Shifted Deformed Deformed Bent	\$ \$ \$	621.00 997.00 468.00	\$ \$	550.00 621.00
RH rear door RH rear door inner lock RH rear door protector RH rear door weatherstrip RH rear door window regulator RH rear door window regulator RH rear door inner trim board	Buckled Shifted Deformed Deformed Bent	\$ \$	997.00 468.00	\$	621.00
RH rear door inner lock RH rear door protector RH rear door weatherstrip RH rear door window regulator RH rear door window regulator motor RH rear door inner trim board	Shifted Deformed Deformed Bent	\$	468.00	je.	
RH rear door protector RH rear door weatherstrip RH rear door window regulator RH rear door window regulator motor RH rear door inner trim board	Deformed Deformed Bent	\$	1.000		
RH rear door weatherstrip RH rear door window regulator RH rear door window regulator motor RH rear door inner trim board	Deformed Bent		97.00		Realign
RH rear door window regulator RH rear door window regulator motor RH rear door inner trim board	Bent			\$	97.00
RH rear door window regulator motor RH rear door inner trim board	2.200.63		168.00	\$	168.00
RH rear door inner trim board	The second secon	\$	299.00	\$	299.00
	Not Working	\$	395.00	\$	395.00
	Deformed	18	460.00	\$	460.00
RH rear fender Review	Buckled	\$	961.00		Repair
RH front shock absorber	Buckled	\$	495.00	\$	495.00
RH front wheel hub w/ bearing	Damaged	\$	604.00	\$	604.00
RH front lower arm	Buckled		CONTRACTOR OF THE PROPERTY OF		435.00
DU	Buckled	_		407710	403.00
RH rear wheel hub w/ bearing	Damaged			0.70	658.10
1.001				_	000.10
4806		\$	11,506.10	\$	9,345.10
Less 25% 3,60+,50			000 * 200000000		2,336.28
300		\$	11,506.10		7,008.83
SPECIAL NETT ITEMS:-					
Sports rim (Set of 4 pcs) wt	Distorted	\$	1,600.00	\$	1,600.00
Tyre (Set of 4 pcs) @50% depreciation	Scratched	\$	1,440.00	\$	720.00
1-00	900	\$	3,040.00	\$	2,320.00
	RH rear shock absorber RH rear wheel hub w/ bearing A806 Less 25% SPECIAL NETT ITEMS:-	RH rear shock absorber RH rear wheel hub w/ bearing A806 Less 25% SPECIAL NETT ITEMS:- Sports rim (Set of 4 pcs.) Tyre (Set of 4 pcs.) Distorted Scratched	RH rear shock absorber RH rear wheel hub w/ bearing A806 SPECIAL NETT ITEMS:- Sports rim (Set of 4 pcs) Tyre (Set of 4 pcs) @50% depreciation reference of the control of the contr	RH rear shock absorber RH rear wheel hub w/ bearing A806 Less 25% SPECIAL NETT ITEMS:- Sports rim (Set of 4 pcs) Tyre (Set of 4 pcs) @50% depreciation	RH rear shock absorber RH rear wheel hub w/ bearing A806 Less 25% SPECIAL NETT ITEMS:- Sports rim (Set of 4 pcs) Tyre (Set of 4 pcs) @50% depreciation SPECIAL NETT ITEMS:- Sports rim (Set of 4 pcs) Sports rim (Set of 4 pcs) Special Specia



6 tampines st 73, #01-03, singapore 528825 tel: 6746 2118 fax: 6746 1148

reg no: 53058468m

Our Reference Vehicle Number : KAAS/TA/5094/8317/TP/05.18

: SJY 8317J

APPRAISEMENT SCHEDULE

S/N	Qty	Descriptions	Comments/ Conditions		Repairer's Estimate	Revised Amount
T		B/F		\$	14,546.10	\$ 9,328.8
		LABOUR & OTHER CHARGES:-				
1		To panel beat and renewal of all necessary damaged body parts		\$	2,080.00	\$ 804,920.0
2		To check wiring and rewire		\$	80.00	\$ 30 60.0
3		To remove and reinstall rh front door components		\$	80.00	\$ /60.0
4		To remove and reinstall rh rear door components		\$	80.00	\$ 60.0
5		To remove and reinstall front undercarriage items		\$	300.00	\$ ¥ 280.0
6		To remove and reinstall rear undercarriage items		\$	300.00	\$ × 280.00
7		To do 4 wheel alignment		\$	120.00	\$ 80100.00
8		To apply anti-rust		\$	180.00	\$ × 150.00
9		To putty and spray-paint of affected areas		\$	1,680.00	\$ 1,540.0
1				\$	4,900.00	\$ 4,450.00
					2130	
					total:6634.50	
				l		
					06 Days.	
					06 Days.	
	_		Sub - Total	\$	19,446.10	\$ 13,778.83



6 tampines st 73, #01-03, singapore 528825 tel: 6746 2118 fax: 6746 1148

reg no: 53058468m


Our Reference Vehicle Number : KAAS/TA/5094/8317/TP/05.18


: SJY 8317J


ASSESSMENT SUMMARY

Damages sustained were consistent with the subject vehicle being involved in a collision with another vehicle and the impact was delivered

Squarely to the RH Side portion of the vehicle.

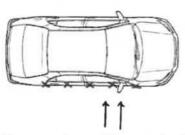

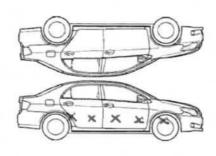

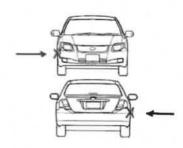

The general area of damages is at the

RH Side Portion

(Please refer to the parts list and photographs as attached for more information)

ASSESSOR'S RECOMMENDATIONS

The estimated repair costs submitted by Messrs

JD Motorsports Pte Ltd

13,778.83 and the repairer has agreed to undertake the repairs at a

is \$ 19,446.10 .

We have adjusted the cost to

Contract Lump Sum of

\$

\$ 11,050.00 to a acceptable quality and standards.

However, we have not given authorization and instruction to the repairer to proceed with the repairs.

The repairs should be completed within a reasonable period of

working days.

106 photographs were taken at the time of static inspection.

This report is strictly done in a Without Prejudice Basis.

We are reverting the matter to you a decision.

We enclose herewith our Invoice No.

5094

for our services rendered and

Kelvin Automotive Appraising Services

we thank you for engaging our services.

KELVIN TEO

Licensed Automotive Appraiser

Nitec in Automotive Technology

Dip MS MSAAA

NOTE: This revised estimate was from a visual inspection. Should there be any discrepancy or unseen items not listed in this survey, kindly notify the company within Seven (7) days from the date hereof. Otherwise this revised amount shall be treated as valid.

Enquire Vehicle & Owner Information (Vehicle No. SHD6652M As At 10 May 2018 / 12:22:00)

Law Firm Search Details

Search Reason:

Insurance claim in relation to traffic accident

Law Firm Case No.:

TCL.GCN.AN.50162.18

Current Owner Details

Owner ID Type:

Company

Owner ID:

199303821R

Owner Name:

COMFORT TRANSPORTATION PTE LTD

Registered Address Type: Private Residential (Condo Apt or House) / Shopping / Office Complexes

Registered Block/House No.:383

Registered Street Name: SIN MING DRIVE

Registered Unit No.:

Registered Building Name: GAS BUILDING

Registered Postal Code:

575717

Current Vehicle Details

Vehicle No.:

SHD6652M

Make Description/Model: MERCEDES BENZ / E220 BLUETEC

Insurance Company Name: INDIA INT'L INS PTE LTD



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

	Affiliated to Federation Intern	nationale Des Experts En Autom	obile
NDIA INTERNATIONA	AL INSURANCE PL	Ref : CS3/III18008652	2/Atbe2-1
64 CECIL STREET #05-02 IOB BUILDING	SINGAPORE 049711	Date: 14-11-2018 Code: III2	
	Policy Particul	ars :- THIRD PARTY CLAIR	M .
Insured Veh.	SHD 6652M	Veh. Inspected	SJY 8317J
Policy No.		Coverage (\$)	0.00
Claim No.	MCT18050242	Excess (\$)	0.00
Assign From		Assign Date	01/11/2018
	Vehicle P	articulars & Condition	
Make & Model	TOYOTA CAMRY	c.c	1998
Engine No.	HIDDEN	Year of Reg.	2010
Chassis No.	MR053BK4107060311	Colour	SILVER
Odometer	217223	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		
3.	Cor	ditions of Tyres	
	Size	Make	Balance
R/H Front Tyre	225/45 R18	ACHILLES	6 mm
L/H Front Tyre	225/45 R18	ACHILLES	6 mm
R/H Rear Tyre	225/45 R18	ACHILLES	6 mm
L/H Rear Tyre	225/45 R18	ACHILLES	6 mm
	Descr	iption of Damages	
THE VEHICLE SU	ISTAINED DAMAGES AT THE	O/S BODY.	
DAMAGES SEE	DETAILS.		
5.	Gen	eral Information	
Accident Date	10/05/2018	Inspection Date	14/05/2018
Survey held at	JD MOTORSPORTS PTE L	TD	
	25 KAKI BUKIT ROAD 4 #06-38 SYNERGY @ KB SINGAPORE 417800		
5a.		Remarks	
A)THE INSPECTI B)IN ACCORDAN	ON WAS CONDUCTED ON A CE TO YOUR INSTRUCTION	"WITHOUT PREJUDICE" BAS S, WE HAVE NOT AUTHORIS	IS. ED REPAIRS.
5b.	Estim	ate Days of Repair	
ESTIMATED NOR	RMAL PERIOD FOR REPAIR:	6 Working Day	S



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJY 8317J

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	RH SIDE MIRROR	NOT NECESSARY	500.00	-
1	RH FRONT FENDER	TO REPAIR SEE LABOUR	732.00	
1	RH FRONT DOOR	BUCKLED	1,045.00	1,045.00
1	RH FRONT DOOR INNER LOCK	NOT NECESSARY	458.00	-
1	RH FRONT DOOR PROTECTOR	DEFORMED	112.00	112.00
1	RH FRONT DOOR OUTER HANDLE	NOT NECESSARY	192.00	-
1	RH FRONT DOOR WEATHERSTRIP	DEFORMED	158.00	158.00
1	RH FRONT DOOR WINDOW REGULATOR	BENT	299.00	299.00
1	RH FRONT DOOR WINDOW REGULATOR MOTOR	NOT NECESSARY	399.00	-
1	RH FRONT DOOR INNER TRIM BOARD	DEFORMED	550.00	550.00
1	RH SIDE SKIRT	DEFORMED	621.00	621.00
1	RH REAR DOOR	BUCKLED	997.00	997.00
1	RH REAR DOOR INNER LOCK	NOT NECESSARY	468.00	-
1	RH REAR DOOR PROTECTOR	DEFORMED	97.00	97.00
1	RH REAR DOOR WEATHERSTRIP	DEFORMED	168.00	168.00
1	RH REAR DOOR WINDOW REGULATOR	BENT	299.00	299.00
1	RH REAR DOOR WINDOW REGULATOR MOTOR	NOT NECESSARY	395.00	
1	RH REAR DOOR INNER TRIM BOARD	DEFORMED	460.00	460.00
1	RH REAR FENDER	TO REPAIR SEE LABOUR	961.00	:-
1	RH FRONT SHOCK ABSORBER	NOT NECESSARY	495.00	-
1	RH FRONT WHEEL HUB W/BEARING	NOT NECESSARY	604.00	
1	RH FRONT LOWER ARM	NOT NECESSARY	435.00	
1	RH REAR SHOCK ABSORBER	NOT NECESSARY	403.00	
1	RH REAR WHEEL HUB W/BEARING	NOT NECESSARY	658.10	
	LESS 25% DISCOUNT		-	-1,201.50
			11,506.10	3,604.50
	SPECIAL NETT ITEMS			
1	SET SPORT RIM (SET OF 4PCS) (SN)	DISTORTED	1,600.00	900.00

Report Ref No. CS3/III18008652/Atbe2-1



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
1	SET TYRE (SET OF 4 PCS) (SN)	NOT NECESSARY	1,440.00	
	(d. 9)		3,040.00	900.00
	LABOUR			
	TO PANEL BEAT AND RENEWAL OF ALL NECESSARY DAMAGED BODY PARTS. INCLUSIVE OF THE REPAIR OF RH FRONT FENDER AND RH REAR FENDER.		2,080.00	800.00
	TO CHECK WIRING AND REWIRE.		80.00	30.00
	TO REMOVE AND REINSTALL RH FRONT DOOR COMPONENTS.		80.00	60.00
	TO REMOVE AND REINSTALL RH REAR DOOR COMPONENTS.		80.00	60.00
	TO REMOVE AND REINSTALL FRONT UNDERCARRIAGE ITEMS.	NOT NECESSARY	300.00	
	TO REMOVE AND REINSTALL REAR UNDERCARRIAGE ITEMS.	NOT NECESSARY	300.00	- *
	TO DO 4 WHEEL ALIGNMENT.		120.00	80.00
	TO APPLY ANTI-RUST.	NOT NECESSARY	180.00	-
	TO PUTTY AND SPRAY-PAINT OF AFFECTED AREAS.		1,680.00	1,100.00
			4,900.00	2,130.00
	GRAND TOTAL		19,446.10	6,634.50

RECOMMENDED COST OF LUMP SUM REPAIRS	5,300.00
(TO ITS PRE-ACCIDENT CONDITION)	

Report Ref No. CS3/III18008652/Atbe2-1



ADRIAN LING WAI PING

B.Eng, AMSOE, AMIRTE, AMSAE-A, M. MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contact or tort, is accepted to any third party who may reply on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.