

ISSUANCE

ASS. REC BY:

REF: CS3/AXA17023774/B66-7

Special Instruction:

Surveyor

Mejmen

ASSIGNMENT (Office)

From (Person):

Chen Xinyou

of

AXA

Date/Time: 12.11.2018

Estimated Cost:

Bill to:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

SGX 343B

Insured:

GR 7385R

at Workshop no/s

N-51 Automotive

Tel:

68420051

of

Blk 2 kaki Bukit # 01-17/18 Autohub 2417921

Policy No:

P1754880

Claim No:

C0462939

Sum Insured:

Excess:

Make of Veh:

(Client's Record)

(up)

15/12/2017

D.O.A.

13/12/2017

CA / REV / REP. / REV 24 HRS

H.O.D. Endorsement

Date/Time:

3.45pm @ 14/12/17

Person Contacted:

Sabrina

Vehicle

IN/OUT

Date/Time

Action/Instruction (X) Estimate

SGX 343B - NA/INC17023750/r3

D.O.A.: 13/12/17

GR 7385R - NA/INC17023750/r3


D.O.A.: 13/12/17

Dismantle: 18/12/2017

After repair: 21/12/2017

19/11/18

Submit HC \$9,450/- @ 8 days  
(\$4,850/- Red - 34%)

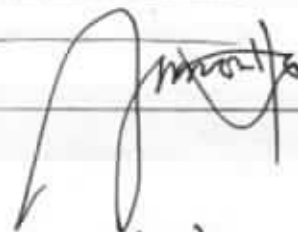

16/11/2018.

Repair days 8

TRIM

lim

15/11/18

PRG  
W. L. W. L.

REP: AXA

# ASSIGNMENT

From: 15/12/2017

Estimated Cost:

OD (TP) WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No: SGX 343B  
at Workshop n/s: N-51 Automotive  
of BIK 2 Kaki Bukit #01-17/18 Autohub

Insured

Policy No:

Claims No:

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

Est. or Market Value:

QAC Accident Report: Consistent? Yes or No

GA / FR Seen: Consistent? Yes or No

Est. Repairs: days Res: Yes or No

Lum Sum: % 3 Val: Yes or No

CA / REV / REP. / 24 HRS up

Date

Person Contacted

Vehicle IN / OUT

Date Time Action / Instruction

11/4 Submit PRS report.

Veh No: SGX 343B Yr Reg: 5/8/2007

Type: M/Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Toyota Vios 1497

Colour: Dark Grey A/C Insured / Std / NI / NA

Sp Reading: 172357 T Resc: Insured / Std / NI / NA

Eng No:

G No: MR254 AY913421586

Gen Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Mod: Nil / S/Rim / STD A/Rim or

Tyre Size F: 185 / 60 R15

R: 185 / 60 R15

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Y. L. L. (12)

Front

R/Bal: 4 mm R/Bal: mm

L/Bal: 4 mm L/Bal: mm

D.O.A: 13/12/2017 D.OI: 15/12/2017

Survey held at: As Above

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision

RECEIVED 12 DEC 2017

Date Time File Pass to?

☐ Prel. Report

☐ Final Report

Date Time File Return to?

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transport:

Phone:

Other:

Other:

Other:

Other:

Report Format: PRS

Lump Sum / I.B. / I.S

Add Fee: ☐ Site Insp \$

☐ Interview \$

☐ Tech. Insp \$

☐ Weighing \$

100

## ...CLAIM SUBFOLDER...(Pending for Payment)

Reinspection PRI

## CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	14 Dec 2017		14 Dec 2017 14:23		18 Apr 2018 09:58 <b>\$50.00</b> (S\$107.00)		<b>Pending for Payment</b> <a href="#">Cancel Case</a>

Main	Reference	Claim Details	Documents	Show All					
<b>CLAIM SUBFOLDER DETAILS</b> <span style="float: right;">[Created by insurer]</span>									
Insured:	RICCO ENGINEERING PTE LTD, Co. Reg. No.: 200507625W								
Main Claimant:	CHEN HAN YEN								
Vehicle Reg. No.:	SGX343B	Date of Loss:	13/12/2017 14:00 - :59 [124 Months and 5 Days From LTA Reg Date (Man Yr)]						
Claim Type:	TP / C0462939	Policy/Cover Note No.:	P1754880 (Third Party Only)						
Vehicle Reg. No. (Insured):	GR7385R	Policy No. (Claimant):							
		Excess:	S\$0.00						
Repairer:	N-S1 Automotive Pte Ltd (HQ) BLK 2 KAKI BUKIT, #01-17/18 KAKI BUKIT AUTOHUB, 417921 Kaki Bukit - Tel: 68420051								
Handling Insurer:	AXA Insurance Pte Ltd (HQ) - Tel: 6338 7288 ... [Handled by Chen Xinyou - 6880 4269]								
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by Teo Cheng Ming Wilson] ... [Final Rpt due 26/12/2017]								
Adj Asp. Remarks:	TP IS NOT ARC WORKSHOP.								
<b>ASSOCIATED MAIL RECEIVED</b> <span style="float: right;"><a href="#">View All</a> <a href="#">Compose Case Mail</a></span>									
<ul style="list-style-type: none"> <li>AXA_SG (12/11/2018): Paper Re-Survey</li> <li>AXA_SG (12/11/2018): Reinspection - C0462939/P1754880</li> <li>AXA_SG (14/12/2017): WP/ PRI Assignment - C0462939/P1754880</li> </ul>									
<b>ALL ASSOCIATED TASKS</b> <span style="float: right;"><a href="#">View All</a> <a href="#">Search Tasks</a> <a href="#">Create New Task</a> <a href="#">Complete</a></span>									
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

# VISION LAW LLC

Advocates & Solicitors - Notaries Public - Commissioners for Oaths  
(Incorporated with limited liability)

ERIC NO CHING BOON  
WONG KENG LEONG RAYNEY  
AUDREY WONG SU-RENN  
PAUL YAP TAI SAN  
ANJALI D O MUNANDY  
SEGA PARAM  
ANG KIM NOI DIANE  
RAVENDRA KRISHNASAMY  
JANICE HAN JIA LIN  
TAN YINGXIAN, SELWYN  
CHEONG YUNHUI, CLARISSA  
EDISON TAM CHYI EU

Unique Entity Number: 200721148H



Head Office: 133 New Bridge Road  
#18-01/02 Chinatown Point  
Singapore 059413

Branch: 490 Loring 6 Tea Payoh  
#03-11 HDB Hub (Bix 3 Lobby 1)  
Singapore 310490

Main  
TEL : (65) 6534 2811 (Hunting)  
FAX : (65) 6535 6802  
E-MAIL : annatan@visionlawllc.com

Branch  
TEL : (65) 63580703

WHEN REPLYING, PLEASE QUOTE OUR REFERENCE - Please to **HEAD OFFICE** for this matter

Our Ref : AKN-atv-Ins-N63-105279-17  
Your Ref : GR 7385 R

60113575

Date: 5 October 2018

3 0 1 9 5 3 9 1 2 8 - - -

WITHOUT PREJUDICE MAILROOM  
BY HAND

**AXA INSURANCE SINGAPORE PTE LTD**  
8 Shenton Way  
#27-01 AXA Tower  
Singapore 068811  
Attn: **Motor Claims Department**

**RICCO ENGINEERING PTE LTD**  
473A Geylang Road  
Singapore 389432

**CERTIFICATE OF POSTING**  
[For your information only]

Dear Sir,

**CLAIMANT : CHEN HAN YEN**  
**ACCIDENT INVOLVING SGX 343 B & GR 7385 R ON 13-DEC-2017 ALONG TPE SLIP ROAD TOWARDS LOYANG AVENUE AT ABOUT 1400HOURS**

We are instructed by the above named to claim damages against you/your insured in connection with a road traffic accident on **13-DEC-2017 ALONG TPE SLIP ROAD TOWARDS LOYANG AVENUE AT ABOUT 1400HOURS** involving our client's vehicle registration number **SGX 343 B** and vehicle registration number **GR 7385 R** driven by you/your insured at the material time.

We are instructed that the accident was caused by you/your insured's negligent driving and /or management of your/your insured vehicle. As a result of the accident, our client's vehicle was damaged and our client has been put to loss and expense, particulars of which are as follows:-

01.	Cost of Repair	\$15,301.00
02.	Loss of Use for 10 days at \$150.00 per day	\$ 1,500.00
03.	2 days loss of use for pre repair	\$ 300.00
04.	Survey report fees	\$ 1,058.00
05.	Towing fees	\$ 100.00
06.	GIA & LTA search / report fees	\$ 41.84
07.	Cost Contribution (at this stage)	\$ 1,605.00
08.	Disbursements (at this stage)	\$ 50.00

**TOTAL \$19,955.84**



.../2 to be continued next page

**CONFIDENTIALITY**  
THE INFORMATION CONTAINED IN THESE DOCUMENTS MAY BE PRIVILEGED AND CONFIDENTIAL AND IS INTENDED FOR THE EXCLUSIVE USE OF THE ADDRESSEE DESIGNATED ABOVE. If you are not the addressee, any disclosure, reproduction, distribution or other dissemination or use of this communication is strictly prohibited. If you have received this transmission in error please contact us immediately by telephone so that we can arrange for its return.

# VISION LAW LLC

Advocates & Solicitors

Page 2

Our Ref : AKN-atv-Ins-N63-105279-17

Your Ref : GR 7385 R

Date: 5 October 2018

## AXA INSURANCE SINGAPORE PTE LTD

8 Shenton Way  
#27-01 AXA Tower  
Singapore 068811

Attn: Motor Claims Department

## RICCO ENGINEERING PTE LTD

473A Geylang Road  
Singapore 389432

We enclose a copy of each of the following documents for your consideration:-

- (a) GIA report lodged by driver of SGX 343 B;
  - (b) Photographs taken at scene of accident;
  - (c) LTANet Search;
  - (d) Certificate of Insurance;
  - (e) Registration Card;
  - (f) Final Repair Bill;
  - (g) Surveyor's report & invoice; and
  - (h) 108 coloured photographs depicting the damages to motor vehicle SGX 343 B.
- (P.S:- Original photographs will be sent to insurance co. only)

The demand herein is in respect of our client's claim for damages pertaining to his motor vehicle and any settlement following or subsequent to this demand shall not prejudice our client's claim in respect of damages and consequential loss in relation to his personal injuries.

Please note that if you are insured and you wish to claim under your insurance policy, you should immediately pass this letter and all the enclosed documents to your insurer.

Please note that you or your insurer should send to us an acknowledgement of receipt of this letter within 14 days of your receipt of this letter, failing which our client will have no alternative but to commence proceedings against you without further notice to you or your insurer. Our client's claim herein is quantified based on supporting documents in our file. Until a settlement is reached, all negotiations are conducted on the basis that the damages quantified herein are subject to revision if so instructed by our client.

Please also note that if you have a counterclaim against our client arising out of the accident, you are also required to send to us a letter giving full particulars of the counterclaim together with all relevant supporting documents within 8 weeks of your receipt of this letter.

Yours faithfully



(HEAD OFFICE)

Enc.

cc: client: Chen Han Yen

*As per your instruction we have submitted your claim as set out above to the third party insurance company. Please do notify us if there is any discrepancy, if any, particularly, the number of days claimed for rental charges and/or loss of use as soon as possible. Thank you.*

### CONFIDENTIALITY

THE INFORMATION CONTAINED IN THESE DOCUMENTS MAY BE PRIVILEGED AND CONFIDENTIAL AND IS INTENDED FOR THE EXCLUSIVE USE OF THE ADDRESSEE DESIGNATED ABOVE. If you are not the addressee, any disclosure, reproduction, distribution or other dissemination or use of this communication is strictly prohibited. If you have received this transmission in error please contact us immediately by telephone so that we can arrange for its return.

## SINGAPORE ACCIDENT STATEMENT

### IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

### ACCIDENT STATEMENT

Date Of Report	14/12/2017 15:00
Date Of Accident	13/12/2017 14:00
Exact Location Of Accident	TPE SLIP RD INTO LOYANG AVE
Country/State of Loss	SINGAPORE

### DETAILS OF OWN VEHICLE

Vehicle Registration Number	SGX343B
<b>Insured/Policyholder</b>	
Name Of Registered Owner	CHEN HAN YEN
NRIC No	S1746701H
Email Address	NOEMAIL
Mobile Phone No	(LOCAL) +65-96557939
Alternative Phone No	OTHERS-96557939
<b>Vehicle Particulars</b>	
Manufacturer	TOYOTA
Model	YARIS
Exact Purpose for which vehicle was being used at time of accident	PRIVATE USE
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	PRIVATE CAR
<b>Insurance Company</b>	
Name of Insurance Company	NTUC INCOME INSURANCE CO-OPERATIVE LTD
Type Of Coverage	THIRD PARTY FIRE AND/OR THEFT
Fleet Policy	NO
Policy Number	5092465154
Cover Note Number	
<b>Driver</b>	
Name of Driver	CHEN HAN YEN
NRIC No	S1746701H
Date Of Birth	10/04/1966
Occupation	OUTDOOR
Date Of Driving Pass	09/10/1986
Driving Experience	31 YEARS AND 2 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-96557939
Fax Number	
Contact Number	OTHERS-96557939
Email Address	NOEMAIL

Address	BLK 211 PASIR RIS ST 21 #04-248
Postcode	510211
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OWNER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

#### General Information of the Accident

Type Of Accident	COLLISION - HEAD TO REAR
Weather Conditions	CLEAR
Road Surface	DRY

#### Other Information

Was any foreign vehicle involved in this accident?	NO
Was any body injured in the Accident?	YES
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

#### Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

#### Circumstances of Accident

PLS REFER TO THE ATTACHED STATEMENT.

#### Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	YES
Remarks/ Reasons:	NOT WORKING
Was there any audio recorded?	NO

#### DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	GR7385R
Vehicle Make/Model/Colour	
Details Of Properties	
Name of Driver	
NRIC/Passport Number	
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

#### Details of Witness

Name	
Phone Number	
Email Address	

#### DETAILS OF INJURED PERSON 1

Name	CHEN HAN YEN
Approximate Age	
Injuries Sustain	SLIGHT
Injured person in which vehicle?	SGX343B
Were seat belts worn?	YES
Was injured conveyed to hospital by ambulance?	NO
Address	
Postcode	



## Sketch Plan

### SKETCH PLAN

#### IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorized Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurers) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers", the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purposes of:
  - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
  - (ii) investigating the accident and/or my claims;
  - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
  - (iv) administering my claims (including the making of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
  - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes").
- (b) All insurer(s) who have insured vehicle(s) involved in this accident and the insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes, and
- (c) my Personal Information may/can be disclosed by any of the insurers and/or GIA to their third party vehicle providers or agents (including their lawyers/law firms), which may be situated outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
  - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
  - (ii) for complying with requirements under any regulations, laws or court orders.

Policyholder's Signature  
Date & Time

Driver's Signature  
(if driver is not the policyholder)  
Date & Time

Report Centre Personnel's Signature  
Name:  
NRIC/ID No.

Sketch Plan #2

Image As per Original  
--CSU--

SKETCH PLAN

VE Slip Road into Canyon Area



A-EG3 343R

W-4R 702-R

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT


On the morning of 12/12/17, I was driving my 2017 Ford Focus on Highway 101, heading south. I was in the right lane, and I was driving at approximately 60 mph. I was following a white sedan, and I was about 100 feet behind it. I was driving on a two-lane road, and there was a curve in the road ahead. I was driving on a wet surface, and I was not paying attention to the road. I was looking at my phone, and I was not aware of my surroundings. I was driving on a wet surface, and I was not paying attention to the road. I was looking at my phone, and I was not aware of my surroundings. I was driving on a wet surface, and I was not paying attention to the road. I was looking at my phone, and I was not aware of my surroundings.

DECLARATION

I/We declare the foregoing papers are true in every respect.

  
Driver's Signature  
Date & Time

  
Driver's Signature  
Date & Time

  
Driver's Signature  
Date & Time

Accident Photo



Accident Photo



Accident Photo



Accident Photo



Accident Photo



Accident Photo





Accident Photo



Accident Photo




Accident Photo



Accident Photo



Accident Photo

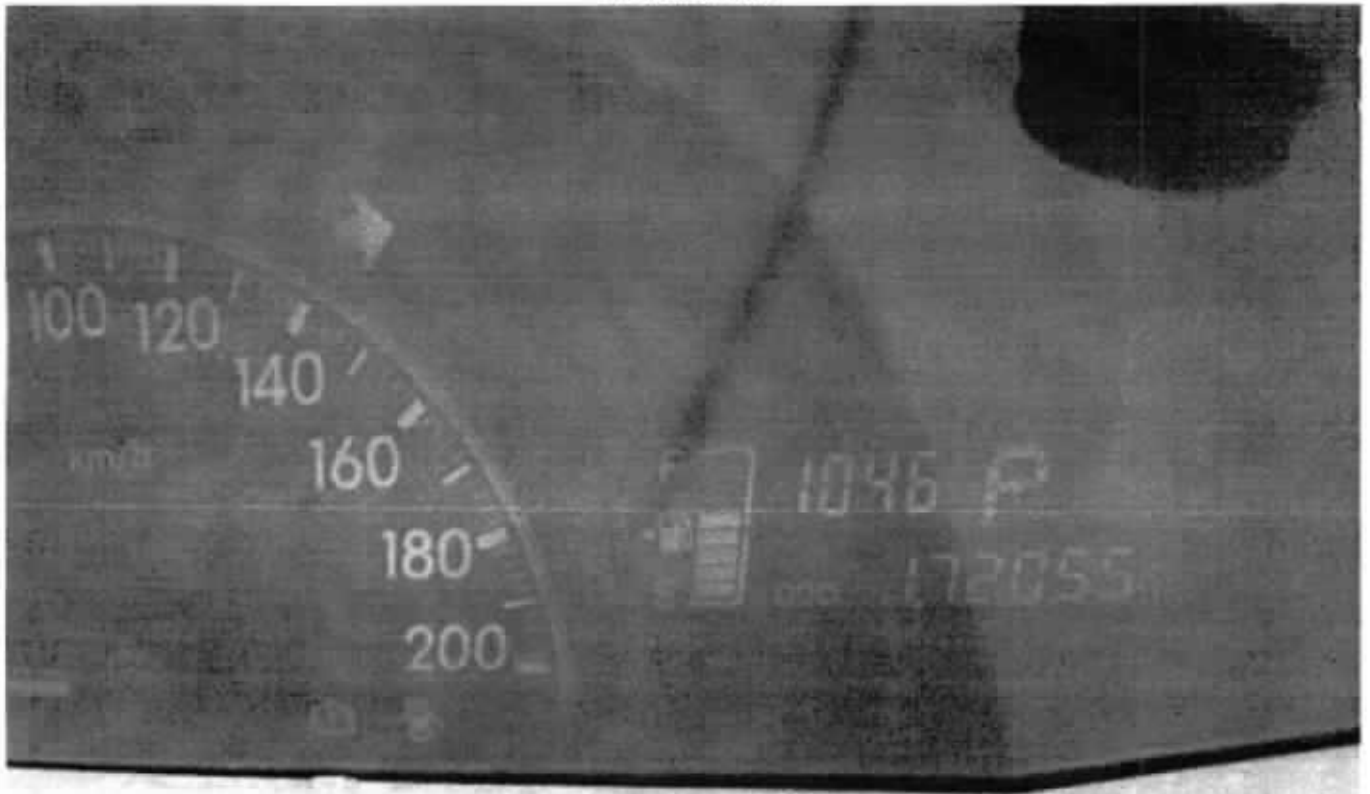

## Enquire Vehicle & Owner Information ( Vehicle No. GR7385R As At 13 Dec 2017 / 14:00:00 )

### Law Firm Search Details

Search Reason: Insurance claim in relation to traffic accident  
Law Firm Case No.: N63-105279-18

### Current Owner Details

Owner ID Type: Company  
Owner ID: 200507625W  
Owner Name: RICCO ENGINEERING PTE LTD  
Registered Address Type: Private Residential (Condo Apt or House) / Shopping / Office Complexes  
Registered Block/House No.: 473A  
Registered Street Name: GEYLANG ROAD  
Registered Unit No.: -  
Registered Building Name: -  
Registered Postal Code: 389432

### Current Vehicle Details

Vehicle No.: GR7385R  
Make Description/Model: NISSAN / CABSTAR  
Insurance Company Name: AXA INSURANCE PTE LTD



For security reasons, please **CLEAR YOUR CACHE** after each session.

S/No.	Asset Type	Asset ID	Asset Owner ID	Transaction Type	Transaction Amount(\$)
1	Vehicle	GR7385R -		18.19 Enquire Veh Owner Info (Others) by Law Firm	7.49





E LICENSED TO DRIVE VEHICLES IN THE FOLLOWING CLASS(ES)

EFFECTIVE DATE

1 Motorcycles  $\leq 200$  cc 31 May 2005  
M  $\leq 3500$  kg with  $\leq 7$  passengers, exclusive 31 May 2005  
vehicles  $\leq 2500$  kg



## Certificate of Insurance

MOTOR VEHICLES (THIRD PARTY RISKS AND COMPENSATION) ACT (CHAPTER 189)  
MOTOR VEHICLES (THIRD PARTY RISKS AND COMPENSATION) RULES, 1960  
ROAD TRANSPORT ACT, 1987 (MALAYSIA)  
MOTOR VEHICLES (THIRD PARTY RISKS) RULES, 1959 (MALAYSIA)

Certificate Number: 5092465154

Cover : Third Party, Fire & Theft

1. Index mark and Registration Number of Vehicle : **SGX343B**  
Chassis Number : **MR054HY9104021086**
2. Name of Policyholder : **CHEN HAN YEN**
3. Effective Date of Insurance : **06 Jul 2017**
4. Expiry Date of Insurance : **05 Jul 2018**
5. Persons or Classes of Persons entitled to drive#  
(a) The Policyholder.  
(b) Any other person who is driving on the Policyholder's order or with his/her permission.  
Provided that the person driving is permitted in accordance with the licensing or other laws or regulations to drive the Motor Vehicle or has been so permitted and is not disqualified by order of a Court of Law or by reason of any enactment or regulation in that behalf from driving the Motor Vehicle.
6. Limitations as to Use#  
(a) Use for social domestic and pleasure purposes and in connection with the Policyholder's business or profession.

**This Policy does not cover**

- (a) Use for hire or reward.
- (b) Use for racing, pace-making, reliability trial or speed-testing.
- (c) Use for the carriage of goods (other than samples) in connection with any trade or business.
- (d) Use for any purpose in connection with the Motor Trade.

# Limitations rendered inoperative by Section 8 of the Motor Vehicle (Third Party Risks and Compensation) Act (Chapter 189) and Section 95 of the Road Transport Act, 1987 (Malaysia), are not to be included under these headings.

EXCESS (SECTION 1)	N/A
EXCESS (SECTION 2)	N/A
ADDITIONAL EXCESS	N/A
UNNAMED DRIVER EXCESS	N/A
REPAIR AT OWNER'S PREFERRED WORKSHOP	NO
INSURE WITH COE	YES
NCD PROTECTION	NO
PRIMARY DRIVER	CHEN HAN YEN
NAMED DRIVER (1)	CHEN HAN HUA
NAMED DRIVER (2)	ENG CHU YANG
HIRE PURCHASE COMPANY	N/A
SUM INSURED	MARKET VALUE OF INSURED VEHICLE AT TIME OF LOSS

I/We hereby Certify that the Policy to which this Certificate relates is issued in accordance with the provisions of the Motor Vehicles (Third Party Risks and Compensation) Act (Chapter 189) and Part IV of the Road Transport Act, 1987 (Malaysia)

Agency : ELITE (L&G) ASSOCIATES (00000572855)  
Date of Issue : 06 Jul 2017 10:55 hrs

For NTUC INCOME INSURANCE CO-OPERATIVE LIMITED



Countersigned By:

Authorised Officer



Chief Executive

## Enquire PARF/COE Rebate for Registered Vehicle

### Vehicle Owner Particulars

Owner ID Type	Singapore NRIC
Owner ID	6701H

### Vehicle Details

Vehicle No.	SGX343B
Vehicle to be Exported	No
Intended De-registration Date	13 Dec 2017
Vehicle Make	TOYOTA
Vehicle Mode	YARIS G AUTO
Primary Colour	Silver
Manufacturing Year	2006
Engine No.	1NZX506870
Chassis No.	MR054HY9104021086
Maximum Power Output	80.0 kW (107 bhp)
Open Market Value	\$15,787.00
Original Registration Date	08 Aug 2007
First Registration Date	08 Aug 2007
Transfer Count	3
Actual ARF Paid	\$17,366.00

### Intended PARF Rebate Details

PARF Eligibility	Forfeited
PARF Eligibility Expiry Date	-
PARF Rebate Amount	\$0.00

### Intended COE Rebate Details

COE Expiry Date	31 Jul 2022
COE Category	A - Car (1600cc & below)
COE Period(Years)	5
PQP Paid	\$24,100.00
COE Rebate Amount	\$22,324.00
<b>Total Rebate Amount</b>	<b>\$22,324.00</b>

### Message

Please note that the 5-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.

The information contained herein is correct as at 13 Dec 2017

6557/yr

Bal = 4 yrs 7.6 mths

Text size + -

**Enquire PARF/COE Rebate for Registered Vehicle****Vehicle Owner Particulars**

Owner ID Type: Company

Owner ID: 0856G

**Vehicle Details**

Vehicle No.: SGX343B

Vehicle to be Exported: Yes

Intended De-registration  
Date: 20 Jun 2017

Vehicle Make: TOYOTA

Vehicle Model: YARIS G AUTO

Primary Colour: Silver

Manufacturing Year: 2006

Engine No.: 1NZX506870

Chassis No.: MR054HY9104021086

Maximum Power Output: 80.0 kW (107 bhp)

Open Market Value: \$15,787.00

Original Registration  
Date: 08 Aug 2007

First Registration Date: 08 Aug 2007

Transfer Count: 2

Actual ARF Paid: \$17,366.00

**Intended PARF Rebate Details**

PARF Eligibility: Yes

PARF Eligibility Expiry  
Date: 07 Aug 2017

PARF Rebate Amount: \$8,683.00

**Intended COE Rebate Details**

COE Expiry Date: 07 Aug 2017

COE Category: A - Car (1600cc &amp; below)

COE Period(Years): 10

QP Paid: \$16,000.00

COE Rebate Amount: \$210.00

**Total Rebate Amount: \$8,893.00**

The information contained herein is correct as at 19 Jun 2017.

OK

Land Transport Authority

Please read through the Privacy Statement, Terms of Use and Disclaimer.

Please do not use the **Back** or **Forward** buttons on your browser as this may alter the results of the transactions.

Best viewed with IE 6.0 SP3 and above, 1024 X 768 resolution

Copyright © 2017 LTA | [Privacy Statement](#) | [Terms of Use](#) | [Disclaimer](#) | [Rate the Website](#) | [Rate this e-Service](#)

Last updated on 11 Jun 2017 at 12:47 AM

# N-51 AUTOMOTIVE PTE LTD

Kaki Bukit AutoHub

2 Kaki Bukit Ave 2

#01-17 / #01-18 / Heavy Vehicle #01-08 / Spray Painting #02-27

Singapore 417921 Tel No. : +65 6842 0051 Fax No. : +65 6741 0510

E-Mail : sales@n51.com.sg

Company Reg. No. : 200616038C

GST Registration No. : 200616038C

CHEN HAN YEN

BLK 211 PASIR RIS ST 21 #04-248

SINGAPORE 510211

Contact : 96557939

## TAX INVOICE

Date : 11/09/2018

Date in : 13/12/2017

Vehicle Num. : SGX343B

Make/Model : TOYOTA YARIS G AUTO-2006

Chassis/Eng# : MR054HY9104021086/INZX506870

Accident Date : 13/12/2017

Claim No : CLM14336

Reference : DEC-27/2017

Policy No. : 5092465154 (05/07/2018)

LUMP SUM REPAIR BILL

AS PER SURVEYOR REPORT

REF : 0527-18-N51 DATED 03/09/2018

BY PAR AUTOMOTIVE CONSULTANCY

Amount S\$

14,300.00

E. & O.E. Sub S\$ : 14,300.00

Add GST ( 7 % ) S\$ : 1,001.00

Total Amount S\$ : 15,301.00



for N-51 AUTOMOTIVE PTE LTD



bizSAFE<sub>3</sub>

# PAR Automotive Consultancy

Regn. No: S2986974L

Thomson Rd Post Office PO Box 029 Singapore 915701. Tel: 645 31173, Fax: 645 36131.

---

Report No: 0527-18-N51

03 September 2018

Chen Han Yen  
Blk 211 Pasir Ris St 21 #04-248  
Singapore 510211

INVOICE No. 0527-18-N51

Vehicle No. SGX343B

<u>S/NO.</u>	<u>SERVICES RENDERED</u>	<u>Amount due</u>
1	Being accident vehicle appraisal services, transport, photographs and re-inspection (work in progress and post repair inspection).	\$1,058.00
Total amount payable		<u>\$1,058.00</u>

Kindly cross your cheque in favour of "PAR Automotive Consultancy"

We thank you in anticipation for your prompt payment.

PAR Automotive Consultancy



AUTOB. TO...

#01-55

S...

...

**CASH SALE**

(N-51)

No. \_\_\_\_\_

Sold to: \_\_\_\_\_

SGX 343 B

Date: 18/12/17

CROWN

Item	Quantity	Description	Unit Price	Amount
		Auto Hub to Ubi IDC		\$100
		Reportly Two Trips		1
E. & O. E.			Sub Total :	
			GST Tax :	
			Total :	\$100

Issued by: \_\_\_\_\_

# PAR Automotive Consultancy

Regn. No: 5298E974L

Thomson Rd Post Office PO Box 029 Singapore 915701. Tel : 645 31173, Fax : 645 36131.

---

Report No: 0527-18-N51

03 September 2018

## ACCIDENT VEHICLE SURVEY REPORT

Chen Han Yen  
Blk 211 Pasir Ris St 21 #04-248  
Singapore 510211

### VEHICLE INFORMATION:

<i>Vehicle Reg No.:</i>	SGX343B	<i>Odometer:</i>	172057km
<i>Make &amp; Model:</i>	Toyota Yaris G Auto	<i>Colour:</i>	Silver
<i>Chassis number:</i>	MR054HY9104021086	<i>Date of accident:</i>	13/12/2017
<i>Year of Regn.:</i>	08/08/2007	<i>Date inspected:</i>	15/12/2017
<i>Repairer at:</i>	N-51 Automotive Pte Ltd 2 Kaki Bukit Ave 2 #01-18 Kaki Bukit Auto Hub Singapore 417921	<i>Date inspected (After Repair):</i>	23/12/2017

### STATIC CHECKS, where applicable:

<i>Steering :</i>	serviceable
<i>Footbrake :</i>	serviceable
<i>Handbrake :</i>	serviceable
<i>Paintwork :</i>	Good
<i>General condition :</i>	Good

### TIRE CONDITION:

	<u>LH / Make</u>	<u>RH / Make</u>	<u>Size</u>
<i>Front:</i>	6mm/Yokohama	6mm/Yokohama	185/60R15
<i>Rear:</i>	6mm/Yokohama	6mm/Yokohama	185/60R15

### POINT OF IMPACT AND DAMAGE, where applicable:

Impact on the rear portion.  
Please see details as described in the Annex for parts and labour.

### REMARKS:

We have inspected the above-mentioned vehicle on a "Without Prejudice" basis.



## Parts and Labour Assessment

### PARTS

Description of part	Qty	Condition	Repairer's estimate	Our adjustment
REAR BUMPER	1	squashed	521.30	521.30 DDV
REAR BUMPER IMPACT BRACKET L/R	2	bent	111.20	111.20 BTV
REAR BUMPER INNER SIDE SHIELD CLIPS L/R	6	necessary	39.00	39.00 NEC ✓
REAR BUMPER INNER SIDE SHIELD L/R	2	fractured	264.50	264.50 CRA ✓
REAR BUMPER NUMBER PLATE LAMP	1	fractured	81.70	81.70 CRA ✓
REAR BUMPER SIDE RETAINER L/R	2	necessary	111.20	111.20 NEC ✓
REAR END PANEL	1	buckled	578.60	578.60 DD ✓
REAR END PANEL INNER TOP GARNISH	1	fractured	279.60	279.60 BRV
REAR END PANEL INNER TOP GARNISH CLIPS	4	necessary	26.00	26.00 NEC ✓
REAR END PANEL LOCK STRIKER	1	bent	43.70	43.70 BT ✓
REAR EXHAUST END CHROME PIPE	1	distorted	182.25	182.25 NNX
REAR EXHAUST GASKET	1	necessary	61.10	61.10 NEC
REAR EXHAUST RUBBER MOUNTING	2	distorted	78.80	78.80 } NNX
REAR EXHAUST SILENCER BOX	1	bent	781.80	781.80 }
REAR LH DOOR GLASS OUTER MOULDING	1	reuse	172.25	0.00
REAR LH DOOR INNER TRIM BOARD	1	fractured	781.10	781.10 BRV
REAR LH DOOR MECHANISM LOCK	1	bent	561.60	561.60 BT ✓
REAR LH DOOR WEATHERSTRIP	1	deformed	145.25	145.25 NNX
REAR LH FENDER	1	buckled	972.85	972.85 DDV
REAR LH FENDER INNER AIR VENT	1	warped	172.45	172.45 CRA ✓
REAR LH FENDER INNER TRIM BOARD	1	deformed	498.30	498.30 CRA ✓
REAR LH FENDER PETROL LID MECHANISM LOCK	1	reuse	123.05	0.00
REAR LH WHEEL HOUSE PANEL ASSY	1	repair	531.35	0.00
REAR RH FENDER	1	repair	972.45	0.00
REAR RH FENDER INNER TRIM BOARD	1	deformed	498.30	498.30 CRA ✓
REAR SPARE TYRE PANEL	1	repair	981.40	0.00
REAR SPARE TYRE PANEL INNER SIDE STORAGE BOX L/R	2	L-deformed	754.80	110.00 CRA ✓
REAR SPARE TYRE PANEL TOP UPHOLSTERY BOARD	1	deformed	581.25	581.25 BT ✓
REAR SPEAKER BOARD	1	reuse	591.60	0.00
REAR SUB CHASSIS FRAME L/R	2	repair	1,162.20	0.00
REAR TAILGATE	1	buckled	1,013.70	1,013.70 DDV
REAR TAILGATE 'LOGO' EMBLEM	1	necessary	53.70	53.70 }
REAR TAILGATE 'TOYOTA' EMBLEM	1	necessary	63.75	63.75 } NEC ✓
REAR TAILGATE 'YARIS' EMBLEM	1	necessary	47.80	47.80 }
REAR TAILGATE 3RD BRAKE LAMP	1	reuse	281.10	0.00
REAR TAILGATE DAMPER L/R	2	bent	438.60	438.60 NNX
REAR TAILGATE HINGES L/R	2	bent	139.40	139.40 NNX
REAR TAILGATE INNER TRIM BOARD	1	fractured	474.30	474.30 BRV
REAR TAILGATE LOCK ACTUATOR	1	shorted	261.60	261.60 CUT ✓
REAR TAILGATE MECHANISM LOCK	1	bent	123.90	123.90 BT ✓
REAR TAILGATE OUTER KEY LOCK	1	reuse	289.90	0.00
REAR TAILGATE OUTER KEY LOCK GARNISH	1	warped	274.45	274.45 BT ✓

REAR TAILGATE RUBBER GUIDE STOPPER	2	deformed	27.00	27.00	CUT✓
REAR TAILGATE WEATHERSTRIP	1	deformed	231.30	231.30	CUT✓
REAR TAILGATE WINDSCREEN	1	shattered	861.50	861.50	BR✓
REAR TAILGATE WINDSCREEN MOULDING	1	necessary	172.75	172.75	NECV
REAR TAILGATE WIPER ARM	1	bent	121.45	121.45	BT✓
REAR TAILGATE WIPER ARM COVER	1	fractured	61.10	61.10	DD✓
REAR TAILGATE WIPER ARM RUBBER SEAL	1	necessary	50.00	50.00	NECV
REAR TAILGATE WIPER MOTOR	1	shorted	581.90	581.90	NNX
REAR TAILLAMP BACK RUBBER GASKET L/R	2	necessary	87.40	87.40	} NECV
REAR TAILLAMP CLIPS L/R	2	necessary	13.00	13.00	
REAR TAILLAMP INNER PANEL L/R	2	L-buckled	379.80	189.90	DD✓
REAR TAILLAMP L/R	2	fractured	722.60	722.60	BR✓
SPARE TYRE RETAINER LOCK	1	bent	163.70	163.70	BT✓
Subtotal before discount			S\$ 19,596.65	S\$ 13,656.65	
Percentage discount 25% and 25%			S\$ 4,899.16	S\$ 3,414.16	
Sub-total 1			S\$ 14,697.49	S\$ 10,242.49	
REAR TAILGATE WIRE HARNESS - SET	1	reuse	380.00	0.00	
Subtotal before discount			S\$ 380.00	S\$ 0.00	
Percentage discount 10% and 10%			S\$ 38.00	S\$ 0.00	
Sub-total 2			S\$ 342.00	S\$ 0.00	
REAR BUMPER CLIPS - SET	1	necessary	30.00	30.00	NECV
REAR BUMPER LOWER LIP	1	deformed	600.00	300.00	DIS✓
REAR BUMPER NUMBER PLATE	1	bent	25.00	25.00	} BT✓
REAR BUMPER NUMBER PLATE HOLDER	1	bent	50.00	20.00	
REAR BUMPER REVERSE CAMERA	1	shorted	800.00	800.00	NNX
REAR BUMPER REVERSE SENSOR - SET	1	shorted	350.00	200.00	350.00 CUT✓
REAR LH DOOR INNER TRIM BOARD CLIPS - SET	1	necessary	30.00	30.00	NNX
REAR LH FENDER INNER TRIM BOARD CLIPS - SET	1	necessary	30.00	20.00	30.00 NECV
REAR RH FENDER INNER TRIM BOARD CLIPS - SET	1	necessary	30.00	30.00	NNX
REAR TAILGATE INNER TRIM BOARD CLIPS - SET	1	necessary	30.00	20.00	30.00 NECV
REAR TAILGATE SPOILER CLIPS - SET	1	necessary	30.00	20.00	30.00 NECV
REAR TAILGATE WINDSCREEN SEALANT	1	necessary	100.00	60.00	100.00
SPARE TYRE	1	reuse	280.00	0.00	
Subtotal before discount			S\$ 2,385.00	S\$ 2,105.00	
Sub-total 3			S\$ 2,385.00	S\$ 2,105.00	
Parts-total			S\$ 17,424.49	S\$ 12,347.49	

## LABOUR

To remove, reinstall electrical wiring harness, check lighting, and rewire for parking sensor.

120.00 <sup>50.00</sup> 80.00

To remove, reinstall tailgate windscreen

150.00 ~~300.00~~ 120.00 ✓

To remove, reinstall rear suspension and undercarriage part. (to FR)

350.00 0.00

To road test driving, check and resetting wheel alignments system.

180.00 0.00

To remove, reinstall petrol tank. (to FR)

80.00 80.00 ~~110.00~~ 60

To remove, reinstall roof top trim upholstery, cushion seat, trim garnish, trim liner carpet. (to FR)

140.00 <sup>80.00</sup> 120.00

To send vehicle for cleaning, shampoo, upholstery and cushion seat.

200.00 150.00 ~~100.00~~ NN X

To re-spray painting on the rear bootlid, rear end panel, rear fender (L/R), spare tyre panel, rear bumper, rear doors (L/R), and roof-top panel.

2,000.00 <sup>1,000.00</sup> 1,540.00

To remove and change exhaust silencer box with pipe, re-align where necessary consistent to the accident.

180.00 <sup>80.00</sup> 120.00

To provide labour, workmanship to change the above damaged bodyparts, repair, re-construct and re-align body structure, body alignments and damaged consistent to the accident.

2,500.00 <sup>1,000.00</sup> 1,750.00 7200

To mount vehicle on to Car 'O' Liner.

400.00 400.00 NN X

To apply anti-rust chemical on repaired and replaced panel.


120.00 <sup>60.00</sup> 90.00

Labour Total	SS 6,420.00	SS 4,450.00
Parts & Labour Total	SS 23,844.49	SS 16,797.49

Results of inspection of the accident vehicle are as shown above.

We have taken into consideration the age and condition of the vehicle in our recommendation.

Hence, the recommended cost of repairs based on Lump Sum repairs is : SS 14,300.00 and the recommended number of working days for the repairs is within 10 day(s).

  
B J Loi (I Eng., MIM, AIRTE)  
Automotive Appraiser

Repair days 8

TGTim



15/11/18



Your Ref: C0462939

Date: 21<sup>st</sup> Nov 2018

Our Ref: CS3/AXA17023774/Bsbe2-1

**M/s Axa Insurance Pte Ltd**

8 Shenton Way #24-01

Axa Tower

Singapore 068811

(The Motor Claims Department)

Attn : Chen Xinyou

Dear Sir / Madam,

**EVALUATION REPORT (PAPER SURVEY) OF ACCIDENT VEHICLE NO: SGX 343B**

**INSURED VEHICLE: GR 7385R**

**ACCIDENT DATE: 13/12/2017**

We thank you for your instruction on 12/11/2018.

We acknowledge receipt of the following documents:-

- a) Automobile Inspection Report of SGX 343B from M/s Par Automotive Consultancy.
- b) Singapore Accident Statement of Vehicles SGX 343B.
- c) Final Repair Bill of SGX 343B from N-51 Automotive Pte Ltd..
- d) Colour damaged vehicle photographs of SGX 343B.

Pre-Repair Inspection Date : 15/12/2017 at M/s N-51 Automotive Pte Ltd, 2 Kaki Bukit Ave 2, #01-17 Kaki Bukit Autohub, Singapore 417921.

Based on the documents received from you, we have evaluated the damages of the vehicle and have the following comments:-

1. Information Recorded: -

Registration Number	: SGX 343B
Make & Model	: Toyota Yaris G Auto
Year of Registration	: 2007
Chassis Number	: MR054HY9104021086
Engine Capacity	: 1497 cc

2. We recommend that the repairs of the entire damage require about 8 (Eight) working days to complete.
3. We hereby provide our recommendations on the cost of repair to the damaged vehicle as stated in the following page.



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SGX 343B

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<b><u>REPLACEMENT OF PARTS</u></b>			
1	REAR BUMPER	DENTED	521.30	521.30
2	REAR BUMPER IMPACT BRACKET L/R	BENT	111.20	111.20
6	REAR BUMPER INNER SIDE SHIELD CLIPS L/R	NECESSARY	39.00	39.00
2	REAR BUMPER INNER SIDE SHIELD L/R	CRUMPLED	264.50	264.50
1	REAR BUMPER NUMBER PLATE LAMP	CRACKED	81.70	81.70
2	REAR BUMPER SIDE RETAINER L/R	NECESSARY	111.20	111.20
1	REAR END PANEL	DENTED	578.60	578.60
1	REAR END PANEL INNER TOP GARNISH	BROKEN	279.60	279.60
4	REAR END PANEL INNER TOP GARNISH CLIPS	NECESSARY	26.00	26.00
1	REAR END PANEL LOCK STRIKER	BENT	43.70	43.70
1	REAR EXHAUST END CHROME PIPE	NOT NECESSARY	182.25	-
1	REAR EXHAUST GASKET	NECESSARY	61.10	61.10
2	REAR EXHAUST RUBBER MOUNTING	NOT NECESSARY	78.80	-
1	REAR EXHAUST SILENCER BOX	NOT NECESSARY	781.80	-
1	REAR LH DOOR GLASS OUTER MOULDING	REUSE	172.25	-
1	REAR LH DOOR INNER TRIM BOARD	BROKEN	781.10	781.10
1	REAR LH DOOR MECHANISM LOCK	BENT	561.60	561.60
1	REAR LH DOOR WEATHERSTRIP	NOT NECESSARY	145.25	-
1	REAR LH FENDER	DENTED	972.85	972.85
1	REAR LH FENDER INNER AIR VENT	CRACKED	172.45	172.45
1	REAR LH FENDER INNER TRIM BOARD	CRACKED	498.30	498.30
1	REAR LH FENDER PETROL LID MECHANISM LOCK	REUSE	123.05	-
1	REAR LH WHEEL HOUSE PANEL ASSY	TO REPAIR SEE LABOUR	531.35	-
1	REAR RH FENDER	TO REPAIR SEE LABOUR	972.45	-
1	REAR RH FENDER INNER TRIM BOARD	CRACKED	498.30	498.30
1	REAR SPARE TYRE PANEL	TO REPAIR SEE LABOUR	981.40	-
2	REAR SPARE TYRE PANEL INNER SIDE STORAGE BOX L/R	N/S CRACKED	754.80	110.00
1	REAR SPARE TYRE PANEL TOP UPHOLSTERY BOARD	BENT	581.25	581.25

Report Ref No. CS3/AXA17023774/Bsbe2-1



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR SPEAKER BOARD	REUSE	591.60	-
2	REAR SUB CHASSIS FRAME L/R	TO REPAIR SEE LABOUR	1,162.20	-
1	REAR TAILGATE	DENTED	1,013.70	1,013.70
1	REAR TAILGATE 'LOGO' EMBLEM	NECESSARY	53.70	53.70
1	REAR TAILGATE 'TOYOTA' EMBLEM	NECESSARY	63.75	63.75
1	REAR TAILGATE 'YARIS' EMBLEM	NECESSARY	47.80	47.80
1	REAR TAILGATE 3RD BRAKE LAMP	REUSE	281.10	-
2	REAR TAILGATE DAMPER L/R	NOT NECESSARY	438.60	-
2	REAR TAILGATE HINGES L/R	NOT NECESSARY	139.40	-
1	REAR TAILGATE INNER TRIM BOARD	BROKEN	474.30	474.30
1	REAR TAILGATE LOCK ACTUATOR	CUT	261.60	261.60
1	REAR TAILGATE MECHANISM LOCK	BENT	123.90	123.90
1	REAR TAILGATE OUTER KEY LOCK	REUSE	289.90	-
1	REAR TAILGATE OUTER KEY LOCK GARNISH	BENT	274.45	274.45
2	REAR TAILGATE RUBBER GUIDE STOPPER	CUT	27.00	27.00
1	REAR TAILGATE WEATHERSTRIP	CUT	231.30	231.30
1	REAR TAILGATE WINDSCREEN	BROKEN	861.50	861.50
1	REAR TAILGATE WINDSCREEN MOULDING	NECESSARY	172.75	172.75
1	REAR TAILGATE WIPER ARM	BENT	121.45	121.45
1	REAR TAILGATE WIPER ARM COVER	DENTED	61.10	61.10
1	REAR TAILGATE WIPER ARM RUBBER SEAL	NECESSARY	50.00	50.00
1	REAR TAILGATE WIPER MOTOR	NOT NECESSARY	581.90	-
2	REAR TAILLAMP BACK RUBBER GASKET L/R	NECESSARY	87.40	87.40
2	REAR TAILLAMP CLIPS L/R	NECESSARY	13.00	13.00
2	REAR TAILLAMP INNER PANEL L/R	N/S DENTED	379.80	189.90
2	REAR TAILLAMP L/R	BROKEN	722.60	722.60
1	SPARE TYRE RETAINER LOCK	BENT	163.70	163.70
	LESS 25% DISCOUNT		-4,899.16	-2,827.16
			14,697.49	8,481.49
	<b>NETT ITEMS</b>			
1	REAR TAILGATE WIRE HARNESS (N)	REUSE	380.00	-

Report Ref No. CS3/AXA17023774/Bsbe2-1



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LESS 10% DISCOUNT		-38.00	-
			342.00	-
	<b><u>SPECIAL NETT ITEMS</u></b>			
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	30.00	30.00
1	REAR BUMPER LOWER LIP (SN)	DISTORTED	600.00	300.00
1	REAR BUMPER NUMBER PLATE (SN)	BENT	25.00	25.00
1	REAR BUMPER NUMBER PLATE HOLDER (SN)	BENT	50.00	20.00
1	REAR BUMPER REVERSE CAMERA (SN)	NOT NECESSARY	800.00	-
1	SET REAR BUMPER REVERSE SENSOR (SN)	CUT	350.00	200.00
1	SET REAR LH DOOR INNER TRIM BOARD CLIPS (SN)	NOT NECESSARY	30.00	-
1	SET REAR LH FENDER INNER TRIM BOARD CLIPS (SN)	NECESSARY	30.00	20.00
1	SET REAR RH FENDER INNER TRIM BOARD CLIPS (SN)	NOT NECESSARY	30.00	-
1	SET REAR TAILGATE INNER TRIM BOARD CLIPS (SN)	NECESSARY	30.00	20.00
1	SET REAR TAILGATE SPOILER CLIPS (SN)	NECESSARY	30.00	20.00
1	REAR TAILGATE WINDSCREEN SEALANT (SN)	NECESSARY	100.00	60.00
1	SPARE TYRE (SN)	REUSE	280.00	-
			2,385.00	695.00
	<b><u>LABOUR</u></b>			
	TO REMOVE, REINSTALL ELECTRICAL WIRING HARNESS, CHECK LIGHTING, AND REWIRE FOR PARKING SENSOR.		120.00	50.00
	TO REMOVE, REINSTALL TAILGATE WINDSCREEN.		150.00	120.00
	TO REMOVE, REINSTALL REAR SUSPENSION AND UNDERCARRIAGE PART. (TO FR)	NOT NECESSARY	350.00	-
	TO ROAD TEST DRIVING, CHECK AND RESETTNG WHEEL ALIGNMENTS SYSTEM.	NOT NECESSARY	180.00	-
	TO REMOVE, REINSTALL PETROL TANK. (TO FR)		80.00	60.00
	TO REMOVE, REINSTALL ROOF TOP TRIM UPHOLSTERY, CUSHION SEAT, TRIM GARNISH, TRIM LINER CARPET. (TO FR)		140.00	80.00
	TO SEND VEHICLE FOR CLEANING, SHAMPOO, UPHOLSTERY AND CUSHION SEAT.	NOT NECESSARY	200.00	-
	TO RE-SPRAY PAINTING ON THE REAR BOOTLID, REAR END PANEL, REAR FENDER (L/R), SPARE TYRE PANEL, REAR BUMPER, REAR DOORS (L/R), AND ROOF TOP PANEL.		2,000.00	1,000.00

Report Ref No. CS3/AXA17023774/Bsbe2-1





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.: 4 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO REMOVE AND CHANGE EXHAUST SILENCER BOX WITH PIPE, RE-ALIGN WHERE NECESSARY CONSISTENT TO THE ACCIDENT.		180.00	80.00
	TO PROVIDE LABOUR, WORKMANSHIP TO CHANGE THE ABOVE DAMAGED BODYPARTS, REPAIR, RE-CONSTRUCT AND RE-ALIGN BODY STRUCTURE, BODY ALIGNMENTS AND DAMAGED CONSISTENT TO THE ACCIDENT. INCLUSIVE OF THE REPAIR OF REAR LH WHEEL HOUSE PANEL ASSY, REAR RH FENDER, REAR SPARE TYRE PANEL AND REAR SUB CHASSIS FRAME L/R.		2,500.00	1,200.00
	TO MOUNT VEHICLE ON TO CAR 'O' LINER.	NOT NECESSARY	400.00	-
	TO APPLY ANTI-RUST CHEMICAL ON REPAIRED AND REPLACED PANEL.		120.00	60.00
			6,420.00	2,650.00
GRAND TOTAL			23,844.49	11,826.49
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				9,450.00

Report Ref No. CS3/AXA17023774/Bsbe2-1

LIM TEOW GUAN

Asst. Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.