

ASS. REC. BY:

REF:

CG/TP18021184 / Asbnz

## ASSIGNMENT

Adrian

From: \_\_\_\_\_ Date: \_\_\_\_\_

Estimated Cost: \_\_\_\_\_

OD / TP / WS / TP RES / OD RES / EVA / INV / MY

To Inspect Vehicle No: \_\_\_\_\_

at Workshop m/s \_\_\_\_\_

of \_\_\_\_\_

Insured: \_\_\_\_\_

Policy No. \_\_\_\_\_

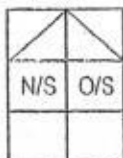
Claims No. \_\_\_\_\_

Sum Insured: \_\_\_\_\_ Excess: \_\_\_\_\_

(Client's Record)

Make of Veh: \_\_\_\_\_

(Policy Condition)

Remark: The veh had commenced its  
repair at the time of inspection.

Bal. or Market Value: \_\_\_\_\_

IDAC Accident Rpt: \_\_\_\_\_ Consistent? : Yes or No

GIA / PR Seen: \_\_\_\_\_ Consistent? : Yes or No

Est. Repairs: 10 days Res.: Yes or No

Lum Sum: % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: \_\_\_\_\_ Vehicle: IN / OUT

Person Contacted: \_\_\_\_\_

Veh No: SFM8193J Yr Regn: 2004, Oct

Type: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Toyota Picnic c.c 1998

Colour: Blue A/C: Insured / Std / Nil / NA

Sp. Reading: 218326 T/Radio: Insured / Std / Nil / NA

Eng/No: \_\_\_\_\_

C/No: JTEGH23B200014333

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rip / STD A/Rim or

Tyre Size: F: 205/65 R15

R: 205/65 R15

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /  
TOYO / YOKO or

Front

Rear

R/Bal. 06 mm R/Bal. 06 mm

L/Bal. 06 mm L/Bal. 06 mm

D.O.A. D.O.I. 22/11/18

Survey held at Hiap Hong

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

TP Malaysia Vehicle Independent. COE Expiry: 30/09/24.

05/12/18 Confirmed L/S \$15,000/- @ 10 days with Adrian.  
(P 9,423.10 Red - 39%)

Submit independent report.

Re-survey No. of Trip - 2

RECEIVED U. DEC 2018

Date/Time, File Pass to?

Date/Time, File Return to?

Part Prices Check:

Survey Fee:

Date: 19X15 = 285

1) 06/12/18  
Typist

2)

IN

OUT

3)

4)

Basic &amp; Add.

S + AS, SI

Photos

Others

TOTAL

170 + 285

50 + 50 + 50

216

80

826

901

Preli Report:

Final Report:

05P 17/12/18

> Back to OneMotoring

## Enquire PARF/COE Rebate for Registered Vehicle

| Vehicle Owner Particulars     |                          |
|-------------------------------|--------------------------|
| Owner ID Type:                | Singapore NRIC           |
| Owner ID:                     | 5391I                    |
| Vehicle Details               |                          |
| Vehicle No.:                  | SFM8193J                 |
| Vehicle to be Exported:       | Yes                      |
| Intended Deregistration Date: | 22 Nov 2018              |
| Vehicle Make:                 | TOYOTA                   |
| Vehicle Model:                | PICNIC AUTO              |
| Primary Colour:               | Blue                     |
| Manufacturing Year:           | 2004                     |
| Engine No.:                   | 1AZ1592109               |
| Chassis No.:                  | JTEGH23B200014333        |
| Maximum Power Output:         | 110.0 kW (147 bhp)       |
| Open Market Value:            | \$26,249.00              |
| Original Registration Date:   | 05 Oct 2004              |
| First Registration Date:      | 05 Oct 2004              |
| Transfer Count:               | 0                        |
| Actual ARF Paid:              | \$28,874.00              |
| Intended PARF Rebate Details  |                          |
| PARF Eligibility:             | Forfeited                |
| PARF Eligibility Expiry Date: | -                        |
| PARF Rebate Amount:           | \$0.00                   |
| Intended COE Rebate Details   |                          |
| COE Expiry Date:              | 30 Sep 2024              |
| COE Category:                 | B - Car (1601cc & above) |
| COE Period(Years):            | 10                       |
| PQP Paid:                     | \$67,429.00              |
| COE Rebate Amount:            | \$39,483.00              |
| Total Rebate Amount:          | \$39,483.00              |

The information contained herein is correct as at 22 Nov 2018

OK

111111 Drive Singapore 575701  
Tel: 1800-CALL LTA (1800-2255 582) Fax: (65) 6553 5329

27 Jan 2010

Our ref 2701100401N002007263

TAN AH THOE  
17 JALAN BUNGA RAMPAI  
SINGAPORE 538406

000895



Dear Sir/Madam

**NOTIFICATION OF SUCCESSFUL VEHICLE CONVERSION FOR VEHICLE NO. SFM8193J**

We are pleased to inform you that your vehicle, SFM8193J, has been successfully converted from P11 - Passenger Station Wagon/Jeep/Land Rover / Off-Peak Car to P11 - Passenger Station Wagon/Jeep/Land Rover / Revised Off-Peak Car with effect from 27 Jan 2010.

2. The owner particulars are as follows:

|    |                         |                  |
|----|-------------------------|------------------|
| 1. | Name                    | : TAN AH THOE    |
| 2. | Identification No. Type | : Singapore NRIC |
| 3. | Identification No.      | : S1255391I      |
| 4. | Place Of Passport Issue | : -              |

3. The updated vehicle information is as follows:

|     |                                      |                                                 |
|-----|--------------------------------------|-------------------------------------------------|
| 1.  | Vehicle No.                          | : SFM8193J                                      |
| 2.  | Previous Vehicle No.                 | : -                                             |
| 3.  | Effective Date of Ownership          | : 05 Oct 2004                                   |
| 4.  | Original Registration Date           | : 05 Oct 2004                                   |
| 5.  | First Registration Date              | : 05 Oct 2004                                   |
| 6.  | Vehicle Type                         | : P11 - Passenger Station Wagon/Jeep/Land Rover |
| 7.  | Vehicle Scheme                       | : Revised Off-Peak Car                          |
| 8.  | Attachment 1                         | : No Attachment                                 |
| 9.  | Attachment 2                         | : -                                             |
| 10. | Attachment 3                         | : -                                             |
| 11. | Vehicle Make Description             | : TOYOTA                                        |
| 12. | Vehicle Model                        | : PICNIC AUTO                                   |
| 13. | Year of Manufacture                  | : 2004                                          |
| 14. | Primary Colour                       | : Blue                                          |
| 15. | Secondary Colour                     | : -                                             |
| 16. | Passenger Capacity                   | : 6                                             |
| 17. | Chassis/Trailer Chassis No.          | : JTEGH23B200014333 / -                         |
| 18. | Propellant                           | : Petrol                                        |
| 19. | Engine No./Motor No.                 | : 1AZ1592109 / -                                |
| 20. | Engine Capacity(cc)/Power Rating(kw) | : 1998 / -                                      |
| 21. | Unladen Weight(kg)                   | : 0                                             |
| 22. | Maximum Laden Weight(kg)             | : 0                                             |
| 23. | Open Market Value                    | : \$26,249.00                                   |
| 24. | PARF Eligibility                     | : Yes                                           |

TP Mission Car  
Shirley.

SFM 8193J.

Toyota Picnic 1988cc

JTE6H23B200014333

|                                 |           |                               |
|---------------------------------|-----------|-------------------------------|
| Rees Number Plate               | But       | 30 (SN) ✓                     |
| Rees Number Plate Holder        | Defunct   | 30 (SN) ✓                     |
| Rees Number Plate Lamp x 02     | no<br>rev | $48 \times 2 = 96$ x          |
| Rees Bumper                     | Distorted | 510.20 ✓                      |
| Rees Bumper Clips               | rev       | 30 ✓                          |
| Rees Bumper Side Holder x 02    | rev       | $51.1 \times 2 = 102.20$ ✓    |
| Rees Bumper Reflector x 02      | crushed   | $71.2 \times 2 = 142.40$ ✓    |
| Rees Bumper Tow Cover x 02      | Distorted | $43.1 \times 2 = 86.20$ ✓     |
| Reverse Sensor (3 pieces)       | Defunct   | <del>350 (SN)</del> 320 (SN). |
| Rees End Panel                  | Distorted | 484.70 ✓                      |
| Rees End Panel Top Garish       | Defunct   | 319.50 ✓                      |
| Rees End Panel Top Garish Clips | rev       | 15 ✓                          |
| Rees End Panel Sealant          | rev       | 60 (SN) ✓                     |
| Taillamp x 02                   | crushed   | $281.2 \times 2 = 562.40$ ✓   |
| Taillamp Sponge Gasket x 02     | rev       | $20 \times 2 = 40$ (SN) ✓     |
| Taillamp Clips                  | rev       | 30 ✓                          |
| Taillamp Panel x 02             | Repair    | $166.3 \times 2 = 332.60$ x   |

SFM 8153J.

|                                                      |                             |
|------------------------------------------------------|-----------------------------|
| Tailgate Distorted                                   | 1228.10 ✓                   |
| Tailgate Lock Jammed                                 | 205.60 ✓                    |
| Tailgate Weatherstripe at                            | 247.80 ✓                    |
| Tailgate Reflector x 02 <sup>crushed</sup>           | $211.1 \times 2 = 422.20$ ✓ |
| Tailgate Reflector Sponge Gasket x 02 <sup>new</sup> | $20 \times 2 = 40 (SN)$ ✓   |
| Tailgate Reflector Clips <sup>new</sup>              | 20 ✓                        |
| Tailgate Outer Moulding <sup>crushed</sup>           | 144.80 ✓                    |
| Tailgate Outer Handle <sup>Damaged</sup>             | 187.20 ✓                    |
| Tailgate Hinge x 02 <sup>new new</sup>               | $69.8 \times 2 = 139.60$ ✓  |
| Tailgate Dampers x 02 <sup>Best</sup>                | $245.2 \times 2 = 490.40$ ✓ |
| Tailgate Inner Trim Board <sup>crushed</sup>         | 409.80 ✓                    |
| Tailgate Inner Trim Board clips <sup>new</sup>       | 30 ✓                        |
| Tailgate Inner Side Garnish x 02 <sup>new</sup>      | $189.2 \times 2 = 378.40$ ✓ |
| Tailgate Inner Side Garnish Clips <sup>new</sup>     | 30 ✓                        |
| Tailgate Wiper Motor <sup>Damaged</sup>              | 571.80 ✓                    |
| Tailgate Wiper Arm <sup>at</sup>                     | 87.20 ✓                     |
| Tailgate Glass Moulding <sup>new</sup>               | 131.20 ✓                    |
| Tailgate Glass Sealant <sup>new</sup>                | 60 (SN) ✓                   |

SFM 8193J.

|                |       |          |
|----------------|-------|----------|
| Toyota Logo    | } New | 76.10 ✓  |
| Toyota Wordmg. |       | 43.90 ✓  |
| Picnic Wordmg. |       | 51.60 ✓  |
| Deluxe Emblem. |       | 75.10. ✓ |

|                                     |           |                          |
|-------------------------------------|-----------|--------------------------|
| Rees Fender x 02.                   | Regis     | 989.8 x 2 = 1979.60 *    |
| Rees Fender Inner Trim Board        | x 02      | Defhd 792.5 x 2 = 1585 ✓ |
| Rees Fender Inner Trim Board Clips. |           | 60. ✓                    |
| Rees Fender Inner Shield x 02       | } New     | 65.3 x 2 = 130.60 x      |
| Rees Fender Inner Shield Clips.     |           | 40 x                     |
| Rees Fender Glass Sealant x 02      |           | 50 x 2 = 100 (sm) x      |
| Jack Cover                          | Defhd     | 175 ✓                    |
| Jack Bracket.                       | Best      | 237.60 ✓                 |
| Floor Panel.                        | Buckleend | 875.20 ✓                 |
| Floor Panel Surround Trim           | crumpled  | 344.40 ✓                 |
| Floor Panel Surround Trim Clips.    |           | 50 ✓                     |
| Floor Panel Top Cover               | Distorted | 687.60 ✓                 |
| Floor Panel Inner Garnish.          | Defhd     | 301.40. ✓                |

6813.1

SFM 8193J.

|                             |         |                                |
|-----------------------------|---------|--------------------------------|
| Floor Panel Insulation Pad. | new     | 280(SN) ✓                      |
| Rees Exhaust Pipe           | Best    | 98530 ✓                        |
| Rees Exhaust Heat Shield    | new     | 81.10 *                        |
| Rees Exhaust Mounting.      | new     | 25 *                           |
| Centre Exhaust Pipe.        | new     | 760.20 *                       |
| Rees Passenger Seat Belt    | new     | 795.2x2 = 1590.40 *            |
| Rees Passenger Seat         | Damaged | 1500x2 = 3000(SN)<br>2400(SN). |

6722

SFM8193J.

|                                          |                      |
|------------------------------------------|----------------------|
| Panel Beating                            | <del>3000</del> 1600 |
| Spray Painting.                          | <del>2500</del> 1600 |
| Wiring                                   | <del>100</del> 50    |
| To underseal.                            | <del>250</del> 120   |
| To remove reverse sensor                 | <del>150</del> 100   |
| To remove upholstery.                    | <del>200</del> 120   |
| To remove tailgate glass                 | <del>180</del> 150   |
| To transfer tailgate fittings.           | <del>150</del> 120   |
| To remove rear passenger seats.          | <del>250</del> 200   |
| To remove rear seat belts.               | <del>200</del> 150   |
| To remove rear and centre exhaust pipes. | <del>300</del> 120   |
| To remove rear LH and RH fender glasses  | 200 x                |
| Towing charges.                          | 60. ✓                |
|                                          | <del>24723.10</del>  |

List: 12007.30  
 less 25%: 900547.

S.N: 3260

Labour: 4390  
 Total: 166547.  
 H/S (10%): 15K.

100 days.

29120.80

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

| Affiliated to Federation Internationale Des Experts En Automobile                                                                         |                                                                            |                 |                           |                                                                                     |
|-------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------|-----------------|---------------------------|-------------------------------------------------------------------------------------|
| HIAP HONG MOTOR REPAIR                                                                                                                    |                                                                            |                 | Ref : CS/TP18021184/Asbn2 |                                                                                     |
| 2 KAKI BUKIT AVE 2<br>#02-13 SINGAPORE 417921                                                                                             |                                                                            |                 | Date : 17-12-2018         |  |
| ON BEHALF OF TAN AH THOE                                                                                                                  |                                                                            |                 | Code : TP336              |                                                                                     |
| <b>1. Policy Particulars :- THIRD PARTY CLAIM</b>                                                                                         |                                                                            |                 |                           |                                                                                     |
| Insured Veh.                                                                                                                              |                                                                            | Veh. Inspected  |                           | SFM 8193J                                                                           |
| Policy No.                                                                                                                                |                                                                            | Coverage (\$)   |                           | 0.00                                                                                |
| Claim No.                                                                                                                                 |                                                                            | Excess (\$)     |                           | 0.00                                                                                |
| Assign From                                                                                                                               |                                                                            | Assign Date     |                           | 22/11/2018                                                                          |
| <b>2. Vehicle Particulars &amp; Condition</b>                                                                                             |                                                                            |                 |                           |                                                                                     |
| Make & Model                                                                                                                              | TOYOTA PICNIC                                                              | c.c             | 1998                      |                                                                                     |
| Engine No.                                                                                                                                | HIDDEN                                                                     | Year of Reg.    | 2004                      |                                                                                     |
| Chassis No.                                                                                                                               | JTEGH23B200014333                                                          | Colour          | BLUE                      |                                                                                     |
| Odometer                                                                                                                                  | 218326                                                                     | Steering        | IN ORDER                  |                                                                                     |
| Brakes                                                                                                                                    | IN ORDER                                                                   | Modification    | SPORTS RIM                |                                                                                     |
| General                                                                                                                                   | GOOD                                                                       |                 |                           |                                                                                     |
| <b>3. Conditions of Tyres</b>                                                                                                             |                                                                            |                 |                           |                                                                                     |
|                                                                                                                                           | Size                                                                       | Make            | Balance                   |                                                                                     |
| R/H Front Tyre                                                                                                                            | 205/65 R15                                                                 | MICHELIN        | 6 mm                      |                                                                                     |
| L/H Front Tyre                                                                                                                            | 205/65 R15                                                                 | MICHELIN        | 6 mm                      |                                                                                     |
| R/H Rear Tyre                                                                                                                             | 205/65 R15                                                                 | MICHELIN        | 6 mm                      |                                                                                     |
| L/H Rear Tyre                                                                                                                             | 205/65 R15                                                                 | MICHELIN        | 6 mm                      |                                                                                     |
| <b>4. Description of Damages</b>                                                                                                          |                                                                            |                 |                           |                                                                                     |
| THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION.<br>DAMAGES SEE DETAILS.                                                                |                                                                            |                 |                           |                                                                                     |
| <b>5. General Information</b>                                                                                                             |                                                                            |                 |                           |                                                                                     |
| Accident Date                                                                                                                             | 22/11/2018                                                                 | Inspection Date | 22/11/2018                |                                                                                     |
| Survey held at                                                                                                                            | HIAP HONG MOTOR REPAIR<br>2 KAKI BUKIT AVE 2<br>#02-13<br>SINGAPORE 417921 |                 |                           |                                                                                     |
| <b>5a. Remarks</b>                                                                                                                        |                                                                            |                 |                           |                                                                                     |
| A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.<br>B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS. |                                                                            |                 |                           |                                                                                     |
| <b>5b. Estimate Days of Repair</b>                                                                                                        |                                                                            |                 |                           |                                                                                     |
| ESTIMATED NORMAL PERIOD FOR REPAIR:                                                                                                       |                                                                            | 10 Working Days |                           |                                                                                     |



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SFM 8193J

| Qty | Description of Parts                  | Condition            | Estimate By Workshop (\$) | Our Adjusted (\$) |
|-----|---------------------------------------|----------------------|---------------------------|-------------------|
|     | <b>REPLACEMENT OF PARTS</b>           |                      |                           |                   |
| 2   | REAR NUMBER PLATE LAMP @\$48.00       | NOT NECESSARY        | 96.00                     | -                 |
| 1   | REAR BUMPER                           | DISTORTED            | 510.20                    | 510.20            |
| 1   | REAR BUMPER CLIPS                     | NECESSARY            | 30.00                     | 30.00             |
| 2   | REAR BUMPER SIDE HOLDER @\$51.10      | NECESSARY            | 102.20                    | 102.20            |
| 2   | REAR BUMPER REFLECTOR @\$71.20        | CRACKED              | 142.40                    | 142.40            |
| 2   | REAR BUMPER TOW COVER @\$43.10        | DISTORTED            | 86.20                     | 86.20             |
| 1   | REAR END PANEL                        | DISTORTED            | 484.70                    | 484.70            |
| 1   | REAR END PANEL TOP GARNISH            | DEFORMED             | 319.90                    | 319.90            |
| 1   | REAR END PANEL TOP GARNISH CLIPS      | NECESSARY            | 15.00                     | 15.00             |
| 2   | TAILLAMP @\$281.20                    | CRACKED              | 562.40                    | 562.40            |
| 1   | TAILLAMP CLIPS                        | NECESSARY            | 30.00                     | 30.00             |
| 2   | TAILLAMP PANEL @\$166.30              | TO REPAIR SEE LABOUR | 332.60                    | -                 |
| 1   | TAILGATE                              | DISTORTED            | 1,228.10                  | 1,228.10          |
| 1   | TAILGATE LOCK                         | JAMMED               | 205.60                    | 205.60            |
| 1   | TAILGATE WEATHERSTRIPE                | CUT                  | 247.80                    | 247.80            |
| 2   | TAILGATE REFLECTOR @\$211.10          | CRACKED              | 422.20                    | 422.20            |
| 1   | TAILGATE REFLECTOR CLIPS              | NECESSARY            | 20.00                     | 20.00             |
| 1   | TAILGATE OUTER MOULDING               | CRACKED              | 144.80                    | 144.80            |
| 1   | TAILGATE OUTER HANDLE                 | DAMAGED              | 187.20                    | 187.20            |
| 2   | TAILGATE HINGE @\$69.80               | NOT NECESSARY        | 139.60                    | -                 |
| 2   | TAILGATE DAMPER @\$245.20             | BENT                 | 490.40                    | 490.40            |
| 1   | TAILGATE INNER TRIM BOARD             | CRACKED              | 409.80                    | 409.80            |
| 1   | TAILGATE INNER TRIM BOARD CLIPS       | NECESSARY            | 30.00                     | 30.00             |
| 2   | TAILGATE INNER SIDE GARNISH @\$189.20 | NOT NECESSARY        | 378.40                    | -                 |
| 1   | TAILGATE INNER SIDE GARNISH CLIPS     | NOT NECESSARY        | 30.00                     | -                 |
| 1   | TAILGATE WIPER MOTOR                  | DAMAGED              | 571.80                    | 571.80            |
| 1   | TAILGATE WIPER ARM                    | CUT                  | 87.20                     | 87.20             |
| 1   | TAILGATE GLASS MOULDING               | NECESSARY            | 131.20                    | 131.20            |
| 1   | TAILGATE LOGO                         | NECESSARY            | 76.10                     | 76.10             |
| 1   | TOYOTA WORDING                        | NECESSARY            | 43.90                     | 43.90             |
| 1   | PICNIC WORDING                        | NECESSARY            | 51.60                     | 51.60             |
| 1   | DELUXE EMBLEM                         | NECESSARY            | 75.10                     | 75.10             |
| 2   | REAR FENDER @\$989.80                 | TO REPAIR SEE LABOUR | 1,979.60                  | -                 |

Report Ref No. CS/TP18021184/Asbn2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

| Qty                              | Description of Parts                                                     | Condition     | Estimate By Workshop (\$) | Our Adjusted (\$) |
|----------------------------------|--------------------------------------------------------------------------|---------------|---------------------------|-------------------|
| 2                                | REAR FENDER INNER TRIM BOARD @\$792.50                                   | DEFORMED      | 1,585.00                  | 1,585.00          |
| 1                                | REAR FENDER INNER TRIM BOARD CLIPS                                       | NECESSARY     | 60.00                     | 60.00             |
| 2                                | REAR FENDER INNER SHIELD @\$65.30                                        | NOT NECESSARY | 130.60                    | -                 |
| 1                                | REAR FENDER INNER SHIELD CLIPS                                           | NOT NECESSARY | 40.00                     | -                 |
| 1                                | JACK COVER                                                               | DEFORMED      | 175.00                    | 175.00            |
| 1                                | JACK BRACKET                                                             | BENT          | 237.60                    | 237.60            |
| 1                                | FLOOR PANEL                                                              | BUCKLED       | 875.20                    | 875.20            |
| 1                                | FLOOR PANEL SURROUND TRIM                                                | CRUMPLED      | 344.40                    | 344.40            |
| 1                                | FLOOR PANEL SURROUND TRIM CLIPS                                          | NECESSARY     | 50.00                     | 50.00             |
| 1                                | FLOOR PANEL TOP COVER                                                    | DISTORTED     | 687.60                    | 687.60            |
| 1                                | FLOOR PANEL INNER GARNISH                                                | DEFORMED      | 301.40                    | 301.40            |
| 1                                | REAR EXHAUST PIPE                                                        | BENT          | 985.30                    | 985.30            |
| 1                                | REAR EXHAUST HEAT SHIELD                                                 | NOT NECESSARY | 81.10                     | -                 |
| 1                                | REAR EXHAUST MOUNTING                                                    | NOT NECESSARY | 25.00                     | -                 |
| 1                                | CENTRE EXHAUST PIPE                                                      | NOT NECESSARY | 760.20                    | -                 |
| 2                                | REAR PASSENGER SEAT BELT @\$795.20                                       | NOT NECESSARY | 1,590.40                  | -                 |
|                                  | LESS 25% DISCOUNT                                                        |               | -                         | -3,001.83         |
|                                  |                                                                          |               | 17,590.80                 | 9,005.47          |
| <b><u>SPECIAL NETT ITEMS</u></b> |                                                                          |               |                           |                   |
| 2                                | TAILLAMP SPONGE GASKET @\$20.20 (SN)                                     | NECESSARY     | 40.00                     | 40.00             |
| 2                                | TAILGATE REFLECTOR SPONGE GASKET @\$20.00 (SN)                           | NECESSARY     | 40.00                     | 40.00             |
| 1                                | REAR NUMBER PLATE (SN)                                                   | BENT          | 30.00                     | 30.00             |
| 1                                | REAR NUMBER PLATE HOLDER (SN)                                            | DEFORMED      | 30.00                     | 30.00             |
| 1                                | REVERSE SENSOR (3 PCS)(SN)                                               | DAMAGED       | 350.00                    | 320.00            |
| 1                                | REAR END PANEL SEALANT (SN)                                              | NECESSARY     | 60.00                     | 60.00             |
| 1                                | TAILGATE GLASS SEALANT (SN)                                              | NECESSARY     | 60.00                     | 60.00             |
| 2                                | REAR FENDER GLASS SEALANT @\$50.00 (SN)                                  | NOT NECESSARY | 100.00                    | -                 |
| 2                                | REAR PASSENGER SEAT @\$1500.00 (SN)                                      | DAMAGED       | 3,000.00                  | 2,400.00          |
| 1                                | FLOOR PANEL INSULATION PAD (SN)                                          | NECESSARY     | 280.00                    | 280.00            |
|                                  |                                                                          |               | 3,990.00                  | 3,260.00          |
| <b><u>LABOUR</u></b>             |                                                                          |               |                           |                   |
|                                  | PANEL BEATING.INCLUSIVE OF THE REPAIR OF TAILLAMP PANEL AND REAR FENDER. |               | 3,000.00                  | 1,600.00          |
|                                  | SPRAY PAINTING.                                                          |               | 2,500.00                  | 1,600.00          |
|                                  | WIRING.                                                                  |               | 100.00                    | 50.00             |
|                                  | TO UNDERSEAL.                                                            |               | 250.00                    | 120.00            |

Report Ref No. CS/TP18021184/Asbn2



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

| Qty                                                                     | Description of Parts                     | Condition     | Estimate By Workshop (\$) | Our Adjusted (\$) |
|-------------------------------------------------------------------------|------------------------------------------|---------------|---------------------------|-------------------|
|                                                                         | TO REMOVE REVERSE SENSOR.                | NOT NECESSARY | 150.00                    | 100.00            |
|                                                                         | TO REMOVE UPHOLSTERY.                    |               | 200.00                    | 120.00            |
|                                                                         | TO REMOVE TAILGATE GLASS.                |               | 180.00                    | 150.00            |
|                                                                         | TO TRANSFER TAILGATE FITTINGS.           |               | 150.00                    | 120.00            |
|                                                                         | TO REMOVE REAR PASSENGER SEATS.          |               | 250.00                    | 200.00            |
|                                                                         | TO REMOVE REAR SEAT BELTS.               |               | 200.00                    | 150.00            |
|                                                                         | TO REMOVE REAR AND CENTRE EXHAUST PIPES. |               | 300.00                    | 120.00            |
|                                                                         | TO REMOVE REAR LH AND RH FENDER GLASSES. |               | 200.00                    | -                 |
|                                                                         | TOWING CHARGES.                          |               | 60.00                     | 60.00             |
|                                                                         |                                          |               | 7,540.00                  | 4,390.00          |
| GRAND TOTAL                                                             |                                          |               | 29,120.80                 | 16,655.47         |
| RECOMMENDED COST OF LUMP SUM REPAIRS<br>(TO ITS PRE-ACCIDENT CONDITION) |                                          |               |                           | 15,000.00         |

Report Ref No. CS/TP18021184/Asbn2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.