### **COMFORTDELGRO** ENGINEERING PTE LTD 205 BRADDELL ROAD SINGAPORE 579701

Claim Reference:

Assessment Number: WW000497

Version: COM-DGRO/1

Date Calculated: 22/11/2018 08:21

**Full Report - V1** 

Registration: SJP3754K

Printed: 22/11/2018 16:23

SGD

TBA

**Summary Information** 

Claim

Location:

Printed by:

Authorisation Status:

Work Provider:

Claim Reference: Policy Number: Other Reference: Third Party:

Insured Amount: Under Warranty: Warranty Expired: Singapore (SG)

Toh Wee Ngo Interim

AXA Insurance S'pore Pte Repairs Authorised:

Ltd

HONDA

H2C 01

SJP3754K

Not Known

%

BASE MODEL

City

Estimated Repair Time: Ouote Due Date: Actual Repair Days:

Parts Ordered Date: Hire Car Start: Hire Car End: Vehicle Collected:

Currency:

Date of Incident:

Able to Authorise Repairs: TBA

**Vehicle Details** 

Vehicle Manufacturer:

Model:

Sub Model:

Model Sheet Number:

Registration:

Registration Month: Registration Year:

VIN Number:

Odometer: Colour:

Engine Number:

Fuel Level:

**Model Specs** 

FROM MODEL 2009 1.5 LTR 88KW

PREPARE OFF VEHICLE

AIR CONDITIONING TWO COAT METALLIC

**Vehicle Condition** 

**Vehicle Status** 

Pre-Accident Condition: Steering:

Brakes Pedal Travel: Place of Inspection: Pre-Accident Damage:

Tyres Condition:

Tread Depth LHF: Tread Depth LHR: Damage Areas:

Severity of Impact: Vehicle Status on

Inspection:

Date of Inspection:

22/11/2018

Tread Depth RHF: Tread Depth RHR:

Direction of Impact:

# **COMFORTDELGRO ENGINEERING PTE LTD**

Claim Reference:


Full Report - V1


**Assessment Number: WW000497** 

Version: COM-DGRO/1

Registration: SJP3754K Printed: 22/11/2018 16:23

Date Calculated: 22/11/2018 08:21

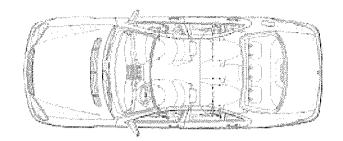

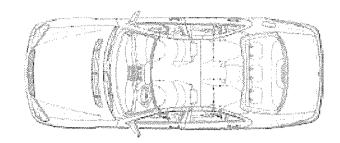

# **Addresses**

**Cost Summary** 

Total Labour	\$823.50
Total Paint/Material	\$225.80
Total Parts	\$776.25
Total of Additional Costs	\$335.00
Excess:	TBA
Grand Total Exc GST:	\$2,160.55
7 % GST:	\$151.24
Grand Total Inc GST:	\$2,311.79

**Repair Information** 

LABOUR	Time Basis 10 WU = 1 HR. Price/CL 1 = \$45.00/HR		
	Price/Dent = \$45.00/HR		
Repair /			
Guide Numbe	r Repair Details	WU	Cost Price (\$)
8111A5)	R + R REAR BUMPER	3.0	13.50
8111A5)	RENEW REAR BUMPER	1.0	4.50
8111B8)	R + R LEFT REAR OUTER BUMPER BRACKET	2.0	9.00
8111B9)	R + R RIGHT REAR OUTER BUMPER BRACKET	2.0	9.00
7141A0	R + R LEFT REAR TAILLAMP	3.0	13.50
7411A5	R + R RIGHT REAR TAILLAMP	3.0	13.50
823104)	R + R BOOT LID	3.0	13.50
823104)	RENEW BOOTLID	9.0	40.50
	(REMOVED)		
	INCLUDES: R + R INNER TAILLAMPS, NUMBER		
	PLATE, BADGE, NUMBER PLATE LAMPS AND		
	LOCK		
8231B6	R + R BOOTLID SEAL	2.0	9.00
8231A9	BOOTLID STRIKER	2.0	9.00
	RENEW REAR END PANEL CPL	45.0	202.50
NO NUMBER	R + R BOOT FLOOR CARPET	1.0	4.50
8571C8	R + R L/BOOT COVER	3.0	13.50
8571C9	R + R R/BOOT COVER	3.0	13.50
LAE	SOUR COST		
	Total Work Units	82.0	
	Corrosion Protection External Labour	0.0HRS	0.00
	Corrosion Protection Internal Labour	0.0HRS	0.00
	Sub Total	8.2HRS	\$369.00
	Paint Labour	10.1HRS	\$454.50
	Total Labour	18.3HRS _	\$823.50

### COMFORTDELGRO ENGINEERING PTE LTD

Claim Reference: Full Report - V1

**Assessment Number: WW000497** Registration: SJP3754K **Version: COM-DGRO/1** Printed: 22/11/2018 16:23

Date Calculated: 22/11/2018 08:21

PAINT V	VORK	Time Basis 10 WU = 1 HR. Price = \$45.00/	HR
Guide Number Description		WU Cost Pric	
	- TWO COAT METALLIC		(1)
	- PREPARE OFF VEHICLE		
2711	REAR PANEL CPL NEW PART PAINTIN	G <b>20.0</b>	
2931	BOOTLID NEW PART PAINTING	15.0	
2583	REAR BUMPER NEW PART PAINT K1R	12.0	
3481	L/R WING SURFACE PAINT	7.0	
3482	R/R WING SURFACE PAINT	7.0	
3900	BOOTFLOOR SURFACE PAINT	10.0	
	LABOUR COST - PAINT		
	TIME(PAINT)	71.0	
	Preparation Main Work Plastic	5.0	
	Preparation Main Work Metal	25.0	
	Preparation Work Multi Layer Pair	nt 0.0	
	Total Work Units (10WU/HR)	101.0	
	Total Paintwork Labour	10.1HRS \$4	54.50
MATERIAL COST - PAINT		Cost	Price
	New Part Painting	\$	65.41
	New Part Painting - Plastic K1R	\$:	58.06
	Material-Constant Main Work Met	al \$	28.60
	Surface-/Blend Paint	\$	64.73
	Material-Const Main Work Plastic	•	\$9.00
	Total Excluding Pearlescent Uplift		25.80
	Pearlescent Uplift @ 0.0%	•	\$0.00
	Total Paint Material Cost		25.80
PARTS			

					Price Valid	l: 01/06/2015
Guide N	o.Qty	Description	Part Number 5	Supplier	Bet.	Price (\$)
2583	1	REAR BUMPER	71501TM4H20ZZ		0%	140.00*
2619	1	L/R OUT BUMPER BRKT	71598TM0T00		0%	<b>8.00</b> *
2620	1	R/R OUT BUMPER BRKT	71593TM0T00		0%	8.00*
2650	4	RR BUMPER CLAMP KIT	91503SZ3003		0%	12.00*
2711	1	REAR PANEL CPL	66100TM4H00ZZ		0%	130.00*
2931	1	BOOTLID	68500TM4H00ZZ		0%	250.00*
2944	1	BOOTLID SEAL	74865TM0T00		0%	35.00*
2977	1	BOOTLID LOCK	74851SNBJ12		0%	35.00*
3013	1	BADGE HONDA	75701TM0000		0%	10.00*
3016	1	ENGINE BADGE	75725TM0T00		0%	12.00*
3017	1	BADGE CITY	75722TM4H00		0%	10.00*
4985	1	END PANEL TRIM	84640TM0T01ZA		0%	25.00*
f: OEM P	arts		Sub Total			\$675.00
g: Original		Mark Up From	n Cost (	15 %)	\$101.25	
h: Secondhand			Sundry Parts	(	Fixed)	\$0.00
p: Parallel			Total Parts		-	\$776.25
x: Exchange						

### NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

#### Extras

Description		Betterment	Price
R NO PLATE W	SPECIALIST	0%	\$35.00
CASING			·
REVERSE SENSOR	SPECIALIST		\$200.00

#### COMFORTDELGRO ENGINEERING PTE LTD

Claim Reference:

Full Report - V1

**Assessment Number: WW000497** 

Registration: SJP3754K

Version: COM-DGRO/1

Printed: 22/11/2018 16:23

Date Calculated: 22/11/2018 08:21

SET

Corr Prot Materials External

\$100.00

**Total Extras** 

\$335.00

**Final Calculation** 

**Total Parts** \$776.25 Labour

Total Panel/Mechanical

\$369.00 Total Paintwork \$454.50

**Total Labour Additional Costs** 

\$823.50

Corr Prot Materials External \$100.00

Cost of Specialist \$235.00

**Total of Additional Costs** \$335.00 **Total Paint/Material Costs** \$225.80

**Grand Total Excludes GST** \$2,160.55 GST @ 7 % \$151.24

**Grand Total Includes GST** \$2,311.79

**Assessment Notes**