

22/03/2002

ASS. REC. BY:

REF:

CB/SM01802191/Tiger

Special Instruction:

Surveyor:

Taufik.

ASSIGNMENT (Office)

From (Person):

Thelma Choo

of

SMO

Date/Time:

05/12/2018 11:40am

Estimated Cost:

Bill to:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

SHD 6332L

Insured:

YP 9624K

at Workshop m/s

SMRT

Tel:

of

60 Woodlands Ind Park #4

Policy No:

D7MTHCVE 000053

Claim No:

CMT01805360

Sum Insured:

Excess:

Make of Veh:

(Client's Record)

D.O.A.

04/12/2018

CA / REV / REP. / REV 24 HRS 'wp'

H.O.D. Endorsement:

Date/Time:

Person Contacted:

Vehicle IN OUT

Date/Time

Action/Instruction (✓) Estimate

SHD 6332L - CB / EQ17023264 / Swisg 2

DIA: 05/12/2017

YP 9624K - X

06/12/18@4.15pm revised to Thelma Choo via Meimer.

29/1/19@5.09pm confirmed with Poh Suan final fig \$2846.15, 3 days.

Cred \$3960.05, 58%

Assignment
Miermen

Tanfer

REF: SMO

ASSIGNMENT

From: Date: 09/22/18

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SHD 6332L

at Workshop m/s

of

SMRT
Woodland

Insured:

Policy No.

Claims No.

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

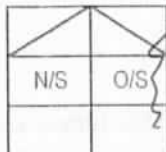

Bal. or Market Value:

IDAC Accident Report: Consistent?: Yes or No

GIA / PR Seen: Consistent?: Yes or No

Est. Repairs: 3 days Res.: Yes or No

Lum Sum: % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: Person Contacted:

Veh No: SHD 6332L Yr Regn: 2016 / June

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Toyota Prius

C.C. 1798

Colour:

Maroon

A/C: Insured / Std / NI / NA

Sp. Reading

414481

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

STDKN 364205768295

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/B / STD A/Rim or

Tyre Size:

F:

195/65R15

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Kallen

Front

Rear

R/Bal.

6

mm

R/Bal.

6

mm

L/Bal.

6

mm

L/Bal.

6

mm

D.O.A.

D.O.I.

5/12/18

Survey held at

SMRT

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

RECEIVED 30 JAN 2019

12/18/2015

JP 9624K

Date/Time, File Pass to?

1) 30/1/18

Date/Time, File Return to?

2)



: Preli. Report

: Final Report

Days Of Repair: 3

Resurvey No. of Trip: 1

Survey Fee:

Transportation:

) S + RS SI

) Photos

) Others

TOTAL

Add Fee:



: Site Insp (\$



: Interview (\$



: Tech. Invs (\$



: Weekend (\$

Report Format :

MER-TP

Lump Sum / I.B.I. (\$

2846.15

750

10

760

...CLAIM SUBFOLDER...(New Assignment)

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	04 Dec 2018		05 Dec 2018 11:40 Assign				New Assignment Cancel Case

Main

Reference

Claim Details

Documents

Show All

CLAIM SUBFOLDER DETAILS

Insured:	ETHOZ GROUP LTD, Co. Reg. No.: 198104531H			[Created by insurer]
Main Claimant:	SMRT TAXIS PTE LTD, Co. Reg. No.: 198905369K			
Vehicle Reg. No.:	SHD6332L	Date of Loss:	04/12/2018 08:00 - :59	
Claim Type:	TP / CMTD1805350	Policy/Cover Note No.:	D17MTHCVE000053 (Third Party Only)	
Vehicle Reg. No. (Insured):	YP9624K	Policy No. (Claimant):		
		Excess:		
Repairer:	Smrt Automotive Services Pte Ltd (HQ) No. 61 Woodlands Industrial Park E9, #04-04 Premium Building, 757047 Woodlands - Tel:			
Handling Insurer:	Sompo Insurance Singapore Pte. Ltd. (HQ) - Tel: 6461 6555 ... [Handled by Thelma Choo - 6322 4681]			
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Final Rpt due 14/12/2018]			
Driver/Custodian (Insured):	TEO KIN SAN (), NRIC: S1274658Z, Tel: +6586536130			

ASSOCIATED MAIL RECEIVED

View All

Compose Case Mail

There are no mail for this case.



ALL ASSOCIATED TASKS

Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Shiau Chan (LKKAUTO)

From: Shiau Chan (LKKAUTO)
Sent: Tuesday, 29 January 2019 5:09 PM
To: 'Yeo Poh Suan (Auto Svcs/Ext Biz Svcs/AR & SC/ARC (Tx&Ex)/ARC (Tx&Ex))'; Taufikh (LKKAUTO)
Cc: SUR; CS A Team; 'Leong Chee kwong'
Subject: RE: SHD6332L

Dear Poh Suan,

WITHOUT PREJUDICE

Confirm final fig \$2,846.15 before GST and 3 repair days.

Kindly send the relevant documents to SOMPO insurance company.

Best Regards,

Shiau Chan (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: siewsc@lkkauto.com | fax: 6256-4315 Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

-----Original Message-----

From: Yeo Poh Suan (Auto Svcs/Ext Biz Svcs/AR & SC/ARC (Tx&Ex)/ARC (Tx&Ex)) <YeoPohsuan@smrt.com.sg>

Sent: Wednesday, 12 December 2018 4:21 PM

To: Taufikh (LKKAUTO) <Taufikh@lkkauto.com>

Cc: SUR <sur@lkkauto.com>; CS A Team <cs-a@lkkauto.com>; 'Leong Chee kwong' <cheekwongwega@gmail.com>

Subject: SHD6332L

Hi Taufikh,

Attached herewith the repair estimate of SHD 6332L having Case No: TAX/12/18/2015.

There is no change to the approved amount of \$2,846.15 @ 3 working days under part by part repair.

Cost of Repair invoice will be generated as approved.

Please finalize with me within 7 working day, thanks.

Aside Kwong,

Please provide the before / after paint photos as per surveyor's request.

Thanks & Regards

Poh Suan

-----Original Message-----

From: Yeo Poh Suan (Auto Svcs/Ext Biz Svcs/AR & SC/ARC (Tx&Ex)/ARC (Tx&Ex))

Sent: Wednesday, 12 December 2018 4:22 PM

To: Yeo Poh Suan (Auto Svcs/Ext Biz Svcs/AR & SC/ARC (Tx&Ex)/ARC (Tx&Ex))

Subject: Scan Data from FX-D421D6

Note: This document has not been finalised.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To: Sompo Insurance Singapore Pte. Ltd.
50 Raffles Place
#05-01/06, Singapore Land Tower
Singapore 048623

From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn: Thelma Choo

Date: 06 Dec 2018

Preliminary Advice

Insured Vehicle No	: YP9624K	Accident Date	: 04/12/2018
TP Vehicle No	: SHD6332L	Assignment Date	: 05/12/2018
Make	:	Est. Duration of Repair	: 3.00
Date of Inspection	: 05/12/2018		
Inspection At	: SMRT AUTOMOTIVE SERVICES PTE LTD (HQ) NO. 61 WOODLANDS INDUSTRIAL PARK E9, #04-04 PREMIUM BUILDING SINGAPORE 757047		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages o/s body and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	6,806.20
Revised Amount	:S\$	2,846.14
Check Items (Estimated)	:S\$	1,627.80
Total	:S\$	4,473.94

Lump Sum Repair	:S\$	
-----------------	------	--

Total Loss Consideration

New for Old Value	:S\$	
Pre-Accident Value	:S\$	
COE / PARF Rebate	:S\$	
Salvage Value	:S\$	
Margin for Repair	:S\$	

Remarks

- () The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.
- () The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.
- () Other comments :

> **Back to OneMotoring**

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Company
Owner ID:	5369K
Vehicle Details	
Vehicle No.:	SHD6332L
Vehicle to be Exported:	No
Intended Deregistration Date:	06 Dec 2018
Vehicle Make:	TOYOTA
Vehicle Model:	PRIUS TAXI (SMRT)
Primary Colour:	Maroon
Manufacturing Year:	2015
Engine No.:	2ZR6603596
Chassis No.:	JTDKN36U205768295
Maximum Power Output:	100.0 kW (134 bhp)
Open Market Value:	\$29,508.00
Original Registration Date:	28 Jun 2016
First Registration Date:	28 Jun 2016
Transfer Count:	0
Actual ARF Paid:	\$5,000.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	27 Jun 2024
PARF Rebate Amount:	\$3,750.00
Intended COE Rebate Details	
COE Expiry Date:	27 Jun 2024
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	8
PQP Paid:	\$37,164.00
COE Rebate Amount:	\$25,821.00
Total Rebate Amount:	\$29,571.00
Message	
Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.	

The information contained herein is correct as at 06 Dec 2018

OK

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	04/12/2018 11:22
Date Of Accident	04/12/2018 08:50
Exact Location Of Accident	TAI SENG AVE TOWARDS TAI SENG LINK
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SHD6332L
Insured/Policyholder	
Name Of Registered Owner	SMRT TAXIS PTE LTD
Co Reg No	198905369K
Email Address	NOEMAIL
Mobile Phone No	
Alternative Phone No	OFFICE-80000000

Vehicle Particulars

Manufacturer	TOYOTA
Model	PRIUS TAXI-1.8 (A)
Exact Purpose for which vehicle was being used at time of accident	HIRE AND REWARD
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	TAXI

Insurance Company

Name of Insurance Company	MS FIRST CAPITAL INSURANCE LTD
Type Of Coverage	THIRD PARTY FIRE AND/OR THEFT
Fleet Policy	YES
Policy Number	D-18090213MFSH
Cover Note Number	

Driver

Name of Driver	KOH WEE TECK
NRIC No	S6815764A
Date Of Birth	24/04/1968
Occupation	OUTDOOR
Date Of Driving Pass	04/02/1989
Driving Experience	29 YEARS AND 10 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-80000000
Fax Number	
Contact Number	
Email Address	NOEMAIL

Address	11
Postcode	
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OTHER - HIRER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	SIDE SWIPE
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles involved in the accident	
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	2
Passenger 1	NAME: : UNKNOWN GENDER: : FEMALE

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

I WAS TRAVELLING ALONG TAI SENG AVE TOWARDS TAI SENG LINK WITH ONE PASSENGER (FEMALE CHINESE) ON BOARD. WHILST I WAS ABOUT TO TURN LEFT INTO TAI SENG LINK, I FELT AN IMPACT AT THE RIGHT PORTION OF MY TAXI. A LORRY YP9624K HAD CUT TOWARD MY LANE AND COLLIDED ONTO THE RIGHT PORTION OF MY TAXI.

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	YES
Remarks/ Reasons:	FILE TOO BIG
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1


Vehicle Registration Number	YP9624K
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	COMMERCIAL VEHICLE
Name of Driver	TEO KIN SAN
NRIC/Passport Number	S1274658Z
Contact Number	
Address	
Postcode	
Insurance Company Name	

Nature Of Damage

No. Of Passenger (Including Driver)

Sketch Plan Pg. 1

SKETCH PLAN

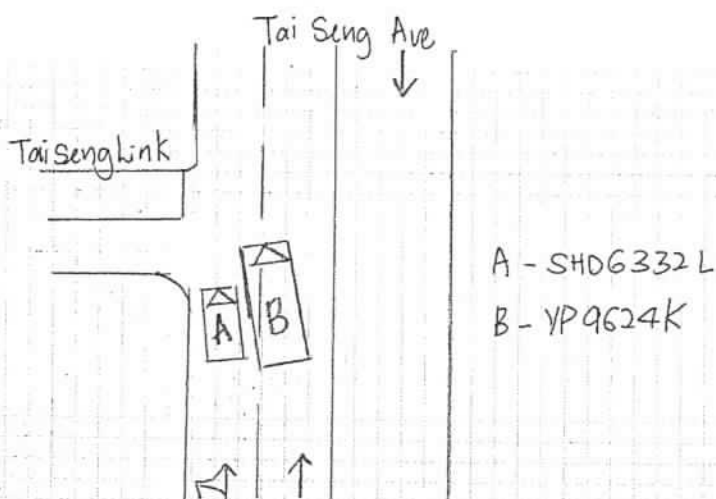

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

This image shows a single sheet of white paper with horizontal blue or grey ruling lines. The lines are evenly spaced and run across the width of the page. There is no handwriting or other markings on the paper.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder Signature _____
Date & Time: _____

Driver's Signature _____
(If driver is not the policyholder)
Date & Time: _____

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

SKETCH PLAN


IMPORTANT NOTICE


1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the Insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.


 Policyholder's Signature
 Date & Time: 017

 4/12/18
 Driver's Signature
 (If driver is not the policyholder)
 Date & Time:

 4/12/2018
 Reporting Centre Personnel's Signature
 Name:
 NRIC/FIN No.:

SMRT Accident Vehicle Repair Estimates

SMRT Automotive Services
60 Woodlands Industrial Park
FAX Number : 63685592
Estimator Telephone Number
Accident Reporting Number

Date Generated : 05/12/2018

User ID : TuckFo

Section A - Accident Details

Registration Number	SHD6332L
Case Reference Number	TAX/12/18/2015
Registration Date	6/28/2016
Company Type	SMRT Taxis Pte Ltd
Make	TOYOTA
Model	PRIUS
Name of Driver	KOH WEE TECK
Type of Accident	Side Swipe
Accident Date and Time	12/4/2018 8:54 AM
Accident Reported Date and Time	12/4/2018 11:05 AM
Is Surveyor Required?	Yes
Survey by	
Vehicle is Towed Back?	No
Towed Back Date and Time	
Replacement Vehicle issued?	No
Job Card Number	24099093
Special Instruction to ARC, if any	TP
Prepared Date and Time	12/5/2018 6:52 AM
Chassis Number	
Mileage	
Work Shop	
Repair Completion Date and Time	

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:



Date:

Right / Driver Side




Section B - Summary of Repair Estimates


Summary of Repair Estimates

	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Cost	\$507.00	\$0.00
Total Spray Cost	\$558.00	\$0.00
Total Spare Part Cost	\$3,964.62	\$0.00
Total Other Cost	\$690.00	\$0.00
TOTAL COST	\$5,719.62	\$0.00
Lump Sum Total	\$0.00	\$0.00
Number of Repair Days	4.0	
Prepared / Adjusted By	Kim Ming Chin	Taufikh
ARC / Surveyor Sign Off Date	05/12/2018 7:07 AM	
Signature		
Remarks		Resurvey before print.

Section C - Quotation and Accident Invoice Details

Quotation Number		Invoice Number	
Quotation Date		Invoice Date	
Invoice Amount		Prepared Date	

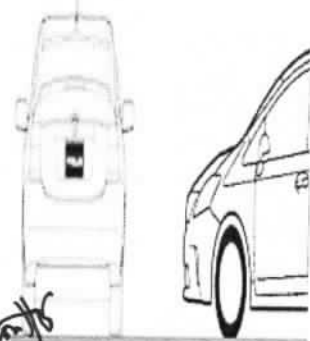


 6/12/18
 Rear
 Left / Pass
 Taufikh 97495749
 WP-
 5/12/18 C 4:5pm.
 Part by part.
 surelkhanto.com.

SMRT Accident Vehicle Repair Estimates

SMRT Automotive Services

60 Woodlands Industrial Park

FAX Number : 63685592

Estimator Telephone Number

Accident Reporting Number

Date Generated : 05/12/2

User ID : TuckFo

Section D - Details of Repair Estimates

Part 1 - Labour Works

Job Scope	Quotation from AR	Adjusted by Surveyor, if applicable
TO REPAIR RH PORTION	\$507.00	
Total Labour	\$507.00	300.-

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO RESPRAY FRONT DOOR RH	\$378.00	200.-
RESPRAY MIRROR COVER RH	\$180.00	100.-
Total Spray Painting & Panel Beating	\$558.00	

Part 3 - Other Costs - Accident and Accident Repair Related Expense

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO CHECK WIRING AND SYSTEM FUNCTION	\$80.00	30.-
TO REMOVE AND REFIX WING MIRROR	\$120.00	60.-
TO TRANSFER DOOR MECHANISM	\$120.00	60.-
TO REMOVE & REFIX FRONT LHS/RHS QUATER GLASS	\$120.00	X
TO PROVIDE LABOUR & MATERIAL FOR SOLAR FILM (NET)	\$250.00	X
Total Other Costs	\$690.00	

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock Number	Part Name	Quantity	List Price (\$)	Discount (%)	Final Price (\$)	Estimator Approved	Surveyor Approved
		67001-47070	DOOR FRT/RH	1.00	\$894.40	25.00	\$670.80	Replace	bt ✓
			STICKER DECAL SMRT (DOOR)	1.00	\$60.00	0.00	\$60.00	Replace	nl ✓
		68710-12151	HINGE UPPER RHF, DOOR	1.00	\$80.50	25.00	\$60.38	Replace	Rx
		68730-12120	HINGE LOWER RHF, DOOR	1.00	\$90.10	25.00	\$67.57	Replace	Rx
		68610-47021	CHECK ASSY, FR DOOR,	1.00	\$150.30	25.00	\$112.73	Replace	Rx
		75710-47021	DOOR BELT FRT/RH	1.00	\$69.20	25.00	\$51.90	Replace	cut ✓
		75921-47020	TAPE OUT WIN FRAME RHF, DOOR	1.00	\$45.60	25.00	\$34.20	Replace	nl ✓
		62110-47021	QUARTER GLASS FRT/RH	1.00	\$234.90	25.00	\$176.18	Replace	?
			SEALANT W/SCREEN	1.00	\$37.00	0.00	\$37.00	Replace	?
		68101-47072	DOOR GLASS FRT/RH	1.00	\$524.00	25.00	\$393.00	Replace	?
		85710-47120F	DOOR REGULATOR MOTOR FRONT RH	1.00	\$947.80	10.00	\$853.02	Replace	?
		69801-52070	DOOR REGULATOR SUB-ASSY, FRT/REAR RH	1.00	\$224.80	25.00	\$168.60	Replace	?
		87910-47330	MIRROR ASSY, RH	1.00	\$1,307.10	25.00	\$980.32	Replace	dis ✓
		87931-47200	MIRROR GLASS RH	1.00	\$212.80	25.00	\$159.60	Replace	cut ✓
		81730-52090	MIRROR LAMP RH	1.00	\$65.30	10.00	\$58.77	Replace	an ✓
		879157-4010	COVER, OUTER MIRROR, RH	1.00	\$107.40	25.00	\$80.55	Replace	ml ✓
Total					\$5,051.20		\$3,964.62		



Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Stock Number	Part Name	Quantity	List Price \$	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check
Total									

6806.70



Section A - Accident Details

Registration Number	SHD6332L
Case Reference Number	TAX/12/18/2015
Registration Date	26/06/16
Company Type	SMRT Taxis Pte Ltd
Make	TOYOTA
Model	PRIUS
Name of Driver	KOH WEE TECK
Type of Accident	Side Swipe
Accident Date and Time	04/12/18 8:54 AM
Accident Reported Date and Time	04/12/18 11:05 AM
Is Surveyor Required?	Yes
Survey by	
Vehicle is Towed Back?	No
Towed Back Date and Time	
Replacement Vehicle issued?	No
Job Card Number	24099093
Special Instruction to ARC, if any	TP
Prepared Date and Time	05/12/18 6:52 AM
Chassis Number	
Mileage	
Work Shop	
Repair Completion Date and Time	

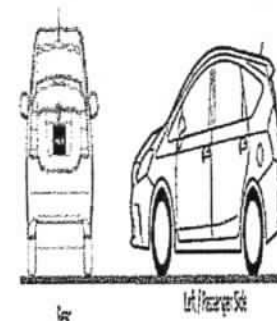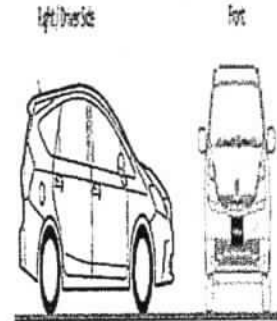

Section B - Summary of Repair Estimates

Summary of Repair Estimates

	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Cost	\$507.00	\$300.00
Total Spray Cost	\$558.00	\$300.00
Total Spare Part Cost	\$3,964.62	\$2,096.15
Total Other Cost	\$690.00	\$150.00
TOTAL COST	\$5,719.62	\$2,846.15 (P/P)
Lump Sum Total	\$0.00	\$0.00
Number of Repair Days	4.0	3.0
Prepared / Adjusted By	Kim Ming Chin	Taufikh (LKK) / Sompoo
ARC / Surveyor Sign Off Date	05/12/2018 7:07 AM	05/12/2018 5:18 PM
Signature		
Remarks	Part By Part HP 9749 5749/ EMAIL: sur@lkkauto.com	

Section C - Quotation and Accident Invoice Details

Quotation Number	QN-1812-0252	Invoice Number	
Quotation Date	12.12.2018	Invoice Date	
Invoice Amount		Prepared Date	

Section D - Details of Repair Estimates
Part 1 - Labour Works

Job Scope	Quotation from AR	Adjusted by Surveyor, if applicable
TO REPAIR RH PORTION	\$507.00	\$300.00
Total Labour	\$507.00	\$300.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO RESPRAY FRONT DOOR RH	\$378.00	\$200.00
RESPRAY MIRROR COVER RH	\$180.00	\$100.00
Total Spray Painting & Panel Beating	\$558.00	\$300.00

Part 3 - Other Costs - Accident and Accident Repair Related Expense

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO CHECK WIRING AND SYSTEM FUNCTION	\$80.00	\$30.00
TO REMOVE AND REFIX WING MIRROR	\$120.00	\$60.00
TO TRANSFER DOOR MECHANISM	\$120.00	\$60.00
TO REMOVE & REFIX FRONT LHS/RHS QUATER GLASS	\$120.00	\$0.00
TO PROVIDE LABOUR & MATERIAL FOR SOLAR FILM (NET)	\$250.00	\$0.00
Total Other Costs	\$690.00	\$150.00

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock Number	Part Name	Quantity	List Price (\$)	Discount (%)	Final Price (\$)	Estimator Approved	Surveyor Approved
		67001-47070	DOOR FRT/RH	1.00	\$894.40	25.00	\$670.80	Replace	Replace ✓
			STICKER DECAL SMRT (DOOR)	1.00	\$60.00	0.00	\$60.00	Replace	Replace ✓
		68710-12151	HINGE UPPER RHF, DOOR	1.00	\$80.50	100.00	\$0.00	Replace	Repair ✓
		68730-12120	HINGE LOWER RHF, DOOR	1.00	\$90.10	100.00	\$0.00	Replace	Repair ✓
		68610-47021	CHECK ASSY, FR DOOR,	1.00	\$150.30	100.00	\$0.00	Replace	Repair ✓
		75710-47021	DOOR BELT FRT/RH	1.00	\$69.20	25.00	\$51.90	Replace	Replace ✓
		75921-47020	TAPE OUT WIN FRAME RHF, DOOR	1.00	\$45.60	25.00	\$34.20	Replace	Replace ✓
		62110-47021	QUARTER GLASS FRT/RH	0.00	\$234.90	0.00	\$0.00	Replace	Check X
			SEALANT W/SCREEN	0.00	\$37.00	0.00	\$0.00	Replace	Check X
		68101-47072	DOOR GLASS FRT/RH	0.00	\$524.00	0.00	\$0.00	Replace	Check X
		85710-47120F	DOOR REGULATOR MOTOR FRONT RH	0.00	\$947.80	0.00	\$0.00	Replace	Check X
		69801-52070	DOOR REGULATOR SUB-ASSY, FRT/REAR RH	0.00	\$224.80	0.00	\$0.00	Replace	Check X
		87910-47330	MIRROR ASSY, RH	1.00	\$1,307.10	25.00	\$980.33	Replace	Replace ✓
		87931-47200	MIRROR GLASS RH	1.00	\$212.80	25.00	\$159.60	Replace	Replace ✓
		81730-52090	MIRROR LAMP RH	1.00	\$65.30	10.00	\$58.77	Replace	Replace ✓



SMRT Accident Vehicle Repair Estimates

SMRT Automotive Services Pte Ltd
60 Woodlands Industrial Park E4, Singapore 757705
FAX Number 63685592
Estimator Telephone Number 68662623
Accident Reporting Number 68662672

Date Generated : 12/12/2016

User ID : PohSuan

		879157-4010	COVER, OUTER MIRROR, RH	1.00	\$107.40	25.00	\$80.55	Replace	Replace
Total					\$5,051.20		\$2,096.15		

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Stock Number	Part Name	Quantity	List Price \$	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check
Total									

$$\begin{array}{r} 2096.15 \\ + 300.00 \\ + 450.00 \\ \hline 2846.15 \end{array}$$

6806.20

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	04 Dec 2018		05 Dec 2018 11:40 Edit Adj Rpt	S\$2,846.15 Edit Estimates	S\$2,846.15 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS [Created by insurer]									
Insured: ETHOZ GROUP LTD , Co. Reg. No.: 198104531H									
Main Claimant: SMRT TAXIS PTE LTD , Co. Reg. No.: 198905369K									
Vehicle Reg. No.: SHD6332L		Date of Loss: 04/12/2018 08:00 - :59 [29 Months and 6 Days From LTA Reg Date (Man Yr)]							
Claim Type: TP / CMTD1805350		Policy/Cover Note No.: D17MTHCVE000053 (Third Party Only)							
Vehicle Reg. No. (Insured): YP9624K		Policy No. (Claimant):							
		Excess:							
Repairer: Smrt Automotive Services Pte Ltd (HQ) No. 61 Woodlands Industrial Park E9, #04-04 Premium Building, 757047 Woodlands - Tel:									
Handling Insurer: Sompo Insurance Singapore Pte. Ltd. (HQ) - Tel: 6461 6555 ... [Handled by Thelma Choo - 6322 4681]									
Adjuster: LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by MOHD TAUFIKH BIN HAMID] ... [Final Rpt due 14/12/2018]									
Driver/Custodian (Insured): TEO KIN SAN () , NRIC: S1274658Z, Tel: +6586536130									
ASSOCIATED MAIL RECEIVED View All Compose Case Mail									
There are no mail for this case.									
ALL ASSOCIATED TASKS View All Search Tasks Create New Task Complete									
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

***SHD6332L (CMTD1805350)**
[YP9624K]

TP

SMRT TAXIS PTE LTD

Dec 4 2018 8:00AM

[ETHOZ GROUP LTD]

Smrt Automotive Services Pte Ltd

[Upload Documents](#)
[Upload Photos](#)
[Compose New Letter](#)

View View in Browser

Assessment Reports				1 per page	<input checked="" type="checkbox"/>
No	Finalized On	Sompo Insurance Singapore Pte. Ltd. (HQ)		Thumbnail	Print
1	05/12/18 11:40	Accident Statement <small>From: SC - Reg. No: YP9624K, Claimant: ETHOZ GROUP LTD</small>	1	Load HTM	
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print
1	06/12/18 16:15	Adjuster Immediate Advice	1	Load HTM	

Photos/Images				3 per page	<input checked="" type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print
1	29/01/19 17:07	Odometer Reading	1	Load JPG	<input checked="" type="checkbox"/>
2	29/01/19 17:07	Chassis Number	1	Load JPG	<input checked="" type="checkbox"/>
3	29/01/19 17:07	General View	1	Load JPG	<input checked="" type="checkbox"/>
4	29/01/19 17:07	General View	1	Load JPG	<input checked="" type="checkbox"/>
5	29/01/19 17:07	General View	1	Load JPG	<input checked="" type="checkbox"/>
6	29/01/19 17:07	General View	1	Load JPG	<input checked="" type="checkbox"/>
7	29/01/19 17:07	General View	1	Load JPG	<input checked="" type="checkbox"/>
8	29/01/19 17:07	General View	1	Load JPG	<input checked="" type="checkbox"/>
9	29/01/19 17:07	General View	1	Load JPG	<input checked="" type="checkbox"/>
10	29/01/19 17:07	General View	1	Load JPG	<input checked="" type="checkbox"/>
11	29/01/19 17:07	General View	1	Load JPG	<input checked="" type="checkbox"/>
12	29/01/19 17:07	General View	1	Load JPG	<input checked="" type="checkbox"/>
13	29/01/19 17:07	General View	1	Load JPG	<input checked="" type="checkbox"/>
14	29/01/19 17:07	General View	1	Load JPG	<input checked="" type="checkbox"/>
15	29/01/19 17:07	General View	1	Load JPG	<input checked="" type="checkbox"/>
16	29/01/19 17:07	General View	1	Load JPG	<input checked="" type="checkbox"/>
17	29/01/19 17:07	General View	1	Load JPG	<input checked="" type="checkbox"/>
18	29/01/19 17:07	General View	1	Load JPG	<input checked="" type="checkbox"/>
19	29/01/19 17:07	General View	1	Load JPG	<input checked="" type="checkbox"/>
20	29/01/19 17:07	General View	1	Load JPG	<input checked="" type="checkbox"/>
21	29/01/19 17:07	General View	1	Load JPG	<input checked="" type="checkbox"/>
22	29/01/19 17:07	General View	1	Load JPG	<input checked="" type="checkbox"/>
23	29/01/19 17:07	Reinspection Photo	1	Load JPG	<input checked="" type="checkbox"/>
24	29/01/19 17:07	Reinspection Photo	1	Load JPG	<input checked="" type="checkbox"/>
25	29/01/19 17:07	Reinspection Photo	1	Load JPG	<input checked="" type="checkbox"/>
26	29/01/19 17:07	Reinspection Photo	1	Load JPG	<input checked="" type="checkbox"/>

Documentation				1 per page	<input checked="" type="checkbox"/>
No	Finalized On	Sompo Insurance Singapore Pte. Ltd. (HQ)		Thumbnail	Print
1	05/12/18 11:40	TP - SAS	1	Load PDF	
2	05/12/18 11:40	TP - ASSIGN LKK	1	Load PDF	

Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			

Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)
<div></div>
Show Remarks To: <input type="checkbox"/> Handling Insurer <small>Note: Remarks are private unless you show it to other parties.</small>

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/SMO18021891/T1QBE2

Date: 31/01/2019

REFERENCE

Handling Insurer:	Sompo Insurance Singapore Pte. Ltd.	Policy No:	D17MTHCVE000053
Claimant Vehicle No :	SHD6332L	Insured Vehicle No :	YP9624K
Date of Loss:	04/12/2018	Nature of Claim:	TP
		Claim No:	CMTD1805350

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SHD6332L		
Make & Model:	TOYOTA PRIUS, 1.8 (A)	Engine No:	2ZR6603596
Reg. Date:	28/06/2016 (Man. Year: 2015)	Chassis No:	JTDKN36U205768295
Colour:	Maroon	Odometer:	414481 km
Engine Capacity:	1798 cc		
Market Value/New Car Price:	N/A		
Sum Insured (\$\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	195/65 R15	Rear Tyre Size:	195/65 R15
Front Left Side:	Falken 6 mm	Rear Left Side:	Falken 6 mm
Front Right Side:	Falken 6 mm	Rear Right Side:	Falken 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	5,051.20	2,096.15	2,955.05	58.50
Miscellaneous Items	0.00	0.00	0.00	
Labour	1,755.00	750.00	1,005.00	57.26
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (\$\$)	6,806.20	2,846.15	3,960.05	58.18

INSPECTION

Date of Assignment:	05/12/2018	
Date Inspected:	05/12/2018 Inspected At:	Smrt Automotive Services Pte Ltd (HQ) 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705
Estimated Period of Repair:	3.0 days	

Adjuster: MOHD TAUFIKH BIN HAMID

Manager: SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 31 Jan 2019)
Parts:	144	TOYOTA PRIUS 1.8 (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SHD6332L)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*DOOR FRT / RH (DISC 25%)	Bent	894.40 F	*670.80 F
2	1		*DOOR BELT FRT / RH (DISC 25%)	Cut	69.20 F	*51.90 F
3	1		*TAPE OUT WIN FRAME RHF, DOOR (DISC 25%)	Necessary	45.60 F	*34.20 F
4	1		*MIRROR ASSY, RH (DISC 25%)	Distorted	1,307.10 F	*980.33 F
5	1		*MIRROR GLASS RH (DISC 25%)	Cracked	212.80 F	*159.60 F
6	1		*COVER, OUTER MIRROR, RH (DISC 25%)	Missing	107.40 F	*80.55 F
7	1		*MIRROR LAMP RH (DISC 10%)	Cracked	65.30 F	*58.77 F
8	1		*STICKER DECAL SMRT (DOOR) (SN)	Necessary	60.00 F	*60.00 F
9	1		*QUARTER GLASS FRT / RH	Not Necessary	234.90 F	*- F
10	1		*SEALANT W/SCREEN	Not Necessary	37.00 F	*- F
11	1		*DOOR GLASS FRT / RH	Not Necessary	524.00 F	*- F
12	1		*DOOR REGULATOR SUB-ASSY, FRT / REAR RH	Not Necessary	224.80 F	*- F
13	1		*HINGE UPPER RHF, DOOR	Repair	80.50 F	*- F
14	1		*HINGE LOWER RHF, DOOR	Repair	90.10 F	*- F
15	1		*CHECK ASSY, FR DOOR	Repair	150.30 F	*- F
16	1		*DOOR REGULATOR MOTOR FRONT RH	Not Necessary	947.80 F	*- F

F=Franchise part.

Total Parts (\$\$) **5,051.20** **2,096.15**

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	PANEL BEATING & BODY WORK	New	507.00	300.00
2	SPRAY PAINT	New	558.00	300.00
3	TO CHECK WIRING AND SYSTEM FUNCTION	New	80.00	30.00
4	TO REMOVE AND REFIX WING MIRROR	New	120.00	60.00
5	TO TRANSFER DOOR MECHANISM	New	120.00	60.00
6	TO REMOVE & REFIX FRONT LHS/RHS QUATER GLASS	New	120.00	0.00
7	TO PROVIDE LABOUR & MATERIAL FOR SOLAR FILM	New	250.00	0.00
Gross Labour Cost (S\$)			1,755.00	750.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >