

**51 Ubi Avenue 1, #01-25
Paya Ubi Industrial Park
Singapore
408933**

Claim Reference:
Assessment Number: GS001845
Version: SMEMOT01/2
Date Calculated: 24/12/2018 07:26

Full Report - V1
Registration: SKR5689E
Printed: 24/12/2018 15:26

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	LKK AUTO	Date of Incident:	10/12/2018
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	AXA Insurance S'pore Pte Ltd	Repairs Authorised:	TBA
Claim Reference:		Estimated Repair Time:	
Policy Number:		Quote Due Date:	
Other Reference:	OD	Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	MERCEDES
Model:	CLA Class
Sub Model:	CLA 250
Model Sheet Number:	375 45
Registration:	SKR5689E
Registration Month:	December
Registration Year:	2014
VIN Number:	WDD1173442N115568
Odometer:	Not Known
Colour:	
Engine Number:	
Fuel Level:	%

Model Specs

FROM VIN N070761	ALU DESIGN PARTS
MODEL 2015	A/C THERMATIC
RAIN SENSOR	DIPPING DOOR MIRROR
ELECT FOLDING MIRROR	AUDIO 20 CD CHANGER
BI-XENON HEADLAMPS	LIGHT-/VIEW PACKAGE
HEADLAMP WASHER UNIT	LEATHERETTE PAD
AMG LINE	MULTI FUNCT S-WHEEL
SILL MLDG ILLUMINAT	S/WHEEL TIP SWITCHES
LEATHER STRG WHEEL	DRIVER SEAT MEMORY
PASS SEAT MEMORY	ELECT LUMBAR ADJUST
SEAT COMFORT PACKAGE	MEDIA INTERFACE
ILLUM SUN VISOR	REARVIEW CAMERA
EMISSION STD EURO 6	STRATIFIED CHARGE
ECO START/STOP	ELECTRIC HORN
CRUISE CONTROL	7 SPEED AUTOMATIC
PARAMETER STEERING	SPORTS SUSPENSION
TYRES 225/40 WR 18	WHEELS 7.5J X 18 ALU
PAINTED GRILLE	KNEE AIRBAG
ELECTRIC SUNROOF	PARKTRONIC
AMG STYLING	BASECOAT CLEAR

Vehicle Condition

Vehicle Status

Pre-Accident Condition:	Severity of Impact:	
Steering:	Vehicle Status on	
	Inspection:	
Brakes Pedal Travel:	Date of Inspection:	12/12/2018
Place of Inspection:		
Pre-Accident Damage:		
Tyres Condition:		
Tread Depth LHF:	Tread Depth RHF:	

Claim Reference:

Full Report - V1

Assessment Number: GS001845


Registration: SKR5689E

Version: SMEMOT01/2


Printed: 24/12/2018 15:26

Date Calculated: 24/12/2018 07:26

Tread Depth LHR:
Damage Areas:

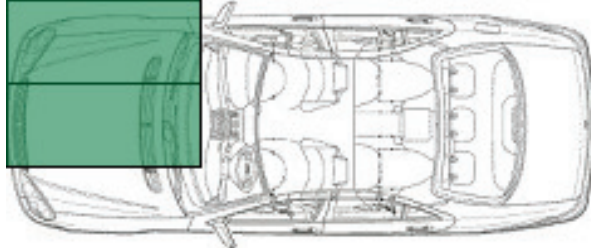

Tread Depth RHR:
Direction of Impact:

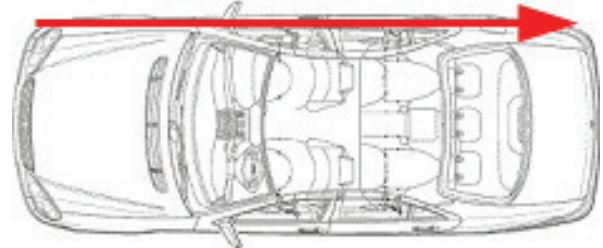

Addresses

Cost Summary

Total Labour	\$355.50
Total Paint/Material	\$99.47
Total Parts	\$4,480.30
Total of Additional Costs	\$400.00
Excess:	TBA
Grand Total Exc GST:	\$5,335.27
7 % GST:	\$373.47
Grand Total Inc GST:	\$5,708.74

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$45.00/HR
Price/Dent = \$0.00/HR

Repair /

Guide Number Repair Details

		WU	Cost Price (\$)
54-1011 01	SHORT TEST	3.0	13.50
	INCLUDES: CONNECT + DISCONNECT STAR		
	DIAGNOSIS,		
	PRINT DATA,		
	DELETE ERROR MEMORY		
61-1071 01	R + R FRONT LOWER ENGINE COMPARTMENT COVER	5.0	22.50
88-1102 01	R + R FRONT BUMPER CPL	8.0	36.00
88-1105 01	DIS + ASS FRONT BUMPER	7.0	31.50
	(BUMPER REMOVED)		
	AFTER CHECK: RENEW PARTS IF NECESSARY		
88-1360 01	ADDITION TO DIS + ASS FRONT BUMPER	3.0	13.50
	(VEHICLE WITH PARK ASSISTANT)		
88-1355 01	ADDITION TO DIS + ASS FRONT BUMPER	2.0	9.00
	(VEHICLE WITH HEADLAMP WASHER SYSTEM)		
82-4800 01)	RENEW RIGHT HEADLAMP	5.0	22.50
	(BUMPER DETACHED)		
	UMFASST: HEADLAMP AND FOG LAMPS		
	ADJUST		
82-4885 01	ADDITIONAL TO RENEW RIGHT HEADLAMP	3.0	13.50
	(VEHICLE WITH XENON HEADLAMP)		
88-3983 01	RENEW R/FR WING	8.0	36.00
	(BUMPER REMOVED/DETACHED)		
	INCLUDES: R/F WHEELHOUSE COVER CPL		
	REMOVE AND REFIT		
97-2500 ZAX	CAVITY PROTECTION (ADD/WORK)	2.0	9.00

Claim Reference:

Full Report - V1

Assessment Number: GS001845

Registration: SKR5689E

Version: SMEMOT01/2

Printed: 24/12/2018 15:26

Date Calculated: 24/12/2018 07:26

97-2500 ZAX	APPLY RUST PROOFING ON R/F WING	2.0	9.00
LABOUR COST			
	Total Work Units	48.0	
	Corrosion Protection		
	Corrosion Protection External Labour	0.0HRS	0.00
	Corrosion Protection Internal Labour	0.4HRS	18.00
	Sub Total	4.8HRS	\$216.00
	Paint Labour	3.1HRS	\$139.50
	Total Labour	7.9HRS	\$355.50

PAINT WORK		Time Basis 10 WU = 1 HR. Price = \$45.00/HR	
Guide Number	Description	WU	Cost Price (\$)
	- BASECOAT CLEAR		
98-1682 01	FRONT BUMPER PAINTING STAGE I-M	11.0	
98-2615 01	R/F WING PAINTING STAGE I-M	6.0	
98-1340 01	PREPARATION WORK FOR TWO COAT PAINTING	14.0	
	OF FITTED BODY PARTS		
LABOUR COST - PAINT			
	TIME(PAINT)	0.0	
	Total Work Units (10WU/HR)	31.0	
	Total Paintwork Labour	3.1HRS	\$139.50
MATERIAL COST - PAINT			Cost Price
	Total Excluding Pearlescent Uplift		\$99.47
	Pearlescent Uplift @ 0.0%		\$0.00
	Total Paint Material Cost		\$99.47

PARTS

					Price Valid: 01/06/2015	
Guide No.	Qty	Description	Part Number	Supplier	Bet.	Price (\$)
283	1	FRONT BUMPER	117 880 4840 9999		0%	1,150.00*
349	1	FRT BUMPER CLAMP KIT	USE SINGLE PARTS		0%	35.00*
832	1	R/F W-ARCH LINER MTG	USE SINGLE PARTS		0%	28.00*
742	1	R/F WING	117 881 0201		0%	430.00*
9652	1	R/H-LAMP CONT UNIT	218 900 9303		0%	580.00*
9650	1	R/H-LAMP LVL C-UNIT	222 900 3300		0%	250.00*
562	1	RIGHT HEADLAMP ASSY	117 906 6600		0%	1,600.00*
f: OEM Parts			Sub Total			\$4,073.00
g: Original			Mark Up From Cost		(10 %)	\$407.30
h: Secondhand			Total Parts			\$4,480.30

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description	Betterment	Price
REPROGRAMME SPECIALIST	0%	\$400.00
HEADLAMP		
Total Extras		\$400.00

Final Calculation

Total Parts **\$4,480.30**

Labour Total Panel/Mechanical \$198.00

Claim Reference:

Full Report - V1

Assessment Number: GS001845

Registration: SKR5689E

Version: SMEMOT01/2

Printed: 24/12/2018 15:26

Date Calculated: 24/12/2018 07:26

Total Paintwork	\$139.50	
Corr Prot Internal 4 WU	\$18.00	
Total Labour		\$355.50
Additional Costs		
Corr Prot Materials External	\$0.00	
Cost of Specialist	\$400.00	
Total of Additional Costs		\$400.00
Total Paint/Material Costs		\$99.47
Grand Total Excludes GST		\$5,335.27
GST @ 7 %		\$373.47
Grand Total Includes GST		\$5,708.74

Assessment Notes
