51 Ubi Avenue 1, #01-25 Paya Ubi Industrial Park **Singapore**

408933

Claim Reference:

Assessment Number: GS001845

Version: SMEMOT01/2

Date Calculated: 20/12/2018 02:43

Full Report - V1

Registration: SKR5689E

Printed: 20/12/2018 10:45

SGD

TBA

10/12/2018

Summary Information

Claim

Location:

Printed by:

Authorisation Status:

Work Provider:

Claim Reference:

Policy Number: Other Reference:

Third Party: Insured Amount: Under Warranty: Warranty Expired: Singapore (SG)

LKK AUTO Interim

MERCEDES

CLA Class

SKR5689E

December

Not Known

WDD1173442N115568

CLA 250

375 45

2014

AXA Insurance S'pore Pte Repairs Authorised: Ltd

OD

Currency:

Date of Incident:

Able to Authorise Repairs: TBA

Estimated Repair Time: Quote Due Date: Actual Repair Days: Parts Ordered Date: Hire Car Start: Hire Car End:

Vehicle Details

Vehicle Manufacturer:

Model: Sub Model:

Model Sheet Number: Registration:

Registration Month: Registration Year:

VIN Number:

Odometer: Colour:

Engine Number:

Fuel Level:

Model Specs

Vehicle Collected:

FROM VIN N070761 **MODEL 2015** RAIN SENSOR

ELECT FOLDING MIRROR **BI-XENON HEADLAMPS** HEADLAMP WASHER UNIT

AMG LINE SILL MLDG ILLUMINAT LEATHER STRG WHEEL

PASS SEAT MEMORY SEAT COMFORT PACKAGE ILLUM SUN VISOR

EMISSION STD EURO 6 ECO START/STOP CRUISE CONTROL PARAMETER STEERING TYRES 225/40 WR 18 PAINTED GRILLE

ELECTRIC SUNROOF AMG STYLING

ALU DESIGN PARTS A/C THERMATIC

DIPPING DOOR MIRROR AUDIO 20 CD CHANGER LIGHT-/VIEW PACKAGE LEATHERETTE PAD MULTI FUNCT S-WHEEL S/WHEEL TIP SWITCHES DRIVER SEAT MEMORY **ELECT LUMBAR ADJUST** MEDIA INTERFACE REARVIEW CAMERA STRATIFIED CHARGE **ELECTRIC HORN**

SPORTS SUSPENSION WHEELS 7.5J X 18 ALU KNEE AIRBAG **PARKTRONIC**

BASECOAT CLEAR

7 SPEED AUTOMATIC

Vehicle Condition

Vehicle Status

Pre-Accident Condition: Steering:

Brakes Pedal Travel: Place of Inspection:

Pre-Accident Damage:

Tyres Condition:

Tread Depth LHF:

Severity of Impact:

Vehicle Status on Inspection:

Date of Inspection:

12/12/2018

Tread Depth RHF:

51 Ubi Avenue 1, #01-25 Paya Ubi Industrial Park Singapore

Claim Reference:

Full Report - V1

Assessment Number: GS001845

Version: SMEMOT01/2


Date Calculated: 20/12/2018 02:43

Registration: SKR5689E


Printed: 20/12/2018 10:45

Tread Depth LHR:

Damage Areas:

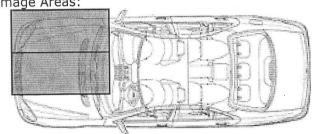

Tread Depth RHR: Direction of Impact:

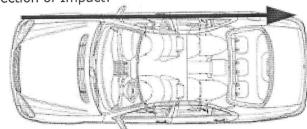

Addresses

Cost Summary

Total Labour	\$355.50
Total Paint/Material	\$99.47
Total Parts	\$4,480.30
Total of Additional Costs	\$400.00
Excess:	TBA
Grand Total Exc GST:	\$5,335.27
7 % GST:	\$373.47
Grand Total Inc GST:	\$5,708.74

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$45.00/HR Price/Dent = \$0.00/HR

Repair /		34711	Cook Duine (d)
	r Repair Details	WU	Cost Price (\$)
54-1011 01		3.0	13.50
	INCLUDES: CONNECT + DISCONNECT STAR		
	DIAGNOSIS,		
	PRINT DATA,		
	DELETE ERROR MEMORY		
61-1071 01	R + R FRONT LOWER ENGINE COMPARTMENT	5.0	22.50
	COVER		
88-1102 01	R + R FRONT BUMPER CPL	8.0	36.00
88-1105 01	DIS + ASS FRONT BUMPER	7.0	31.50
	(BUMPER REMOVED)		
	AFTER CHECK: RENEW PARTS IF NECESSARY		
88-1360 01	ADDITION TO DIS + ASS FRONT BUMPER	3.0	13.50
	(VEHICLE WITH PARK ASSISTANT)		
88-1355 01	ADDITION TO DIS + ASS FRONT BUMPER	2.0	9.00
	(VEHICLE WITH HEADLAMP WASHER SYSTEM)		
82-4800 01)	RENEW RIGHT HEADLAMP	5.0	22.50
,	(BUMPER DETACHED)		
	UMFASST: HEADLAMP AND FOG LAMPS		
	ADJUST		
82-4885 01	ADDITIONAL TO RENEW RIGHT HEADLAMP	3.0	13.50
OE 1000 3E	(VEHICLE WITH XENON HEADLAMP)		
88-3983 01	RENEW R/FR WING	8.0	36.00
00 0500 01	(BUMPER REMOVED/DETACHED)		
	INCLUDES: R/F WHEELHOUSE COVER CPL		
	REMOVE AND REFIT		
97-2500 ZAX	CAVITY PROTECTION (ADD/WORK)	2.0	9.00
J1 2300 ZAX	0,1111111111111111111111111111111111111		

51 Ubi Avenue 1, #01-25 Paya Ubi Industrial Park Singapore

Claim Reference:

Full Report - V1 Registration: SKR5689E

Assessment Number: GS001845

Version: SMEMOT01/2

Printed: 20/12/2018 10:45

Date Calculated: 20/12/2018 02:43

97-2500 ZAX	APPLY RUST PROOFING ON R/F WING	2.0	9.00
LAB	OUR COST Total Work Units Corrosion Protection	48.0	
	Corrosion Protection External Labour	0.0HRS	0.00
	Corrosion Protection Internal Labour	0.4HRS	18.00
	Sub Total	4.8HRS	\$216.00
	Paint Labour	3.1HRS	\$139.50
	Total Labour	7.9HRS	\$355.50

PAINT WORK Guide Number Description		Time Basis 10 WU = 1 HR. Price = \$45.00/HR		
			WU	Cost Price (\$)
	- BASECOAT CLEAR			
98-1682 01	FRONT BUMPER PAINTING STAGE I-N	1	11.0	
98-2615 01	R/F WING PAINTING STAGE I-M		6.0	
98-1340 01	PREPARATION WORK FOR TWO COAT	PAINTING	14.0	
	OF FITTED BODY PARTS			
LAB	OUR COST - PAINT			
	TIME(PAINT)		0.0	
	Total Work Units (10WU/HR)		31.0	
	Total Paintwork Labour		3.1HRS	\$139.50
MAT	TERIAL COST - PAINT			Cost Price
	Total Excluding Pearlescent Uplif	t		\$99.47
÷	Pearlescent Uplift @ 0.0%			\$0.00
	Total Paint Material Cost			\$99.47

		Price Valid	: 01/06/2015
Description FRONT BUMPER	Part Number Supplier 117 880 4840 9999	Bet. 0%	Price (\$) 1,150.00*
	USE SINGLE PARTS	0%	35.00*
	USE SINGLE PARTS VCC	0%	28.00* (A)
AND	117 881 0201	0%	430.00*
The state of the s	210 300 3000	0%	580.00* (A)
The second secon	222 900 3300 Short circuit	0%	250.00* (A
RIGHT HEADLAMP ASSY	117 906 6600 Sub Total Mark Up From Cost (10 ^o Total Parts	0% %)	1,600.00* \$4,073.00 \$407.30 \$4,480.30
	FRONT BUMPER FRT BUMPER CLAMP KIT R/F W-ARCH LINER MTG R/F WING R/H-LAMP CONT UNIT R/H-LAMP LVL C-UNIT	FRONT BUMPER FRT BUMPER CLAMP KIT R/F W-ARCH LINER MTG R/F WING R/H-LAMP CONT UNIT R/H-LAMP LVL C-UNIT RIGHT HEADLAMP ASSY 117 880 4840 9999 USE SINGLE PARTS USE SINGLE PARTS VEC 117 881 0201 218 900 9303 Short Circuit 117 906 6600 Sub Total Mark Up From Cost (10 9)	Description Part Number Supplier Bet. FRONT BUMPER 117 880 4840 9999 0% FRT BUMPER CLAMP KIT USE SINGLE PARTS 0% R/F W-ARCH LINER MTG USE SINGLE PARTS 0% R/F WING 117 881 0201 0% R/H-LAMP CONT UNIT 218 900 9303 Short circuit 0% R/H-LAMP LVL C-UNIT 222 900 3300 Short circuit 0% RIGHT HEADLAMP ASSY 117 906 6600 0% Sub Total Mark Up From Cost (10 %)

p: Parallelx: Exchange

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description REPROGRAMME	SPECIALIST	0%	\$400.00 (A) 🗸
HEADLAMP		Total Extras	\$400.00
		I Otal Extlas	7

Final Calculation

\$4,480.30

Labour

Total Parts

Total Panel/Mechanical

\$198.00

51 Ubi Avenue 1, #01-25 Paya Ubi Industrial Park Singapore

Claim Reference:

Full Report - V1

Assessment Number: GS001845

Registration: SKR5689E

Version: SMEMOT01/2

Printed: 20/12/2018 10:45

Date Calculated: 20/12/2018 02:43

4 WU

\$139.50

\$18.00

\$355.50

Total Labour Additional Costs

\$0.00 Corr Prot Materials External

\$400.00

Cost of Specialist **Total of Additional Costs**

Total Paintwork Corr Prot Internal

\$400.00

Total Paint/Material Costs Grand Total Excludes GST

\$99.47

GST @ 7 %

\$5,335.27 \$373.47

Grand Total Includes GST

\$5,708.74

Assessment Notes