

Ah Lim Motor Company
10 Ang Mo Kio Industrial
Park 2A
#01-09 AMK Autopoint
Singapore 568047

SURVEYOR COPY

Claim Reference:
Assessment Number: AH000991
Version: AHLIM001/1
Date Calculated: 13/12/2018 02:26

Full Report - V1
Registration: SLV8965E
Printed: 13/12/2018 10:26

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	Ahlim ahlim	Date of Incident:	
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	AXA Insurance S'pore Pte Ltd	Repairs Authorised:	TBA
Claim Reference:	3rd party	Estimated Repair Time:	
Policy Number:		Quote Due Date:	
Other Reference:	LKx	Actual Repair Days:	
Third Party:	1:30	Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	AUDI
Model:	Q5
Sub Model:	BASE MODEL
Model Sheet Number:	0A5 01
Registration:	SLV8965E
Registration Month:	September
Registration Year:	2014
VIN Number:	WAUZZZ8R3EA078310
Manufacture Year:	2014
Odometer:	Not Known
Colour:	
Engine Number:	
Fuel Level:	%

Model Specs

FROM 11/2013	CHROME BADGE
DEACTIVATED P/AIRBAG	R/ASPHERIC D/MIRROR
L/MIRROR CONVEX	MIRROR GLASS BIG FOV
STOP-START SYSTEM	LAUNCH ASSIST
AIR CON AUTO 3 ZONES	SS SILL MOULDING
AUTO BOOTLID	STORAGE PACKAGE
AUTO DIPPING MIRROR	MULTIMEDIA INTERFACE
ELEC FOLD DR MIRRORS	DIPPING DOOR MIRROR
ACTIVE LOUD SPEAKER	MMI RADIO HIGH/NAVIG
XENON HEADLAMPS	ULTRASONIC PARK SYS
HEADLAMP WASHERS	LIGHT-/RAIN SENSOR
KEYLESS ENTRY/SAFE	RR SLIDING S/CUSHION
EQUIP LEATHER MILANO	SPORT S-WHEEL LEATH
ELECT LUMBAR ADJUST	DRIVER INFO COLOUR
THROUGH LOAD SYSTEM	INTERIOR LAMP PACK
FRT ELECT MEM SEAT	FRONT CENTRE ARMREST
HD COOLING	2.0 LTR 165KW
AUTOMATIC 8-SPEED	DYNAMIC STEERING
SELECT DRIVE	ELECTRIC DAMPER REG
CRUISE CONTROL	TWO COAT PEARL/MICA

Vehicle Condition

Vehicle Status

Pre-Accident Condition:
Steering:

Brakes Pedal Travel:
Place of Inspection:
Pre-Accident Damage:

Tyres Condition:

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

Severity of Impact:
Vehicle Status on
Inspection:

Date of Inspection: 13/12/2018


Not Authorised
1-B.1
Repair 13 days
4 days

Ah Lim Motor Company


Claim Reference:
Assessment Number: AH000991
Version: AHLIM001/1
Date Calculated: 13/12/2018 02:26

Full Report - V1
Registration: SLV8965E
Printed: 13/12/2018 10:26

Tread Depth LHF:
Tread Depth LHR:
Damage Areas:

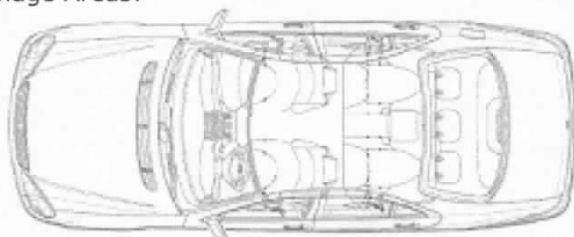

Tread Depth RHF:
Tread Depth RHR:
Direction of Impact:

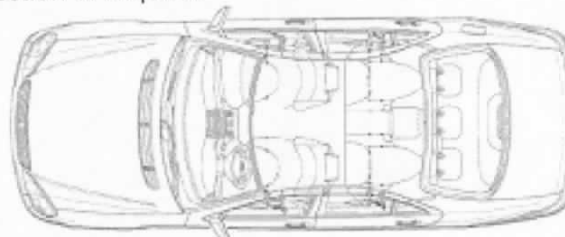

Addresses

Cost Summary

Total Labour	\$846.00
Total Paint/Material	\$146.43
Total Parts	\$3,904.25
Total of Additional Costs	\$400.00
Excess:	TBA
Grand Total Exc GST:	\$5,296.68
7 % GST:	\$370.77
Grand Total Inc GST:	\$5,667.45

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$45.00/HR
Price/Dent = \$45.00/HR

Repair /

Guide Number Repair Details

	WU	Cost Price (\$)
27 06 27 ZAX DETACH + REFIT BATTERY	2.0	9.00
INCLUDES: PROGRAM RADIO		
44 05 19 00 R + R REAR WHEEL (WHEELS)	2.0	9.00
66 19 19 00 R + R LEFT LOWER WING COVER	2.0	9.00
57 63 19 50) R + R L/F DOOR SEAL (EDGE PROTECTION)	2.0	9.00
(B-PILLAR TRIM REMOVED)		
INCLUDES: R + R LOWER A-PILLAR TRIM		
(INNER SILL TRIM)		
58 63 19 50) R + R L/R DOOR WEATHERSTRIP	1.0	4.50
(LOWER B-PILLAR TRIM REMOVED)		
57 51 19 00 R + R L/F DOOR	4.0	18.00
INCLUDES: ADJUST DOOR		
57 29 55 50 RENEW L/F DOOR BODY	22.0	99.00
(DOOR REMOVED)		
INCLUDES: CONVERT ATTACHED PARTS		
58 51 19 00 R + R LEFT REAR DOOR	3.0	13.50
INCLUDES: ADJUST DOOR		
58 29 55 50 RENEW L/R DOOR BODY	22.0	99.00
(DOOR REMOVED)		
INCLUDES: CONVERT ATTACHED PARTS		
66 29 19 50 R + R L/SILL TRIM SEAL	2.0	9.00
72 48 19 00 R + R LEFT REAR SEAT	4.0	18.00
70 67 19 00) R + R LEFT B-PILLAR LOWER TRIM	2.0	9.00
70 67 19 00) R + R L/UPPER B-PILLAR TRIM		
70 39 19 00 R + R LOCK CARRIER COVER	2.0	9.00

Ah Lim Motor Company

Claim Reference:

Assessment Number: AH000991

Version: AHLIM001/1

Date Calculated: 13/12/2018 02:26

Full Report - V1

Registration: SLV8965E

Printed: 13/12/2018 10:26

70 03 19 00)	INCLUDES: R + R REAR BOOT TRIM		
	R + R L/BOOT TRIM	3.0	13.50
	(LOCK CARRIER COVER REMOVED)		
70 68 19 00)	R + R LEFT C-PILLAR TRIM	2.0	9.00
51 01 75 01)	RUST PROOFING BODY SHELL PART	2.0	9.00
51 01 75 50	APPLY CAVITY SEALING ON L/R DOOR	1.0	4.50
	(COMPOSITE WORK)		
44 40 55 50)	R + R L/R TYRE (WHEEL REMOVED)	2.0	9.00
44 05 93 50	BALANCE L/R WHEEL (WHEEL REMOVED)	1.0	4.50
2101	REPAIR L/OUTER SILL PANEL	30.0* X	135.00

LABOUR COST

Total Work Units

111.0

Corrosion Protection

Corrosion Protection External Labour

0.0HRS

0.00

Corrosion Protection Internal Labour

0.3HRS

13.50

Sub Total

11.1HRS

\$499.50

Paint Labour

7.7HRS

\$346.50

Total Labour

18.8HRS

\$846.00

PAINT WORK

Time Basis 10 WU = 1 HR. Price = \$45.00/HR

Guide Number Description

WU

Cost Price (\$)

	- TWO COAT PEARL/MICA	
1481	LEFT FRONT DOOR NEW PART PAINTING	18.0
1781	L/R DOOR NEW PART PAINTING	16.0
2101	L/OUTER SILL PANEL REPAIR PAINTING >50%	12.0
3481	L/R SIDE PANEL SURFACE PAINT	6.0

LABOUR COST - PAINT

TIME(PAINT)

52.0

Preparation Work Multi Layer Paint

0.0

Total Work Units (10WU/HR)

77.0

Total Paintwork Labour

7.7HRS

\$346.50

MATERIAL COST - PAINT

Cost Price

New Part Painting

\$97.52

Material-Constant Main Work Metal

\$28.60

Surface-/Blend Paint

\$13.20

Repair Painting

\$7.11

Total Excluding Pearlescent Uplift

\$146.43

Pearlescent Uplift @ 0.0%

\$0.00

Total Paint Material Cost

\$146.43

PARTS

Guide No.	Qty	Description	Part Number	Supplier	Bet.	Price (\$)
1481	1	LEFT FRONT DOOR	8R0 831 051 E		0%	990.00* <i>15WU</i>
1509	1	L/F DOOR SEAL	8R0 837 911 L		0%	85.00* X
1525	1	L/F DOOR CLAMP KIT	8R0 098 619		0%	0.00
1685	1	L/F DOOR COVER	8R0 853 959 D 4U8		0%	185.00* X
1781	1	L/R DOOR	8R0 833 051 B		0%	990.00* ✓
1809	1	L/R DOOR SEAL	8R0 839 911 L		0%	85.00* ✓
1825	1	L/R DOOR CLAMP KIT	8R0 098 620		0%	0.00
1985	1	L/R DOOR LOWER COVER	8R0 853 969 D 4U8		0%	170.00* X
9551	1	L/R WHEEL	8R0 601 025 BN		0%	890.00* <i>15WU</i>

Ah Lim Motor Company

Claim Reference:

Assessment Number: AH000991

Version: AHLIM001/1

Date Calculated: 13/12/2018 02:26

Full Report - V1

Registration: SLV8965E

Printed: 13/12/2018 10:26

f: OEM Parts
g: Original
h: Secondhand
p: Parallel
x: Exchange

Sub Total
Mark Up From Cost (15 %)
Total Parts

\$3,395.00
\$509.25
\$3,904.25

THIS ASSESSMENT CONTAINS UNPRICED PARTS
NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description	Betterment	Price
CHK WIRING SPECIALIST	0%	\$40.00 <i>201</i>
WHEEL ALIGNMENT SPECIALIST		\$80.00 <i>601</i>
RESET & DIAGNOSE SPECIALIST	0%	\$280.00 <i>1201</i>
Total Extras		\$400.00

Final Calculation

Total Parts **\$3,904.25**

Labour

Total Panel/Mechanical	\$486.00
Total Paintwork	\$346.50
Corr Prot Internal 3 WU	\$13.50

Total Labour

\$846.00

Additional Costs

Corr Prot Materials External	\$0.00
Cost of Specialist	\$400.00

Total of Additional Costs

\$400.00

Total Paint/Material Costs

\$146.43

Grand Total Excludes GST

\$5,296.68

GST @ 7 %

\$370.77

Grand Total Includes GST

\$5,667.45

Assessment Notes