
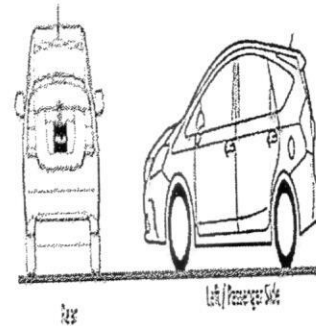


Toh Kin

Section A - Accident Details

Registration Number	SHC4723K
Case Reference Number	TAX/12/18/2062
Registration Date	4/3/2015
Company Type	SMRT Taxis Pte Ltd
Make	TOYOTA
Model	PRIUS
Name of Driver	WOON YONG CHIANG (YUN YONGQIANG)
Type of Accident	Head to Rear
Accident Date and Time	13/12/2018 1:30 PM
Accident Reported Date and Time	14/12/2018 12:13 PM
Is Surveyor Required?	Yes
Survey by	
Vehicle is Towed Back?	No
Towed Back Date and Time	
Replacement Vehicle issued?	No
Job Card Number	24099265
Special Instruction to ARC, if any	TP /TOWED 40/AIG - LKK
Prepared Date and Time	15/12/2018 8:30 AM
Chassis Number	
Mileage	
Work Shop	
Repair Completion Date and Time	

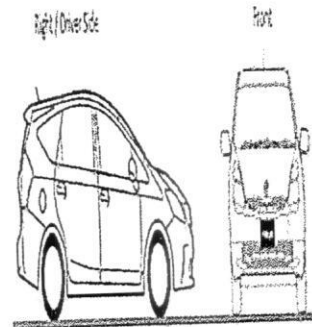

Toyota

L/S \$2150 + 5 days.

Section B - Summary of Repair Estimates

Summary of Repair Estimates

	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Cost	\$1,045.00	\$500.00
Total Spray Cost	\$1,098.00	\$380.00
Total Spare Part Cost	\$3,706.28	\$1,084.68
Total Other Cost	\$536.00	\$170.00
TOTAL COST	\$6,385.28	\$2,134.68
Lump Sum Total	\$6,400.00	\$2,150.00 (L/S)
Number of Repair Days	6.0	5.0
Prepared / Adjusted By	Tuck Foo Kok	Hwee Jie (LKK) / AIG
ARC / Surveyor Sign Off Date	18/12/2018 9:17 AM	17/12/2018 3:51 PM
Signature		
Remarks	SUP = 2 DAYS	L/S photo after paint. supplementary items send e-mail to: naz@lkkauto.com (91803151)

Section C - Quotation and Accident Invoice Details

Quotation Number	QN-1906-0288	Invoice Number	
Quotation Date	19.06.2019	Invoice Date	
Invoice Amount		Prepared Date	

Section D - Details of Repair Estimates

Part 1 - Labour Works

Job Scope	Quotation from AR	Adjusted by Surveyor, if applicable
TO REPAIR RR END PANEL	\$200.00	\$100.00
TO REPAIR REAR PORTION	\$845.00	\$400.00
Total Labour	\$1,045.00	\$500.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO RESPRAY REAR PANEL	\$180.00	\$80.00
TO RESPRAY BUMPER BEAM	\$180.00	\$100.00
TO RESPRAY REAR BUMPER	\$378.00	\$200.00
TO RESPRAY REAR PANEL	\$180.00	\$0.00
TO RESPRAY REAR SPARE TYRE PANEL	\$180.00	\$0.00
Total Spray Painting & Panel Beating	\$1,098.00	\$380.00

Part 3 - Other Costs - Accident and Accident Repair Related Expense

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TOWING CHARGE	\$56.00	\$40.00
TO CHECK WIRING AND SYSTEM FUNCTION	\$80.00	\$30.00
TO TEST AND REFIX REVERSE SENSOR SYSTEM	\$120.00	\$50.00
TO REMOVE AND INSTALL LUGGAGE COMPARTMENT TRIM TO FACILITATE REPAIR.	\$120.00	\$50.00
TO REPLACE SUNDRY PARTS	\$100.00	\$0.00
TO WASH AND VACUUM	\$60.00	\$0.00
Total Other Costs	\$536.00	\$170.00

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock Number	Part Name	Quantity	List Price (\$)	Discount (%)	Final Price (\$)	Estimator Approved	Surveyor Approved
		52159-47905	BUMPER REAR	1.00	\$458.60	25.00	\$343.95	Replace	Replace
		52161-16010	BUMPER CLIPS	10.00	\$1.61	25.00	\$12.08	Replace	Replace
		52023-12240	BUMPER REINFORCEMENT	0.00	\$205.70	0.00	\$0.00	Replace	Check X
		52016-47030	ARM SUB-ASSY, RR BUMPER LH	0.00	\$139.60	0.00	\$0.00	Replace	Check X
		52015-47050	ARM SUB-ASSY, RR BUMPER RH	0.00	\$139.60	0.00	\$0.00	Replace	Check X
		89997-30070	ANTENNA, ELECTRICAL	0.00	\$157.40	0.00	\$0.00	Replace	Check X
			SENSOR REVERSE	1.00	\$180.00	0.00	\$180.00	Replace	Replace
			PIXEL STICKER	2.00	\$60.00	0.00	\$120.00	Replace	Replace
		76088-47020	BUMPER LIP COVER RR/LH	0.00	\$72.20	0.00	\$0.00	Replace	Not Given X
		76087-47020	BUMPER LIP COVER RR/RH	0.00	\$118.10	0.00	\$0.00	Replace	Not Given X



SMRT Accident Vehicle Repair Estimates

SMRT Automotive Services Pte Ltd
60 Woodlands Industrial Park E4, Singapore 757705
FAX Number : 63685592
Estimator Telephone Number : 68662823
Accident Reporting Number : 68662672

Date Generated : 20/06/2019

User ID : PohSuan

	76891-47020	BUMPER LIP REAR	0.00	\$228.90	0.00	\$0.00	Replace	Not Given	X
	52592-47021	BUMPER SEAL, RR LH	0.00	\$88.90	0.00	\$0.00	Replace	Not Given	X
	52591-47021	BUMPER SEAL, RR RH	0.00	\$65.70	0.00	\$0.00	Replace	Not Given	X
	52576-47020	BUMPER SIDE RETAINER	0.00	\$94.80	0.00	\$0.00	Replace	Not Given	X
	52575-47020	BUMPER SIDE RETAINER	0.00	\$94.80	0.00	\$0.00	Replace	Check	X
	58308-47011	UNDER COVER SUBASSY, RR	0.00	\$514.50	0.00	\$0.00	Replace	Not Given	X
	69350-47030	TAILGATE DOOR LOCK	0.00	\$444.10	0.00	\$0.00	Replace	Not Given	X
	67881-47022	TAILGATE DOOR WEATHER	0.00	\$353.40	0.00	\$0.00	Replace	Not Given	X
	69415-47020	TAILGATE LOCK, COVER	0.00	\$15.70	0.00	\$0.00	Replace	Not Given	X
	69431-47010	STRIKER, BACK DOOR	0.00	\$48.90	0.00	\$0.00	Replace	Not Given	X
	58307-47060	END PANEL	0.00	\$602.10	0.00	\$0.00	Replace	Check	X
	64718-47031B0	END PANEL COVER, DECK	0.00	\$46.10	0.00	\$0.00	Replace	Check	X
	64716-47031B0	END PANEL COVER, DECK	0.00	\$121.10	0.00	\$0.00	Replace	Check	X
	58336-12090	REINFORCEMENT, RR	0.00	\$34.60	0.00	\$0.00	Replace	Check	X
4006314		SEALANT SIKAFLEX	0.00	\$37.00	0.00	\$0.00	Replace	Check	X
	58311-47071	SPARE TYRE PANEL	0.00	\$667.70	0.00	\$0.00	Replace	Check	X
Total				\$4,991.11		\$656.03			

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Stock Number	Part Name	Quantity	List Price \$	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check
		52023-12240	BUMPER REINFORCEMENT	1.00	\$205.70	25.00	\$154.28	Replace	Replace ✓
		52016-47030	ARM SUB-ASSY, RR BUMPER LH	1.00	\$139.60	25.00	\$104.70	Replace	Replace ✓
		52015-47050	ARM SUB-ASSY, RR BUMPER RH	1.00	\$139.60	25.00	\$104.70	Replace	Replace ✓
		52575-47020	BUMPER SIDE RETAINER	1.00	\$94.80	25.00	\$71.10	Replace	Replace ✓
		67881-47022	TAILGATE DOOR WEATHER	1.00	\$353.40	25.00	\$265.05	Replace	Replace ✓
Total					933.10		699.83		

1355.86
- 202

1084.69

+ 500.00
+ 550.00

2134.69

45 \$2150/-