

ASS. REC. BY

REF

CS/CTI18022988/Asd302

and Instruction

Surveyor

Adrian

ASSIGNMENT (Office)

From (Person) Elaine Cheong

at

CTI

Date/Time

24/12/18 @ 12:13pm

Estimated Cost:

Bill to:

OI / TI / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

SFA 7123G

Insured:

SKN 2475X

at Workshop m/s

Kah Motor

Tel:

90721766 / 68465672

of

15 Ubi Road 4

81006303

Policy No:

Claim No:

Sum Insured:

Excess:

Make of Veh:

(Client's Record)

D.O.A. 20/12/2018

CA / REV / REP. / REV 24 HRS

up

H.O.D. Endorsement

Date/Time: 12:16pm @ 24/12/18

Person Contacted:

Mr. Lim

Vehicle IN / OUT

Date/Time	Action/Instruction (✓) Estimate
	SFA 7123G-X
	SKN 2475X-X

REF: CTI

ASSIGNMENT

From: Date: 24/12/18

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No:

at Workshop no:

of:

Insured:

Policy No:

Claims No:

Semi Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value:

IDAC Accident Report:

Consistent? Yes or No

GIA / PR Seen:

Consistent? Yes or No

Est. Repairs:

21 days

Res: Yes or No

Lump Sum:

%

3 Val: Yes or No

CA / REV / REP. / 24 HRS (up)

Date:

Person Contacted:

Vehicle IN / OUT

Veh No:

SFA7123G

To Reg: 2018 June.

Type: ☒ M.C. / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Honda Civic.

C.C. 1597

Colour:

Grey.

A/C Insured / Std / NI / NA

Sp Reading:

16510

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

MRHFC5650JT000812

Gen. Cond: ☒ Good / Fair / Poor / BurntSteering: ☒ In order / Jammed / Leaked / Burnt orBrake: ☒ In order / Jammed / Leaked / Burnt orMod: Nil ☒ S/Rim / STD A/Rim or

Tyre Size:

F:

215/55R16.

R:

215/55R16.

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Hankook.

Front

Rear

R/Bal.

06

mm

R/Bal.

06

mm

L/Bal.

06

mm

L/Bal.

06

mm

D.O.A.

D.O.I.

24/12/18

Survey held at

Kah Molar

Des. of Damages: ☒ Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

TP Ling.

26/04/19

Confirmed

P/P

\$ 31,434.64

21 days

with

Adrian.

C \$ 4,235.46

Red - 12%.

MV: 85K

PV: 44.5K.

Nett: 40.5K.

26/4/2019

Date/Time, File Pass to?

29/04/19

If

Type

Date/Time, File Return to?

To



Prel. Report



Final Report

Days Of Repair:

21

Resurvey No. of Trip:

3

Survey Fee:

220

Transportation:

S + RE. 21

Photos:

Other:

Add Fee:



Site Insp (\$)



Interview (\$)



Tech. Invs (\$)



Weekend (\$)

Report Format:

Lump Sum / L.B.I. (\$)

31,434.64

TOTAL

220

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	8281G
Vehicle Particulars	
Vehicle No.:	SFA7123G
Vehicle to be Exported:	Yes
Intended Deregistration Date:	24 Dec 2018
Vehicle Make:	HONDA
Vehicle Model:	CIVIC 1.6 VTI CVT
Primary Colour:	Grey
Manufacturing Year:	2018
Engine No.:	R16B25500894
Chassis No.:	MRHFC5650JT000812
Maximum Power Output:	92.0 kW (123 bhp)
Open Market Value:	\$19,890.00
Original Registration Date:	04 Jun 2018
First Registration Date:	04 Jun 2018
Transfer Count:	0
Actual ARF Paid:	\$19,890.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	03 Jun 2028
PARF Rebate Amount:	\$14,917.00
Intended COE Rebate Details	
COE Expiry Date:	03 Jun 2028
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$37,000.00
COE Rebate Amount:	\$29,600.00
Total Rebate Amount:	\$44,517.00


The information contained herein is correct as at 24 Dec 2018

OK

500+ dealers
competed to
buy my car!



- Sell ur Car for More Cash
- Highest Price or Get \$100 Free
- Get Paid Now, Handover Later

[SELL YOUR CAR](#)


FOR SALE BY OWNER

Post an Advertisement
Sell it yourself! Advertise it at just
\$58 until it's SOLD!

[Post an Ad](#) [Advertiser Login](#) [3 Ways of Selling](#)

New 5 Years Coo Renewal Honda Stream 1.8A

 2.89% p.a. Lowest Interest @ Gov
Cars Financing \$2000
Downpayment Monthly From
\$638
OK Credit Pte Ltd StarAd

Lake View Credit Pte Ltd [View Our Cars](#)

- > Low prices guaranteed
- > Specialist in Japanese cars
- > Easy loan approval
- > All terms are negotiable

Browse by Category  Save Search  Print Sort by Date Posted 20 results/page

7 vehicles **Search** [Advanced Search](#) [Search](#) [View All](#)

Make Model Price Depreciation Reg Date Eng Cap Mileage Veh Type Status

Search Selection: civic Any Any 2018 Any Any Any Available



☐ **Honda Civic 1.6A VTI** **\$82,800** **\$7,970 /yr** **26-Feb-2018** **1,597 cc** **13,162 km** **Sedan** **Available**

Almost New Condition, Under Warranty. Savings From Buying Brand New Unit, Able To Do High/full Loan Or Low Down Payment Drive Away! No Long Waiting Time For Car To Be Delivered! We Are A Case Trust Co...

Mayfair Motoring

 Posted: 19-Oct-2018 [Tags: 2018 Honda Civic, 2018 Honda Civic, Honda Civic, Honda Civic, Honda Civic, Civic, Used Honda](#)



☐ **Honda Civic Type-R 2.0M VTEC Turbo GT** **\$169,700** **\$15,550 /yr** **27-Feb-2018** **1,996 cc** **14,700 km** **Sports** **Available**

Consignment Vehicle. New Arrival! 3 Years Warranty, Original Paintwork, Perfectly Taken Care From Previous Owner. Guaranteed Accident Free! High Trade In Available With Flexible Loan. Call For Appointment...

 Posted: 03-Dec-2018 [Tags: 2018 Honda Civic, 2018 Honda Civic, Honda Civic, Honda Civic, Honda Civic, Civic, Used Honda](#)



☐ **Honda Civic 1.6A VTI** **\$83,800** **\$7,990 /yr** **26-Mar-2018** **1,597 cc** **13,000 km** **Sedan** **Available**

In Many Ways, Performance-wise, The 1.6-litre Loses Very Little Against The 1.8, Its Output Is Down From 140bhp To 125bhp, And Torque Is Down From 174Nm To 151Nm, But Following In The Best Honda Trad...

DM Pre-Owned Pte Ltd

 Posted: 26-Dec-2018 [Tags: 2018 Honda Civic, 2018 Honda Civic, Honda Civic, Honda Civic, Honda Civic, Civic, Used Honda](#)



☐ **Honda Civic HB 1.5M VTEC Turbo Sport** **\$123,000** **\$11,270 /yr** **11-Apr-2018** **1,498 cc** **-** **Hatchback** **Available**

6MT VTEC Turbo 182PS 240Nm, High Performance, Full Black Roofline & Interior From Factory. Sporty Red Instrument Cluster, Same Chassis As FK8 Type R. Made In UK, Not Made In Thailand. 6 Speed Manual T...

 Posted: 14-Nov-2018 [Tags: 2018 Honda Civic, 2018 Honda Civic, Honda Civic, Honda Civic, Honda Civic, Civic, Used Honda](#)



Better Cornering With Hardrace Camber Kit

Hardrace Front Camber Kit (For Honda FD Civic)

[More info about this product](#)



☐ **Honda Civic HB 1.5A VTEC Turbo Sport** **\$121,000** **\$11,290 /yr** **13-Apr-2018** **1,498 cc** **-** **Hatchback** **Available**

182ps 220Nm, 18KM/L, High Spec With Honda Sensing. Rear Aircon Blower. Made In UK, JDM Spec, New Car, 0 Transfer, Available In Blue/Red/White.

 Posted: 14-Nov-2018 [Tags: 2018 Honda Civic, 2018 Honda Civic, Honda Civic, Honda Civic, Honda Civic, Civic, Used Honda](#)



☐ **Honda Civic Type R 2.0M Turbo** **\$178,000** **\$16,020 /yr** **21-Jun-2018** **1,996 cc** **7,199 km** **Sports** **Available**

Rare Beauty. Drive With Peace Of Mind. 6 Month Agent Unit With 5 Years Unlimited Mileage Warranty. Please Call For Viewing Now.

 Posted: 10-Nov-2018 [Tags: 2018 Honda Civic, 2018 Honda Civic, Honda Civic, Honda Civic, Honda Civic, Civic, Used Honda](#)



☐ **Honda Civic HB 1.0A VTEC Turbo SR** **\$106,800** **\$9,340 /yr** **29-Jun-2018** **988 cc** **72 km** **Hatchback** **Available**

Loan Up To 90% Is Available. New Condition Civic Hatchback From UK! This Unit Comes With High ARF Value Of \$35,857! Low And Affordable Annual Depreciation Of \$9000+ To Own This Hot Hatchback. One Look...

UNPUBLISHED 10/10/18

[Compare](#) 

[PREMIUM AD](#)

Nivitha (LKK Auto)

From: Elaine Cheong <elaine.cheong@sg.cntaiping.com>
Sent: Monday, 24 December 2018 12:13 PM
To: Liew Thye Wui; 'assignments'
Cc: 'SUR'
Subject: FW: DIRECT SETTLEMENT OF VEHICLE NO. SFA7123G AGAINST SKN2475X (CHINA TAIPING - 20180002289)
Attachments: 2828_001.pdf

WITHOUT PREJUDICE

Dear Mr Liew,

We refer to your email of 24.12.18.

We will be assigning M/s LKK Auto Consultants Pte Ltd to survey your client's vehicle.

Aside to LKK,

Please refer to the attachment and proceed to survey the third party vehicle.

Thank you.

Regards,

Elaine Cheong
Executive (Motor Claims)
Claims Department

China Taiping Insurance (Singapore) Pte. Ltd.

3 Anson Road #16-00 Springleaf Tower
Singapore 079909
Co. Reg. No. 200208384E
DID: 6389 6530
Fax: 6224 7478 / 6224 7175
Email: elaine.cheong@sg.cntaiping.com
Website: www.sg.cntaiping.com



From: Liew Thye Wui [mailto:twliew@honda.com.sg]
Sent: Monday, 24 December, 2018 11:57 AM
To: Elaine Cheong <elaine.cheong@sg.cntaiping.com>
Subject: FW: DIRECT SETTLEMENT OF VEHICLE NO. SFA7123G AGAINST SKN2475X (CHINA TAIPING)

To The Officer In Charge,

Please Refer The Above Attachment For Your Reference.

Kindly Help To Arrange Surveyor To Survey This Vehicle SFA7123G. ***VEHICLE IS IN***

Your Insured vehicle number is SKN2475X, Accident Date 20/12/2018.

Thank You

Best Regards

TW LIEW

Kah Motor Co. Sdn. Bhd.

15 Ubi Road 4

Singapore 408610

DID: 6514 5687

Fax: 6748 0770

From: Jeshurueben Rao Thomas <jeshurueben@honda.com.sg>

Sent: Saturday, 22 December, 2018 3:40 PM

To: claimsdept@sg.cntaiping.com

Cc: Liew Thye Wui <twliew@honda.com.sg>; Faeaz <faeaz@honda.com.sg>; Lim Chou Siong <cslim@honda.com.sg>

Subject: DIRECT SETTLEMENT OF VEHICLE NO. SFA7123G AGAINST SKN2475X (CHINA TAIPING)

To The Officer In Charge,

Please Refer The Above Attachment For Your Reference.

Kindly Help To Arrange Surveyor To Survey This Vehicle SFA7123G. ***VEHICLE IS IN***

Your Insured vehicle number is SKN2475X, Accident Date 20/12/2018.

Thank You

Warmest Regards

Jeshurueben Rao Thomas (Rueben)

Bodyshop Service Advisor

Kah Motor Body Repair Centre

15, Ubi Road 4

Singapore 408610

Tel : 68465672

Hp : 90721766



Confidential Note: The information contained in this email is intended only for the use of the individual or entity named above and may contain information that is privileged, confidential and exempt from disclosure under applicable law. If the reader of this message is not the intended recipient, you are hereby notified that any dissemination, distribution or copying of this

communication is strictly prohibited. If you have received this message in error, please immediately notify the sender and delete the mail. Thank you.

This email has been scanned by the Symantec Email Security.cloud service.
For more information please visit <http://www.symanteccloud.com>

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	21/12/2018 17:34
Date Of Accident	20/12/2018 21:55
Exact Location Of Accident	BISHAN ROAD/BISHAN ST 14 JUNCTION
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SFA7123G
Insured/Policyholder	
Name Of Registered Owner	LEE HWEE NGUAN
NRIC No	S1638281G
Email Address	LHN1105@HOTMAIL.COM
Mobile Phone No	(LOCAL) +65-98768281
Alternative Phone No	OFFICE-98768281
Vehicle Particulars	
Manufacturer	HONDA
Model	CIVIC-1.6 VTI CVT (A)
Exact Purpose for which vehicle was being used at time of accident	PERSONAL USE
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	PRIVATE CAR
Insurance Company	
Name of Insurance Company	TOKIO MARINE INSURANCE SINGAPORE LTD
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	18-MT102868-R00
Cover Note Number	
Driver	
Name of Driver	GRACE LEE NIEN EN
NRIC No	S9308215Z
Date Of Birth	04/03/1993
Occupation	INDOOR
Date Of Driving Pass	26/09/2015
Driving Experience	3 YEARS AND 2 MONTHS
Gender	FEMALE
Mobile Number	(LOCAL) +65-92253421
Fax Number	
Contact Number	
Email Address	LHN1105@HOTMAIL.COM

Address	APT BLK 547 ANG MO KIO AVENUE 10 #07-2242
Postcode	560547
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	RELATIVE
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	COLLISION - CROSS JUNCTION
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles (including own vehicle) involved in the accident	2
Was any body injured in the Accident?	YES
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	3
Passenger 1	NAME: : LEE NIEN SHI MELANIE GENDER: : FEMALE
Passenger 2	NAME: : TAN CONG WEN GENDER: : FEMALE

Details of Police Action

Was the accident reported to the police?	YES
If Yes, Please state which Police Station	
Police Station Name	ANG MO KIO SOUTH NEIGHBOURHOOD POLICE CENTRE
Police Station Address	ROAD: 81 ANG MO KIO AVE 3 , POSTCODE: 569929 , COUNTRY: SINGAPORE
Police Station Contact	TEL NO: 1800-4519999 - FAX NO: 65535679
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

REFER TO ATTACHED POLICE REPORT NO: T/20181221/2067

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	YES
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SKN2475X
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	PRIVATE CAR
Name of Driver	YAP WEI TING

NRIC/Passport Number S8870561J
Contact Number 92276546
Address
Postcode
Insurance Company Name CHINA TAIPING INSURANCE (SINGAPORE) PTE. LTD.
Nature Of Damage
No. Of Passenger (Including Driver)

DETAILS OF INJURED PERSON 1

Name GRACE LEE NIEN EN
Approximate Age 25
Injuries Sustain
Injured person in which vehicle? SFA7123G
Were seat belts worn? YES
Was this injured conveyed to hospital by ambulance? NO
Address
Postcode

DETAILS OF INJURED PERSON 2

Name LEE NIEN SHI MELANIE
Approximate Age 20
Injuries Sustain
Injured person in which vehicle? SFA7123G
Were seat belts worn? YES
Was this injured conveyed to hospital by ambulance? NO
Address
Postcode

DETAILS OF INJURED PERSON 3

Name TAN CONG WEN
Approximate Age 20
Injuries Sustain
Injured person in which vehicle? SFA7123G
Were seat belts worn? YES
Was this injured conveyed to hospital by ambulance? NO
Address
Postcode

Vehicle No

SFA 7123 G

SKETCH PLAN

Annex D

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers, at the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

B. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:

(i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;

(ii) investigating the accident and/or my claims;

(iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;

(iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or

(v) complying with applicable law in administering, processing, handling and/or dealing with my claims.

(collectively the "Purposes")

(b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and

(c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.

Policyholder's Signature / Date & Time

21/12/19
4:18pm


Driver's Signature (If driver is not the policyholder) / Date & Time

GND

Witnessed by Reporting Centre Personnel

Calcutt

Sketch Plan

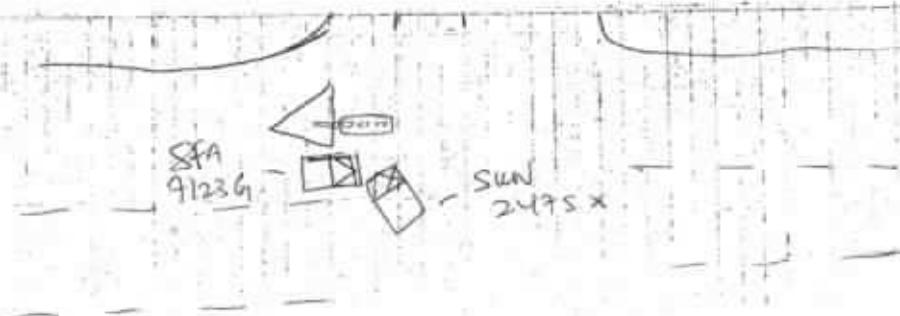

Please continue to Annex E

Vehicle No SFA 71234.

Annex I

Describe Circumstances of the Accident

Refer to
police Report NO:

T	2018	22	2067
---	------	----	------

Declaration

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature / Date & Time

Driver's Signature (If driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre
Personnel



Police Station Of Origin:
Ang Mo Kio South N.P.C
81 Ang Mo Kio Avenue 3 SINGAPORE
569929
Tel No: 1800-4519999

Report No. T/20181221/2067

REPORT OF A TRAFFIC ACCIDENT

Date/Time Report Made: 21/12/2018 14:53	Vide Report No.:	Station Diary No.: 73
--	------------------	--------------------------

Informant's Particulars

Name of Informant: GRACE LEE NIEN EN			Address: APT BLK 547 ANG MO KIO AVENUE 10 #07-2242 SINGAPORE 560547	
ID Type / ID No.: NRIC NO / S9308215Z			Contact No.: Home/Office:	Mobile: 92253421
Nationality: SINGAPORE CITIZEN			Email:	
Sex: Female	Age: 25	Date of Birth: 04/03/1993	Type of Informant: Driver	
Race: Chinese			Language: English	Institution / School Name:
Occupation: TEMPORARY ADMIN			Driving Licence Information: Class: 3A	Date of Expiry:

General Information of the Accident

General Information of the Accident				
Type of Accident:	Injury Others	Drink Drive: No	Date/Time of Accident: 20/12/2018 21:55	Type of Location: X-Junction
Location: Junction of Road 1 and Road 2 BISHAN ROAD BISHAN STREET 14				
Weather: Clear		Road Surface: Dry		Road Speed Limit:
Traffic Flow:		Traffic Control: Traffic Light - Working		Traffic Volume: Light
Type of Collision: Between Moving Vehicles - Head To Side				Anyone conveyed by ambulance: No

Details of Vehicle Involved

Vehicle No.	Type	Make	Model	Color	Condition	No of Passenger
SFA7123G	Car	HONDA	CIVIC	Grey	Seriously Damaged	2
SKN2475X	Car	VOLVO		Black		0

Details of Vehicle Insurance

Vehicle No.	Insurance Company	Insurance No	Effective	Expiry Date
SFA7123G	TOKIO MARINE INSURANCE SINGAPORE LTD.	18-MT102868-R00	04/06/2018	03/06/2021



Police Station Of Origin:
Ang Mo Kio South N.P.C
81 Ang Mo Kio Avenue 3 SINGAPORE
569929
Tel No: 1800-4519999

CONTINUATION OF REPORT

Details of Person Involved			
Any Pedestrian Involved: No			
No. of Pedestrians Injured: NIL		Use of Pedestrian Crossing: NA	
Passenger			
Name	TAN CONG WEN	ID No.	NIL
Related Vehicle	SFA7123G (Car)	Contact No.	96275994
Hospital/Clinic	NIL	Class of Driving Licence & Expiry Date	Class: NIL Date of Expiry: NIL
Date Treatment	NIL	Date Discharge	NIL
No. of Days granted Medical Leave	NIL	Degree of Injury	NIL
Driver			
Name	GRACE LEE NIEN EN	ID No.	S9308215Z
Related Vehicle	SFA7123G (Car)	Contact No.	92253421
Hospital/Clinic	TAN TOCK SENG HOSPITAL	Class of Driving Licence & Expiry Date	Class: 3A Date of Expiry: NIL
Date Treatment	20/12/2018	Date Discharge	21/12/2018
No. of Days granted Medical Leave	07	Degree of Injury	Slight
Passenger			
Name	LEE NIEN SHI MELANIE	ID No.	S9805825G
Related Vehicle	SFA7123G (Car)	Contact No.	93685855
Hospital/Clinic	NIL	Class of Driving Licence & Expiry Date	Class: NIL Date of Expiry: NIL
Date Treatment	NIL	Date Discharge	NIL
No. of Days granted Medical Leave	NIL	Degree of Injury	NIL



Police Station Of Origin:
Ang Mo Kio South N.P.C
81 Ang Mo Kio Avenue 3 SINGAPORE
569929
Tel No: 1800-4519999

Report No. T/20181221/2067

CONTINUATION OF REPORT

Driver				
Name	YAP WEI TING		ID No.	S8870561J
Related Vehicle	SKN2475X (Car)		Contact No.	92276546
Hospital/Clinic	NIL		Class of Driving Licence & Expiry Date	Class: NIL Date of Expiry: NIL
Date Treatment	NIL		Date Discharge	NIL
No. of Days granted Medical Leave	NIL		Degree of Injury	NIL

Brief Details.

On 20/12/2018 at about 2155hrs, I was driving one grey colour Honda Civic (SFA7123G) along Bishan Road from Ang Mo Kio. There were two passengers in my car and they are my sister and her boyfriend. My sister sat at the front passenger seat while her boyfriend sat at the rear seat. When I was driving at the junction of Bishan Road and Bishan St 14, I saw that the traffic light was green in my favour. As such, I continued to drive straight. Suddenly, when I was at the cross junction, suddenly one black colour Volvo car (SKN2475X), which was travelling from the opposite direction, turned right abruptly towards Bishan St 14 and did not stop to check for traffic. Due to this, my car hit onto the Volvo's left portion.

My car's front portion was damaged. My passengers and I then proceeded to Tan Tock Seng Hospital to seek medical attention as we felt unwell after the accident. I had bruise on my head and sore on my back. I was issued 7 days of Medical Leave. My sister was given 5 days of Medical Leave while her boyfriend had 2 days of Medical Leave. The in-car camera of my car recorded the whole accident and I am able to furnish it to the police.



Police Station Of Origin:
Ang Mo Kio South N.P.C
81 Ang Mo Kio Avenue 3 SINGAPORE
569929
Tel No: 1800-4519999

CONTINUATION OF REPORT

Sketch Plan

Informant is not able to provide sketch plan

IMPORTANT: Please attach a copy of your vehicle's Insurance Certificate to this report. If you don't have the certificate with you now, please fax a copy to 65474885 stating the report number as reference.

Signature Of Officer Recording The Report:
F /
Staff Sgt MUHAMMAD AZRI BIN ABDUL RAHIM

Signature Of Informant:

Signature Of Interpreter:
Not applicable

Date/Time:
21/12/2018 14:53

Officer In Charge Of Case:
TP / AEIT /

Classification Of Case:

Contact No.:

SN 085

Authentication Stamp
NP168



Signature:

Singapore Police Force



Certificate of Insurance

MOTOR VEHICLES (THIRD-PARTY RISKS AND COMPENSATION) ACT (CHAPTER 189)
MOTOR VEHICLES (THIRD-PARTY RISKS AND COMPENSATION) RULES, 1960
ROAD TRANSPORT ACT, 1987 (MALAYSIA)
MOTOR VEHICLES (THIRD-PARTY RISKS) RULES, 1959 (MALAYSIA)

Policy No.: 18-MT102868-R00 (Private Motor Car 24 Months)

- | | | |
|---|----------------|--------------------------------|
| 1. Index Mark and Registration Number of Vehicle | SFA7123G | Chassis No.: MRHFC5650JT000812 |
| 2. Name of Policyholder | LEE HWEE NGUAN | |
| 3. Effective date of the Commencement of Insurance for the purposes of the Act | 04/06/2018 | |
| 4. Date of Expiry of Insurance | 03/06/2020 | |
| 5. Persons or Class of Persons entitled to drive* | | |
| (a) The Policyholder. | | |
| (b) Any other person who is driving on the Policyholder's order or with his permission. | | |

* Provided that the Person driving is permitted in accordance with the licensing or other laws or regulations to drive the Motor Vehicle or has been so permitted and is not disqualified by order of a Court of Law or by reason of any enactment or regulation in that behalf from driving the Motor Vehicle. And provided further that the Motor Vehicle is registered under the Road Traffic Act and its registration under the Road Traffic Act has not been cancelled at the time of the accident loss or damage.

6. Limitations as to use*

Use only for social domestic and pleasure purposes and for the Policyholder's business.

The policy does not cover use for hire or reward, racing, pace-making, reliability trial, speed-testing or the carriage of goods (other than samples) in connection with any trade or business or use for any purpose in connection with the Motor Trade.

* Limitations rendered inoperative by Section 8 of the Motor Vehicles (Third-Party Risks and Compensation) Act (Chapter 189) and Section 95 of the Road Transport Act, 1987 (Malaysia), are not to be included under these headings.

We hereby certify that the Policy to which this Certificate relates is issued in accordance with the provision of the Motor Vehicles (Third-Party Risks and Compensation) Act (Chapter 189) and Part IV of the Road Transport Act, 1987 (Malaysia).

Please refer to the Policy Schedule for full details, terms and conditions of the insurance.

IMPORTANT NOTICE

This Certificate is not transferable. During its currency, if the insurance is cancelled for whatsoever reason, you must return the Certificate to Tokio Marine Insurance Singapore Ltd. within 7 days thereof or, if the Certificate has been lost destroyed, you must make a statutory declaration to that effect. Failure to comply with this duty is an offence under Motor Vehicle (Third-Party Risks and Compensation) Act (Chapter 189).

ADDITIONAL INFORMATION

Account: E2316DDA

Insurance Plan:	Comprehensive Approved Workshop Plan	
Limit for total loss or theft:	Prevailing Market Value	
Policy Excess:	Own Damage Claims	SGD 600
	Windscreen Excess	SGD 100
Financial Interest:	OCBC BANK LIMITED	

Tokio Marine Insurance Singapore Ltd.

Authorised Signature

REPUBLIC OF SINGAPORE
IDENTITY CARD NO. S9308215Z



Name

GRACE LEE NIEN EN

李念恩

Race

CHINESE

Date of birth

04-03-1993

Sex

F

Country of birth

SINGAPORE

S9308215Z

REPUBLIC OF SINGAPORE DRIVING LICENCE



Licence Number S9308215Z

Name

GRACE LEE NIEN EN

Birth Date: 04 Mar 1993

Issue Date: 26 Sep 2015



002477161H



8185433



NRIC No. S9308215Z

3033

Date of issue

07-03-2008

APT BLK 547 ANG MO KIO AVENUE 10 #07-2242
SINGAPORE 560547

NRIC No: S9308215Z

Date: 24/12/2012

No: 7181716

YOU ARE LICENSED TO DRIVE VEHICLES IN THE FOLLOWING CLASS(ES)

EFFECTIVE DATE

Class 3A Motor cars without clutch pedals (Auto) ≤ 3000kg 26 Sep 2015
≤ 7 passengers, exclusive of the driver; and
other motor vehicles without clutch pedals ≤ 2500kg



Licence No: S9308215Z

NP 428A

**KAH MOTOR CO. SDN. BHD.**

(A Member of the Oriental Holdings Berhad)

Service and Body Repair

Tel: +65 6841 3838

Website: www.honda.com.sg

For 24-hours Roadside Assistance, Call 98203838

QUOTATION

GST Reg No.: M200050223

Company Ref. No.: S60FC1380G

Customer	: CHINA TAIPING INSURANCE	Document No.	: SQT18005452	Page	1
	3 ANSON ROAD #16-00	Date	: 21. Dec 2018		
	SPRINGLEAF TOWER	Customer No.	: WZC008		
	SINGAPORE 079909	Svc Advisor	: RUEBEN THOMAS		
Registration No	: SFA7123G	Engine No	: R16B25500894		
Chassis No	: MRHFC5650JT000812	Date Time	: 21. Dec 2018 2:19:51 PM		
Model	: CIVIC 1.6 VTI YM2018	Surveyor Name	:		
Owner's Name	: LEE HWEE NGUAN	Survey Date	:		
Ins Policy No.	:	Authorisation Date	:		
Date of Accident	: 20/12/2018				

Item	Description	Qty	Unit Price	Disc %	Amount	0% GST Amount	Amount Incl GST
	TP DIRECT SETTLEMENT (J/NO:)						
	OWNER: LEE HWEE NGUAN						
	OWNER INSURER: TOKIO MARINE						
	ACC DATE: 20/12/2018						
	SURVEYED BY:						
	DATE:						
	REF NO:						
	TP INSURER: CHINA TAIPING INSURANCE						
	TP VEH: SKN2475X						
71410-TEA-T01	BULKHEAD ASSYFR. <i>nsld</i>	1	525.90	25	✓ 394.42	27.61	✓ 422.03
71430-TEA-T00	BRACEBULKHEAD LOWER	1	15.50	25	✓ 11.62	0.81	12.43
04605-TEA-T00ZZ	OUTRIGGER SETL FR.SIDE	1	255.80	25	✓ 191.85	13.43	205.28
04684-TEA-T01ZZ	EXTENSION SETL FR.SHOCK ABS	1	200.50	25	✓ 150.37	10.53	160.90
60630-TEA-T00	BASE COMPBATTERY SETTING	1	30.30	25	✓ 22.72	1.59	24.31
60723-TEA-T00ZZ	EXTENSIONL FR.BULKHEAD	1	28.70	25	✓ 21.52	1.51	23.03
60724-TEA-T01	SEPARATORL W/HOUSE UPPER MEMB	1	3.40	25	✓ 2.55	0.18	2.73
60750-TEA-305ZZ	HOUSING SETL FR.SHOCK ABS	1	196.70	25	✓ 147.52	10.33	157.85
60911-TEA-305ZZ	FRAME SETL FR.SIDE	1	203.60	25	✓ 152.70	10.69	163.39
60912-TEA-305ZZ	PLATE SETL FR.SIDE BACK <i>6</i>	1	124.30	25	✓ 93.22	6.53	99.75
60919-TEA-T00ZZ	FLANGEL FR.BUMPER BEAM EXTENS	1	34.20	25	✓ 25.65	1.80	27.45
60921-TBA-A00ZZ	BRACKETL FR.SUB FRAME FR.	1	32.60	25	✓ 24.45	1.71	26.16
60922-TEA-T00ZZ	PLATEL FR.SIDE FRAME	1	31.10	25	✓ 23.32	1.63	24.95
60947-TEA-T00ZZ	SUPPORTL FR.SIDE FRAME	1	31.10	25	✓ 23.32	1.63	24.95
76208-TEA-T02	MIRROR ASSY.R. <i>lot</i>	1	254.30	25	✓ 190.72	13.35	204.07
60211-TBA-A00ZZ	PANELR.FENDER <i>Buckled</i>	1	248.90	25	✓ 186.67	13.07	199.74
60213-TBA-A00ZZ	BRACKET AR.FR.FENDER <i>Best</i>	1	29.40	25	✓ 22.05	1.54	23.59
60261-TBA-A00ZZ	PANELL.FENDER <i>Distorted</i>	1	248.90	25	✓ 186.67	13.07	199.74
60263-TBA-A00ZZ	BRACKET AL.FR.FENDER <i>nsld</i>	1	29.40	25	✓ 22.05	1.54	23.59
74105-TEA-T00	ENCLOSURER.FR.FENDER	1	8.90	25	✓ 6.67	0.47	7.14
74151-TEA-T00	FENDERL.FR INNER <i>to</i>	1	51.10	25	✓ 38.32	2.68	41.00



KAH MOTOR CO. SDN. BHD.
 (A Member of the Oriental Holdings Berhad)
 Service and Body Repair
 Tel: +65 6841 3838 Website: www.honda.com.sg
 For 24-hours Roadside Assistance, Call 98203838

QUOTATION

GST Reg No.: M200050223
 Company Ref. No.: S60FC1380G

Customer	: CHINA TAIPING INSURANCE	Document No.	: SQT18005452	Page	2
	3 ANSON ROAD #16-00	Date	: 21. Dec 2018		
	SPRINGLEAF TOWER	Customer No.	: WZC008		
	SINGAPORE 079909	Svc Advisor	: RUEBEN THOMAS		
Registration No	: SFA7123G	Engine No	: R16B25500894		
Chassis No	: MRHFC5650JT000812	Date Time	: 21. Dec 2018 2:19:51 PM		
Model	: CIVIC 1.6 VTI YM2018	Surveyor Name	:		
Owner's Name	: LEE HWEE NGUAN	Survey Date	:		
Ins Policy No.	:	Authorisation Date	:		
Date of Accident	: 20/12/2018				

Item	Description	Qty	Unit Price	Disc %	Amount	0% GST Amount	Amount incl GST
74155-TEA-T00	ENCLOSURE FR.FENDER <i>distorted</i>	1	8.90	25	✓ 6.67	0.47	7.14
91501-TR0-003	CLIP INNER FENDER <i>in</i>	20	2.80	25	✓ 42.00	2.94	44.94
60100-TEA-T00ZZ	HOOD COMPENGINE <i>distorted</i>	1	598.70	25	✓ 449.02	31.43	480.45
60120-TEA-T00ZZ	HINGE COMPR.HOOD <i>2 bent</i>	1	32.90	25	✓ 24.67	1.73	26.40
60170-TEA-T00ZZ	HINGE COMPL.HOOD <i>2 bent</i>	1	32.90	25	✓ 24.67	1.73	26.40
74120-TBA-A01	LOCK ASSYHOOD <i>2nd</i>	1	87.90	25	✓ 65.92	4.61	70.53
74131-TEA-T01	WIRE ASSYFR.HOOD <i>purged</i>	1	18.90	25	✓ 14.17	0.99	15.16
74141-TEA-T00	INSULATORHOOD <i>crushed</i>	1	77.00	25	✓ 57.75	4.04	61.79
74148-TBA-A00	SEALRUBBER INTAKE <i>cut</i>	1	19.20	25	✓ 14.40	1.01	15.41
74220-TEA-T00	COVER FR.FENDER <i>2nd</i>	1	14.20	25	✓ 10.65	0.75	11.40
74270-TEA-T00	COVERL FR.FENDER <i>2nd</i>	1	14.20	25	✓ 10.65	0.75	11.40
73111-TEC-T41	GLASS SETFR.WINDSHIELD <i>shattered</i>	1	1814.90	25	✓ 1361.17	95.28	1456.45
73125-TEA-T01	MOLDINGFR.WINDSHIELD SIDE <i>2mm</i>	2	2.40	25	✓ 3.60	0.25	3.85
73150-TEA-T01	MOLDINGFR.WINDSHIELD	1	38.80	25	✓ 29.10	2.04	31.14
73151-TEA-T01	MOLDINGFR.WINDSHIELD LOWER	1	31.70	25	✓ 23.77	1.66	25.43
76630-TEA-T02	BLADE WINDSHIELD WIPER <i>cut</i>	1	52.60	25	✓ 39.45	2.76	42.21
80100-TBA-A01	CONDENSER ASSY <i>distorted</i>	1	704.40	25	✓ 528.30	36.98	565.28
80312-TEA-T11	HOSE COMPSUCTION <i>2nd</i>	1	88.20	25	✓ 66.15	4.63	70.78
80315-TEA-T01	HOSE COMPDISCHARGE <i>2nd</i>	1	159.80	25	✓ 119.85	8.39	128.24
80341-TEA-T11	PIPE COMPRECEIVER <i>2nd</i>	1	27.10	25	✓ 20.32	1.42	21.74
80525-TBA-A01	SENSOR ASSYAMBIENT <i>orange</i>	1	40.10	25	✓ 30.07	2.10	32.17
91555-TBA-K01	CLIPAMBIENT SENSOR <i>in</i>	1	5.40	25	✓ 4.05	0.28	4.33
17201-5FE-M00	CASE SETAIR CLEANER <i>crushed</i>	1	48.60	25	✓ 36.45	2.55	39.00
17210-5FE-M00	COVER COMPAIR CLEANER <i>crushed</i>	1	21.00	25	✓ 15.75	1.10	16.85
17220-5BA-A00	ELEMENT ASSYAIR CLEANER <i>crushed</i>	1	35.60	25	✓ 26.70	1.87	28.57
17230-5FE-M00	CHAMBER ASSYRESONATOR <i>in</i>	1	51.00	25	✓ 38.25	2.68	40.93
19010-5FA-Z01	RADIATOR COMP <i>distorted</i>	1	1100.50	25	✓ 825.37	57.78	883.15
19015-5BA-A01	SHROUD COMP <i>crushed</i>	1	120.70	25	✓ 90.52	6.34	96.86
19019-5BA-A01	PROTECTORFAN MOTOR HEAT <i>2 distorted</i>	1	17.60	25	✓ 13.20	0.92	14.12
19020-5BA-A01	FAN COMPCOOLING	1	66.40	25	✓ 49.80	3.49	53.29

Printed on 22/12/2018 3:33:51 PM

This is a computer generated invoice. No signature is required.

Part prices are subjected to change without notice.

The above estimated cost of repair do not include any unforeseen damages.

GST Amount is calculated from individual line(s)



QUOTATION

KAH MOTOR CO. SDN. BHD.

(A Member of the Oriental Holdings Berhad)

Service and Body Repair

Tel: +65 6841 3838

Website: www.honda.com.sg

For 24-hours Roadside Assistance, Call 98203838

GST Reg No.: M200050223
Company Ref. No.: S60FC1380G

Customer : CHINA TAIPING INSURANCE
3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

Registration No : SFA7123G

Chassis No : MRHFC5650JT000812

Model : CIVIC 1.6 VTI YM2018

Owner's Name : LEE HWEE NGUAN

Ins Policy No. :

Date of Accident : 20/12/2018

Document No. : SQT18005452 Page 3

Date : 21. Dec 2018

Customer No. : WZC008

Svc Advisor : RUEBEN THOMAS

Engine No : R16B25500894

Date | Time : 21. Dec 2018 2:19:51 PM

Surveyor Name :

Survey Date :

Authorisation Date :

Item	Description	Qty	Unit Price	Disc %	Amount	0% GST Amount	Amount incld GST
19030-5BA-A01	MOTORCOOLING FAN <i>Disband</i>	1	686.40	25	✓ 514.80	36.04	550.84
19501-5FA-Z00	HOSEWATER UPPER <i>hissled</i>	1	10.50	25	✓ 7.87	0.55	8.42
19502-5FA-Z00	HOSE AWATER LOWER <i>but</i>	1	12.90	25	✓ 9.67	0.68	10.35
50820-TEA-T12	MOUNTING,ENGINE SIDE <i>Torn</i>	1/12.10	167.00	25	✓ 125.25	8.77	134.02
50850-TBA-A81	MOUNTINGTRANSMISSION <i>Torn</i>	1	135.20	25	✓ 101.40	7.10	108.50
50200-TEA-T02	SUB FRAMEFR. <i>Best</i>	1	1285.50	25	✓ 964.12	67.49	1031.61
90179-SDA-A00	BOLT FLANGE 14 X 90 <i>see</i>	2	6.80	25	✓ 10.20	0.71	10.91
74110-TEA-T00	COVER ASSY,ENGINE UNDER <i>torn</i>	1	213.20	25	✓ 159.90	11.19	171.09
74113-TEA-T00	LID,ENGINE UNDER COVER <i>see</i>	1	12.80	25	✓ 9.60	0.67	10.27
32200-TEC-S02	ENGINE ROOM WIRE HARNESS <i>Snapped</i>	1	927.80	25	✓ 695.85	48.71	744.56
38256-TEA-P02	COVER RELAY BOX UPPER <i>could</i>	1	19.40	25	✓ 14.55	1.02	15.57
32130-TEA-T00	HARNESSFR.END WIRE <i>snapped</i>	1	67.50	25	✓ 50.62	3.54	54.16
33100-TEC-306	HEADLIGHT ASSY,R? <i>could</i>	1	585.70	25	✓ 439.27	30.75	470.02
33150-TEC-306	HEADLIGHT ASSY,L <i>could</i>	1	585.70	25	✓ 439.27	30.75	470.02
37820-5FF-S51	CONTROL MODULEPOWERTRAIN <i>Not see</i>	1	830.90	25	X 623.17	43.62	666.79
37821-5FA-Z10	BRCKET COMPP/TRAIN CTL MODULE <i>Best</i>	1	23.50	25	✓ 17.62	1.23	18.85
37823-RB0-000	COVERCONTROL MODULE <i>could</i>	1	12.90	25	✓ 9.67	0.68	10.35
77930-TEA-B11	SENSOR ASSYFR.CRASH <i>Activated</i>	1	71.40	25	✓ 53.55	3.75	57.30
77930-TEA-B21	SENSOR ASSYFR.CRASH <i>Activated</i>	1	71.40	25	✓ 53.55	3.75	57.30
77960-TEA-Z42	SRS UNIT <i>Activated</i>	1	815.00	25	✓ 611.25	42.79	654.04
77100-TEA-T00ZA	PANEL COMPINSTRUMENT <i>torn</i>	1	696.20	25	✓ 522.15	36.55	558.70
77820-TEA-H80	MODULE ASSYPASSENGER <i>Activated</i>	1	1827.00	25	✓ 1370.25	95.92	1466.17
81450-TEA-Q01ZA	TONGUE ASSYR.FR.SEATBELT <i>Activated</i>	1	429.30	25	✓ 321.97	22.54	344.51
81850-TEA-Q01ZA	TONGUE ASSYL.FR.SEATBELT OUT <i>Activated</i>	1	429.30	25	✓ 321.97	22.54	344.51
77810-TEA-T80ZA	MODULE ASSYDRIVER <i>Activated</i>	1	1827.00	25	✓ 1370.25	95.92	1466.17
18120-R1A-T00	COVER COMPCHAMBER <i>see see</i>	1	60.10	25	X 45.07	3.15	48.22
18150-5FB-G00	CONVERTER ASSY <i>Not see</i>	1	1096.50	25	X 822.37	57.57	879.94
18181-R1A-A00	COVERCONVERTER <i>Best</i>	1	48.00	25	✓ 36.00	2.52	38.52
18717-RNA-A00	PIPEEGR. <i>Best</i>	1	108.40	25	✓ 81.30	5.69	86.99
36531-R1A-A01	SENSORAIR FUEL RATIO <i>dummy</i>	1	512.30	25	✓ 384.22	26.90	411.12

Printed on 22/12/2018 3:33:51 PM

This is a computer generated invoice. No signature is required.

Part prices are subjected to change without notice

The above estimated cost of repair do not include any unforeseen damages.

GST Amount is calculated from individual line(s)

14673.26

**KAH MOTOR CO. SDN. BHD.**

(A Member of the Oriental Holdings Berhad)

Service and Body Repair

Tel: +65 6841 3838

Website: www.honda.com.sg

For 24-hours Roadside Assistance, Call 98203838

QUOTATION

GST Reg No.: M200050223

Company Ref. No.: S60FC1380G

Customer : CHINA TAIPING INSURANCE
3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

Registration No : SFA7123G

Chassis No : MRHFC5650JT000812

Model : CIVIC 1.6 VTI YM2018

Owner's Name : LEE HWEE NGUAN

Ins Policy No. :

Date of Accident : 20/12/2018

Document No. : SQT18005452

Date : 21. Dec 2018

Customer No. : WZC008

Svc Advisor : RUEBEN THOMAS

Engine No : R16B25500894

Date | Time : 21. Dec 2018 2:19:51 PM

Surveyor Name :

Survey Date :

Authorisation Date :

Page 4

Item	Description	Qty	Unit Price	Disc %	Amount	0% GST Amount	Amount Incl GST
36532-5M1-H11	SENSOR OXYGEN <i>2x1</i>	1	106.40	25	✓ 79.80	5.59	85.39
18011-5M1-H00	VALVE SETEGR <i>2x1</i>	1	295.30	25	✓ 221.47	15.50	236.97
25560-R3W-003	WARMER COMP. CVTF <i>Paged</i>	1	186.50	25	✓ 139.87	9.79	149.66
08CLA-P9911LK8	COOLANT ANTI-FREEZE TYPE 2 <i>new</i>	3	23.20	25	✓ 52.20	3.65	55.85
BO-WS-SEALANT	WINDSCREEN SEALANT (N) <i>new</i>	2	60.00		✓ 120.00	8.40	128.40
30485005-812000020	IDEMITSU BRAKE FLUID DOT4 0.5L <i>new new</i>	1	8.23	25 X	✓ 6.17	0.43	6.60
BO-NUM-COMP-L	NUMBER PLATE WITH CASING-L(N) <i>Missing</i>	1	45.00		✓ 45.00	3.15	48.15
Sum Item					16832.06	1,178.27	18,010.33
BO-R-COOL-FWS	SUPPLY & INSTALL SOLAR FILM ON FRONT WINDSCREEN. <i>new</i>	1	300.00		✓ 300.00	21.00	321.00
TOW-SPEEDWAY	TOWING SERVICE	1	150.00		✓ 150.00	10.50	160.50
BO-WHEEL ALIGN X4	WHEEL ALIGNMENT X4	1	180.00		✓ 180.00	12.60	192.60
Sum Ext. Service					630.00	44.10	674.10
BOSUN	SUNDRIES	1	50.00		<i>20</i> 50.00	3.50	53.50
BOMISC1	RESET VEHICLE SMART ENTRY SYSTEM (N)	1	320.00		<i>280</i> 320.00	22.40	342.40
BMS00R	RENEW BOTH DRIVER & PASSENGER AIRBAG ASSY ECU &	1	450.00		✓ 450.00	31.50	481.50
BMI00D	REMOVE & INSTALL DASHBOARD EVAPORATOR UNIT	1	1000.00		✓ 1000.00	70.00	1070.00
BME00D	REMOVE & INSTALL ENGINE ASSY GEARBOX & OTHERS	1	1000.00		✓ 1000.00	70.00	1070.00
BMB01D	REMOVE & INSPECT ABS MODULAR BLEED BRAKE SYSTEM	1	450.00		<i>300</i> 450.00	31.50	481.50
BMA01D	REMOVE & INSTALL A/C CONDENSER WITH FITTINGS	1	280.00		✓ 280.00	19.60	299.60
BMC01D	REMOVE & INSTALL RADIATOR WITH FITTINGS	1	230.00		✓ 230.00	16.10	246.10
BG01R	REPLACE FR. WINDSCREEN (N)	1	300.00		✓ 300.00	21.00	321.00
BKOT00A	PLACE VEHICLE TO BENCH FOR CHASSIS FRAME ALIGNMENT	1	1300.00		<i>1800</i> 1300.00	91.00	1391.00
BML01I	INSPECT FR LIGHTING MECHANISMS & FOCUS	1	100.00		✓ 100.00	7.00	107.00
BOJSE	BODY JOINT SEALANT	2	100.00		✓ 200.00	14.00	214.00
BOBC	BODY UNDERSIDE COATING (N)	1	100.00		✓ 100.00	7.00	107.00
BP00R	APPLY BODY UNDERSIDE COATING (N)	1	250.00		<i>180</i> 250.00	17.50	267.50

Printed on 22/12/2018 3:33:51 PM

This is a computer generated invoice. No signature is required.

Part prices are subjected to change without notice.

The above estimated cost of repair do not include any unforeseen damages.

GST Amount is calculated from individual line(s).



KAH MOTOR CO. SDN. BHD.
(A Member of the Oriental Holdings Berhad)
Service and Body Repair
Tel: +65 6841 3838 Website: www.honda.com.sg
For 24-hours Roadside Assistance, Call 98203838

QUOTATION

GST Reg No.: M200050223
Company Ref. No.: S60FC1380G

Customer	: CHINA TAIPING INSURANCE	Document No.	: SQT18005452	Page	5
	: 3 ANSON ROAD #16-00	Date	: 21. Dec 2018		
	: SPRINGLEAF TOWER	Customer No.	: WZC008		
	: SINGAPORE 079909	Svc Advisor	: RUEBEN THOMAS		
Registration No	: SFA7123G	Engine No	: R16B25500894		
Chassis No	: MRHFC5650JT000812	Date Time	: 21. Dec 2018 2:19:51 PM		
Model	: CIVIC 1.6 VTI YM2018	Surveyor Name	:		
Owner's Name	: LEE HWEE NGUAN	Survey Date	:		
Ins Policy No.	:	Authorisation Date	:		
Date of Accident	: 20/12/2018				

Item	Description	Qty	Unit Price	Disc %	Amount	0% GST Amount	Amount incld GST
BKBH11B	CUT OFF & RENEW BULKHEAD FR L HOUSING COMP.	1	5000.00	4100	5000.00	350.00	5350.00
BP06R	SPRAY PAINTING ON REPAIRED OR REPLACED AREAS. (8P)	1	4000.00	2700	4000.00	280.00	4280.00
Sum Labor					15030.00	1,052.10	16,082.10

Survey By Adrian Lim
Date & Time 24/12/18
Excess Not Authorised
Status Not Authorised
Signature [Signature]

Total Amount 32,492.06 2,274.47 34,766.53
Total (Inclusive of GST) 34,766.53
18-21 Days.
35640.10

Printed on 22/12/2018 3:33:51 PM

This is a computer generated invoice. No signature is required.

Part prices are subjected to change without notice.

The above estimated cost of repair do not include any unforeseen damages.

GST Amount is calculated from individual line(s)

**KAH MOTOR CO. SDN. BHD.**

(A Member of the Oriental Holdings Berhad)

Service and Body Repair

Tel: +65 6841 3838

Website: www.honda.com.sg

For 24-hours Roadside Assistance, Call 98203838

QUOTATION

GST Reg No.: M200050223

Company Ref. No.: S60FC1380G

Customer : CHINA TAIPING INSURANCE
3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

Registration No : SFA7123G

Chassis No : MRHFC5650JT000812

Model : CIVIC 1.6 VTI YM2018

Owner's Name : LEE HWEE NGUAN

Ins Policy No. :

Date of Accident :

Document No. : SQT19000312

Date : 17. Jan 2019

Customer No. : WZC008

Svc Advisor : RUEBEN THOMAS

Engine No : R16B25500894

Date | Time : 17. Jan 2019 5:17:33 PM

Surveyor Name :

Survey Date :

Authorisation Date :

Page 1

Item	Description	Qty	Unit Price	Disc %	Amount	0% GST Amount	Amount Incl GST
SUPPLEMENTARY PARTS & LABOUR							
BO-NUM-COMP-L	NUMBER PLATE WITH CASING-L(N) <i>Missing</i>	1	80.00		80.00	5.60	85.60
71121-TEA-T01	BASE,FR.GRILLE CHROME <i>Smashed</i>	1	73.80	25	55.35	3.87	59.22
71124-TEA-T01	EXTENSION ASSYR.FR.GRILLE <i>Smashed</i>	1	85.60	25	64.20	4.49	68.69
71129-TEA-T01	EXTENSION ASSYL.FR.GRILLE <i>Smashed</i>	1	85.60	25	64.20	4.49	68.69
71125-TEA-T01	MOLDINGFR.GRILLE <i>Smashed</i>	1	100.40	25	75.30	5.27	80.57
74127-TEA-T00	COVERFR.BULKHEAD <i>Distorted</i>	1	18.20	25	13.65	0.96	14.61
74146-TEA-T00	RUBBERHOOD SEAL <i>Cut</i>	1	27.60	25	20.70	1.45	22.15
74175-SMA-000	CUSHIONHOOD <i>Cut</i>	2	5.00	25	7.50	0.53	8.03
75700-TBA-A00	EMBLEM	1	15.00	25	11.25	0.79	12.04
90301-ST0-003	NUTPUSH 3MM	2	2.10	25	3.15	0.22	3.37
91504-TBA-A01	CLIP,HOOD SEAL	6	0.50	25	2.25	0.16	2.41
91505-TM8-003	CLIP,BUMPER	20	2.30	25	34.50	2.42	36.92
74128-TED-Q00	LABEL, FR. BULKHEAD COVER	1	1.50	25	1.12	0.08	1.20
71101-TEA-T00ZZ	FACEFR.BUMPER <i>Distorted</i>	1	579.90	25	434.92	30.44	465.36
71102-TBA-A10	GRILLEFR.BUMPER LOWER	1	36.10	25	27.07	1.89	28.96
71103-TEA-T00	GARNISHR.FR.BUMPER SIDE	1	18.00	25	13.50	0.95	14.45
71108-TEA-T00	GARNISHL.FR.BUMPER SIDE	1	18.00	25	13.50	0.95	14.45
71130-TEA-T00	BEAM COMPFR.BUMPER	1	345.90	25	259.42	18.16	277.58
71140-TEA-T00	BEAMR.FR.BUMPER UPPER	1	26.70	25	20.02	1.40	21.42
71190-TEA-T00	BEAML.FR.BUMPER UPPER	1	26.70	25	20.02	1.40	21.42
71150-TEA-T00	BEAM COMPFR.BUMPER CENTER UPP	1	214.80	25	161.10	11.26	172.38
71193-TEA-T01	SPACERR.FR.BUMPER SIDE	1	10.40	25	7.80	0.55	8.35
71198-TEA-T01	SPACERL.FR.BUMPER SIDE	1	10.40	25	7.80	0.55	8.35
71201-TEA-T00	PLATER.FR.BUMPER SIDE INDUCTN	1	43.30	25	32.47	2.27	34.74
71206-TEA-T00	PLATEL.FR.BUMPER SIDE INDUCTN	1	44.00	25	33.00	2.31	35.31
71207-TEA-T00	EXTENSIONL.SIDE INDUCTN PLATE	1	44.00	25	33.00	2.31	35.31
19504-SBA-A00	HOSE BWATER LOWER <i>Damaged</i>	1	11.80	25	8.85	0.62	9.47
19511-RB0-004	CLIPWATER HOSE <i>REL</i>	2	4.30	25	6.45	0.45	6.90
16400-5FA-Z01	THROTTLE BODYELECTRONIC CTL <i>Damaged</i>	1	1065.10	25	798.82	55.92	854.74



KAH MOTOR CO. SDN. BHD.
(A Member of the Oriental Holdings Berhad)

Service and Body Repair

Tel: +65 6841 3838

Website: www.honda.com.sg

For 24-hours Roadside Assistance, Call 98203838

QUOTATION

GST Reg No.: M200050223

Company Ref. No.: S60FC1380G

Customer : CHINA TAIPING INSURANCE
3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909
Registration No : SFA7123G
Chassis No : MRHFC5650JT000812
Model : CIVIC 1.6 VTI YM2018
Owner's Name : LEE HWEE NGUAN
Ins Policy No. :
Date of Accident :

Document No. : SQT19000312
Date : 17. Jan 2019
Customer No. : WZC008
Svc Advisor : RUEBEN THOMAS
Engine No : R16B25500894
Date | Time : 17. Jan 2019 5:17:33 PM
Surveyor Name :
Survey Date :
Authorisation Date :

Page 2

Item	Description	Qty	Unit Price	Disc %	Amount	0% GST Amount	Amount incld GST
51320-TBA-A01	LINK COMPFR.STABILIZER <i>Cracked</i>	1	70.50	25	52.87	3.70	56.57
44306-TEA-T01	DRIVESHAFT ASSY.L. <i>Bt</i>	1	870.00	25	652.50	45.68	698.18
32600-TBA-A00	CABLE ASSYBATTERY EARTH <i>Cut</i>	1	14.50	25	10.87	0.76	11.63
80050-TG7-000	LABLE AIR CON <i>NEC</i>	1	0.80	25	0.60	0.04	0.64
19043-5AA-E00	LABEL COOLANT INFORMATION <i>NEC</i>	1	10.00	25	7.50	0.53	8.03
31521-TEA-T00	BOXBATTERY <i>Def</i>	1	87.70	25	65.77	4.60	70.37
19422-R1A-A60	HOSEATF WARMER OUT <i>damaged</i>	1	4.60	25	3.45	0.24	3.69
19421-R1A-A60	HOSEATF WARMER IN <i>damaged</i>	1	4.20	25	3.15	0.22	3.37
91408-RWC-A01	CLIPWATER HOSE <i>NEC</i>	2	4.00	25	6.00	0.42	6.42
19121-5AA-A00	HOSE BEXPANSION TANK INLET <i>damaged</i>	1	4.50	25	3.37	0.24	3.61
60714-TEA-T10ZZ	MEMBER L FR WHEEL HOUSE UPP <i>Distorted</i>	1	76.80	25	57.60	4.03	61.63
19109-5BA-A00	HOSE BEXPANSION TANK OUTLET <i>damaged</i>	1	4.60	25	3.45	0.24	3.69
Sum Item					3178.04	222.48	3,400.52

Survey By

Date & Time

Excess

Status

Signature

Total Amount 3,178.04 222.48 3,400.52

Total (inclusive of GST) 3,400.52

Printed on 30/1/2019 6:25:16 PM

This is a computer generated invoice. No signature is required.

Part prices are subjected to change without notice.

The above estimated cost of repair do not include any unforeseen damages.

GST Amount is calculated from individual line(s)

30/1/2019.

PAGE 1/4



SERVICE PRE-INVOICE

KAH MOTOR CO. SDN. BHD.

(A Member of the Oriental Holdings Berhad)

ATTN: ADRIAN LING

GST Reg No.: M200050223

Company Ref. No.: S60FC1380G

370 Ubi Road 3 Singapore 408651, Tel: +65 6841 3883 Fax: +65 6741 5022

255 Alexandra Road Singapore 159937, Tel: +65 6471 5458 Fax: +65 6471 5480

WD: 21 DAYS

Customer: WZC008 / CHINA TAIPING
 Chassis No: MRHFC5650JT000812
 License No: SFA7123G
 Mileage: 6515
 Engine No: R16B25500894

Document No: SVO18077397
 Printed By: JESHURUEBEN
 Order Date: 27. December 2018
 Order Time: 3:14:48 PM
 Service Advisor: RUEBEN THOMAS

ITEM	DESCRIPTION	QTY	UNIT	DISC %	AMOUNT	7% GST Amount	Amount incld GST
	TP DIRECT SETTLEMENT (J/NO: 71906)						
	OWNER: LEE HWEE NGUAN						
	OWNER INSURER: TOKIO MARINE						
	ACC DATE: 20/12/2018						
	SURVEYED BY: ADRIAN LING						
	DATE: 24/12/18						
	REF NO: 20180002289						
	TP INSURER: CHINA TAIPING INSURANCE						
	TP VEH: SKN2475X						
71410-TEA-T01	BULKHEAD ASSYFR.	1	525.90	25	394.42	27.61	422.03
71430-TEA-T00	BRACEBULKHEAD LOWER	1	15.50	25	11.62	0.81	12.43
04605-TEA-T00ZZ	OUTRIGGER SETL.FR.SIDE	1	255.80	25	191.85	13.43	205.28
04684-TEA-T01ZZ	EXTENSION SETL.FR.SHOCK ABS	1	200.50	25	150.37	10.53	160.90
60630-TEA-T00	BASE COMPBATTERY SETTING	1	30.30	25	22.72	1.59	24.31
60723-TEA-T00ZZ	EXTENSIONL.FR.BULKHEAD	1	28.70	25	21.52	1.51	23.03
60724-TEA-T01	SEPARATORL.W/HOUSE UPPER MEMB	1	3.40	25	2.55	0.18	2.73
60750-TEA-305ZZ	HOUSING SETL.FR.SHOCK ABS	1	196.70	25	147.52	10.33	157.85
60911-TEA-305ZZ	FRAME SETL.FR.SIDE	1	203.60	25	152.70	10.69	163.39
60912-TEA-305ZZ	PLATE SETL.FR.SIDE BACK	1	124.30	25	93.22	6.53	99.75
60919-TEA-T00ZZ	FLANGEL.FR.BUMPER BEAM EXTENS	1	34.20	25	25.65	1.80	27.45
60921-TBA-A00ZZ	BRACKETL.FR.SUB FRAME FR.	1	32.60	25	24.45	1.71	26.16
60922-TEA-T00ZZ	PLATEL.FR.SIDE FRAME	1	31.10	25	23.32	1.63	24.95
60947-TEA-T00ZZ	SUPPORTL.FR.SIDE FRAME	1	31.10	25	23.32	1.63	24.95
76208-TEA-T02	MIRROR ASSY.R.	1	254.30	25	190.72	13.35	204.07
60211-TBA-A00ZZ	PANELR.FENDER	1	248.90	25	186.67	13.07	199.74
60213-TBA-A00ZZ	BRACKET AR.FR.FENDER	1	29.40	25	22.05	1.54	23.59
60261-TBA-A00ZZ	PANELL.FENDER	1	248.90	25	186.67	13.07	199.74
60263-TBA-A00ZZ	BRACKET AL.FR.FENDER	1	29.40	25	22.05	1.54	23.59
74105-TEA-T00	ENCLOSURER.FR.FENDER	1	8.90	25	6.67	0.47	7.14
74151-TEA-T00	FENDERL.FR INNER	1	51.10	25	38.32	2.68	41.00
74155-TEA-T00	ENCLOSUREL.FR.FENDER	1	8.90	25	6.67	0.47	7.14
91501-TR0-003	CLIP INNER FENDER	20	2.80	25	42.00	2.94	44.94
60100-TEA-T00ZZ	HOOD COMPENGINE	1	598.70	25	449.02	31.43	480.45
60120-TEA-T00ZZ	HINGE COMPR.HOOD	1	32.90	25	24.67	1.73	26.40
60170-TEA-T00ZZ	HINGE COMPL.HOOD	1	32.90	25	24.67	1.73	26.40
74120-TBA-A01	LOCK ASSYHOOD	1	67.90	25	50.92	3.58	54.50
74141-TEA-T00	INSULATORHOOD	1	77.00	25	57.75	4.04	61.79
74148-TBA-A00	SEALRUBBER INTAKE	1	19.20	25	14.40	1.01	15.41
74220-TEA-T00	COVERR.FR.FENDER	1	14.20	25	10.65	0.75	11.40
74270-TEA-T00	COVERL.FR.FENDER	1	14.20	25	10.65	0.75	11.40
73111-TEC-T41	GLASS SETFR.WINDSHIELD	1	1,814.90	25	1,361.17	95.28	1,456.45
73125-TEA-T01	MOLDINGFR.WINDSHIELD SIDE	2	2.40	25	3.60	0.25	3.85
73150-TEA-T01	MOLDINGFR.WINDSHIELD	1	38.80	25	29.10	2.04	31.14
73151-TEA-T01	MOLDINGFR.WINDSHIELD LOWER	1	31.70	25	23.77	1.66	25.43
76630-TEA-T02	BLADE WINDSHIELD WIPER	1	52.60	25	39.45	2.76	42.21
80100-TBA-A01	CONDENSER ASSY	1	704.40	25	528.30	36.98	565.28
80341-TEA-T11	PIPE COMPRECEIVER	1	27.10	25	20.32	1.42	21.74
80525-TBA-A01	SENSOR ASSYAMBIENT	1	40.10	25	30.07	2.10	32.17
91555-TBA-K01	CLIPAMBIENT SENSOR	1	5.40	25	4.05	0.28	4.33



SERVICE PRE-INVOICE

KAH MOTOR CO. SDN. BHD.

(A Member of the Oriental Holdings Berhad)

370 Ubi Road 3 Singapore 408651. Tel: +65 6841 3883 Fax: +65 6741 5022

255 Alexandra Road Singapore 159937. Tel: +65 6471 5458 Fax: +65 6471 5460

GST Reg No.: M200050223

Company Ref. No.: S60FC1380G

Customer: WZC008 / CHINA TAIPING
Chassis No: MRHFC5650JT000812
License No: SFA7123G
Mileage: 6515
Engine No: R16B25500894

Document No: SVO18077397
Printed By: JESHURUEBEN
Order Date: 27. December 2018
Order Time: 3:14:48 PM
Service Advisor: RUEBEN THOMAS

17201-SFE-M00	CASE SETAIR CLEANER	1	48.60	✓	25	36.45	2.55	39.00
17210-SFE-M00	COVER COMPAIR CLEANER	1	21.00	✓	25	15.75	1.10	16.85
17220-SBA-A00	ELEMENT ASSYAIR CLEANER	1	35.60	✓	25	26.70	1.87	28.57
17230-SFE-M00	CHAMBER ASSYRESONATOR	1	51.00	✓	25	38.25	2.68	40.93
19010-SFA-Z01	RADIATOR COMP	1	1,100.50	✓	25	825.37	57.78	883.15
19015-SBA-A01	SHROUD COMP	1	120.70	✓	25	90.52	6.34	96.86
19019-SBA-A01	PROTECTORFAN MOTOR HEAT	1	17.60	✓	25	13.20	0.92	14.12
19020-SBA-A01	FAN COMPCOOLING	1	66.40	✓	25	49.80	3.49	53.29
19030-SBA-A01	MOTORCOOLING FAN	1	686.40	✓	25	514.80	36.04	550.84
19501-SFA-Z00	HOSEWATER UPPER	1	10.50	✓	25	7.87	0.55	8.42
50200-TEA-T02	SUB FRAMEFR.	1	1,285.50	✓	25	964.12	67.49	1,031.61
90179-SDA-A00	BOLT FLANGE 14 X 90	2	6.80	✓	25	10.20	0.71	10.91
74110-TEA-T00	COVER ASSY,ENGINE UNDER	1	213.20	✓	25	159.90	11.19	171.09
74113-TEA-T00	LID,ENGINE UNDER COVER	1	12.80	✓	25	9.60	0.67	10.27
38256-TEA-Z01	COVERRELAY BOX UPPER	1	19.40	✓	25	14.55	1.02	15.57
32130-TEA-T00	HARNESSFR.END WIRE	1	67.50	✓	25	50.62	3.54	54.16
33100-TEC-306	HEADLIGHT ASSY,R.	1	585.70	✓	25	439.27	30.75	470.02
33150-TEC-306	HEADLIGHT ASSY,L.	1	585.70	✓	25	439.27	30.75	470.02
37823-RB0-000	COVERCONTROL MODULE	1	12.90	✓	25	9.67	0.68	10.35
77930-TEA-B11	SENSOR ASSYFR.CRASH	1	71.40	✓	25	53.55	3.75	57.30
77930-TEA-B21	SENSOR ASSYFR.CRASH	1	71.40	✓	25	53.55	3.75	57.30
77960-TEA-Z42	SRS UNIT	1	815.00	✓	25	611.25	42.79	654.04
77100-TEA-T00ZA	PANEL COMPINSTRUMENT	1	696.20	✓	25	522.15	36.55	558.70
77820-TEA-H80	MODULE ASSYPASSENGER	1	1,827.00	✓	25	1,370.25	95.92	1,466.17
81450-TEA-Q01ZA	TONGUE ASSYR.FR.SEATBELT	1	429.30	✓	25	321.97	22.54	344.51
81850-TEA-Q01ZA	TONGUE ASSYL.FR.SEATBELT OUT	1	429.30	✓	25	321.97	22.54	344.51
77810-TEA-T80ZA	MODULE ASSYDRIVER	1	1,827.00	✓	25	1,370.25	95.92	1,466.17
18181-R1A-A00	COVERCONVERTER	1	48.00	✓	25	36.00	2.52	38.52
18717-RNA-A00	PIPEEGR.	1	108.40	✓	25	81.30	5.69	86.99
36531-R1A-A01	SENSORAIR FUEL RATIO	1	512.30	✓	25	384.22	26.90	411.12
36532-5M1-H11	SENSOROXYGEN	1	106.40	✓	25	79.80	5.59	85.39
18011-5M1-H00	VALVE SETEGR	1	295.30	✓	25	221.47	15.50	236.97
25560-R3W-003	WARMER COMP,CVTF	1	186.50	✓	25	139.87	9.79	149.66
08CLA-P9911LK8	COOLANT ANTI-FREEZE TYPE 2	3	23.20	✓	25	52.20	3.65	55.85
BO-WS-SEALANT	WINDSCREEN SEALANT (N)	2	60.00	✓		120.00	8.40	128.40
BO-NUM-COMP-L	NUMBER PLATE WITH CASING-L(N) (S) Missing		80.00	✓		80.00	5.60	85.60
60714-TEA-T10ZZ	MEMBER L FR WHEEL HOUSE UPP (S) Distorted		76.80	✓	25	57.60	4.03	61.63
37821-SFA-Z10	BRCKET COMPP/TRAIN CTL MODULE	1	23.50	✓	25	17.62	1.23	18.85
71121-TEA-T01	BASE,FR.GRILLE CHROME (S) } Smashed	1	73.80	✓	25	55.35	3.87	59.22
71124-TEA-T01	EXTENSION ASSYR.FR.GRILLE (S) } Smashed	1	85.60	✓	25	64.20	4.49	68.69
71125-TEA-T01	MOLDINGFR.GRILLE (S) } Smashed	1	100.40	✓	25	75.30	5.27	80.57
71129-TEA-T01	EXTENSION ASSYLFR.GRILLE (S) } Smashed	1	85.60	✓	25	64.20	4.49	68.69
74127-TEA-T00	COVERFR.BULKHEAD (S) Distorted	1	18.20	✓	25	13.65	0.96	14.61
74146-TEA-T00	RUBBERHOOD SEAL (S) cut	1	27.60	✓	25	20.70	1.45	22.15
74175-SMA-000	CUSHIONHOOD (S) Distorted	2	5.00	✓	25	7.50	0.53	8.03
75700-TBA-A00	EMBLEM (S) } new	1	15.00	✓	25	11.25	0.79	12.04
90301-ST0-003	NUTPUSH 3MM (S) } new	2	2.10	✓	25	3.15	0.22	3.37
91504-TBA-A01	CLIP,HOOD SEAL (S) } new	8	0.50	✓	25	2.25	0.16	2.41
91505-TM8-003	CLIP,BUMPER (S) } new	20	2.30	✓	25	34.50	2.42	36.92
74128-TED-Q00	LABEL, FR. BULKHEAD COVER (S) new	1	1.50	✓	25	1.12	0.08	1.20
71101-TEA-T00ZZ	FACEFR.BUMPER (S) Distorted	1	579.90	✓	25	434.92	30.44	465.36

**KAH MOTOR CO. SDN. BHD.**

(A Member of the Oriental Holdings Berhad)

370 Ubi Road 3 Singapore 408651, Tel: +65 6841 3883 Fax: +65 6741 5022

255 Alexandra Road Singapore 159637, Tel: +65 6471 5458 Fax: +65 6471 5460

SERVICE PRE-INVOICE

GST Reg No.: M200050223

Company Ref. No.: S60FC1380G

Customer: WZC008 / CHINA TAIPING
 Chassis No: MRHFC5650JT000812
 License No: SFA7123G
 Mileage: 6515
 Engine No: R16B25500894

Document No: SVO18077397
 Printed By: JESHURUEBEN
 Order Date: 27. December 2018
 Order Time: 3:14:48 PM
 Service Advisor: RUEBEN THOMAS

71102-TBA-A10	GRILLEFR.BUMPER LOWER (S) } distorted	1	36.10	✓	25	27.07	1.89	28.96
71103-TEA-T00	GARNISHR.FR.BUMPER SIDE (S) }	1	18.00	✓	25	13.50	0.95	14.45
71108-TEA-T00	GARNISHL.FR.BUMPER SIDE (S) }	1	18.00	✓	25	13.50	0.95	14.45
71130-TEA-T00	BEAM COMPFR.BUMPER (S) Bent	1	345.90	✓	25	259.42	18.16	277.58
71140-TEA-T00	BEAMR.FR.BUMPER UPPER (S) Bent	1	26.70	✓	25	20.02	1.40	21.42
71190-TEA-T00	BEAML.FR.BUMPER UPPER (S) Bent	1	26.70	✓	25	20.02	1.40	21.42
71150-TEA-T00	BEAM COMPFR.BUMPER CENTER UPP (S) Bent	1	214.80	✓	25	161.10	11.28	172.38
71193-TEA-T01	SPACERR.FR.BUMPER SIDE (S) Bent	1	10.40	✓	25	7.80	0.55	8.35
71198-TEA-T01	SPACERL.FR.BUMPER SIDE (S) Bent	1	10.40	✓	25	7.80	0.55	8.35
71201-TEA-T00	PLATER.FR.BUMPER SIDE INDUCTN (S) Bent	1	43.30	✓	25	32.47	2.27	34.74
71206-TEA-T00	PLATEL.FR.BUMPER SIDE INDUCTN (S) Bent	1	44.00	✓	25	33.00	2.31	35.31
71207-TEA-T00	EXTENSIONL.SIDE INDUCTN PLATE (S) Bent	1	44.00	✓	25	33.00	2.31	35.31
19504-SBA-A00	HOSE BWATER LOWER (S) Damaged	1	11.80	✓	25	8.85	0.62	9.47
19511-RB0-004	CLIPWATER HOSE (S) new	2	4.30	✓	25	8.45	0.45	6.90
16400-SFA-Z01	THROTTLE BODYELECTRONIC CTL (S) Damaged	1	1,055.10	✓	25	798.82	55.92	854.74
51320-TBA-A01	LINK COMPFR.STABILIZER (S) Bent	1	70.50	✓	25	52.87	3.70	56.57
44306-TEA-T01	DRIVESHAFT ASSY.L (S) Bent	1	870.00	✓	25	652.50	45.68	698.18
32600-TBA-A00	CABLE ASSYBATTERY EARTH (S) Bent	1	14.50	✓	25	10.87	0.76	11.63
80315-TEA-T01	HOSE COMPDISCHARGE	1	159.80	✓	25	119.85	8.39	128.24
50820-TEA-T02	MOUNTING ENGINE SIDE	1	162.10	✓	25	121.57	6.51	130.08
50850-TBA-A81	MOUNTINGTRANSMISSION	1	135.20	✓	25	101.40	7.10	108.50
80050-TG7-000	LABLE AIR CON (S) new	1	0.80	✓	25	0.60	0.04	0.64
19043-SAA-E00	LABEL COOLANT INFORMATION (S) new	1	10.00	✓	25	7.50	0.53	8.03
80312-TEA-T11	HOSE COMPSUCTION	1	88.20	✓	25	66.15	4.63	70.78
74131-TEA-T01	WIRE ASSYFR.HOOD	1	18.90	✓	25	14.17	0.99	15.16
31521-TEA-T00	BOXBATTERY (S) Bent	1	87.70	✓	25	65.77	4.60	70.37
32200-TEC-S02	ENGINE ROOM WIRE HARNESS	1	927.80	✓	25	695.85	48.71	744.56
19422-R1A-A60	HOSEATF WARMER OUT (S) Bent	1	4.60	✓	25	3.45	0.24	3.69
19421-R1A-A60	HOSEATF WARMER IN (S) Bent	1	4.20	✓	25	3.15	0.22	3.37
91408-RWC-A01	CLIPWATER HOSE (S) new	2	4.00	✓	25	5.00	0.42	6.42
19109-SBA-A00	HOSE BEXPANSION TANK OUTLET (S) Bent	1	4.60	✓	25	3.45	0.24	3.69
19502-SFA-Z00	HOSE AWATER LOWER	1	12.90	✓	25	9.67	0.68	10.35
19121-SAA-A00	HOSE BEXPANSION TANK INLET (S) Bent	1	4.50	✓	25	3.37	0.24	3.61
SUM PARTS:			18,464.64			1,292.57		19,757.21
BOSUN	0760	1	20.00			20.00	1.40	21.40
	SUNDRIES							
BOMISC1	RESET VEHICLE SMART ENTRY SYSTEM (N)	1	280.00			280.00	19.60	299.60
BMS00R	RENEW BOTH DRIVER & PASSENGER AIRBAG ASSY ECU & RESET SRS SYSTEM.(N)	1	450.00			450.00	31.50	481.50
BMI00D	REMOVE & INSTALL DASHBOARD EVAPORATOR UNIT AUDIO WIRING HARNESS & ETC.(N)	1	1,000.00			1,000.00	70.00	1,070.00
BME00D	REMOVE & INSTALL ENGINE ASSY GEARBOX & OTHERS ATTACHMENT PARTS.(N)	1	1,000.00			1,000.00	70.00	1,070.00

**KAH MOTOR CO. SDN. BHD.**

(A Member of the Oriental Holdings Berhad)

370 Ubi Road 3 Singapore 408651. Tel: +65 6841 3883 Fax: +65 6741 5022

255 Alexandra Road Singapore 159937. Tel: +65 6471 5458 Fax: +65 6471 5460

**SERVICE PRE-INVOICE**

GST Reg No.: M200050223

Company Ref. No.: S60FC1380G

Customer: WZC008 / CHINA TAIPING
 Chassis No: MRHFC5650JT000812
 License No: SFA7123G
 Mileage: 6515
 Engine No: R16B25500894

Document No: SVO18077397
 Printed By: JESHURUEBEN
 Order Date: 27. December 2018
 Order Time: 3:14:48 PM
 Service Advisor: RUEBEN THOMAS

BMB01D	REMOVE & INSPECT ABS MODULAR BLEED BRAKE SYSTEM & RESET ABS SYSTEM.(N)	1	300.00	300.00	21.00	321.00
BMA01D	REMOVE & INSTALL A/C CONDENSER WITH FITTINGS. VACUUM & RECHARGE A/C GAS.(N)	1	280.00	280.00	19.60	299.60
BMC01D	REMOVE & INSTALL RADIATOR WITH FITTINGS. PRESSURE TEST COOLING SYSTEM.(N)	1	230.00	230.00	16.10	246.10
BG01R	EXT-YJ REPLACE FR. WINDSCREEN.(N)	1	300.00	300.00	21.00	321.00
BKOT00A	PLACE VEHICLE TO BENCH FOR CHASSIS FRAME ALIGNMENT	1	1,000.00	1,000.00	70.00	1,070.00
BML01I	INSPECT FR LIGHTING MECHANISMS & FOCUS HEADLIGHTS.(N)	1	100.00	100.00	7.00	107.00
BOJSE	0760 BODY JOINT SEALANT.	1	200.00	200.00	14.00	214.00
BOBC	BODY UNDERSIDE COATING (N)	1	100.00	100.00	7.00	107.00
BP00R	APPLY BODY UNDERSIDE COATING (N). EXT-YJ	1	180.00	180.00	12.60	192.60
BKBH11B	CUT OFF & RENEW BULKHEAD FR L HOUSING COMP. STRAIGHTEN ALIGN FR L FRAME & RENEW DAMAGE PARTS. EXT-YBH	1	4,200.00	4,200.00	294.00	4,494.00
BP06R	SPRAY PAINTING ON REPAIRED OR REPLACED AREAS. (8P)	1	2,700.00	2,700.00	189.00	2,889.00
			SUM LABOUR:	12,340.00	863.80	13,203.80
BO-R-COOL-FWS	SUPPLY & INSTALL SOLAR FILM ON FRONT WINDSCREEN.	1	300.00	300.00	21.00	321.00
TOW-SPEEDWAY	TOWING SERVICE	1	150.00	150.00	10.50	160.50
BO-WHEEL ALIGN X4	WHEEL ALIGNMENT X4	1	180.00	180.00	12.60	192.60
			SUM EXT SERVICE:	630.00	44.10	674.10
			TOTAL SGD	31,434.64	2,200.47	33,635.11
			Total Payable (SGD)			33,635.11

GST Amount is calculated from individual line(s)

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	24 Dec 2018		25 Apr 2019 16:20 Edit Adj Rpt	S\$31,434.64 Edit Estimates	S\$31,434.64 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All
------	-----------	---------------	-----------	----------

CLAIM SUBFOLDER DETAILS		[Created by insurer]
Insured:	-, Co. Reg. No.: -	
Main Claimant:	LEE HWEE NGUAN, ID: 51638281G	
Vehicle Reg. No.:	SFA7123G	Date of Loss: 20/12/2018 21:00 - :59 [6 Months and 16 Days From LTA Reg Date (Man Yr)]
Claim Type:	TP / SNM19D200899C02	Policy/Cover Note No.: DMPCSN3017441800
Vehicle Reg. No. (Insured):	SKN2475X	Policy No. (Claimant): 18-MT102868-R00
		Excess: S\$2,000.00
Repairer:	Kah Motor Co Sdn Bhd (Ubi) 15 Ubi Road 4, 408610 Ubi - Tel: 68465671	
Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd. (HQ) - Tel: 6389 6111 ... [Handled by Elaine Cheong]	
Claimant's Insurer:	Tokio Marine Insurance Singapore Ltd (HQ) - Tel: 6221 6111	
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by ADRIAN LING] ... [Final Rpt due 07/05/2019]	

ASSOCIATED MAIL RECEIVED	View All	Compose Case Mail
There are no mail for this case.		

ALL ASSOCIATED TASKS										View All	Search Tasks	Create New Task	Complete
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?				
No results.													

Claim Documents

*SFA7123G (SNM19D200899C02)
[SKN2475X]
TP
LEE HWEE NGUAN
Dec 20 2018 9:00PM
[-]
Kah Motor Co Sdn Bhd

Upload Documents

Upload Photos

Compose New Letter

View

View in Browser

Video

1 per page

No	Finalized On	Kah Motor Co Sdn Bhd (Ubl)		Thumbnail	Print
1	21/12/18 18:06	Video - Accident [Linked Accident Report Documents]	1	Load MP4	

Assessment Reports

1 per page

No	Finalized On	Kah Motor Co Sdn Bhd (Ubl)		Thumbnail	Print
1	21/12/18 18:06	Accident Statement	1	Load HTM	

Photos/Images

3 per page

No	Finalized On	Kah Motor Co Sdn Bhd (Ubl)		Thumbnail	Print
1	21/12/18 18:06	Accident Photo [Linked Accident Report Documents]	1	Load JPG	
2	21/12/18 18:06	Accident Photo [Linked Accident Report Documents]	1	Load JPG	
3	21/12/18 18:06	Accident Photo [Linked Accident Report Documents]	1	Load JPG	
4	21/12/18 18:06	Accident Photo [Linked Accident Report Documents]	1	Load JPG	
5	21/12/18 18:06	Accident Photo [Linked Accident Report Documents]	1	Load JPG	
6	21/12/18 18:06	Accident Photo [Linked Accident Report Documents]	1	Load JPG	
7	21/12/18 18:06	Accident Photo [Linked Accident Report Documents]	1	Load JPG	
8	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print
1	26/04/19 09:48	General View	1	Load JPG	
2	26/04/19 09:48	General View	1	Load JPG	
3	26/04/19 09:48	General View	1	Load JPG	
4	26/04/19 09:48	General View	1	Load JPG	
5	26/04/19 09:48	General View	1	Load JPG	
6	26/04/19 09:48	General View	1	Load JPG	
7	26/04/19 09:48	General View	1	Load JPG	
8	26/04/19 09:48	General View	1	Load JPG	
9	26/04/19 09:48	General View	1	Load JPG	
10	26/04/19 09:48	General View	1	Load JPG	
11	26/04/19 09:48	General View	1	Load JPG	
12	26/04/19 09:48	General View	1	Load JPG	
13	26/04/19 09:48	General View	1	Load JPG	
14	26/04/19 09:48	General View	1	Load JPG	
15	26/04/19 09:48	General View	1	Load JPG	
16	26/04/19 09:48	General View	1	Load JPG	
17	26/04/19 09:48	General View	1	Load JPG	
18	26/04/19 09:48	General View	1	Load JPG	
19	26/04/19 09:48	General View	1	Load JPG	
20	26/04/19 09:48	General View	1	Load JPG	

Video			1 per page	☒
No	Finalized On	Kah Motor Co Sdn Bhd (Ubl)	Thumbnail	Print
				☒
21	26/04/19 09:48	General View		☒
22	26/04/19 09:48	General View		☒
23	26/04/19 09:48	General View		☒
24	26/04/19 09:48	General View		☒
25	26/04/19 09:48	General View		☒
26	26/04/19 09:48	General View		☒
27	26/04/19 09:48	General View		☒
28	26/04/19 09:48	General View		☒
29	26/04/19 09:48	General View		☒
30	26/04/19 09:48	General View		☒
31	26/04/19 09:48	General View		☒
32	26/04/19 09:48	General View		☒
33	26/04/19 09:48	General View		☒
34	26/04/19 09:48	General View		☒
35	26/04/19 09:48	General View		☒
36	26/04/19 09:48	General View		☒
37	26/04/19 09:48	General View		☒
38	26/04/19 09:48	General View		☒
39	26/04/19 09:48	General View		☒
40	26/04/19 09:48	General View		☒
41	26/04/19 09:48	General View		☒
42	26/04/19 09:48	General View		☒
43	26/04/19 09:48	General View		☒
44	26/04/19 09:48	General View		☒
45	26/04/19 09:48	General View		☒
46	26/04/19 09:48	General View		☒
47	26/04/19 09:48	General View		☒
48	26/04/19 09:48	General View		☒
49	26/04/19 09:48	General View		☒
50	26/04/19 09:48	General View		☒
51	26/04/19 09:48	General View		☒
52	26/04/19 09:48	General View		☒
53	26/04/19 09:48	General View		☒
54	26/04/19 09:48	General View		☒
55	26/04/19 09:48	General View		☒
56	26/04/19 09:48	General View		☒
57	26/04/19 09:48	General View		☒
58	26/04/19 09:48	General View		☒
59	26/04/19 09:48	General View		☒
60	26/04/19 09:48	General View		☒
61	26/04/19 09:48	General View		☒
62	26/04/19 09:48	General View		☒
63	26/04/19 09:48	General View		☒
64	26/04/19 09:48	General View		☒
65	26/04/19 09:48	General View		☒
66	26/04/19 09:48	General View		☒
67	26/04/19 09:48	General View		☒
68	26/04/19 09:48	General View		☒
69	26/04/19 09:48	General View		☒

Video			1 per page	☒
No	Finalized On	Kah Motor Co Sdn Bhd (Ubi)	Thumbnail	Print
70	26/04/19 09:48	General View	 Load JPG	☒
71	26/04/19 09:48	General View	 Load JPG	☒
72	26/04/19 09:48	General View	 Load JPG	☒
73	26/04/19 09:48	General View	 Load JPG	☒
74	26/04/19 09:48	General View	 Load JPG	☒
75	26/04/19 09:48	General View	 Load JPG	☒
76	26/04/19 09:48	General View	 Load JPG	☒
77	26/04/19 09:48	General View	 Load JPG	☒
78	26/04/19 09:48	General View	 Load JPG	☒
79	26/04/19 09:48	General View	 Load JPG	☒
80	26/04/19 09:48	General View	 Load JPG	☒
81	26/04/19 09:48	General View	 Load JPG	☒
82	26/04/19 09:48	General View	 Load JPG	☒
83	26/04/19 09:48	General View	 Load JPG	☒
84	26/04/19 09:48	General View	 Load JPG	☒
85	26/04/19 09:48	General View	 Load JPG	☒
86	26/04/19 09:48	General View	 Load JPG	☒
87	26/04/19 09:48	General View	 Load JPG	☒
88	26/04/19 09:48	General View	 Load JPG	☒
89	26/04/19 09:48	General View	 Load JPG	☒
90	26/04/19 09:48	General View	 Load JPG	☒
91	26/04/19 09:48	General View	 Load JPG	☒
92	26/04/19 09:48	General View	 Load JPG	☒
93	26/04/19 09:48	General View	 Load JPG	☒
94	26/04/19 09:48	General View	 Load JPG	☒
95	26/04/19 09:48	General View	 Load JPG	☒
96	26/04/19 09:48	General View	 Load JPG	☒
97	26/04/19 09:48	General View	 Load JPG	☒
98	26/04/19 09:48	General View	 Load JPG	☒
99	26/04/19 09:48	General View	 Load JPG	☒
100	26/04/19 09:48	General View	 Load JPG	☒
101	26/04/19 09:48	General View	 Load JPG	☒
102	26/04/19 09:48	General View	 Load JPG	☒
103	26/04/19 09:48	General View	 Load JPG	☒
104	26/04/19 09:48	General View	 Load JPG	☒
105	26/04/19 09:48	General View	 Load JPG	☒
106	26/04/19 09:48	General View	 Load JPG	☒
107	26/04/19 09:48	General View	 Load JPG	☒
108	26/04/19 09:48	General View	 Load JPG	☒
109	26/04/19 09:48	General View	 Load JPG	☒
110	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
111	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
112	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
113	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
114	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
115	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
116	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
117	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
118	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
119	26/04/19 09:49	Reinspection Photo	 Load JPG	☒

Video			1 per page	☒
No	Finalized On	Kah Motor Co Sdn Bhd (Ubl)	Thumbnail	Print
120	26/04/19 09:49	Reinspection Photo		☒
121	26/04/19 09:49	Reinspection Photo		☒
122	26/04/19 09:49	Reinspection Photo		☒
123	26/04/19 09:49	Reinspection Photo		☒
124	26/04/19 09:49	Reinspection Photo		☒
125	26/04/19 09:49	Reinspection Photo		☒
126	26/04/19 09:49	Reinspection Photo		☒
127	26/04/19 09:49	Reinspection Photo		☒
128	26/04/19 09:49	Reinspection Photo		☒
129	26/04/19 09:49	Reinspection Photo		☒
130	26/04/19 09:49	Reinspection Photo		☒
131	26/04/19 09:49	Reinspection Photo		☒
132	26/04/19 09:49	Reinspection Photo		☒
133	26/04/19 09:49	Reinspection Photo		☒
134	26/04/19 09:49	Reinspection Photo		☒
135	26/04/19 09:49	Reinspection Photo		☒
136	26/04/19 09:49	Reinspection Photo		☒
137	26/04/19 09:49	Reinspection Photo		☒
138	26/04/19 09:49	Reinspection Photo		☒
139	26/04/19 09:49	Reinspection Photo		☒
140	26/04/19 09:49	Reinspection Photo		☒
141	26/04/19 09:49	Reinspection Photo		☒
142	26/04/19 09:49	Reinspection Photo		☒
143	26/04/19 09:49	Reinspection Photo		☒
144	26/04/19 09:49	Reinspection Photo		☒
145	26/04/19 09:49	Reinspection Photo		☒
146	26/04/19 09:49	Reinspection Photo		☒
147	26/04/19 09:49	Reinspection Photo		☒
148	26/04/19 09:49	Reinspection Photo		☒
149	26/04/19 09:49	Reinspection Photo		☒
150	26/04/19 09:49	Reinspection Photo		☒
151	26/04/19 09:49	Reinspection Photo		☒
152	26/04/19 09:49	Reinspection Photo		☒
153	26/04/19 09:49	Reinspection Photo		☒
154	26/04/19 09:49	Reinspection Photo		☒
155	26/04/19 09:49	Reinspection Photo		☒
156	26/04/19 09:49	Reinspection Photo		☒
157	26/04/19 09:49	Reinspection Photo		☒
158	26/04/19 09:49	Reinspection Photo		☒
159	26/04/19 09:49	Reinspection Photo		☒
160	26/04/19 09:49	Reinspection Photo		☒
161	26/04/19 09:49	Reinspection Photo		☒
162	26/04/19 09:49	Reinspection Photo		☒
163	26/04/19 09:49	Reinspection Photo		☒
164	26/04/19 09:49	Reinspection Photo		☒
165	26/04/19 09:49	Reinspection Photo		☒
166	26/04/19 09:49	Reinspection Photo		☒
167	26/04/19 09:49	Reinspection Photo		☒
168	26/04/19 09:49	Reinspection Photo		☒
169	26/04/19 09:49	Reinspection Photo		☒

Video			1 per page	☒
No	Finalized On	Kah Motor Co Sdn Bhd (Ubi)	Thumbnail	Print
170	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
171	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
172	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
173	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
174	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
175	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
176	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
177	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
178	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
179	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
180	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
181	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
182	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
183	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
184	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
185	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
186	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
187	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
188	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
189	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
190	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
191	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
192	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
193	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
194	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
195	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
196	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
197	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
198	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
199	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
200	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
201	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
202	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
203	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
204	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
205	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
206	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
207	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
208	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
209	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
210	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
211	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
212	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
213	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
214	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
215	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
216	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
217	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
218	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
219	26/04/19 09:49	Reinspection Photo	 Load JPG	☒

Video			1 per page	☒
No	Finalized On	Kah Motor Co Sdn Bhd (Ubi)	Thumbnail	Print
220	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
221	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
222	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
223	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
224	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
225	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
226	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
227	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
228	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
229	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
230	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
231	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
232	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
233	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
234	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
235	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
236	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
237	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
238	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
239	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
240	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
241	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
242	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
243	26/04/19 09:49	Reinspection Photo	 Load JPG	☒
244	26/04/19 09:50	Reinspection Photo	 Load JPG	☒
245	26/04/19 09:50	Reinspection Photo	 Load JPG	☒
246	26/04/19 09:50	Reinspection Photo	 Load JPG	☒
247	26/04/19 09:50	Reinspection Photo	 Load JPG	☒
248	26/04/19 09:50	Reinspection Photo	 Load JPG	☒
249	26/04/19 09:50	Reinspection Photo	 Load JPG	☒
250	26/04/19 09:50	Reinspection Photo	 Load JPG	☒
251	26/04/19 09:50	Reinspection Photo	 Load JPG	☒
252	26/04/19 09:50	Reinspection Photo	 Load JPG	☒
253	26/04/19 09:50	Reinspection Photo	 Load JPG	☒
Documentation			1 per page	☒
No	Finalized On	China Taiping Insurance (Singapore) Pte. Ltd. (HQ)	Thumbnail	Print
1	25/04/19 16:22	PRS - SFA7123G	 Load PDF	
No	Finalized On	Kah Motor Co Sdn Bhd (Ubi)	Thumbnail	Print
1	21/12/18 18:05	Sketch Plan (Linked Accident Report Documents)	 Load TIF	
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	29/04/19 12:03	Supplementary	 Load PDF	

Linked Accident Report Documents

Video			1 per page	☒
No	Finalized On	Kah Motor Co Sdn Bhd (Ubi)	Thumbnail	Print
1	21/12/18 18:06	Video - Accident	 Load MP4	
Assessment Reports			1 per page	☒

Video				1 per page	☒
No	Finalized On	Kah Motor Co Sdn Bhd (Ubl)		Thumbnail	Print
No	Finalized On	Kah Motor Co Sdn Bhd (Ubl)		Thumbnail	Print
1	21/12/18 18:06	Accident Statement		Load HTM	
Photos/Images				3 per page	☒
No	Finalized On	Kah Motor Co Sdn Bhd (Ubl)		Thumbnail	Print
1	21/12/18 18:06	Accident Photo		Load JPG	☒
2	21/12/18 18:06	Accident Photo		Load JPG	☒
3	21/12/18 18:06	Accident Photo		Load JPG	☒
4	21/12/18 18:06	Accident Photo		Load JPG	☒
5	21/12/18 18:06	Accident Photo		Load JPG	☒
6	21/12/18 18:06	Accident Photo		Load JPG	☒
7	21/12/18 18:06	Accident Photo		Load JPG	☒
Documentation				1 per page	☒
No	Finalized On	Kah Motor Co Sdn Bhd (Ubl)		Thumbnail	Print
1	21/12/18 18:05	Sketch Plan		Load TIF	

Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			
Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)			
Show Remarks To: ☐ Handling Insurer Note: Remarks are private unless you show it to other parties.			

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/CT118022988/ASD3E2

Date: 29/04/2019

REFERENCE

Handling Insurer: China Taiping Insurance (Singapore) Pte. Ltd. Policy No: DMPCSN3017441800

Claimant Vehicle No: SFA7123G Insured Vehicle No: SKN2475X

Date of Loss: 20/12/2018 Nature of Claim: TP Claim No: SNM19D200899C02

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: SFA7123G

Make & Model: HONDA CIVIC, 1.6 VTI CVT (A) Engine No: R16B25500894

Reg. Date: 04/06/2018 (Man. Year: 2018) Chassis No: MRHFC5650JT000812

Colour: Grey Odometer: 6510 km

Engine Capacity: 1597 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition: Yes

CONDITION OF TYRES

Front Tyre Size: 215/55 R16 Rear Tyre Size: 215/55 R16

Front Left Side: Hankook 6 mm Rear Left Side: Hankook 6 mm

Front Right Side: Hankook 6 mm Rear Right Side: Hankook 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	20,360.10	18,784.64	1,575.46	7.74
Miscellaneous Items	0.00	0.00	0.00	
Labour	15,310.00	12,650.00	2,660.00	17.37
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	35,670.10	31,434.64	4,235.46	11.87
+ GST 7.00/7.00% (S\$)	2,496.91	2,200.42	296.49	11.87
Nett Amount (S\$)	38,167.01	33,635.06	4,531.95	11.87

INSPECTION

Date of Assignment: 25/04/2019

Date Inspected: 24/12/2018 Inspected At: Kah Motor Co Sdn Bhd (Ubi)
15 Ubi Road 4
Singapore 408610

Estimated Period of Repair: 21.0 days

Adjuster: ADRIAN LING

Manager: Hiew May Fung

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 29 Apr 2019)
Parts:	143	HONDA CIVIC 1.6 VTI CVT (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SFA7123G)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*BULKHEAD ASSYFR.	Distorted	394.42 FS	*394.42 FS
2	1		*BRACEBULKHDEAD LOWER	Distorted	11.62 FS	*11.62 FS
3	1		*OUTRIGGER SETL.FR.SIDE	Distorted	191.85 FS	*191.85 FS
4	1		*EXTENSION SETL.FR.SHOCK ABS	Distorted	150.37 FS	*150.37 FS
5	1		*BASE COMPBATTERY SETTING	Distorted	22.72 FS	*22.72 FS
6	1		*EXTENSIONL.FR.BULKHEAD	Distorted	21.52 FS	*21.52 FS
7	1		*SEPARATORL.W/HOUSE UPPER MEMB	Distorted	2.55 FS	*2.55 FS
8	1		*HOUSING SETL.FR.SHOCK ABS	Distorted	147.52 FS	*147.52 FS
9	1		*FRAME SETL.FR.SIDE	Distorted	152.70 FS	*152.70 FS
10	1		*FLANGEL.FR.BUMPER BEAM EXTENS	Distorted	25.65 FS	*25.65 FS
11	1		*BRACKETL.FR.SUB FRAME FR.	Distorted	24.45 FS	*24.45 FS
12	1		*PLATEL.FR.SIDE FRAME	Distorted	23.32 FS	*23.32 FS
13	1		*SUPPORTL.FR.SIDE FRAME	Distorted	23.32 FS	*23.32 FS
14	1		*MIRROR ASSY,R.	Cut	190.72 FS	*190.72 FS
15	1		*PANELR.FENDER	Buckled	186.67 FS	*186.67 FS
16	1		*BRACKET AR.FR.FENDER	Bent	22.05 FS	*22.05 FS
17	1		*PANELL.FENDER	Distorted	186.67 FS	*186.67 FS
18	1		*BRACKET AL.FR.FENDER	Distorted	22.05 FS	*22.05 FS
19	1		*ENCLOSURER.FR.FENDER	Distorted	6.67 FS	*6.67 FS
20	1		*FENDERL.FR INNER	Torn	38.32 FS	*38.32 FS
21	1		*ENCLOSUREL.FR.FENDER	Distorted	6.67 FS	*6.67 FS
22	20		*CLIP, INNER FENDER	Necessary	42.00 FS	*42.00 FS
23	1		*HOOD COMPENGINE	Distorted	449.02 FS	*449.02 FS
24	1		*HINGE COMPR.HOOD	Bent	24.67 FS	*24.67 FS
25	1		*HINGE COMPL. HOOD	Bent	24.67 FS	*24.67 FS
26	1		*LOCK ASSYHOOD	Damaged	65.92 FS	*65.92 FS
27	1		*WIRE ASSYFR.HOOD	Damaged	14.17 FS	*14.17 FS
28	1		*INSULATORHOOD	Crumpled	57.75 FS	*57.75 FS
29	1		*SEALRUBBER INTAKE	Cut	14.40 FS	*14.40 FS
30	1		*COVERL.FR.FENDER	Damaged	10.65 FS	*10.65 FS
31	1		*GLASS SETFR.WINDSHIELD	Shattered	1,361.17 FS	*1,361.17 FS
32	2		*MOLDINGFR.WINDSHIELD SIDE	Necessary	3.60 FS	*3.60 FS
33	1		*MOLDINGFR.WINDSHIELD	Necessary	29.10 FS	*29.10 FS
34	1		*MOLDINGFR.WINDSHIELD LOWER	Necessary	23.77 FS	*23.77 FS
35	1		*BLADE WINDSHIELD WIPER	Cut	39.45 FS	*39.45 FS
36	1		*CONDENSER ASSY	Distorted	528.30 FS	*528.30 FS
37	1		*HOSE COMPSUCTION	Bent	66.15 FS	*66.15 FS
38	1		*HOSE COMPDISCHARGE	Bent	119.85 FS	*119.85 FS
39	1		*PIPE COMPRECEIVER	Bent	20.32 FS	*20.32 FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
40	1		*SENSOR ASSYAMBIENT	Damaged	30.07 FS	*30.07 FS
41	1		*CLIPAMBIENT SENSOR	Necessary	4.05 FS	*4.05 FS
42	1		*CASE SETAIR CLEANER	Cracked	36.45 FS	*36.45 FS
43	1		*COVER COMPAIR CLEANER	Cracked	15.75 FS	*15.75 FS
44	1		*ELEMENT ASSYAIR CLEANER	Cracked	26.70 FS	*26.70 FS
45	1		*CHAMBER ASSYRESONATOR	Cracked	38.25 FS	*38.25 FS
46	1		*RADIATOR COMP	Distorted	825.37 FS	*825.37 FS
47	1		*SHROUD COMP	Cracked	90.52 FS	*90.52 FS
48	1		*PROTECTORFAN MOTOR HEAT	Distorted	13.20 FS	*13.20 FS
49	1		*FAN COMPCOOLING	Distorted	49.80 FS	*49.80 FS
50	1		*MOTORCOOLING FAN	Distorted	514.80 FS	*514.80 FS
51	1		*HOSEWATER UPPER	Twisted	7.87 FS	*7.87 FS
52	1		*HOSE AWATER LOWER	Cut	9.67 FS	*9.67 FS
53	1		*MOUNTING, ENGINE SIDE	Torn	125.25 FS	*121.57 FS
54	1		*MOUNTINGTRANSMISSION	Torn	101.40 FS	*101.40 FS
55	1		*SUB FRAMEFR.	Bent	964.12 FS	*964.12 FS
56	2		*BOLT FLANGE 14 X 90	Necessary	10.20 FS	*10.20 FS
57	1		*COVER ASSY, ENGINE UNDER	Torn	159.90 FS	*159.90 FS
58	1		*LID, ENGINE UNDER COVER	Necessary	9.60 FS	*9.60 FS
59	1		*ENGINE ROOM WIRE HARNESS	Snapped	695.85 FS	*695.85 FS
60	1		*COVER RELAY BOX UPPER	Cracked	14.55 FS	*14.55 FS
61	1		*HARNESSFR.END WIRE	Snapped	50.62 FS	*50.62 FS
62	1		*HEADLIGHT ASSY, R.	Cracked	439.27 FS	*439.27 FS
63	1		*HEADLIGHT ASSY,L.	Cracked	439.27 FS	*439.27 FS
64	1		*CONTROL MODULEWERTRAIN	Not Necessary	623.17 FS	*- FS
65	1		*BRCKET COMPP/TRAIN CTL MODULE	Bent	17.62 FS	*17.62 FS
66	1		*COVERCONTROL MODULE	Cracked	9.67 FS	*9.67 FS
67	1		*SENSOR ASSYFR.CRASH	Activated	53.55 FS	*53.55 FS
68	1		*SENSOR ASSYFR.CRASH	Activated	53.55 FS	*53.55 FS
69	1		*SRS UNIT	Activated	611.25 FS	*611.25 FS
70	1		*PANEL COMPINSTRUMENT	Torn	522.15 FS	*522.15 FS
71	1		*MODULE ASSYPASSENGER	Activated	1,370.25 FS	*1,370.25 FS
72	1		*TONGUE ASSYR.FR.SEATBELT	Activated	321.97 FS	*321.97 FS
73	1		*TONGUE ASSYL.FR.SEATBELT OUT	Activated	321.97 FS	*321.97 FS
74	1		*MODULE ASSYDRIVER	Activated	1,370.25 FS	*1,370.25 FS
75	1		*COVER COMPCHAMBER	Not Necessary	45.07 FS	*- FS
76	1		*CONVERTER ASSY	Not Necessary	822.37 FS	*- FS
77	1		*COVERCONVERTER	Dented	36.00 FS	*36.00 FS
78	1		*PIPEEGR.	Bent	81.30 FS	*81.30 FS
79	1		*SENSORAIR FUEL RATIO	Damaged	384.22 FS	*384.22 FS
80	1		*SENSOROXYGEN	Damaged	79.80 FS	*79.80 FS
81	1		*VALVE SETEGR	Damaged	221.47 FS	*221.47 FS
82	1		*WARMER COMP. CVTF	Damaged	139.87 FS	*139.87 FS
83	3		*COOLANT ANTI-FREEZE TYPE 2	Necessary	52.20 FS	*52.20 FS
84	2		*WINDSCREEN SEALANT	Necessary	120.00 FS	*120.00 FS
85	1		*IDEMITSU BRAKE FLUID DOT4 0.5L	Not Necessary	6.17 FS	*- FS
86	1		*NUMBER PLATE WITH CASING - L	Not Necessary	45.00 FS	*- FS
87	1		*SOLAR FILM ON FRONT WINDSCREEN	Necessary	300.00 FS	*300.00 FS
88	1		*SUNDRIES	Necessary	50.00 FS	*20.00 FS
89	1		*NUMBER PLATE WITH CASING-L	Missing	80.00 FS	*80.00 FS
90	1		*BASE,FR.GRILLE CHROME	Smashed	55.35 FS	*55.35 FS
91	1		*EXTENSION ASSYR.FR.GRILLE	Smashed	64.20 FS	*64.20 FS
92	1		*EXTENSION ASSYL.FR.GRILLE	Smashed	64.20 FS	*64.20 FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
93	1		*MOLDINGFR.GRILLE	Smashed	75.30 FS	*75.30 FS
94	1		*COVERFR.BULKHEAD	Distorted	13.65 FS	*13.65 FS
95	1		*RUBBERHOOD SEAL	Cut	20.70 FS	*20.70 FS
96	2		*CUSHIONHOOD	Cut	7.50 FS	*7.50 FS
97	1		*EMBLEM	Necessary	11.25 FS	*11.25 FS
98	1		*NUTPUSH 3MM (2PCS)	Necessary	3.15 FS	*3.15 FS
99	1		*CLIP, HOOD SEAL (6PCS)	Necessary	2.25 FS	*2.25 FS
100	1		*CLIP, BUMPER (20PCS)	Necessary	34.50 FS	*34.50 FS
101	1		*LABEL,FR.BULKHEAD COVER	Necessary	1.12 FS	*1.12 FS
102	1		*FACEFR.BUMPER	Distorted	434.92 FS	*434.92 FS
103	1		*GRILLEFR.BUMPER LOWER	Distorted	27.07 FS	*27.07 FS
104	1		*GARNISHR.FR.BUMPER SIDE	Distorted	13.50 FS	*13.50 FS
105	1		*GARNISHL.FR.BUMPER SIDE	Distorted	13.50 FS	*13.50 FS
106	1		*BEAM COMPFR.BUMPER	Bent	259.42 FS	*259.42 FS
107	1		*BEAMR.FR.BUMPER UPPER	Bent	20.02 FS	*20.02 FS
108	1		*BEAML.FR.BUMPER UPPER	Bent	20.02 FS	*20.02 FS
109	1		*BEAM COMPFR.BUMPER CENTER UPP	Bent	161.10 FS	*161.10 FS
110	1		*SPACERR.FR.BUMPER SIDE	Necessary	7.80 FS	*7.80 FS
111	1		*SPACERL.FR.BUMPER SIDE	Necessary	7.80 FS	*7.80 FS
112	1		*PLATER.FR.BUMPER SIDE INDUCTN	Distorted	32.47 FS	*32.47 FS
113	1		*EXTENSIONL.SIDE INDUCTN PLATE	Distorted	33.00 FS	*33.00 FS
114	1		*HOSE BWATER LOWER	Damaged	8.85 FS	*8.85 FS
115	1		*CLIPWATER HOSE (2PCS)	Necessary	6.45 FS	*6.45 FS
116	1		*THROTTLE BODYELECTRONIC CTL	Damaged	798.82 FS	*798.82 FS
117	1		*LINK COMPFR.STABILIZER	Cracked	52.87 FS	*52.87 FS
118	1		*DRIVESHAFT ASSY,L	Bent	652.50 FS	*652.50 FS
119	1		*CABLE ASSYBATTERY EARTH	Cut	10.87 FS	*10.87 FS
120	1		*LABLE AIR CON	Necessary	0.60 FS	*0.60 FS
121	1		*LABEL, COOLANT INFORMATION	Necessary	7.50 FS	*7.50 FS
122	1		*BOXBATTERY	Deformed	65.77 FS	*65.77 FS
123	1		*HOSEATF WARMER OUT	Damaged	3.45 FS	*3.45 FS
124	1		*HOSE ATF WARMER IN	Damaged	3.15 FS	*3.15 FS
125	2		*CLIPWATER HOSE	Necessary	6.00 FS	*6.00 FS
126	1		*HOSE BEXPANSION TANK INLET	Damaged	3.37 FS	*3.37 FS
127	1		*MEMBER L FR WHEEL HOUSE UPP	Distorted	57.60 FS	*57.60 FS
128	1		*HOSE BEXPANSION TANK OUTLET	Damaged	3.45 FS	*3.45 FS
129	1		*COVERR.FR.FENDER	Damaged	10.65 FS	*10.65 FS
130	1		*PLATEL.FR.BUMPER SIDE INDUCTN	Distorted	33.00 FS	*33.00 FS
131	1		*PLATE SETL.FR.SIDE BACK	Distorted	93.22 FS	*93.22 FS

F=Franchise part. S=SpcNett.

Total Parts (\$\$)	20,360.10	18,784.64
---------------------------	------------------	------------------

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	TOWING SERVICE	New	150.00	150.00
2	WHEEL ALIGNMENT X4	New	180.00	180.00
3	RESET VEHICLE SMART ENTRY SYSTEM	New	320.00	280.00
4	RENEW BOTH DRIVER & PASSENGER AIRBAG ASSY ECU &	New	450.00	450.00
5	REMOVE & INSTALL DASHBOARD EVAPORATOR UNIT	New	1,000.00	1,000.00
6	REMOVE & INSTALL ENGINE ASSY GEARBOX & OTHERS	New	1,000.00	1,000.00
7	REMOVE & INSPECT ABS MODULAR BLEED BRAKE SYSTEM	New	450.00	300.00
8	REMOVE & INSTALL A/C CONDENSER WITH FITTINGS	New	280.00	280.00
9	REMOVE & INSTALL A/C CONDENSER WITH FITTINGS	New	230.00	230.00
10	REPLACE FR.WINDSCREEN	New	300.00	300.00
11	PLACE VEHICLE TO BENCH FOR CHASSIS FRAME ALIGNMENT	New	1,300.00	1,000.00
12	INSPECT FR LIGHTING MECHANISMS & FOCUS	New	100.00	100.00
13	BODY JOINT SEALANT	New	200.00	200.00
14	BODY UNDERSIDE COATING	New	100.00	100.00
15	APPLY BODY UNDERSIDE COATING	New	250.00	180.00
16	CUT OFF & RENEW BULKHEAD FR L HOUSING COMP	New	5,000.00	4,200.00
17	SPRAY PAINTING ON REPAIRED OR REPLACED AREAS. (8P)	New	4,000.00	2,700.00
Gross Labour Cost (S\$)			15,310.00	12,650.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >