

15/02/20

INS. CASE OWNER:

GAUMA

CC 3/AIG1802

LKK:

IDAC:

Surveyor:

HJ

DOI:

ASSIGNMENT

Date / Time:

Registered in Merimen:

Pre-assign / CCU / FTE



Insured Vehicle No.:

Name of Insured:

Insured Tel No.:

Excess Sec II :SS

Is driver the owner?

(YES) NO)

If NO, Driver Name / Age:

Driver Tel No.:

Nature of Accident:

(V/L: YES/ NO)

Claim No.:

Policy No.:

Make / Model:

Place of Accident:

OI GIA REPORT: YES / NO : TP GIA REPORT: YES / NO

Insured Liability:

Final ? Yes / No



INSRS:

WSP:

Tel:

Liability:

RMKS:

Smart



INSRS:

WSP:

Tel:

Liability:

RMKS:



INSRS:

WSP:

Tel:

Liability:

RMKS:



INSRS:

WSP:

Tel:

Liability:

RMKS:

Date/ Time

8/4/19

vic

16/10/19

21/11/19

3/3/2020

Khanhwa

GHL415AP - X

GHL169C - X

AIG instructed to get TP VIDEO & NO NOT ENGAGE OICOLD YET.

FILE REVIEWED. OI EXTING WASTE ROAD EMAIL TO TP TO GET VIDEO FOOTAGE IF ANY.

OI VIDEO FOOTAGE UPLOADED IN WILSON GANBO COPY IN V PRINCE VIC/666/GAC.

NO TP VIDEO FOOTAGE. ONLY PHOTO.

EMAIL TO AIG SEND PHOTOS.

PENDING INTERVIEW

FINISHED.

TP LOD IN BY EMAIL

File pass to MK to close

→ Sallha 2A/G/ (31/1/2020 - SAB)

STAGE DATE / PIC

Non-Reporting ltr (1st):

Non-Reporting ltr (2nd):

Non-Reporting ltr (Final):

Notification ltr (if non-pickup):

Call OI: → AIG will contact OI

After call ltr to OI:

Documentation Check List: Handler Typist

Notification ltr (if non-pickup)

After call ltr to OI:

Authorisation To Act:

Release Voucher:

Final Repair Bill:

Car Rental Invoice:

Towing Invoice:

LTA/GIA:

Medical Bill:

PIR:

Mandate/Reject Instruction:

LOD:

Payment Breakdown Form:

Post-Repair Photos:

Others:

PRELIMINARY ADVICE Date/Time:

Sent By:

FINALIZATION

Date/Time:

Confirm with:

Confirm by:

Repair Cost:

L19

SS 6,300.00

(6 days)

Reduction:

61

%

Email

Call

FINAL SETTLEMENT

Date/Time:

Confirm with:

Email

Call

Final Liability:

%

100

(Agreed / Assessed) BOILA S/N No.:

24

Repair Cost:

SS

6,300

Loss of Rental (LOR):

SS

1,203.75

(9 days)

X \$133.76

Loss of Use (LOU):

SS

-

(S - x - days)

Loss of Income (LOI):

SS

-

(S - x - days)

LOR only

LOU only

LOR + LOU

LOR + LOU

LOR + LOU

LOR + LOU

LOR + LOU

LOR + LOU

LOR + LOU

LOR + LOU

LOR + LOU

LOR + LOU

LOR + LOU

LOR + LOU

LOR + LOU

LOR + LOU

LOR + LOU

LOR + LOU

LOR + LOU

LOR + LOU

LOR + LOU

LOR + LOU

LOR + LOU

LOR + LOU

LOR + LOU

LOR + LOU

LOR + LOU

LOR + LOU

LOR + LOU

LOR + LOU

GIA/LTA Search

SS

700

Medical:

SS

-

Disbursement:

SS

-

(e.g. Tow/ Independent)

Legal Cost

SS

-

Total:

SS

7,510.75

Global Sum SS:

7,510

FINAL PAYMENT

Date/Time:

Confirm with:

Email

Call

Payee 1:

SS

7,510

Name 1:

SMART TAXIS PTE LTD

Payee 2: (Strike if N.A.)

SS

Name 2:

4/3/2020

Payee 3: (Strike if N.A.)

SS

Name 3:

4/3/2020

1) Claim status: Normal/Reject/Private Settle

2) Report Format:

3) Survey fee:

\$320

REF:

AIG

Hwee Je

ASSIGNMENT

From: _____ Date: _____
 Estimated Cost: _____
 OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No:

Claims No:

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
 repair at the time of inspection.



Bal. or Market Value:

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

6

days

Res.: Yes or No

Lump Sum:

20

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date:

Person Contacted:

Veh No: SHC 4159P Yr Regn: 29/11/13

Type: M.Car / M.Cycle / Bus / Van / Lorry / Van / Prime Mover /

Truck / Trailer or

Make: Toyota Prius

C.C. 1798

Colour: maroon

A/C: Insured / Std / NI / NA

Sp. Reading: 501722

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No: JTDKN36U40S706252

Gen. Cond: Good / Fair / Poor / BurntSteering: In order / Jammed / Leaked / Burnt orBrake: In order / Jammed / Leaked / Burnt orModi: Nil / 2 Rim / STD A/Rim or

Tyre Size: F: 195/65R15

R: —

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Falken

Front

Rear

R/Bal. 6 mm

R/Bal. 6 mm

L/Bal. 6 mm

L/Bal. 6 mm

D.O.A. 24/12/18

D.O.I. 27/12/18

Survey held at

SmartDes. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

12/18/2103

L/G \$6,300.00

CRPD: \$10,101.96/61%

SGG169C

6 days + 1 Sunday + 1 PH + 1 PRS = 9 days

Date/Time, File Pass to?



Preli. Report

1)



Final Report

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation

) \$ + RS \$

) Photos

) Others

) ...

TOTAL

Report Format :

Lump Sum / I.B.I. (\$)

Add Fee:



Site Insp (\$



Interview (\$



Tech. Invs (\$



Week end (\$



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315



Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
AIG ASIA PACIFIC INSURANCE PTE LTD		Ref : CC3/AIG18023243/Jhb3	
78 SHENTON WAY #08-16 CHARTIS BUILDING SINGAPORE 079120		Date : 28-12-2018	
		Code : AIG	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	SGG 169C	Veh. Inspected	SHC 4159P
Policy No.		Coverage (\$)	0.00
Claim No.		Excess (\$)	0.00
Assign From		Assign Date	28/12/2018
2. Vehicle Particulars & Condition			
Make & Model		c.c	0
Engine No.	HIDDEN	Year of Reg.	
Chassis No.		Colour	
Odometer	-	Steering	
Brakes		Modification	
General			
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm
4. Description of Damages			
5. General Information			
Accident Date	24/12/2018	Inspection Date	27/12/2018
Survey held at	SMRT AUTOMOTIVE SERVICES PTE LTD 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			

Vic

Section A - Accident Details

Registration Number	SHC4159P
Case Reference Number	TAX/12/18/2103
Registration Date	29/11/13
Company Type	SMRT Taxis Pte Ltd
Make	TOYOTA
Model	PRIUS
Name of Driver	NG SEE KIAT
Type of Accident	Head To Side
Accident Date and Time	24/12/18 3:05 PM
Accident Reported Date and Time	26/12/18 10:36 AM
Is Surveyor Required?	Yes
Survey by	
Vehicle Is Towed Back?	No
Towed Back Date and Time	
Replacement Vehicle issued?	No
Job Card Number	24099394
Special Instruction to ARC, if any	TOWED \$40/AIG - LKK
Prepared Date and Time	27/12/18 11:08 AM
Chassis Number	
Mileage	
Work Shop	
Repair Completion Date and Time	

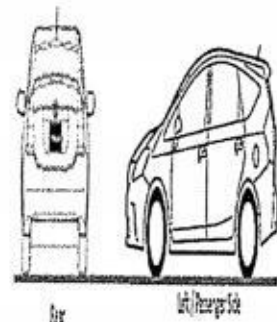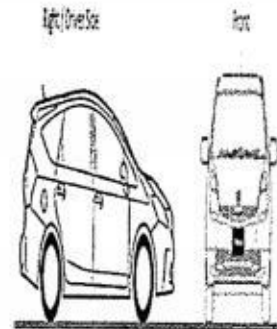

Hwee Jie

Section B - Summary of Repair Estimates

Summary of Repair Estimates

	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Cost	\$1,352.00	\$700.00
Total Spray Cost	\$2,034.00	\$750.00
Total Spare Part Cost	\$11,659.98	\$4,435.01
Total Other Cost	\$1,356.00	\$400.00
TOTAL COST	\$16,401.98	\$6,285.01
Lump Sum Total	\$16,400.00	\$6,300.00 (L/S)
Number of Repair Days	9.0	6.0
Prepared / Adjusted By	Zhi Yang Phua	Hwee Jie (LKK) / AIG
ARC / Surveyor Sign Off Date	07/01/2019 2:53 PM	07/01/2019 2:25 PM
Signature		
Remarks	SUP = 1 DAYS	L/S repair, photo after paint

Finalized - Hwee Jie

Section C - Quotation and Accident Invoice Details

Quotation Number	QN-1901-0388	Invoice Number	
Quotation Date	18.01.2019	Invoice Date	
Invoice Amount		Prepared Date	

Section D - Details of Repair Estimates

Part 1 - Labour Works

Job Scope	Quotation from AR	Adjusted by Surveyor, if applicable
TO REPAIR LH PORTION	\$1,352.00	\$700.00 ✓
Total Labour	\$1,352.00	\$700.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO RESPRAY FRONT FENDER LH	\$378.00	\$200.00 ✓
TO REPSRAY FRONT BUMPER	\$378.00	\$200.00 ✓
TO RESPRAY FRONT BUMPER LOWER GRILLE	\$180.00	\$0.00
TO RESPRAY FRONT SUPPORT PANEL	\$180.00	\$0.00
TO RESPRAY APRON PANEL LH	\$180.00	\$0.00
TO RESPRAY RIM	\$180.00	\$50.00 ✓
TO RESPRAY ROCKER PANEL MOULDING	\$180.00	\$100.00 ✓
TO RESPRAY FRONT DOOR LH	\$378.00	\$200.00 ✓
Total Spray Painting & Panel Beating	\$2,034.00	\$750.00

Part 3 - Other Costs - Accident and Accident Repair Related Expense

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REMOVE AND REFIX UNDERCARRIAGE	\$250.00	\$200.00 ✓
TOWING CHARGE	\$56.00	\$40.00 ✓
TO CHECK WIRING AND SYSTEM FUNCTION	\$80.00	\$20.00 ✓
TO APPLY RUST-PROOFING ON AFFECTED AREA	\$100.00	\$20.00 ✓
TO WASH AND VACUUM	\$60.00	\$0.00
TO REPLACE SUNDRY PARTS	\$100.00	\$0.00
TO REMOVE AND REFIT TYRE RIM (SPRAYING PURPOSE)	\$120.00	\$30.00 ✓
TO REMOVE AND REFIT TYRE	\$120.00	\$30.00 ✓
TO DO WHEEL ALIGNMENT / TYRE BALANCING	\$120.00	\$60.00 ✓
TO CHECK & RESET SYSTEM FUNCTION	\$350.00	\$0.00
Total Other Costs	\$1,356.00	\$400.00

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock Number	Part Name	Quantity	List Price (\$)	Discount (%)	Final Price (\$)	Estimator Approved	Surveyor Approved
		52119-47930	BUMPER FRT	1.00	\$482.00	25.00	\$361.50 ✓	Replace	Replace ✓
		52161-16010	BUMPER CLIPS	10.00	\$1.61	25.00	\$12.08 ✓	Replace	Replace ✓
		52116-47040	BUMPER SUPPORT F/LH	1.00	\$76.40	25.00	\$57.30 ✓	Replace	Replace ✓
		52611-47080	BUMPER ENERGY ABSORBER FRT	0.00	\$78.80	0.00	\$0.00	Replace	Check ✓

DEF
MEC
CUT
NN

SMRT Accident Vehicle Repair Estimates

SMRT Automotive Services Pte Ltd
60 Woodlands Industrial Park E4, Singapore 757155
Fax Number : 6365592
Estimator Telephone Number : 65662623
Accident Reporting Number : 58662672

Date Generated : 18/01/2018

User ID : PehSuan

	52021-47023	BUMPER REINFORCEMENT FRT	0.00	\$496.40	0.00	\$0.00	Replace	Check	X	NN
	57014-47030	ARM SUB-ASSY,FR BUMPER LH	0.00	\$250.40	0.00	\$0.00	Replace	Check	X	NN
	53102-47020	BUMPER GRILLE SUB-ASSY, LOWER	0.00	\$311.10	0.00	\$0.00	Replace	Not Given	X	NN
	82113-47180	WIRE, ENGINE ROOM, NO.3	0.00	\$242.00	0.00	\$0.00	Replace	Check	X	NN
	81521-47050	LENS & BODY,FR TURN LH	0.00	\$511.80	0.00	\$0.00	Replace	Check	X	NN
	81529-47040	BRACKET, FR TURN UPPER LH	0.00	\$24.40	0.00	\$0.00	Replace	Check	X	NN
	81529-47060	BRACKET, FR TURN CENTER LH	0.00	\$58.20	0.00	\$0.00	Replace	Check	X	NN
	81529-47050	BRACKET, FR TURN LOWER LH	0.00	\$26.00	0.00	\$0.00	Replace	Check	X	NN
	76851-47020	BUMPER LIP FRT	0.00	\$139.60	0.00	\$0.00	Replace	Not Given	X	NN
	52618-47050	BUMPER FRT ABSORBER LOWER	0.00	\$127.70	0.00	\$0.00	Replace	Not Given	X	NN
	53201-47902	SUPPORT SUB-ASSY	0.00	\$1,460.40	0.00	\$0.00	Replace	Not Given	X	NN
10/11	81170-47500	HEAD LAMP LH	1.00	\$945.20	10.00	\$850.68	Replace	Replace	/	SCR
	53802-47050	FENDER FRT/LH	1.00	\$723.40	25.00	\$542.55	Replace	Replace	/	BUC
	75374-47051	NAME PLATE (HYBRID)	1.00	\$51.90	25.00	\$38.93	Replace	Replace	/	NEL
	53876-47030	FENDER LINER FRT/LH	1.00	\$171.70	25.00	\$128.78	Replace	Replace	/	DEF
	53852-47020	FENDER LINER PAD, FR WHEEL LH	1.00	\$49.30	25.00	\$36.98	Replace	Replace	/	NEL
	53702-47050	FENDER APRON SUB FRT/LH	0.00	\$637.80	0.00	\$0.00	Replace	Check	X	NN
16	42611-47140(Frt)	WHEEL DISC. FRONT	1.00	\$1,484.20	100.00	\$0.00	Replace	Repair	/	R
FN		TYRE	1.00	\$126.74	0.00	\$126.74	Replace	Replace	/	CUT
16	75852-47900	MOULDING BODY, LH	1.00	\$673.60	100.00	\$0.00	Replace	Repair	/	R
	48520-80294	SHOCK ABSORBER FRT/LH	0.00	\$394.20	0.00	\$0.00	Replace	Check	X	NN
	48609-47040	SHOCK ABSORBER MOUNTNG FRT,RH/LH	0.00	\$193.80	0.00	\$0.00	Replace	Check	X	NN
	48619-28010	SHOCK ABSORBER BEARING, FRT LH/RH	0.00	\$34.00	0.00	\$0.00	Replace	Check	X	NN
	48820-47020	STABILIZER BAR LINK FRT/RH/LH	0.00	\$195.00	0.00	\$0.00	Replace	Check	X	NN
	43202-47030	STEERING KNUCKLE LH FRT	0.00	\$580.80	0.00	\$0.00	Replace	Check	X	NN
	45047-49165	TIE ROD END LH	0.00	\$159.30	0.00	\$0.00	Replace	Check	X	NN
	48069-47050	LOWER ARM FRT/LH	0.00	\$625.90	0.00	\$0.00	Replace	Check	X	NN
	43420-47030	DRIVE SHAFT LH	0.00	\$1,543.80	0.00	\$0.00	Replace	Check	X	NN
	43550-47011	WHEEL HUB FRT	0.00	\$549.70	0.00	\$0.00	Replace	Check	X	NN
	43330-49185	JOINT ASSY,LWR BALL	0.00	\$195.60	0.00	\$0.00	Replace	Check	X	NN
4	67002-47070	DOOR FRT/LH	1.00	\$894.40	100.00	\$0.00	Replace	Repair	/	R
FN		STICKER DECAL SMRT (DOOR)	1.00	\$60.00	0.00	\$60.00	Replace	Replace	/	NEL
Total				\$14,579.15		\$2,215.54				

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Stock Number	Part Name	Quantity	List Price \$	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check	
		76851-47020	BUMPER LIP FRT	1.00	\$139.60	25.00	\$104.70	Replace	Replace	MIS
		48520-80294	SHOCK ABSORBER FRT/LH	1.00	\$394.20	25.00	\$295.65	Replace	Replace	DEF
		48820-47020	STABILIZER BAR LINK FRT/RH/LH	1.00	\$195.00	25.00	\$146.25	Replace	Replace	DEF
		43202-47030	STEERING KNUCKLE LH FRT	1.00	\$580.80	25.00	\$435.60	Replace	Replace	DEF
		45047-49165	TIE ROD END LH	1.00	\$159.30	25.00	\$119.48	Replace	Replace	DEF

	48089-47050	LOWER ARM FRT/LH	1.00	\$625.90	25.00	\$469.43	Replace	Replace	ORP
	43550-47011	WHEEL HUB FRT	1.00	\$549.70	25.00	\$412.28	Replace	Replace	ORP
	43330-49185	JOINT ASSY, LWR BALL	1.00	\$195.60	25.00	\$146.70	Replace	Replace	ORP
	45510-47070	STEERING RACK ASSY	1.00	\$1,597.50	25.00	\$1,198.13	Replace	Replace	ORP
Total				4,437.60		3,328.22			

19335.64
23773.244

5543.76
- 20%
4435.01
+ 700.00
+ 1150.00

6285.01
45 \$6300/-

24/1/19 - Finalized L/S repair \$6,300/- with 6 days.

Hwee Jie - Lkk



REQUEST FOR SUPPLYMENT PARTS

Contractor:			
Accident Case Number	TAX/12/18/2103	Date of Collection :	1 / 1
Vehicle No	SIC 4159 P	Date of Request	31/12/2018
Vehicle Model	TOYOTA PRIUS	Number of Days to Extend (if any)	1 1

S/N	Part Number	Part Description	Quantity	Unit Price
		FRONT BUMPER LH	1pc	MISSING
		FRONT SHOCK ABSORBER	14 1pc	DEF
		FRONT STAB LINK LH	1pc	DEF
		FRONT KNUCKLE ARM LH	1pc	DEF
		FRONT TIE ROD END LH	1pc	DEF
		FRONT LOWER ARM LH	1pc	DEF

<<Please submit photographs for damaged parts>>

7/1/19

I, (Name) _____

(Position) _____

do solemnly and sincerely declare that:- Supplementary Parts are raised for replacement for the aforesaid vehicle.

Signature of person making this declaration
[to be signed in front of an authorised witness]

I acknowledge that this declaration is true and correct, and I make it with the understanding and belief that a person who makes a false declaration is liable to the damages of perjury.

For SMRT Staff

Acknowledge By	ARCExecutive / Supervisor / SA:	
Approval By	Surveyor / In-house Staff	
Parts Ordering	SMRT Store / Contractor Supply / Form 22 / WOC	Form 22 / PO / WOC / Reservation / Number
Photo Submitted	YES / NO:	Date of submission

Pg 2

REQUEST FOR SUPPLYMENT PARTS

Contractor:			
Accident Case Number	TAX/12/18/2013	Date of Collection :	1 / 1
Vehicle No	SHC 4159 P	Date of Request	3/11/2018
Vehicle Model	TOYOTA PRIUS	Number of Days to Extend (if any)	1 1

S/N	Part Number	Part Description	Quantity	Unit Price
		FRONT WHEEL HUB LM	1pc	DEF
		FRONT LOWER BALL JOINT LH	1pc	DEF
		STEERING RACK & PIVOT	1pc	DEF
		Labour to remove & replace front under carriage		200 200

<<<Please submit photographs for damaged parts>>>

7/1/19

I, (Name) _____

(Position) _____

do solemnly and sincerely declare that:- Supplementary Parts are raised for replacement for the aforesaid vehicle.

Signature of person making this declaration
(to be signed in front of an authorised witness)

I acknowledge that this declaration is true and correct, and I make it with the understanding and belief that a person who makes a false declaration is liable to the damages of perjury.

For SMRT Staff

Acknowledge By	ARC Executive / Supervisor / SA	
Approval By	Surveyor / In-house Staff	
Parts Ordering	SMRT Store / Contractor Supply / Form 22 / WOC	Form 22 / PO / WOC / Reservation / Number
Photo Submitted	YES / NO	Date of submission

19 1/2

REQUEST FOR SUPPLEMENT PARTS

Contractor:			
Accident Case Number	TAX/12/18/2103	Date of Collection	1 / 1
Vehicle No	SHC 4159-P	Date of Request	03/01/2019
Vehicle Model	TOYOTA PRIUS	Number of Days to Extend (If any)	1

S/N	Part Number	Part Description	Quantity	Unit Price
	Labour	TO SPRAY FRONT FENDER LH		\$ 378

<<Please submit photographs for damaged parts>>

2/1/19

I, (Name) _____

(Position) _____

do solemnly and sincerely declare that:- Supplementary Parts are raised for replacement for the aforesaid vehicle.

.....
Signature of person making this declaration
(to be signed in front of an authorised witness)

I acknowledge that this declaration is true and correct, and I make it with the understanding and belief that a person who makes a false declaration is liable to the damages of perjury.

For SMRT Staff

Acknowledge By	ARCExecutive / Supervisor / SA	
Approval By	Surveyor / In-house Staff	
Parts Ordering	SMRT Store / Contractor Supply / Form 22 / WOC	Form 22 / PO / WOC / Reservation / Number
Photo Submitted	YES / NO	Date of submission

Wheel Alignment Report

License NO.: SHC4159P

Custom name: SMRT

Custom tel:

Custom addr: SMRT

Manufacture: TOYOTA

Model: PRIUS All Models With 15"/16"wheel

Model year: 2004-0

	Before Adj.	Min	Max	After Adj.
Front Axle				
Total Toe	-1.01°	-0.20°	0.20°	0.05°
Left Toe	-0.44°	-0.10°	0.10°	0.03°
Right Toe	-0.57°	-0.10°	0.10°	0.03°
Left Caster		2.72°	3.62°	
Right Caster		2.72°	3.62°	
Left Camber	-0.53°	-1.33°	0.17°	-0.56°
Right Camber	-0.13°	-1.33°	0.17°	-0.21°
Left SAI		11.52°	13.33°	
Right SAI		11.52°	13.33°	
Included angle(Left)				
Included angle(right)				
Rear Axle				
Total Toe	-0.49°	0.05°	0.55°	-0.49°
Left Toe	-0.53°	0.03°	0.28°	-0.53°
Right Toe	0.03°	0.03°	0.28°	0.03°
Left Camber	-1.31°	-2.00°	-1.00°	-1.27°
Right Camber	-0.01°	-2.00°	-1.00°	0.00°
Thrust Angle	0.28°			0.28°

Test time: 2019-01-04 09:26:00

Operator:

Fault discription:

Remark:



Case Details

Case Reference Number : TAX/12/18/2103
 Type of Repair : Accident Repair
 Vehicle Registration Number : SHC4159P

Company Type : SMRT Taxis Pte Ltd
 Estimation ID : EST-5099-ID
 Assigned By : Taxi Claims Manager Team

Insurance Company Name : AIG Asia Pacific Insurance Pte Ltd
 Accident Date and Time : 24/12/2018 07:05 AM
 Vehicle Age(In Months) : 61

Documents / Photographs

[View Documents / Photographs](#)

Total Documents: 1

Estimation Details

Spare Part's Cost Detail

BOM Type	Costing Type	Portion	Material Number	SMRT Recommendation							Surveyor Approval		
				Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace
One Time Key In	Main			BUMPER FRT	1	482.00	482.00	25.00	361.50	Replace	1	361.50	Replace ▾ 00
One Time Key In	Main			BUMPER CLIPS	10	1.61	16.10	25.00	12.08	Replace	10	12.08	Replace ▾ NEC
One Time Key In	Main			BUMPER SUPPORT F/LH	1	76.40	76.40	25.00	57.30	Replace	1	57.30	Replace ▾ CRA
One Time Key In	Main			BUMPER ENERGY ABSORBER FRT	1	78.80	78.80	25.00	59.10	Replace	0	0	Check ▾
One Time Key In	Main			BUMPER REINFORCEMENT FRT	1	498.40	498.40	25.00	373.80	Replace	0	0	Check ▾
One Time Key In	Main			ARM SUB-ASSY,FR BUMPER LH	1	250.40	250.40	25.00	187.80	Replace	0	0	Check ▾
One Time Key In	Main			BUMPER GRILLE SUB-ASSY, LOWER	1	311.10	311.10	25.00	233.33	Replace	0	0	Not Give ▾
One Time Key In	Main			WIRE, ENGINE ROOM, NO.3	1	242.00	242.00	10.00	217.80	Replace	0	0	Check ▾
One Time Key In	Main			LENS & BODY,FR TURN LH	1	511.80	511.80	10.00	460.62	Replace	0	0	Check ▾
One Time Key In	Main			BRACKET, FR TURN UPPER LH	1	24.40	24.40	25.00	18.30	Replace	0	0	Check ▾

Total Spare Part Cost 11,246.77

Surveyor Total 2,215.51

Lump Sum Discount (%) 20.00

Lump Sum Dis (%) 20

Final Spare Part Cost 8,997.42

Final Sur Total 1,772.41

001

SMRT Recommendation											Surveyor Approval			
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace	
One Time Key In	Main			BRACKET, FRONT TURN CENTER LH	1	58.20	58.20	25.00	43.65	Replace	0	0	Check	▼
One Time Key In	Main			BRACKET, FRONT TURN LOWER LH	1	26.00	26.00	25.00	19.50	Replace	0	0	Check	▼
One Time Key In	Main			BUMPER LIP FRONT	1	139.60	139.60	25.00	104.70	Replace	0	0	Not Given	▼
One Time Key In	Main			BUMPER FRONT ABSORBER LOWER	1	127.70	127.70	25.00	95.78	Replace	0	0	Not Given	▼
One Time Key In	Main			SUPPORT SUB-ASSY	1	1,460.40	1,460.40	25.00	1,095.30	Replace	0	0	Not Given	▼
One Time Key In	Main			HEAD LAMP LH	1	945.20	945.20	10.00	850.68	Replace	1	850.68	Replace	▼ CRA
One Time Key In	Main			FENDER FRONT/LH	1	723.40	723.40	25.00	542.55	Replace	1	542.55	Replace	▼ BUC
One Time Key In	Main			NAME PLATE (HYBRID)	1	51.90	51.90	25.00	38.92	Replace	1	38.92	Replace	▼ NEC
One Time Key In	Main			FENDER LINER FRONT/LH	1	171.70	171.70	25.00	128.77	Replace	1	128.77	Replace	▼ TN
One Time Key In	Main			FENDER LINER PAD, FRONT WHEEL LH	1	49.30	49.30	25.00	36.97	Replace	1	36.97	Replace	▼ NEC
One Time Key In	Main			FENDER APRON SUB FRONT/LH	1	637.80	637.80	25.00	478.35	Replace	0	0	Check	▼
One Time Key In	Main			WHEEL DISC. FRONT	1	1,484.20	1,484.20	25.00	1,113.15	Replace	1	0	Repair	▼
One Time Key In	Main			TYRE	1	126.74	126.74	0.00	126.74	Replace	1	126.74	Replace	▼ CUT
One Time Key In	Main			MOULDING BODY, LH	1	673.60	673.60	25.00	505.20	Replace	1	0	Repair	▼
One Time Key In	Main			SHOCK ABSORBER FRONT/LH	1	394.20	394.20	25.00	295.65	Replace	0	0	Check	▼
Total Spare Part Cost									11,246.77		Surveyor Total	2,215.51		
Lump Sum Discount (%)									20.00		Lump Sum Dis (%)	20		
Final Spare Part Cost									8,997.42		Final Sur Total	1,772.41		

SMRT Recommendation											Surveyor Approval		
BOM Type	Costing Type	Portion	Material Number	Part Name	Qty	List Price Per Unit(\$)	List Price(\$)	Dis(%)	Final Price(\$)	Repair/ Replace	Surveyor Quantity	Surveyor Final Price(\$)	Repair/Replace
One Time Key In	Main			SHOCK ABSORBER MOUNTNG FRT,RH/LH	1	193.80	193.80	25.00	145.35	Replace	0	0	Check ▼
One Time Key In	Main			SHOCK ABSORBER BEARING, FRT LH/RH	1	34.00	34.00	25.00	25.50	Replace	0	0	Check ▼
One Time Key In	Main			STABILIZER BAR LINK FRT/RH/LH	1	195.00	195.00	25.00	146.25	Replace	0	0	Check ▼
One Time Key In	Main			STEERING KNUCKLE LH FRT	1	580.80	580.80	25.00	435.60	Replace	0	0	Check ▼
One Time Key In	Main			TIE ROD END LH	1	159.30	159.30	25.00	119.48	Replace	0	0	Check ▼
One Time Key In	Main			LOWER ARM FRT/LH	1	625.90	625.90	25.00	469.42	Replace	0	0	Check ▼
One Time Key In	Main			DRIVE SHAFT LH	1	1,543.80	1,543.80	25.00	1,157.85	Replace	0	0	Check ▼
One Time Key In	Main			WHEEL HUB FRT	1	549.70	549.70	25.00	412.28	Replace	0	0	Check ▼
One Time Key In	Main			JOINT ASSY,LWR BALL	1	195.60	195.60	25.00	146.70	Replace	0	0	Check ▼
One Time Key In	Main			DOOR FRT/LH	1	894.40	894.40	25.00	670.80	Replace	1	0	Repair ▼
One Time Key In	Main			STICKER DECAL SMRT (DOOR)	1	60.00	60.00	0.00	60.00	Replace	1	60.00	Replace ▼

NEC

Total Spare Part Cost 11,246.77

Surveyor Total 2,215.51

Lump Sum Discount (%) 20.00

Lump Sum Dis (%) 20

Final Spare Part Cost 8,997.42

Final Sur Total 1,772.41

Labour's Cost Detail

S.No.	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	TO REPAIR LH PORTION	1,352.00	700	
Total:		1,352.00	700.00	

Spray Cost Detail

S.No.	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
Total:		1,476.00	550.00	

S.No.	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	TO REPSRAY FRONT BUMPER	378.00	200	
2	TO RESPRAY FRONT BUMPER LOWER GRILLE	180.00	0	
3	TO RESPRAY FRONT SUPPORT PANEL	180.00	0	
4	TO RESPRAY APRON PANEL LH	180.00	0	
5	TO RESPRAY RIM	0.00	50	
6	TO RESPRAY ROCKER PANEL MOULDING	180.00	100	
7	TO RESPRAY FRONT DOOR LH	378.00	200	
Total:		1,476.00	550.00	

Other Cost Detail

S.No.	Job Scope	SMRT Recommendation(\$)	Surveyor Adjustment(\$)	Remarks
1	TOWING CHARGE	56.00	0	
2	TO CHECK WIRING AND SYSTEM FUNCTION	80.00	20	
3	TO APPLY RUST-PROOFING ON AFFECTED AREA	100.00	20	
4	TO WASH AND VACUUM	60.00	0	
5	TO REPLACE SUNDRY PARTS	100.00	0	
6	TO REMOVE AND REFIT TYRE RIM (SPRAYING PURPOSE)	120.00	30	
7	TO REMOVE AND REFIT TYRE	120.00	30	
8	TO DO WHEEL ALIGNMENT / TYRE BALANCING	120.00	60	
9	TO CHECK & RESET SYSTEM FUNCTION	350.00	0	
Total:		1,106.00	160.00	

Summary

	Estimator Assesment(\$)	Surveyor Assesment(\$)
Total Spare Part Detail	8,997.42	1,772.41
Total Labour Cost	1,352.00	700.00
Total Spray Painting	1,476.00	550.00

Estimator Assessment(\$)

Surveyor Assessment(\$)

Other

1,106.00

160.00

Overall Total

12,931.42

3,182.41

Lump Sum Repair Option

☒☒

Lump Sum Total

12,950.00

3,200.00

Surveyor Approved Amount

3,200.00

No of Repair Days*

9

5

Remarks

-

L/S repair, photo after paint

Surveyor Name

Hiwee jie

Signature



Save

Clear

Survey Date

27/12/2018

**LKK Auto Consultants hence notify
the Repairer of the following:**

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and
is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Wheel Alignment Report

License NO.: SHC4159P

Custom name: SMRT

Custom tel:

Custom addr: SMRT

Manufacture: TOYOTA

Model: PRIUS All Models With 15"/16"wheel

Model year: 2004-0

	Before Adj.	Min	Max	After Adj.
Front Axle				
Total Toe	-6.88°	-0.20°	0.20°	-6.88°
Left Toe	-7.17°	-0.10°	0.10°	-7.17°
Right Toe	0.29°	-0.10°	0.10°	0.29°
Left Caster		2.72°	3.62°	
Right Caster		2.72°	3.62°	
Left Camber	-0.66°	-1.33°	0.17°	-0.65°
Right Camber	-0.27°	-1.33°	0.17°	-0.27°
Left SAI		11.52°	13.33°	
Right SAI		11.52°	13.33°	
Included angle(Left)				
Included angle(right)				
Rear Axle				
Total Toe	-0.48°	0.05°	0.55°	-0.48°
Left Toe	-0.77°	0.03°	0.28°	-0.77°
Right Toe	0.29°	0.03°	0.28°	0.29°
Left Camber	-1.69°	-2.00°	-1.00°	-1.68°
Right Camber	0.26°	-2.00°	-1.00°	0.24°
Thrust Angle	0.53°			0.53°

Test time: 2018-12-31 13:40

Operator:

Fault discription:

Remark: