

AH LIM Motor Company
#01-09, AMK Autopoint, 10 Ang
Mo Kio Ind. Park 2A
568047

SURVEYOR COPY

Claim Reference:
Assessment number: SDA9638Z
Version: 1712
Date calculated: 01/03/2019 11:32 AM

Full Report
Registration: SDA9638Z
Printed: 01/03/2019 11:33 AM

Summary Information

Claim

Location: Singapore (SG)
Printed by: Kee Mui Hong
Claim Reference:
Estimated Repair Time: 10 4 days
Actual Repair Days:

Work Provider: AXA Insurance Pte Ltd
Currency: SGD
Date of Incident: 2018-12-30
Hire Car Start:
Hire Car End:

Vehicle Details

Vehicle

Manufacturer: MERCEDES-BENZ
Model: A-CLASS (W176)
Sub Model: A 180 BE
Model Sheet Number: 03 A2 41
Registration: SDA9638Z
VIN number: WDD1760422J229693
Odometer:

Model Specs

FR PRODUCTION START
RAIN SENSOR
AUDIO SYSTEM 20 CD
MULTI FUNCT S-WHEEL
PASS SEAT MEMORY
ILLUM SUN VISOR
POWER REDUCTION
ECO START/STOP
WHEELS 7.5J X 17 ALU
PARKTRONIC
CLEAR COAT HARD

TECH CHANGES 13/02
DIPPING DOOR MIRROR
LIGHT-/VIEW PACKAGE
SILL MLDG ILLUMINAT
ELECT LUMBAR ADJUST
DRIVER SEAT TRAY
SOCKET 12V
CRUISE CONTROL
TYRE W/FLAT RUNNING
COMPRESSOR VARIABLE

MODEL 2014
COLLISION WARNER
CLOTH/IMI LEATH PAD
S/WHEEL TIP SWITCHES
SEAT COMFORT PACKAGE
PASS SEAT ST/BOX
EMISSION STD EURO 6
7 SPEED AUTOMATIC
ELECTRIC HORN
TWO COAT METALLIC

A/C THERMATIC
ELECT FOLDING MIRROR
STYLE-PACK
DRIVER SEAT MEMORY
MEDIA INTERFACE
FRT SEAT LUGGAGE NET
STORAGE PACKAGE
TYRES 225/45 VR 17
KNEE AIRBAG
PREPARE OFF VEHICLE

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:
Date:

Page 1 of 5

*Not Notified
I.B.1
Resurvey By paint*

AH LIM Motor Company
#01-09, AMK Autopoint, 10 Ang
Mo Kio Ind. Park 2A
568047

Claim Reference:

Assessment number: SDA9638Z

Version: 1712

Date calculated: 01/03/2019 11:32 AM

Full Report

Registration: SDA9638Z

Printed: 01/03/2019 11:33 AM

Vehicle Condition


Vehicle Status

Pre-Accident Damage:

Date of Inspection:

Damage Areas

All ☐
Underbody ☐

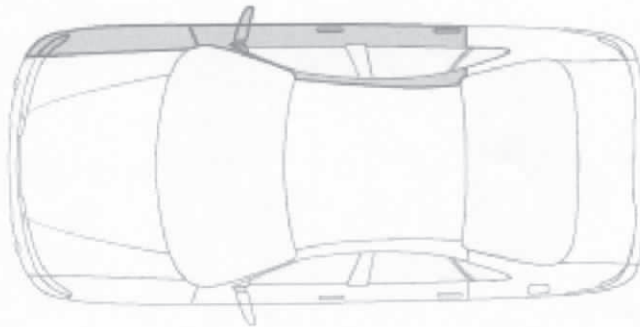

Labour

Code	Description	Time Base 10 WU/h	Price = 45.00 SGD/h	
			WU	Price SGD
54-1011 01	SHORT TEST INCLUDES: CONNECT + DISCONNECT STAR DIAGNOSIS, PRINT DATA, DELETE ERROR MEMORY		3.0	13.50
54-7989 01	R + R BATTERY EARTH CABLE (WHEN DISCONNECTING ELECTRIC PLUG AND SOCKET CONNECTIONS)		2.0	9.00
61-1117 01	R + R R/UNDERFLOOR COVER		3.0	13.50
72-1515 01	RENEW R/F DOOR AND CONVERT PARTS INCLUDES: DOOR TRIM REMOVE AND REFIT AND ALL ATTACHED PARTS ASSEMBLE		31.0	139.50
72-2690 01	RENEW R/F UPPER DOOR HINGE		3.0	13.50
72-6665 01)	RENEW R/F DOOR TRIM (REMOVED)		5.0	22.50
72-5886 01	RENEW RIGHT FRONT DOOR BASIS SUPPORT (DOOR MODULE REMOVED)		5.0	22.50

AH LIM Motor Company
#01-09, AMK Autopoint, 10 Ang
Mo Kio Ind. Park 2A
568047

Claim Reference:

Assessment number: SDA9638Z

Version: 1712

Date calculated: 01/03/2019 11:32 AM

Full Report

Registration: SDA9638Z

Printed: 01/03/2019 11:33 AM

Code	Description	WU	Price SGD
72-5712 01	R + R R/F WINDOW REGULATOR DRIVE MOTOR (DOOR TRIM REMOVED)	2.0	9.00
72-7933 01	R + R RIGHT FRONT DOOR EDGE PROTECTION	3.0	13.50
72-7935 01	R + R RIGHT REAR DOOR EDGE PROTECTION	2.0	9.00
88-5232 01	R + R RIGHT SILL TRIM	4.0	18.00
68-1040 01	R + R RIGHT A-PILLAR LOWER TRIM	2.0	9.00
68-1093 01	R + R R/LOWER B-PILLAR TRIM	5.0	22.50
1782	R/R DOOR REPAIR	10 30.0*	135.00
2102	R/SILL PANEL REPAIR	30.0* ?	135.00
Labour Cost		Hrs	WU
Panel / Mechanical Labour		13.00	130.0
Total of Labour			585.00

Paint

Code	Description - TWO COAT METALLIC	WU	Price SGD
	RIGHT FRONT DOOR NEW PART PAINTING	16.0	
	R/SILL PANEL COVER NEW PART PAINT K1R	7.0	
	R/R DOOR REPAIR PAINTING >50%	23.0	
	R/SILL PANEL REPAIR PAINTING >50%	15.0	

Paint Material Per Part

Code	Description	Price SGD
1482	RIGHT FRONT DOOR NEW PART PAINTING	45.92
2208	R/SILL PANEL COVER NEW PART PAINT K1R	26.57
1782	R/R DOOR REPAIR PAINTING >50%	30.42
2102	R/SILL PANEL REPAIR PAINTING >50%	12.25

Labour Cost - Paint

	Hrs	WU	Price SGD
Factor		61.0	
Time Paint		25.0	112.50
Preparation Main Work Metal	2.50	5.0	22.50
Preparation Comp. Work Plastic	0.50	91.0	409.50
Total	10 WU/h		

AH LIM Motor Company
#01-09, AMK Autopoint, 10 Ang
Mo Kio Ind. Park 2A
568047

Claim Reference:

Assessment number: SDA9638Z

Version: 1712

Date calculated: 01/03/2019 11:32 AM

Full Report

Registration: SDA9638Z

Printed: 01/03/2019 11:33 AM

Material Cost - Paint

New Part Painting
 New Part Painting - Plastic K1R
 Repair Painting
 Material-constant Metal Preparation
 Material-constant Plastic
Total

Price SGD

45.92
 26.57
 42.67
 28.60
 9.00
152.76

Spare Parts

Code	Description	Part Number	Supplier	prices as at 2015-06-01	
					Price SGD
1480	R/F DOOR MODULE	176 720 6600			350.00 ?
1482	RIGHT FRONT DOOR	176 720 0205		B1	950.00 ✓
1488	R/F UPPER DOOR HINGE	246 720 1237		n	70.00 X
1496	R/F LOWER DOOR HINGE	246 720 0437		n	85.00 X
1510	R/F DOOR SEAL	204 727 1187		Ne	180.00 ?
1552	R/F WINDOW MOTOR	246 906 5200			330.00 ?
1578	R/F DOOR LOCK	166 720 0235		n	190.00 X
1714	R/F DOOR TRIM	176 720 0800 9J00		Sm	555.00 X
2208	R/SILL PANEL COVER	246 698 0654 9999		CM	250.00 —
1000	SIDE SKIRT CLIPS	123		Ne	100.00 ✓
f: OEM Parts					Savings 0.00
n: Non-OEM Parts					Subtotal 3,060.00
u: Used parts					Addition(+15.00%) 459.00
					Sundry Parts(+2.0%) 2.30
Total					3,521.30

Extras

Code	Description	Price SGD
1001	TRANS DOOR FITTING	80.00* 601
1002	RESET & DIAGNOSE	180.00* ?
1003	FULL WRAP STICKER	1,800.00* (Bill) X?
Total Extras		2,060.00

AH LIM Motor Company
#01-09, AMK Autopoint, 10 Ang
Mo Kio Ind. Park 2A
568047

Claim Reference:

Assessment number: SDA9638Z

Version: 1712

Date calculated: 01/03/2019 11:32 AM

Full Report

Registration: SDA9638Z

Printed: 01/03/2019 11:33 AM

Final Calculation

	SGD	SGD
Parts	3,060.00	
Addition(+15.00%)	459.00	
Sundry Parts(+2.0%)	2.30	
Total Parts		3,521.30
Labour Time Base 10 WU/h		
Total 130.0 WU X 45.00 SGD/h	585.00	
Total of Labour		585.00
Total Of Extras		2,060.00
Paint Work Time Base 10 WU/h		
Labour Cost 91.0 WU X 45.00 SGD/h	409.50	
Material Cost	152.76	
Total Paint Including Material		562.26
Repair Cost Excludes GST		6,728.56
GST (+7.0%)		471.00
Repair Cost Included GST		7,199.56

Comments

* - USER SUPPLIED DATA

NN - NO MANUFACTURERS CODE EXISTS

) - WU PARTIAL INCL IN OTHER POSITIONS