

ASS. REC. BY

REF:

CS/FCI19000307/10302

Special Instructions:

Surveyor

CWS

Hue Jee

ASSIGNMENT (Office)

From (Person):

Joanne Yong

of

FCI

Date/Time:

4/1/19 @ 6:06pm

Estimated Cost:

Bill to:

OD/TP

FWS/TP RES/OD RES/EVA/INV/MV/CS

To Inspect Vehicle No:

SLH 7150 U

Insured:

8HC2787P

at Workshop in/s

World Auto

Tel:

6362 1776

of

No.1 Krnji Jomp

Policy No:

Claim No:

D19000225MFST

Sum Insured:

Excess:

Make of Veh:

(Client's Record)

D.O.A.

3/1/19

CA / REV / REP. / REV 24 HRS

Wp

H.O.D. Endorsement:

Date/Time:

9:34am 9/1/19

Person Contacted:

Ainee

Vehicle IN/OUT

Date/Time

Action/Instruction (✓) Estimate

SLH 7150P-X

8HC2787P-CS/FCI/2019958/9/13

Joanne Y

8/1/2019

- 4:58pm - Revised preli advice via email.

Hwee Jia

REF: FCI

ASSIGNMENT

From: Date: 7/1/19

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No: SLH 7150PU

at Workshop n/s: world auto

of: No. 1 Kranji Jct

Insured:

Policy No:

Claims No:


Sum Insured: Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

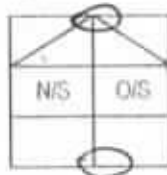

Bal. or Market Value:

IDAC Accident Report: Consistent? Yes or No

GIA / PR Seen: Consistent? Yes or No

Est. Repairs: days Res: Yes or No

Lum Sum: % 3 Val: Yes or No

CA / REV / REP. / 24 HRS ^{up}

Date: Person Contacted:

Vehicle: IN / OUT

Veh No: SLH 7150PU Yr Regd: 16 Nov 2016

Type: Motor / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Honda Vezel CC 1496

Colour: Red AC: Insured / Std / NI / NA

Sp. Reading: 212389 T/Radio: Insured / Std / NI / NA

Eng/No:

ChNo: RV31213261

Gen. Cond: Good / Fair / Poor / BurntSteering: In order / Jammed / Leaked / Burnt orBrake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 215/60 R16

R: -

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Giti

Front

Rear

R/Bal: 6 mm

R/Bal: 6 mm

L/Bal: 6 mm

L/Bal: 6 mm

D.O.A: 3/1/19

D.O.L: 7/1/19

Survey held at: World Auto

Des. of Damages: Fit / Rea / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

Finalised at \$20,957.38, 7 days. Cred: 1453.32% (41%)

RECEIVED 23 JUL 2019

Date/Time: File Pass to?

19/7 Typist

Date/Time: File Return to?

2)

☐: Preli. Report☒: Final Report

Days Of Repair: 7

Resurvey No. of Trip: 1

Add Fee: ☐: Site Insp (\$)☐: Interview (\$)☐: Tech. Invs (\$)☐: Weekend (\$)

Survey Fee:

Transportation:

) 3 + RS: \$1

) Photos:

) Other:

25x15=375

170+375

50

50

146

791

Report Format:

Lump Sum / I.B. (\$ 20,957.38)

TP

550
800
24/7/19

CPL

MOTOR SURVEY ASSIGNMENT

Date

4/1/19

Our Ref No.

SHC2787P

Accident Date

3/1/19

Claim Type.

TP

Insured Vehicle

SHC2787P

Third Party Vehicle.

SLH7150U

Survey Location

No.1 Kranji Loop S'pore 739535

Contact Person.

Contact No.

6362 1776

Fax No. - Nil-

Survey Type

without prejudice

Appointed

Surveyor

Lkh

Contact Person

Contact Number.

6256 3561

Fax No. 68416315

FOR DIRECT SETTLEMENT

Please submit to us the Tax Invoice together with letter of claim for Rental OR Loss of use (based on NIMA Benchmark rates) together with your survey report.

Cc : Workshop

World Auto Pte Ltd

Attention.

Daniel

Cc : TP Solicitor

- Nil -

TP Solicitor Fax No.

- Nil -

Officer Incharge

Joanne Yong

IMPORTANT NOTE

Kindly submit the survey report via CWS within 14 days for survey assignment and 7 days for re-inspection.

This is a computer generated letter, no signature required.

Denise Tay (LKKAUTO)

From: Teo Swee Keong <TeoSweeKeong@msfirstcapital.com.sg>
Sent: Tuesday, 23 July 2019 9:46 AM
To: Denise Tay (LKKAUTO); Admin-D (LKKAUTO); assignments
Cc: Joanne Yong; SUR
Subject: RE: NEW SURVEY ASSIGNMENT - SLH7150U DOA 03-01-19 OUR REF: SHC2787P

Dear LKK

Our Claim ref no: D19000225MFSH

Thanks and Regards,

SK Teo
Motor Claims Dept

MS First Capital Insurance Ltd | 36 Robinson Road #16-01 City House Singapore 068877 | DID : 6507 3848 | Fax No. : 6507 3849 |

A Member of **MS&AD** INSURANCE GROUP

Personal Data Protection Act 2012 ("PDPA"):

Under the PDPA, there are various requirements that regulate the processing of your personal data.

Please refer to www.msfirstcapital.com.sg for details of PDPA Personal Data Collection Statement.

Confidentiality Notice: This e-mail is confidential. It may also be legally privileged.

If you are not the addressee or to whom it is intended, you may not copy, forward, disclose or use any part of it.

If you have received this message in error, please delete the message and all copies from your system and notify the sender immediately by return e-mail.

From: Denise Tay (LKKAUTO) <denisetay@lkkauto.com>
Sent: Monday, July 22, 2019 9:43 AM
To: Admin-D (LKKAUTO) <admin-d@lkkauto.com>; Teo Swee Keong <TeoSweeKeong@msfirstcapital.com.sg>; assignments <assignments@lkkauto.com>
Cc: Joanne Yong <Joanneyong@msfirstcapital.com.sg>; SUR <sur@lkkauto.com>
Subject: RE: NEW SURVEY ASSIGNMENT - SLH7150U DOA 03-01-19 OUR REF: SHC2787P

Dear Sir,

Please provide claim number.

Best Regards,

Denise Tay | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Denise Tay (LKKAUTO) <denisetay@lkkauto.com>
Sent: Tuesday, 8 January 2019 4:58 PM
To: Admin-D (LKKAUTO) <admin-d@lkkauto.com>; 'Teo Swee Keong' <TeoSweeKeong@msfirstcapital.com.sg>;

Denise Tay (LKKAUTO)

From: Denise Tay (LKKAUTO)
Sent: Tuesday, 8 January 2019 4:58 PM
To: Admin-D (LKKAUTO); 'Teo Swee Keong'; assignments
Cc: 'Joanne Yong Lai fong'; SUR
Subject: RE: NEW SURVEY ASSIGNMENT - SLH7150U DOA 03-01-19 OUR REF: SHC2787P
Attachments: PRELI ADVISED SLH 7150P.pdf

Dear Sir/Madam,

Enclosed preliminary revised of vehicle **SLH 7150P**

Please provide your ref no.

Best Regards,

Denise Tay | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: denisetay@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Admin-D (LKKAUTO)
Sent: Monday, 7 January 2019 9:39 AM
To: 'Teo Swee Keong' <TeoSweeKeong@msfirstcapital.com.sg>; assignments <assignments@lkkauto.com>
Cc: 'Joanne Yong Lai fong' <Joanneyong@msfirstcapital.com.sg>; SUR <sur@lkkauto.com>
Subject: RE: NEW SURVEY ASSIGNMENT - SLH7150U DOA 03-01-19 OUR REF: SHC2787P

Dear Sir/Mdm,

Thank you for the assignment.

BEST REGARDS,

G.Nivitha | Admin

LKK Auto Consultants Pte Ltd

Phone: 6841-1972 | email: assignments@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Teo Swee Keong [<mailto:TeoSweeKeong@msfirstcapital.com.sg>]
Sent: Friday, 4 January 2019 6:06 PM
To: 'assignments@lkkauto.com' <assignments@lkkauto.com>
Cc: Joanne Yong Lai fong <Joanneyong@msfirstcapital.com.sg>
Subject: NEW SURVEY ASSIGNMENT - SLH7150U DOA 03-01-19 OUR REF: SHC2787P

Dear Sirs

Denise Tay (LKKAUTO)

From: tgttan@worldauto.com.sg
Sent: Friday, 19 July 2019 1:19 PM
To: Denise Tay (LKKAUTO)
Subject: RE: SLH7150U Honda Vezel Hybrid Finalise DOA: 03/01/2019

Hi Denise

Confirmed finalised at \$20,957.88 and 7 repair days.

Rdgs
Sophia

From: Denise Tay (LKKAUTO) <denisetay@lkkauto.com>
Sent: Thursday, 18 July 2019 5:41 PM
To: Celine Fong (LKKAUTO) <celinefong@lkkauto.com>; tgttan@worldauto.com.sg
Subject: RE: SLH7150U Honda Vezel Hybrid Finalise DOA: 03/01/2019

Dear Sophia,

Finalized at \$20,957.88, 7 Days

Please check and revert.

Best Regards,

Denise Tay | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Celine Fong (LKKAUTO)
Sent: Thursday, 18 July 2019 5:00 PM
To: tgttan@worldauto.com.sg; Denise Tay (LKKAUTO) <denisetay@lkkauto.com>
Subject: RE: SLH7150U Honda Vezel Hybrid Finalise DOA: 03/01/2019

Dear Sophia,

Thank you for the email.

Dear Denise,

As spoken, please assist to send the finalisation to Sophia.

Best Regards,

Celine Fong

LKK Auto Consultants Pte Ltd



Auto
Consultants
Pte Ltd

51 UBI AVE 1, #01-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 62564315

Your Ref: -

Date: 08/01/2018

Our Ref: CS/FC119000307/Jtd3

The Motor Claims Department
First Capital Insurance Ltd

Dear Sir/Madam,

INITIAL INSPECTION REPORT OF VEHICLE NO. SLH 7150P

Please be informed that we had conducted the inspection of the above mentioned vehicle
07/01/2019 at the premises of M/s World Auto have the following to report: -

Workshop Estimate Amount	: S\$ 31,426.20
Revised Estimate Amount	: S\$ 14,348.60
"Check" Items Amount	: S\$ 7,795.60
Market Value	: S\$ _____
LTA Reimbursement Value	: S\$ _____
Nett Value	: S\$ _____

Description of Damage:

The vehicle sustained damages at the front and rear portion.



Comments/ Present Status:

Damages Consistent.

Yours faithfully

Hwee Jie

Automotive Assessor

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT	
Date Of Report	04/01/2019 10:28
Date Of Accident	03/01/2019 13:40
Exact Location Of Accident	PIE & CHANGI AIRPORT
Country/State of Loss	SINGAPORE
DETAILS OF OWN VEHICLE	
Vehicle Registration Number	SLH7150U
Insured/Policyholder	
Name Of Registered Owner	LCRF PTE LTD
Co Reg No	201624597K
Email Address	NOEMAIL
Mobile Phone No	
Alternative Phone No	OFFICE-62414992
Vehicle Particulars	
Manufacturer	HONDA
Model	VEZEL-1.5 HYBRID (A)
Exact Purpose for which vehicle was being used at time of accident	
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	PRIVATE HIRE
Insurance Company	
Name of Insurance Company	AIG ASIA PACIFIC INSURANCE PTE. LTD.
Type Of Coverage	COMPREHENSIVE
Fleet Policy	YES
Policy Number	999994967
Cover Note Number	
Driver	
Name of Driver	HUAN PENG KIAN
NRIC No	S7329733H
Date Of Birth	22/08/1973
Occupation	OUTDOOR
Date Of Driving Pass	07/08/1997
Driving Experience	21 YEARS AND 4 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-90486163
Fax Number	
Contact Number	
EEmail Address	NOEMAIL

Address	NOADDRESS
Postcode	
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	PAID DRIVER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	CHAIN COLLISION
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles (including own vehicle) involved in the accident	4
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	2
Passenger 1	NAME: : UNKNOWN GENDER: : MALE

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

PLEASE SEE ATTACHED SKETCH

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	YES
Remarks/ Reasons:	VIDEO OVERWRITTEN
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SHC2787P
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	TAXI
Name of Driver	
NRIC/Passport Number	
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	

No. Of Passenger (Including Driver)

DETAILS OF OTHER VEHICLE PROPERTY 2

Vehicle Registration Number SMF4680A
Vehicle Make/Model/Colour
Details Of Properties
Vehicle Category PRIVATE CAR
Name of Driver
NRIC/Passport Number
Contact Number
Address
Postcode
Insurance Company Name
Nature Of Damage
No. Of Passenger (Including Driver)

DETAILS OF OTHER VEHICLE PROPERTY 3

Vehicle Registration Number SJA7289P
Vehicle Make/Model/Colour
Details Of Properties
Vehicle Category PRIVATE CAR
Name of Driver
NRIC/Passport Number
Contact Number
Address
Postcode
Insurance Company Name
Nature Of Damage
No. Of Passenger (Including Driver)

Sketch Plan

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorized Driver.
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false report may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available if/when.
8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

 - (i) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this Form and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firm, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelops/airmail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims, (collectively the "Purposes")
 - (ii) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firm, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
 - (iii) my Personal Information may/are be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.


Policyholder's Signature / Date & Time



Driver's Signature (If driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel

Sketch Plan

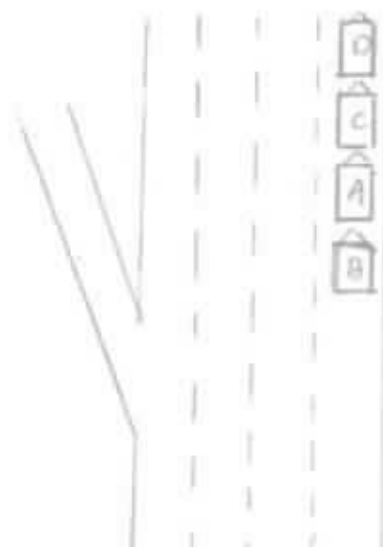

- A. SLH 71504
- B. SHC 2787P
- C. SMF 4680A
- D. SJA 7289P

Sketch Plan #2

Describe Circumstances of the Accident

03.01.2019 at 13:40 hours have accident
AT PIE TOWARDS CHANG ANPODI NEAR
BIDGE BEX BMD.

TOTAL 4 CARS INVOLVED, 3 CAR AT 3RD CAR
1ST CAR STOP AND THE 2ND CAR ALSO
STOP AND I TRY TO STOP AT THE CAR
BEHIND THE BEND WAS -

1ST CAR	- SJA 7289 P
2ND	- SMF 4680 A
3RD	- GLH 7160 U
4TH	- SHC 2787 P

Declaration

We declare the foregoing particulars are true in every respect.


Policyholder's Signature / Date & Time



Driver's Signature (if driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel

Sketch Plan #3

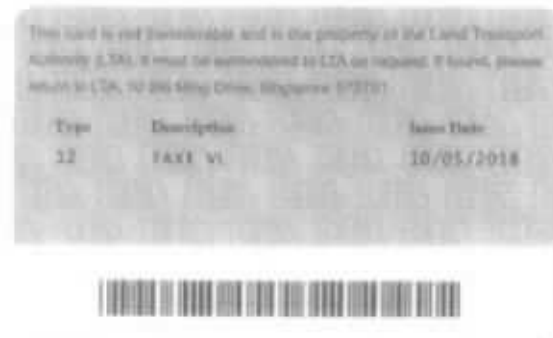



Individual Statement



DEALS TO OVER 60
DESTINATIONS

ALL-IN FARE FROM

\$56*

ScootBiz from \$177*

Book Now

*Terms & conditions apply



HONDA VEZEL

Price Range

Depreciation

2016

Vehicle Type

Advanced
Search

Home » Used Cars » AA Trust Automotive » Honda Vezel Hybrid 1.5A X

Honda Vezel Hybrid 1.5A X

Overview

Financial

Insurance

Accessories

Similar

Research

Photos

Map



Price	\$83,800	Fuel Type	Petrol-Electric
Depreciation ⓘ	\$11,100 /yr View models with similar depre	Reg Date	04-Nov-2016 (7yrs 3mths 25days COE left)
Mileage	N.A.	Manufactured ⓘ	2016
Road Tax ⓘ	N.A.	Transmission	Auto
Dereg Value ⓘ	\$45,427 as of today (change)	OMV ⓘ	\$26,057
COE ⓘ	\$56,889	ARF ⓘ	\$5,000
Engine Cap	1,496 cc	No. of Owners ⓘ	1
Curb Weight ⓘ	1,280 kg		
Type of Vehicle	SUV		

Features

1.5L Hybrid I-VECTEC Engine, 7 Speed Dual Clutch Auto With Paddle Shifters, Airbags, ABS, Electric Park Brake, Cruise Control, Keyless Entry/Start/Stop. View specs of the Honda Vezel Hybrid (2014)

Accessories

Leather Seats, Sports Rims, Touch Screen DVD Player, Steering Controls, Reverse Camera And Sensors And Solar Film.

Description

1 Owner! AA Trust Certified Quality Vehicle! Very Well Maintained By One Single Owner Only! Low Maintenance And Fuel Efficiency. Striking Red Exterior And Black Leather Interior! Spacious Legroom And Boot Space For All! Flexible Bank Or In House Loan Available! Trade In Welcome! Hurry Down Now Before It's Gone! Category

Category

PARF Car, Hybrid Cars

Status

Available

Resources



Vehicle Evaluation

Afraid of lemons? Request to have this car evaluated professionally. Find out more



Car Valuation - Free

Find out the market value of your existing car for free. Get started


Post a car
Compare

dated on: 09-Jul-2019



Price Chart

Summary

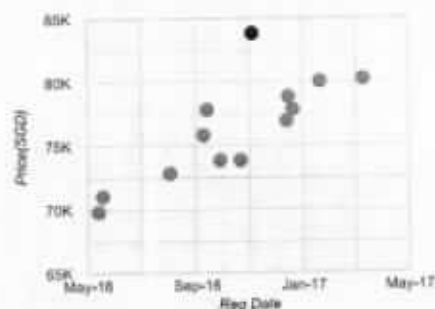

Click on the point to view the vehicle

Shortlist

Compare

Add note

Report Error

More Actions

Seller Information

Company	AA Trust Automotive	
	• dealer's pricelist	
	• 72 vehs sold 98 vehs available	
	★ PREMIUM DEALER 2015 ★	
Address	73 Mackenzie Road Lot 03/04/07/08	
	Search cars nearby this location	
Location	Mackenzie Used Car Centre	
Office No	63450381	
Contact Person(s)	Willey	91632071
	Clement	93365036
	Andra	92221331
	Dave	98500051



Enjoy rates from 3.7% p.a. (EIR 7% p.a.) and S\$0 p.m.
Plus S\$100 cash back (online exclusive) when apply

HONDA VEZEL Price Range Depreciation 2016 Vehicle Type

Advanced Search

Home » Used Cars » Zion Auto Gallery » Honda Vezel 1.5A X

Honda Vezel 1.5A X

[Overview](#) [Financial](#) [Insurance](#) [Accessories](#) [Similar](#) [Research](#) [Photos](#) [Map](#)

PREMIUM AD

Price	\$67,800		
Depreciation	\$8,530 /yr View models with similar depre	Reg Date	25-Nov-2016 (7yrs 4mths 15days COE left)
Mileage	54,000 km (20.6k /yr)	Manufactured	2016
Road Tax	\$682 /yr	Transmission	Auto
Dereg Value	\$46,166 as of today (change)	OMV	\$19,704
COE	\$52,668	ARF	\$9,704
Engine Cap	1,496 cc	Power	96.0 kW (128 bhp)
Curb Weight	1,190 kg	No. of Owners	1
Type of Vehicle	SUV		



Features

Powerful 1.5L I-VTEC Engine Producing 128 Bhp, Earth Dream Technology, Keyless Entry/Start/Auto Brake Hold, Cruise Control, Electric Park Brake. View specs of the Honda Vezel (2014)

Accessories

Leather Seats, Solar Firm, Sports Rims, Pioneer Audio System With AUX, Reverse Camera, Keyless Entry/Start/Stop, Etc.

Description

New Arrive 100% Loan Available, Only 1 Owner Upgraded To Mercedes Benz, Very Well Kept, Come With 6 Months Warranty And Free Servicing. Striking Blue Paint With Black Leather Interiors. Low Maintenance Cost, Bank Loan Available, Trade In Are Welcome, Call Now To Make To View.

Category

PARF Car, Premium Ad Car

Status

Available

Resources



Vehicle Evaluation

Afraid of lemons? Request to have this car evaluated professionally. Find out more




Car Valuation - Free

Find out the market value of your existing car for free. Get started

Price Chart

Summary

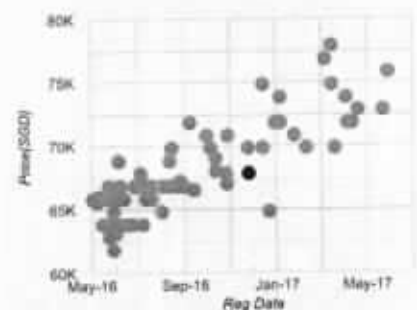

[Shortlist](#)
[Compare](#)
[Add note](#)
[Report Error](#)
[More Actions](#)

Seller Information

Company

Zion Auto Gallery

• dealer's pricelist
• 6 vehs sold | 11 vehs available

Address

159 Sin Ming Road #01-01
[Search cars nearby this location](#)

Posted on: 01-Jul-2019 | Last Updated on: 01-Jul-2019

Upfront Payment:

[+ more Financial Info](#)

Transfer Fee	\$25
Down Payment	\$20,340 (change)
1s Compare	\$683 est. rate



Reg No: 52977287 J

CASH SALE/WORK ORDER
迅速拖車服務
SPEEDWAY RECOVERY SERVICE

Singapore Post Centre Post Office P.O. Box 201 Singapore 914007

Tel: 6841 0080

No: B 23952

Date: 3/1/19

Name/Company World Auto

Vehicle No. SUH 7150 U Model VEZEL

From Pit -> Changi Before Bedok North

To Kranji Loop

Remarks 90486163

Time:

1	4	:	0	4	-	1	1	:	1	5	-	1	5	:	1	0
---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---

- ☐ Jump Start
- ☐ Tyre Replacement
- ☒ Accident/Breakdown
- ☐ Muff/Basement
- ☐ With Load/Cargo Box
- ☐ King Dolly
- ☐ Transport Charge
- ☐ Low Body Kit
- ☐ Door Opening Service
- ☐ Crane Up/Winch Out
- ☐ Collect Doc/Key
- ☐ Repo Payment
- ☐ Trips

Amount \$ 60

NOTE: Vehicle is towed at owner's risk. The Company accepts no responsibility for damages or other misadventure to your vehicle whilst being towed.

Tow Truck WIC

24 HRS TOWING SERVICE
6841 0080

www.speedwayrecovery.com
Email: speedwaytowing@gmail.com

Received By [Signature]

WORLD AUTO PTE LTD

47 Jalan Pemimpin #01-02/03

Halcyon 2, S'pore 577200

Tel No. : 6451 3933 Fax No. : 6455 7576

E-Mail : worldaut@singnet.com.sg

Website : www.worldauto.com.sg

Tax Reg. No. : 200006765-H Buss. Reg. No. : 200006765H

MS FIRST CAPITAL INSSURANCE LIMITED

6 RAFFLES QUAY,

#21-00 048580

Attention : Motor Claim Department

Contact : 6222 2311 Fax No. : 6222 3547

Estimate : ES000004

Date : 04/01/2019

Vehicle Num. : SLH 7150U (LCR)

Make/Model : HONDA VEZEL HYBRID

Chassis/Eng# :

Accident Date : 03/01/2019

Claim No. :

Reference : AINEE

Policy No. :

S/N	Quantity	Particular	Unit Price	Amount S\$
LIST ITEMS :				
1.	CTBA(1)	FRONT WINDSCREEN GLASS CRA	2000	2,250.00 ✓
2.	1	FRONT WINDSCREEN MOULDING NEC		250.00 ✓
3.	1	FRONT BONNET BUC	750	1,100.00 ✓
4.	2	* FRONT BONNET HINGE DEF	110.00	220.00 ✓
5.	1	* FRONT BONNET INSULATOR BUC		220.00 ✓
6.	1	FRONT BONNET STAY BAR b1		100.00 ✓
7.	1	FRONT BONNET INNER RUBBER MOULDING X NN		230.00 X
8.	1	FRONT BONNET LOCK b1		210.00 ✓
9.	1	FRONT BONNET LOCK CABLE X NN		90.00 X
10.	1	FRONT BONNET RUBBER MOULDING X NN		130.00 X
11.	2	FRONT BONNET STOPPER X NN	75.00	150.00 X
12.	1	FRONT RADIATOR GRILLE EMBLEM	30	400.00 ✓
13.	1	FRONT RADIATOR GRILLE BASE		360.00 ✓
14.	1	FRONT RADIATOR GRILLE CHROME		380.00 ✓
15.	1	FRONT RADIATOR GRILLE CHROME STRIP	80	480.00 ✓
16.	2(LED)	* FRONT HEADLAMP ASSY	1,850.00	3,700.00 ✓
17.	2	FRONT HEADLAMP LOWER BRACKET C-4	78.00	156.00 ✓
18.	2	FRONT HEADLAMP TOP BRACKET C-4	68.00	136.00 ✓
19.	1	FRONT BUMPER DD		900.00 ✓
20.	1	FRONT BUMPER TOW COVER DD		89.00 ✓
21.	2	FRONT BUMPER RETAINER d1	89.00	178.00 ✓
22.	1	* FRONT BUMPER LOWER GRILLE CUT		118.00 ✓
23.	1	FRONT LOWER BUMPER DD		300.00 ✓
24.	1	* FRONT BUMPER REINFORCEMENT DD		450.00 ✓
25.	2	FOG LAMP ASSY X NN	315.00	630.00 X
26.	2	FOG LAMP BRACKET X NN	65.00	130.00 X
27.	2	* FOG LAMP COVER SCR	68.00	136.00 ✓
28.	1	RADIATOR b1	1100	1,450.00 ✓
29.	1	RADIATOR FAN BLADE ASSY X NN		99.00 X

CONTINUE / ...

WORLD AUTO PTE LTD

47 Jalan Pemimpin #01-02/03
 Halcyon 2, S'pore 577200
 Tel No. : 6451 3933 Fax No. : 6455 7576
 E-Mail : worldaut@singnet.com.sg
 Website : www.worldauto.com.sg
 Tax Reg. No. : 200006765-H Buss. Reg. No. : 200006765H

MS FIRST CAPITAL INSURANCE LIMITED
 6 RAFFLES QUAY,
 #21-00 048580

Attention : Motor Claim Department
 Contact : 6222 2311 Fax No. : 6222 3547

Estimate : ES000004

Date : 04/01/2019
 Vehicle Num. : SLH 7150U (LCR)
 Make/Model : HONDA VEZEL HYBRID
 Chassis/Eng# :
 Accident Date : 03/01/2019
 Claim No. :
 Reference : AINEE
 Policy No. :

S/N	Quantity	Particular	Unit Price	Amount S\$
30.	1	RADIATOR FAN MOTOR <i>X NN</i>		440.00 <i>X</i>
31.	1	RADIATOR FAN COWLING <i>ana</i>		210.00 <i>✓</i>
32.	1	CONDENSER ASSY <i>bt</i>	650.00	650.00 <i>✓</i>
33.	1	CONDENSER FAN BLADE <i>cut</i>		80.00 <i>✓</i>
34.	1	CONDENSER FAN COWLING <i>an</i>		180.00 <i>✓</i>
35.	1	CONDENSER FAN MOTOR <i>an</i>		350.00 <i>✓</i>
36.	1	AIRCON RECEIVER PIPE <i>X NN</i>		170.00 <i>X</i>
37.	2	RADIATOR AIR GUIDE <i>X NN</i>	30.00	60.00 <i>X</i>
38.	1	RADIATOR SPARE TANK <i>de X NN</i>		60.00 <i>X</i>
39.	1	RADIATOR SPARE TANK CAP <i>X NN</i>		15.00 <i>X</i>
40.	1	WIPER WASHER MOTOR <i>X NN</i>		130.00 <i>X</i>
41.	1	WIPER WASHER TANK ASSY <i>de</i>		100.00 <i>✓</i>
42.	1	AIR RESONATOR <i>X NN</i>		150.00 <i>X</i>
43.	1	AIR INTAKE AIR DUCT <i>an</i>		57.00 <i>✓</i>
44.	1	AIR INTAKE AIR DUCT TUBE <i>X NN</i>		57.00 <i>X</i>
45.	1	FRONT CENTER LOCK BRACKET <i>bt</i>		38.00 <i>✓</i>
46.	1	FRONT SUPPORT PANEL <i>bt</i>		672.80 <i>✓</i>
47.	1	FRONT SUPPORT PANEL TOP GARNISH <i>de</i>		94.00 <i>✓</i>
48.	1	INTAKE MANIFOLD BREATHER HOSE <i>cut</i>		28.50 <i>✓</i>
49.	1	RADIATOR OUTLET JOINT HOSE <i>X NN</i>		72.20 <i>X</i>
50.	1	BATTERY TRAY <i>NN</i>		100.00 <i>X</i>
51.	1	BATTERY TRAY BRACKET <i>NN</i>		90.00 <i>X</i>
52.	1	INTAKE MANIFOLD <i>an</i>		576.00 <i>✓</i>
53.	1	REAR BOOT LID <i>DD</i>	1200.00	1,200.00 <i>✓</i>
54.	1	REAR BOOT LOCK ASSY <i>NN</i>		300.00 <i>X</i>
55.	1	REAR WINDSCREEN GLASS MOULDING <i>NEC</i>		250.00 <i>✓</i>
56.	1	REAR BOOT HYBRID EMBLEM (VEZEL) <i>NEC</i>	56.00	56.00 <i>✓</i>
57.	1	REAR BOOT VEZEL EMBLEM (VEZEL) <i>NEC</i>	56.00	56.00 <i>✓</i>
58.	2	REAR BOOT REFLECTOR LAMP <i>NN</i>	580.00	1,160.00 <i>X</i>
59.	1	REAR BUMPER <i>90</i>		900.00 <i>✓</i>
60.	1	REAR END PANEL <i>Rx</i>		680.00 <i>X</i>

CONTINUE / ...

WORLD AUTO PTE LTD

47 Jalan Pemimpin #01-02/03

Halcyon 2, S'pore 577200

Tel No. : 6451 3933 Fax No. : 6455 7576

E-Mail : worldaut@singnet.com.sg

Website : www.worldauto.com.sg

Tax Reg. No. : 200006765-H Buss. Reg. No. : 200006765H

MS FIRST CAPITAL INSSURANCE LIMITED

6 RAFFLES QUAY,

#21-00 048580

Attention : Motor Claim Department

Contact : 6222 2311 Fax No. : 6222 3547

Estimate : ES000004

Date : 04/01/2019

Vehicle Num. : SLH 7150U (LCR)

Make/Model : HONDA VEZEL HYBRID

Chassis/Eng# :


Accident Date : 03/01/2019

Claim No. :

Reference : AINEE

Policy No. :

S/N	Quantity	Particular	Unit Price	Amount S\$
61.	1	REAR END PANEL TOP GARNISH X NH		260.00 X
62.	(	REAR BOOT WEATHER STRIP NH		180.00 X
63.	2	REAR TAIL LAMP NH	580.00	1,160.00 X
64.	3	* REAR BUMPER REFLECTOR LENS (LH) CRA	180.00	140 360.00 ✓
List Total S\$:				26,150.50
20.00% Discount S\$:				5,230.10
				20,920.40
SPECIAL NETT ITEMS :				
1.	1	FRONT WINDSCREEN SEALANT NEC	60	100.00 ✓
2.	1	PRIVATE HIRE DECAL NEC		20.00 ✓
3.	1	IU BRACKET NEC		155.80 ✓
4.	1	FRONT BONNET INSULATOR CLIP NEC	30	40.00 ✓
5.	1	FRONT BONNET STAY BAR CLIP NEC	20	40.00 ✓
6.	1	FRONT BUMPER CLIP NEC	30	40.00 ✓
7.	1	FRONT NUMBER PLATE WITH CASING MIS		40.00 ✓
8.	1	FRONT SUPPORT PANEL TOP GARNISH CLIPS NEC	30	40.00 ✓
9.	1	BATTERY NH		210.00 X
10.	1	COOLANT ✓ NEC	50	100.00 ✓
11.	1	AIRCON GAS ✓ NEC	50	120.00 ✓
12.	1	TOWING CHARGE	60	60.00 ✓
13.	1	REAR WINDSCREEN SEALANT NEC	60	100.00 ✓
14.	1	REAR BUMPER CLIP NEC	30	40.00 ✓
15.	1	REAR END PANEL TOP GARNISH CLIPS NH		40.00 X
16.	1	REVERSE SENSOR Shorted	200	280.00 ✓
17.	2	REAR TAILLAMP CLIPS NH	40.00	80.00 X
Special Nett Total S\$:				1,505.80
LABOUR :				
REMOVE AND REPLACE FRONT WINDSCREEN GLASS				120 180.00

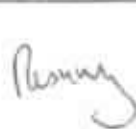

 4/1/19 @ 330pm CONTINUE / ...

WORLD AUTO PTE LTD

47 Jalan Pemimpin #01-02/03
 Halcyon 2, S'pore 577200
 Tel No. : 6451 3933 Fax No. : 6455 7576
 E-Mail : worldaut@singnet.com.sg
 Website : www.worldauto.com.sg
 Tax Reg. No. : 200006765-H Buss. Reg. No. : 200006765H

MS FIRST CAPITAL INSSURANCE LIMITED
 6 RAFFLES QUAY,
 #21-00 048580

Attention : Motor Claim Department
 Contact : 6222 2311 Fax No. : 6222 3547

Estimate : ES000004

Date : 04/01/2019
 Vehicle Num. : SLH 7150U (LCR)
 Make/Model : HONDA VEZEL HYBRID
 Chassis/Eng# :
 Accident Date : 03/01/2019
 Claim No. :
 Reference : AINEE
 Policy No. :

S/N	Quantity	Particular	Unit Price	Amount S\$
-----	----------	------------	------------	------------

TO APPLY RUSTPROOFING/ TUFFCOATING TREATMENT TO
 REPLACED PARTS.

60 180.00

SEND VEHICLE TO INSPECTION CENTRA FOR PRIVATE HIRER
 DECAL PASTING

100 180.00

SEND VEHICLE TO INSPECTION CENTRA FOR IU INSPECTION &
 REGISTRATION OF IU.

50 180.00

TO DISMANTLE FRONT DAMAGE PARTS, CUT AND WELD FRONT
 PANEL, KNOCK, STRAIGHTEN AND RESHAPE O/S FRONT
 CHASSIS FRAME AND REPLACE RECOMMENDED PARTS.

140 1000
 2200.00

PUTTY AND SPRAY PAINT FRONT AFFECTED AREAS INCLUDING
 (INNER/OUTER)

800 1800.00

AIRCON SYSTEM CHECK AND RECTIFY WHERE NECESSARY
 INCLUDING REPLACING ABOVE AIRCON PARTS AND REFILLING
 AIRCON GAS

60 180.00

ENGINE COOLING SYSTEM CHECK AND RECTIFY WHERE
 NECESSARY INCLUDING REPLACING ABOVE PARTS AND REFILLING
 ENGINE COOLANT

60 180.00

TO APPLY ANTI RUST TREATMENT ON THE REPLACED AND
 REPAIRED PANELS.

100 280.00

TO CHECK WIRES, CONNECTOR, REPLACED DAMAGED HEADLAMPS,
 CHECK AND CONNECTOR AND SOCKET

50 180.00

CONTINUE / ...

WORLD AUTO PTE LTD

47 Jalan Pemimpin #01-02/03

Halcyon 2, S'pore 577200

Tel No. : 6451 3933 Fax No. : 6455 7576

E-Mail : worldaut@singnet.com.sg

Website : www.worldauto.com.sg

Tax Reg. No. : 200006765-H Buss. Reg. No. : 200006765H

MS FIRST CAPITAL INSSURANCE LIMITED

6 RAFFLES QUAY,

#21-00 048580

Attention : Motor Claim Department

Contact : 6222 2311 Fax No. : 6222 3547

Estimate : ES000004

Date : 04/01/2019

Vehicle Num. : SLH 7150U (LCR)

Make/Model : HONDA VEZEL HYBRID

Chassis/Eng# :

Accident Date : 03/01/2019

Claim No. :

Reference : AINEE

Policy No. :

S/N	Quantity	Particular	Unit Price	Amount S\$
		TO DISMANTLE REAR DAMAGE PARTS, CUT AND WELD REAR PANEL, KNOCK, STRAIGHTEN AND RESHAPE O/S REAR CHASSIS FRAME AND REPLACE RECOMMENDED PARTS.	600	1,200.00
		PUTTY AND SPRAY PAINT REAR AFFECTED AREAS INCLUDING (INNER/OUTER)	600	1,000.00
		REMOVE & REFIT REAR WINDSCREEN GLASS	150	150.00
		TO CHECK REAR WIRES, CONNECTORS, REPLACE DAMAGED LAMPS REVERSE SENSORS AND START/STOP UNIT CAPACITORS	30	150.00
		DEACTIVATE HV BATTERY SYSTEM IN ORDER TO FACILITATE REPAIRS AND REACTIVATE BACK SAME. (HV HYBRID SYSTEM SAFETY PROCEDURES)	250	450.00
		PERFORM WHOLE VEHICLE DIAGNOSTICS INCLUDING CLEARING FAULT CODES AND REINITIALISING HV HYBRID SYSTEM FOR POST REPAIRS. (HV HYBRID SYSTEM SAFETY PROCEDURES)	120	450.00
		Labour Total S\$:		9,000.00

E. & O.E.

Total S\$: 31,426.20

39104.20

Hwee Jie - LKK

2/1/19

P/P 7 days

for WORLD AUTO PTE LTD

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

WORLD AUTO PTE LTD

47 Jalan Pemimpin #01-02/03
Halcyon 2, S'pore 577200
Tel No. : 6451 3933 Fax No. : 6455 7576
E-Mail : worldaut@singnet.com.sg
Website : www.worldauto.com.sg
Tax Reg. No. : 200006765-H Buss. Reg. No. : 200006765H

MS FIRST CAPITAL INSURANCE LIMITED
36 ROBINSON RD #16-01 CITY HOUSE
068877

Supplementary Estimate : SE000004

Attention : Motor Claim Department
Contact : 6222 2311 Fax No. : 6222 3547

Date : 03/01/2019
Vehicle Num. : SLH 7150U (LCR)
Make/Model : HONDA VEZEL HYBRID
Chassis/Eng# :
Accident Date : 03/01/2019
Claim No. :
Reference :
Policy No. :

S/N	Quantity	Particular	Unit Price	Amount S\$
		LIST ITEMS :		
1.	1	WIPER WASHER TANK NECK <i>BT</i>		55.00 ✓
2.	1	MILIWAVE RADAR <i>CR A</i>		2,250.00 ✓
3.	1	MILIWAVE RADAR BRACKET <i>BUG</i>	761.80	400 1,730.00 ✓
		List TotalS\$:		4,035.00
		LABOUR :		
		PERFORM MILIWAVE RADAR AIMING AND CALIBRATION	250	450.00 ✓
		Labour Total S\$:		450.00
E. & O.E.			Total S\$:	4,485.00 =====

for WORLD AUTO PTE LTD

Three Lx
17/1/19
[Signature]

Invoice

Tracking number : EG6000803471JP

Date : 11-Dec-17

[illegible]

Celine Fong (LKKAuto)

From: tggtan@worldauto.com.sg
Sent: Wednesday, 12 June 2019 3:37 PM
To: Celine Fong (LKKAuto)
Subject: FW: SLH7150U Honda Vezel Hybrid Finalise DOA: 03/01/2019
Attachments: RADAR BRACKET AIR FREIGHT INVOICE.pdf

Hi Celine

This is the case I spoken to you about.

Thanks
Sophia

From: tggtan@worldauto.com.sg <tggtan@worldauto.com.sg>
Sent: Monday, 10 June 2019 5:49 PM
To: 'kklau@lkkauto.com' <kklau@lkkauto.com>
Subject: FW: SLH7150U Honda Vezel Hybrid Finalise DOA: 03/01/2019

KK

This is the case that I spoke to you about.

Your price is \$400

Our purchase price is \$1050 with no freight charges.

These parts were purchased in 2017 at this price.

The price difference is too vast.

Can you assist?

Thanks again

Sophia

From: daniel@worldauto.com.sg <daniel@worldauto.com.sg>
Sent: Saturday, 8 June 2019 1:28 PM
To: 'Hwee Jie (LKK Auto)' <hweejie@lkkauto.com>
Cc: 'Denise Tay (LKKAuto)' <denisetay@lkkauto.com>; tggtan@worldauto.com.sg; 'Adrian Tan' <adrian22@worldauto.com.sg>
Subject: RE: SLH7150U Honda Vezel Hybrid Finalise DOA: 03/01/2019

Hi Hwee Jie,

Reference made to above matter.

This is the invoice we received for the air freight order in Dec 2017 for the Milimeterwave Radar Bracket.
Kindly look into this.

Thks & Rgds,
Daniel

Insurance practice laban & is basing on the date of accident. we have checked. again, best we can increase to —

parts pricing

WORLD AUTO PTE LTD

47 Jalan Pemimpin #01-02/03
 Halcyon 2, S'pore 577200
 Tel No. : 6451 3933 Fax No. : 6455 7576
 E-Mail : worldaut@singnet.com.sg
 Website : www.worldauto.com.sg
 Tax Reg. No. : 200006765-H Buss. Reg. No. : 200006765H

MS FIRST CAPITAL INSSURANCE LIMITED
 6 RAFFLES QUAY,
 #21-00 048580

Attention : Motor Claim Department
 Contact : 6222 2311 Fax No. : 6222 3547

Estimate : ES000004

Date : 04/01/2019
 Vehicle Num. : SLH 7150U (LCR)
 Make/Model : HONDA VEZEL HYBRID
 Chassis/Eng# :
 Accident Date : 03/01/2019
 Claim No. :
 Reference : AINEE
 Policy No. :

S/N	Quantity	Particular	Unit Price	Amount S\$
LIST ITEMS :				
1.	CTBA(1)	FRONT WINDSCREEN GLASS CRA	1650	2,250.00 ✓
2.	1	FRONT WINDSCREEN MOULDING NEL		250.00 ✓
3.	1	FRONT BONNET BUC	790	4,100.00 ✓
4.	2	* FRONT BONNET HINGE DEF	110.00	170 220.00 ✓
5.	1	* FRONT BONNET INSULATOR BUC		220.00 ✓
6.	1	FRONT BONNET STAY BAR		100.00 ✓
7.	1	FRONT BONNET INNER RUBBER MOULDING		230.00 ✓
8.	1	FRONT BONNET LOCK		210.00 ✓
9.	1	FRONT BONNET LOCK CABLE		90.00 ✓
10.	1	FRONT BONNET RUBBER MOULDING		130.00 ✓
11.	2	FRONT BONNET STOPPER	75.00	150.00 ✓
12.	1	FRONT RADIATOR GRILLE EMBLEM		30 100.00 ✓
13.	1	FRONT RADIATOR GRILLE BASE		360.00 ✓
14.	1	FRONT RADIATOR GRILLE CHROME		380.00 ✓
15.	1	FRONT RADIATOR GRILLE CHROME STRIP		20 180.00 ✓
16.	2(LED)	* FRONT HEADLAMP ASSY	1,850.00	3,700.00 ✓
17.	2	FRONT HEADLAMP LOWER BRACKET	78.00	156.00 ✓
18.	2	FRONT HEADLAMP TOP BRACKET	68.00	136.00 ✓
19.	1	FRONT BUMPER DD		900.00 ✓
20.	1	FRONT BUMPER TOW COVER DEF		89.00 ✓
21.	2	FRONT BUMPER RETAINER	89.00	178.00 ✓
22.	1	* FRONT BUMPER LOWER GRILLE CUT		118.00 ✓
23.	1	FRONT LOWER BUMPER DD		300.00 ✓
24.	1	* FRONT BUMPER REINFORCEMENT DD		320 450.00 ✓
25.	2	FOG LAMP ASSY	315.00	630.00 ✓
26.	2	FOG LAMP BRACKET	65.00	130.00 ✓
27.	2	* FOG LAMP COVER SCR	68.00	136.00 ✓
28.	1	RADIATOR		1,450.00 ✓
29.	1	RADIATOR FAN BLADE ASSY		99.00 ✓

CONTINUE / ...

WORLD AUTO PTE LTD

47 Jalan Pemimpin #01-02/03
 Halcyon 2, S'pore 577200
 Tel No. : 6451 3933 Fax No. : 6455 7576
 E-Mail : worldaut@singnet.com.sg
 Website : www.worldauto.com.sg
 Tax Reg. No. : 200006765-H Buss. Reg. No. : 200006765H

MS FIRST CAPITAL INSSURANCE LIMITED
 6 RAFFLES QUAY,
 #21-00 048580

Attention : Motor Claim Department
 Contact : 6222 2311 Fax No. : 6222 3547

Estimate : ES000004

Date : 04/01/2019
 Vehicle Num. : SLH 7150U (LCR)
 Make/Model : HONDA VEZEL HYBRID
 Chassis/Eng# :
 Accident Date : 03/01/2019
 Claim No. :
 Reference : AINEE
 Policy No. :

S/N	Quantity	Particular	Unit Price	Amount S\$
30.	1	RADIATOR FAN MOTOR		440.00 ?
31.	1	RADIATOR FAN COWLING		210.00 ?
32.	1	CONDENSER ASSY		1,250.00 ?
33.	1	CONDENSER FAN BLADE		80.00 ?
34.	1	CONDENSER FAN COWLING		180.00 ?
35.	1	CONDENSER FAN MOTOR		350.00 ?
36.	1	AIRCON RECEIVER PIPE		170.00 ?
37.	2	RADIATOR AIR GUIDE	30.00	60.00 ?
38.	1	RADIATOR SPARE TANK		60.00 ?
39.	1	RADIATOR SPARE TANK CAP		15.00 ?
40.	1	WIPER WASHER MOTOR		130.00 ?
41.	1	WIPER WASHER TANK ASSY		100.00 ?
42.	1	AIR RESONATOR		150.00 ?
43.	1	AIR INTAKE AIR DUCT		57.00 ?
44.	1	AIR INTAKE AIR DUCT TUBE		57.00 ?
45.	1	FRONT CENTER LOCK BRACKET		38.00 ?
46.	1	FRONT SUPPORT PANEL		672.80 ?
47.	1	FRONT SUPPORT PANEL TOP GARNISH		94.00 ?
48.	1	INTAKE MANIFOLD BREATHER HOSE		28.50 ?
49.	1	RADIATOR OUTLET JOINT HOSE		72.20 ?
50.	1	BATTER TRAY NN		100.00 x
51.	1	BATTER TRAY BRACKET NN		90.00 x
52.	1	INTAKE MANIFOLD		576.00 ?
53.	1	REAR BOOT LID DD		1,300.00 ✓
54.	1	REAR BOOT LOCK ASSY NN		300.00 x
55.	1	REAR WINDSCREEN GLASS MOULDING NEL		250.00 ✓
56.	1	REAR BOOT HYBRID EMBLEM (VEZEL) NEL		89.00 ✓
57.	1	REAR BOOT VEZEL EMBLEM (VEZEL) NEL		89.00 ✓
58.	2	REAR BOOT REFLECTOR LAMP NN	580.00	1,160.00 x
59.	1	REAR BUMPER DD		900.00 ✓
60.	1	REAR END PANEL		680.00 ?

CONTINUE / ...

WORLD AUTO PTE LTD

47 Jalan Pemimpin #01-02/03
 Halcyon 2, S'pore 577200
 Tel No. : 6451 3933 Fax No. : 6455 7576
 E-Mail : worldaut@singnet.com.sg
 Website : www.worldauto.com.sg
 Tax Reg. No. : 200006765-H Buss. Reg. No. : 200006765H

MS FIRST CAPITAL INSSURANCE LIMITED
 6 RAFFLES QUAY,
 #21-00 048580

Attention : Motor Claim Department

Contact : 6222 2311 Fax No. : 6222 3547

Estimate : ES000004

Date : 04/01/2019

Vehicle Num. : SLH 7150U (LCR)

Make/Model : HONDA VEZEL HYBRID

Chassis/Eng# :

Accident Date : 03/01/2019

Claim No. :

Reference : AINEE

Policy No. :

S/N	Quantity	Particular	Unit Price	Amount S\$
61.	1	REAR END PANEL TOP GARNISH		260.00 ?
62.	1	REAR BOOT WEATHER STRIP NN		180.00 X
63.	2	REAR TAIL LAMP NN	580.00	1,160.00 X
64.	1	* REAR BUMPER REFLECTOR LENS (LH) CRA	180.00	140 360.00 ✓
List Total S\$:				26,150.50
20.00% Discount S\$:				5,230.10
				20,920.40
SPECIAL NETT ITEMS :				
1.	1	FRONT WINDSCREEN SEALANT NEC	60	400.00 ✓
2.	1	PRIVATE HIRE DECAL NEC		20.00 ✓
3.	1	IU BRACKET NEC		155.80 ✓
4.	1	FRONT BONNET INSULATOR CLIP NEC	30	40.00 ✓
5.	1	FRONT BONNET STAY BAR CLIP NEC	20	40.00 ✓
6.	1	FRONT BUMPER CLIP NEC	30	40.00 ✓
7.	1	FRONT NUMBER PLATE WITH CASING MIS		40.00 ✓
8.	1	FRONT SUPPORT PANEL TOP GARNISH CLIPS NEC	30	40.00 ✓
9.	1	BATTERY NN		210.00 X
10.	1	COOLANT		100.00 ?
11.	1	AIRCON GAS		120.00 ?
12.	1	TOWING CHARGE	60	60.00 ✓
13.	1	REAR WINDSCREEN SEALANT NEC	60	100.00 ✓
14.	1	REAR BUMPER CLIP NEC	30	40.00 ✓
15.	1	REAR END PANEL TOP GARNISH CLIPS		40.00 ?
16.	1	REVERSE SENSOR Shorted	200	280.00 ✓
17.	2	REAR TAILLAMP CLIPS NN	40.00	80.00 X
Special Nett Total S\$:				1,505.80
LABOUR :				
REMOVE AND REPLACE FRONT WINDSCREEN GLASS				180.00

CONTINUE / ...

WORLD AUTO PTE LTD

47 Jalan Pemimpin #01-02/03
 Halcyon 2, S'pore 577200
 Tel No. : 6451 3933 Fax No. : 6455 7576
 E-Mail : worldaut@singnet.com.sg
 Website : www.worldauto.com.sg
 Tax Reg. No. : 200006765-H Buss. Reg. No. : 200006765H

MS FIRST CAPITAL INSSURANCE LIMITED
 6 RAFFLES QUAY,
 #21-00 048580

Attention : Motor Claim Department
 Contact : 6222 2311 Fax No. : 6222 3547

Estimate : ES000004

Date : 04/01/2019
 Vehicle Num. : SLH 7150U (LCR)
 Make/Model : HONDA VEZEL HYBRID
 Chassis/Eng# :
 Accident Date : 03/01/2019
 Claim No. :
 Reference : AINEE
 Policy No. :

S/N	Quantity	Particular	Unit Price	Amount S\$
		TO APPLY RUSTPROOFING/ TUFFCOATING TREATMENT TO REPLACED PARTS.	60	180.00
		SEND VEHICLE TO INSPECTION CENTRA FOR PRIVATE HIRER DECAL PASTING	100	180.00
		SEND VEHICLE TO INSPECTION CENTRA FOR IU INSPECTION & REGISTRATION OF IU.	80	180.00
		TO DISMANTLE FRONT DAMAGE PARTS, CUT AND WELD FRONT PANEL, KNOCK, STRAIGHTEN AND RESHAPE O/S FRONT CHASSIS FRAME AND REPLACE RECOMMENDED PARTS.	240 1000 2400	2,200.00
		PUTTY AND SPRAY PAINT FRONT AFFECTED AREAS INCLUDING (INNER/OUTER)	800 1800	1,800.00
		AIRCON SYSTEM CHECK AND RECTIFY WHERE NECESSARY INCLUDING REPLACING ABOVE AIRCON PARTS AND REFILLING AIRCON GAS	60	180.00
		ENGINE COOLING SYSTEM CHECK AND RECTIFY WHERE NECESSARY INCLUDING REPLACING ABOVE PARTS AND REFILLING ENGINE COOLANT	60	180.00
		TO APPLY ANTI RUST TREATMENT ON THE REPLACED AND REPAIRED PANELS.	100	280.00
		TO CHECK WIRES, CONNECTOR, REPLACED DAMAGED HEADLAMPS, CHECK AND CONNECTOR AND SOCKET	50	180.00

CONTINUE / ...

WORLD AUTO PTE LTD

47 Jalan Pemimpin #01-02/03
 Halcyon 2, S'pore 577200
 Tel No. : 6451 3933 Fax No. : 6455 7576
 E-Mail : worldaut@singnet.com.sg
 Website : www.worldauto.com.sg
 Tax Reg. No. : 200006765-H Buss. Reg. No. : 200006765H

MS FIRST CAPITAL INSSURANCE LIMITED
 6 RAFFLES QUAY,
 #21-00 048580

Attention : Motor Claim Department
 Contact : 6222 2311 Fax No. : 6222 3547

Estimate : ES000004

Date : 04/01/2019
 Vehicle Num. : SLH 7150U (LCR)
 Make/Model : HONDA VEZEL HYBRID
 Chassis/Eng# :
 Accident Date : 03/01/2019
 Claim No. :
 Reference : AINEE
 Policy No. :

S/N	Quantity	Particular	Unit Price	Amount S\$
		TO DISMANTLE REAR DAMAGE PARTS, CUT AND WELD REAR PANEL, KNOCK, STRAIGHTEN AND RESHAPE O/S REAR CHASSIS FRAME AND REPLACE RECOMMENDED PARTS.	600	1,200.00
		PUTTY AND SPRAY PAINT REAR AFFECTED AREAS INCLUDING (INNER/OUTER)	600	1,000.00
		REMOVE & REFIT REAR WINDSCREEN GLASS	150	180.00
		TO CHECK REAR WIRES, CONNECTORS, REPLACE DAMAGED LAMPS REVERSE SENSORS AND START/STOP UNIT CAPACITORS	30	180.00
		DEACTIVATE HV BATTERY SYSTEM IN ORDER TO FACILITATE REPAIRS AND REACTIVATE BACK SAME. (HV HYBRID SYSTEM SAFETY PROCEDURES)	250	450.00
		PERFORM WHOLE VEHICLE DIAGNOSTICS INCLUDING CLEARING FAULT CODES AND REINITIALISING HV HYBRID SYSTEM FOR POST REPAIRS. (HV HYBRID SYSTEM SAFETY PROCEDURES)	120	450.00
		Labour Total S\$:		9,000.00

E. & O.E.

Total S\$: 31,426.20

=====

[Signature]
 14/1/19

for WORLD AUTO PTE LTD

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Hwee Jie - LKK

2/1/19

P/P 7 days

[Signature]



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD			Ref : CS/FCI19000307/Etd3e2	
36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Date : 08-08-2019	
			Code : FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SHC 2787P		Veh. Inspected	SLH 7150U
Policy No.			Coverage (\$)	0.00
Claim No.	D19000225MFSH		Excess (\$)	0.00
Assign From	JOANNE YONG		Assign Date	04/01/2019
2. Vehicle Particulars & Condition				
Make & Model	HONDA VEZEL		c.c	1496
Engine No.	HIDDEN		Year of Reg.	2016
Chassis No.	RU31213261		Colour	RED
Odometer	212389		Steering	IN ORDER
Brakes	IN ORDER		Modification	SPORTS RIM
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	215/60 R16	GITI	6 mm	
L/H Front Tyre	215/60 R16	GITI	6 mm	
R/H Rear Tyre	215/60 R16	GITI	6 mm	
L/H Rear Tyre	215/60 R16	GITI	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT AND REAR PORTION, DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	03/01/2019		Inspection Date	07/01/2019
Survey held at	NO.1 KRANJI LOOP			
Repairer	WORLD AUTO PTE LTD			
5a. Remarks				
A)DAMAGES CONSISTENT TO ACCIDENT REPORT. B)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. C)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			7 Working Days	

**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 5

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLH 7150U

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	FRONT WINDSCREEN GLASS	CRACKED	2,250.00	2,000.00
1	FRONT WINDSCREEN MOULDING	NECESSARY	250.00	250.00
1	FRONT BONNET	BUCKLED	1,100.00	790.00
2	FRONT BONNET HINGE @\$110.00	DEFORMED	220.00	110.00
1	FRONT BONNET INSULATOR	BUCKLED	220.00	220.00
1	FRONT BONNET STAY BAR	BENT	100.00	100.00
1	FRONT BONNET INNER RUBBER MOULDING	NOT NECESSARY	230.00	-
1	FRONT BONNET LOCK	BENT	210.00	210.00
1	FRONT BONNET LOCK CABLE	NOT NECESSARY	90.00	-
1	FRONT BONNET RUBBER MOULDING	NOT NECESSARY	130.00	-
2	FRONT BONNET STOPPER @\$75.00	NOT NECESSARY	150.00	-
1	FRONT RADIATOR GRILLE EMBLEM	CRACKED	100.00	30.00
1	FRONT RADIATOR GRILLE BASE	CRACKED	360.00	360.00
1	FRONT RADIATOR GRILLE CHROME	CRACKED	380.00	380.00
1	FRONT RADIATOR GRILLE CHROME STRIP	CRACKED	180.00	80.00
2	(LED) FRONT HEADLAMP ASSY @\$1850.00	CRACKED	3,700.00	3,100.00
2	FRONT HEADLAMP LOWER BRACKET @\$78.00	CRACKED	156.00	156.00
2	FRONT HEADLAMP TOP BRACKET @\$68.00	CRACKED	136.00	136.00
1	FRONT BUMPER	DENTED	900.00	900.00
1	FRONT BUMPER TOW COVER	DEFORMED	89.00	56.00
2	FRONT BUMPER RETAINER @\$89.00	DEFORMED	178.00	178.00
1	FRONT BUMPER LOWER GRILLE	CUT	118.00	118.00
1	FRONT LOWER BUMPER	DENTED	300.00	300.00
1	FRONT BUMPER REINFORCEMENT	DENTED	450.00	450.00
2	FOG LAMP ASSY @\$315.00	NOT NECESSARY	630.00	-
2	FOG LAMP BRACKET @\$85.00	NOT NECESSARY	130.00	-
2	FOG LAMP COVER @\$68.00	SCRATCHED	136.00	136.00
1	RADIATOR	BENT	1,450.00	1,100.00
1	RADIATOR FAN BLADE ASSY	NOT NECESSARY	99.00	-
1	RADIATOR FAN MOTOR	NOT NECESSARY	440.00	-
1	RADIATOR FAN COWLING	CRACKED	210.00	210.00

Report Ref No. CS/FCI19000307/Etd3e2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No. 2 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	CONDENSER ASSY	BENT	1,250.00	650.00
1	CONDENSER FAN BLADE	CUT	80.00	80.00
1	CONDENSER FAN COWLING	CRACKED	180.00	180.00
1	CONDENSER FAN MOTOR	JAMMED	350.00	350.00
1	AIRCON RECEIVER PIPE	NOT NECESSARY	170.00	-
2	RADIATOR AIR GUIDE @\$30.00	NOT NECESSARY	60.00	-
1	RADIATOR SPARE TANK	NOT NECESSARY	60.00	-
1	RADIATOR SPARE TANK CAP	NOT NECESSARY	15.00	-
1	WIPER WASHER MOTOR	NOT NECESSARY	130.00	-
1	WIPER WASHER TANK ASSY	DEFORMED	100.00	100.00
1	AIR RESONATOR	NOT NECESSARY	150.00	-
1	AIR INTAKE AIR DUCT	CRACKED	57.00	57.00
1	AIR INTAKE AIR DUCT TUBE	NOT NECESSARY	57.00	-
1	FRONT CENTER LOCK BRACKET	BENT	38.00	38.00
1	FRONT SUPPORT PANEL	BENT	672.80	672.80
1	FRONT SUPPORT PANEL TOP GARNISH	DEFORMED	94.00	94.00
1	INTAKE MANIFOLD BREATHER HOSE	CUT	28.50	28.50
1	RADIATOR OUTLET JOINT HOISING	NOT NECESSARY	72.20	-
1	BATTER TRAY	NOT NECESSARY	100.00	-
1	BATTER TRAY BRACKET	NOT NECESSARY	90.00	-
1	INTAKE MANIFOLD	CRACKED	576.00	576.00
1	REAR BOOT LID	DENTED	1,300.00	1,200.00
1	REAR BOOT LOCK ASSY	NOT NECESSARY	300.00	-
1	REAR WINDSCREEN GLASS MOULDING	NECESSARY	250.00	250.00
1	REAR BOOT HYBRID EMBLEM (VEZEL)	NECESSARY	89.00	56.00
1	REAR BOOT VEZEL EMBLEM (VEZEL)	NECESSARY	89.00	56.00
2	REAR BOOT REFLECTOR LAMP @\$580.00	NOT NECESSARY	1,160.00	-
1	REAR BUMPER	DENTED	900.00	900.00
1	REAR END PANEL	TO REPAIR SEE LABOUR	680.00	-
1	REAR END PANEL TOP GARNISH	NOT NECESSARY	260.00	-
1	REAR BOOT WEATHER STRIP	NOT NECESSARY	180.00	-
2	REAR TAIL LAMP @\$580.00	NOT NECESSARY	1,160.00	-

Report Ref No. CS/FCI19000307/Etd3e2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	REAR BUMPER REFLECTOR LENS @\$180.00	N/S CRACKED	360.00	140.00
1	WIPER WASHER TANK NECK (ADDITIONAL)	BENT	55.00	55.00
1	MILIWAVE RADAR (ADDITIONAL)	CRACKED	2,250.00	2,000.00
1	MILIWAVE RADAR BRACKET (ADDITIONAL)	BUCKLED	1,730.00	761.80
	LESS 20% DISCOUNT		-6,037.10	-3,923.02
			24,148.40	15,692.08
	<u>SPECIAL NETT ITEMS</u>			
1	FRONT WINDSCREEN SEALANT (SN)	NECESSARY	100.00	60.00
1	PRIVATE HIRE DECAL (SN)	NECESSARY	20.00	20.00
1	IU BRACKET (SN)	NECESSARY	155.80	155.80
1	FRONT BONNET INSULATOR CLIP (SN)	NECESSARY	40.00	30.00
1	FRONT BONNET STAY BAR CLIP (SN)	NECESSARY	40.00	20.00
1	FRONT BUMPER CLIP (SN)	NECESSARY	40.00	30.00
1	FRONT NUMBER PLATE WITH CASING (SN)	MISSING	40.00	40.00
1	FRONT SUPPORT PANEL TOP GARNISH CLIPS (SN)	NECESSARY	40.00	30.00
1	BATTERY (SN)	NOT NECESSARY	210.00	-
1	COOLANT (SN)	NECESSARY	100.00	50.00
1	AIRCON GAS (SN)	NECESSARY	120.00	50.00
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	100.00	60.00
1	REAR BUMPER CLIP (SN)	NECESSARY	40.00	30.00
1	REAR END PANEL TOP GARNISH CLIPS (SN)	NOT NECESSARY	40.00	-
1	REVERSE SENSOR (SN)	SHORTED	280.00	200.00
2	REAR TAILLAMP CLIPS @\$40.00 (SN)	NOT NECESSARY	80.00	-
			1,445.80	775.80
	<u>LABOUR</u>			
	TOWING CHARGE.		60.00	60.00
	REMOVE AND REPLACE FRONT WINDSCREEN GLASS.		180.00	120.00
	TO APPLY RUSTPROOFING / TUFFCOATING TREATMENT TO REPLACED PARTS.		180.00	60.00
	SEND VEHICLE TO INSPECTION CENTRA FOR PRIVATE HIRER DECAL PASTING.		180.00	100.00
	SEND VEHICLE TO INSPECTION CENTRA FOR IU INSPECTION & REGISTRATION OF IU.		180.00	80.00

Report Ref No. CS/FCI19000307/Etd3e2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO DISMANTLE FRONT DAMAGE PARTS, CUT AND WELD FRONT PANEL, KNOCK, STRAIGHTEN AND RESHAPE O/S FRONT CHASSIS FRAME AND REPLACE RECOMMENDED PARTS. INCLUSIVE OF THE REPAIR OF REAR END PANEL.		2,200.00	1,000.00
	PUTTY AND SPRAY PAINT FRONT AFFECTED AREAS INCLUDING (INNER/OUTER).		1,800.00	800.00
	AIRCON SYSTEM CHECK AND RECTIFY WHERE NECESSARY INCLUDING REPLACING ABOVE AIRCON PARTS AND REFILLING AIRCON GAS.		180.00	60.00
	ENGINE COOLING SYSTEM CHECK AND RECTIFY WHERE NECESSARY INCLUDING REPLACING ABOVE PARTS AND REFILLING ENGINE COOLANT.		180.00	60.00
	TO APPLY ANTI RUST TREATMENT ON THE REPLACED AND REPAIRED PANELS.		280.00	100.00
	TO CHECK WIRES, CONNECTOR, REPLACED DAMAGED HEADLAMPS, CHECK AND CONNECTOR AND SOCKET.		180.00	50.00
	TO DISMANTLE REAR DAMAGE PARTS, CUT AND WELD REAR PANEL, KNOCK, STRAIGHTEN AND RESHAPE O/S REAR CHASSIS FRAME AND REPLACE RECOMMENDED PARTS.		1,200.00	600.00
	PUTTY AND SPRAY PAINT REAR AFFECTED AREAS INCLUDING (INNER / OUTER).		1,000.00	600.00
	REMOVE & REFIT REAR WINDSCREEN GLASS.		180.00	150.00
	TO CHECK REAR WIRES, CONNECTORS, REPLACE DAMAGED LAMPS REVERSE SENSORS AND START / STOP UNIT CAPACITORS.		180.00	30.00
	DEACTIVATE HV BATTERY SYSTEM IN ORDER TO FACILITATE REPAIRS AND REACTIVATE BACK SAME. (HV HYBRID SYSTEM SAFETY PROCEDURES).		450.00	250.00
	PERFORM WHOLE VEHICLE DIAGNOSTICS INCLUDING CLEARING FAULT CODES AND REINTIALISING HV HYBRID SYSTEM FOR POST REPAIRS. (HV HYBRID SYSTEM SAFETY PROCEDERES)		450.00	120.00
	PERFORM MILIWAVE RADAR AIMING AND CALIBRATION. (ADDITIONAL)		450.00	250.00
			-	-
			-	-
			-	-
			9,510.00	4,490.00

Report Ref No. CS/FCI19000307/Etd3e2



GRAND TOTAL		35,104.20	20,957.88
RECOMMENDED COST OF REPAIRS			20,957.88

Report Ref No. CS/FCI19000307/Etd3e2

CHEN TSUE YEE

Automotive Assessor

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.